Department of the Army Pamphlet 385-40

Safety

Army Accident Investigations and Reporting

Headquarters
Department of the Army
Washington, DC
18 March 2015

UNCLASSIFIED

SUMMARY of CHANGE

DA PAM 385-40 Army Accident Investigations and Reporting

This major revision, dated 18 March 2015---

- o Changes Armed Forces Institute of Pathology to Armed Forces Medical Examiner System (para 2-1c(4)(d)).
- o Adds additional definitions (glossary).

Safety

Army Accident Investigations and Reporting

By Order of the Secretary of the Army:

RAYMOND T. ODIERNO General, United States Army Chief of Staff

Official:

GERALD B. O'KEEFE

Administrative Assistant to the Secretary of the Army

History. This publication is a major revision.

Summary. This Department of the Army pamphlet is published in support of the consolidated AR 385–10, and it encompasses Army accident investigations and reporting procedures, to include aviation, ground, explosives, chemical, nuclear, radiation, biological, civilian, and maritime.

Applicability. This pamphlet applies to the Active Army, the Army National Guard/Army National Guard of the United States, and the U.S. Army Reserve, unless otherwise stated. Also, it applies to Department of Army civilian employees, all Department of Defense personnel, and foreign military with and under Army operational control, as well as contract personnel, as prescribed in AR 385–10.

Proponent and exception authority. The proponent of this pamphlet is the Director of the Army Staff. The proponent has the authority to approve exceptions or waivers to this pamphlet that are consistent with controlling law and regulations. The proponent may delegate this approval authority, in writing, to a division chief within the proponent agency or its direct reporting unit or field operating agency, in the grade of colonel or the civilian equivalent. Activities may request a waiver to this pamphlet by providing justification that includes a full analysis of the expected benefits and must include formal review by the activity's senior legal officer. All waiver requests will be endorsed by the commander or senior leader of the requesting activity and forwarded through their higher headquarters to the policy proponent. Refer to AR 25–30 for specific guidance.

Suggested improvements. Users are invited to send comments and suggested improvements on DA Form 2028 (Recommended Changes to Publications and Blank Forms) directly to Director, Army Safety (DACS–SF), 9351 Hall Road, Building 1456, Fort Belvoir, VA 22060–5860.

Distribution. This publication is available in electronic media only and is intended for command levels C, D, and E for the Active Army, the Army National Guard/Army National Guard of the United States, and the U.S. Army Reserve.

i

Contents (Listed by paragraph and page number)

Chapter 1

Introduction, page 1

Purpose • 1–1, page 1

References • 1-2, page 1

Explanation of Abbreviations and Terms • 1–3, page 1

Methodology • 1-4, page 1

Concept • 1-5, page 1

Safeguarding Personally Identifiable Information and Accident Information • 1-6, page 2

Use of forms and reports • 1-7, page 2

Occupational Safety and Health Administration recordkeeping requirements • 1-8, page 2

Types of accidents and incidents • 1–9, page 3

Accident costs • 1-10, page 5

Personnel classifications • 1-11, page 7

Special notification and reporting requirements • 1–12, page 8

^{*}This regulation supersedes DA Pam 385-40, dated 6 March 2009.

Chapter 2

Investigation Procedures and Techniques, page 12

```
Section I
```

Procedures, page 12

Organization and planning • 2-1, page 12

Preliminary accident site procedures • 2-2, page 16

Section II

Techniques and Procedures, page 18

Witness interviews • 2-3, page 18

Human factors investigation • 2-4, page 21

Materiel factors investigation • 2-5, page 25

Environmental factors • 2–6, page 31

Accident investigation techniques for electromagnetic environmental effects • 2-7, page 31

Analysis • 2-8, page 32

Accident investigation kit • 2-9, page 34

Chapter 3

Aviation Accident Reporting, page 35

Introduction • 3–1, page 35

DA Form 2397-Series, Technical Report of U.S. Army Aircraft Accident • 3-2, page 35

DA Form 2397, Part I, Statement of Reviewing Officials • 3-3, page 35

DA Form 2397-1, Part II, Summary • 3-4, page 35

DA Form 2397-2, Part III, Findings and Recommendations • 3-5, page 35

DA Form 2397-3, Part IV, Narrative • 3-6, page 36

DA Form 2397-4, Part V, Summary of Witness Interview • 3-7, page 36

DA Form 2397-5, Part VI, Wreckage Distribution • 3-8, page 36

DA Form 2397-6, Part VII, In-Flight or Terrain Impact and Crash Damage Data • 3-9, page 37

DA Form 2397-7, Part VIII, Maintenance and Materiel Data • 3-10, page 37

DA Form 2397-8, Part IX, Personal Data • 3-11, page 37

DA Form 2397-9, Part X, Injury/Occupational Illness Data • 3-12, page 38

DA Form 2397-10, Part XI, Personal Protective Escape/Survival/Rescue Data • 3-13, page 38

DA Form 2397-11, Part XII, Weather/Environmental • 3-14, page 38

DA Form 2397-12, Part XIII, Fire • 3-15, page 38

DA Forms 2397-13, Index A and 2397-14, Index B • 3-16, page 38

Substantiating data • 3-17, page 38

Miscellaneous • 3–18, page 40

Assembly of the accident folder • 3-19, page 40

DA Form 2397-AB, Abbreviated Aviation Accident Report • 3-20, page 40

DA Form 2397-U, Unmanned Aircraft System Accident Report • 3-21, page 43

Completion instructions for DA Form 2397, Part I, Statement of Reviewing Officials • 3-22, page 43

Completion instructions for DA Form 2397-1, Part II, Summary • 3-23, page 45

Completion Instructions for DA Form 2397-2, Part III, Findings and Recommendations • 3-24, page 51

Completion instructions for DA Form 2397-3, Part IV, Narrative • 3-25, page 55

Completion instructions for DA Form 2397-4, Part V, Summary of Witness Interview • 3-26, page 63

Completion instructions for DA Form 2397-5, Part VI, Wreckage Distribution • 3-27, page 66

Completion instructions for DA Form 2397-6, Part VII, In-flight or Terrain Impact and Crash Damage Data • 3-28, page 68

Completion instructions for DA Form 2397-7, Part VIII, Maintenance and Materiel Data • 3-29, page 73

Completion instructions for DA Form 2397-8, Part IX, Personal Data • 3-30, page 76

Completion instructions for DA Form 2397-9, Part X, Injury/Occupational Illness Data • 3-31, page 80

Completion instructions for DA Form 2397–10, Part XI, Personal Protective Escape/Survival/ Rescue Data • 3–32, page 83

Completion instructions for DA Form 2397-11, Part XII, Weather/Environmental • 3-33, page 87

Completion instructions for DA Form 2397-12, Part XIII, Fire • 3-34, page 89

Completion instructions for DA Forms 2397-13 and 14, Index A and Index B • 3-35, page 91

Completion instructions for DA Form 2397–AB, Abbreviated Aviation Accident Report (AAAR) • 3–36, page 94 Completion instructions for DA Form 2397–U, Unmanned Aircraft System Accident Report (UASAR) • 3–37, page 100

Chapter 4

Ground Accident Reporting, page 138

Introduction • 4–1, page 138

DA Form 285, Technical Report of U.S. Army Ground Accident • 4-2, page 139

Findings and recommendations • 4-3, page 139

Narrative of investigation • 4-4, page 142

DA Form 285-W, Technical Report of U.S. Army Ground Accident, Summary of Witness Interview • 4-5, page 146

Assembly of the accident folder • 4-6, page 147

DA Form 285-A, Index A and DA Form 285-B, Index B • 4-7, page 147

Substantiating data • 4-8, page 147

DA Form 285–O, Technical Report of U.S. Army Ground Accident, Statement of Reviewing • 4–9, page 149 Miscellaneous • 4–10, page 149

DA Form 285-AB, Abbreviated Ground Accident Report (AGAR) • 4-11, page 149

Completion instructions for DA Form 285, Technical Report of U.S. Army Ground Accident • 4-12, page 161

Completion instructions for DA Form 285-W, Summary of Witness Interview • 4-13, page 169

Completion instructions for DA Form 285-A, Index A and 285-B, Index B • 4-14, page 172

Completion instructions for DA Form 285-O, Statement of Reviewing Officials • 4-15, page 174

Completion instructions for DA Form 285-AB, Abbreviated Ground Accident Report (AGAR) • 4-16, page 177

Chapter 5

Special Notification and Reporting Requirements, page 188

Marine accidents • 5-1, page 188

Chemical agent mishaps • 5-2, page 191

Explosives accidents • 5-3, page 192

Ionizing and nonionizing radiation accidents • 5-4, page 193

Nuclear weapon and reactor accidents • 5-5, page 198

Biological mishaps • 5-6, page 198

Investigation of North Atlantic Treaty Organization nation aircraft or missile accidents and incidents • 5-7, page 198

Appendixes

- A. References, page 202
- **B.** Explanations, Examples, and Keywords, page 209
- C. Crash Survival Charts and Figures, page 223
- **D.** Basic Examples of Fractures and Damaging Stresses, page 232
- E. Medical, page 240
- F. Accident/Incident Event Codes Associated With Manned and Unmanned Aircraft Accidents, page 243
- **G.** Accident Investigation Information/Equipment Requirements, page 250
- **H.** Notification Phone Numbers, page 252
- **I.** Military and Civilian OSHA Recordkeeping Requirements, page 253

Table List

Table 1-1: Cost Standards Table, page 7

Table 3-1A: Elements of a human error present and contributing finding, page 50

Table 3-1B: Elements of a materiel failure present and contributing finding, page 50

- Table 3-1C: Elements of an environmental factor present and contributing finding, page 51
- Table 3–2: Accident/incident event codes associated with manned and unmanned aircraft accidents (see app F-1 and F-2), page 110
- Table 3-3: Ownership of damaged property, page 113
- Table 3-4: Phase of operation, page 113
- Table 3-5: Duty position codes, page 114
- Table 3-6: Accident case number, page 116
- Table 3-7: Accident errors/failures/effects/system inadequacy(ies)/recommendations, page 117
- Table 3-8: Pay grade codes, page 119
- Table 3-9: Personnel service codes, page 120
- Table 3–10: Injury/illness terms and codes, page 121
- Table 3-11: Equipment Information Codes, page 126
- Table 3-12: Equipment information codes, page 128
- Table 3-13: Method of evacuation/escape, page 130
- Table 3-14: Location in aircraft, page 130
- Table 3–15: Exit attempted, page 131
- Table 3-16: Exit used, page 131
- Table 3-17: Aircraft attitude at time of Escape, page 132
- Table 3-18: Cockpit/Cabin Condition, page 132
- Table 3-19: Escape difficulties, page 132
- Table 3-20: Survival problems, page 134
- Table 3-21: Means used to locate individual, page 135
- Table 3-22: Rescue equipment used, page 136
- Table 3-23: Factors that helped rescue, page 136
- Table 3-24: Factors that complicated rescue, page 137
- Table 3-25: Inidividual's physical condition, page 138
- Table 4-1: Ground accident notification, reporting requirements, and suspenses, page 139
- Table 4-2: Ground Finding Examples (Human, Materiel, Environmental), page 140
- Table 4-3: Army branches, page 184
- Table 4-4: Types of accident locations, page 185
- Table 4-5: Pay Grade/Rank codes, page 187
- Table 4-6: Personnel classification codes, page 187
- Table 5-1: Chemical Accident and Incidents Report-Guidance and Distribution Format, page 191
- Table 5-2: Radiological Accident Report, page 195
- Table B-1: Aviation specific, page 210
- Table B-2: Ground Specific, page 212
- Table B-3: Materiel failures/malfunctions, page 217
- Table B-4: Environmental conditions, page 218
- Table B-5: System inadequacies/readiness shortcomings/root causes ("Why" the error/failure/malfunction occurred)
- LEADER FAILURE occurs when leaders fail to monitor mission execution and planning, correct inappropriate behavior, take appropri- ate action, or emphasize correct procedures that allowed subordinates to commit task errors or results in a materiel failure., page 219
- Table B-6: Recommendations/controls/corrective actions/countermeasures, page 222
- Table F-1: Accident/incident event codes, page 243
- Table F-2: Materiel factor events, page 248

Figure List

- Figure 1-1: "3W" Approach to Information Collection, Analysis and Recommendations, page 2
- Figure 1-2: Ground Accident Reporting (Peacetime), page 9
- Figure 1-3: Aviation Accident Reporting (Peacetime), page 10
- Figure 1-4: Combat Accident Reporting, page 11
- Figure 2-1: Determining System Inadequacy(ies) Responsible for Human Error, page 24
- Figure 2-2: Methods to Place Each Factor in its Proper Perspective in Relation to Other Events, page 25
- Figure 3-1: Aviation Accident/Incident Notification, Reporting Requirements, and Suspenses, page 42

- Figure 3-2: Example of a completed DA Form 2397, Part I, Statement of Reviewing Officials, page 44
- Figure 3-3: Example of a completed DA Form 2397-1, Part II, Summary, page 46
- Figure 3-3: Example of a completed DA Form 2397-1, Part II, Summary-continued, page 47
- Figure 3-4: Example of a completed DA Form 2397-2, Part III, Findings and Recommendations, page 52
- Figure 3-4: Example of a completed DA Form 2397-2, Part III, Findings and Recommendations—continued, page 53
- Figure 3-5: Example of a completed DA Form 2397-3, Part IV, Narrative, page 56
- Figure 3-5: Example of a completed DA Form 2397-3, Part IV, Narrative-continued, page 57
- Figure 3-5: Example of a completed DA Form 2397-3, Part IV, Narrative-continued, page 58
- Figure 3-5: Example of a completed DA Form 2397-3, Part IV, Narrative—continued, page 59
- Figure 3-6: Example of a completed DA Form 2397-4, Part V, Summary of Witness Interview, page 64
- Figure 3-6: Example of a completed DA Form 2397-4, Part V, Summary of Witness Interview—continued, page 65
- Figure 3-7: Example of a completed DA Form 2397-5, Part VI, Wreckage Distribution, page 67
- Figure 3–8: Example of a completed DA Form 2397–6, Part VII, In-flight or Terrain Impact and Crash Damage Data, page 69
- Figure 3–8: Example of a completed DA Form 2397–6, Part VII, In-flight or Terrain Impact and Crash Damage Data—continued, page 70
- Figure 3-9: Example of a completed DA Form 2397-7, Part VIII, Maintenance and Materiel Data, page 74
- Figure 3-10: Example of a completed DA Form 2397-8, Part IX, Personal Data, page 77
- Figure 3-10: Example of a completed DA Form 2397-8, Part IX, Personal Data—continued, page 78
- Figure 3-11: Example of a completed DA Form 2397-9, Part X, Injury/Occupational Illness Data, page 81
- Figure 3–12: Example of a completed DA Form 2397–10, Part XI, Personal Protective Escape/Survival/Rescue Data, page 84
- Figure 3-13: Example of a completed DA Form 2397-11, Part XII, Weather/Environmental, page 88
- Figure 3-14: Example of a completed DA Form 2397-12, Part XIII, Fire, page 90
- Figure 3-15: Example of a completed DA Form 2397-13, Index A, page 92
- Figure 3-16: Example of a completed DA Form 2397-14, Index B, page 93
- Figure 3-17: Example of a completed DA Form 2397-AB, Abbreviated Aviation Accident Report (AAAR), page 95
- Figure 3-17: Example of a completed DA Form 2397-AB, Abbreviated Aviation Accident Report (AAAR)—continued, page 96
- Figure 3–17: Example of a completed DA Form 2397–AB, Abbreviated Aviation Accident Report (AAAR)—continued, page 97
- Figure 3–18: Example of a completed DA Form 2397–U, Unmanned Aircraft System Accident Report (UASAR), page 101
- Figure 3–18: Example of a completed DA Form 2397–U, Unmanned Aircraft System Accident Report (UASAR)—continued, page 102
- Figure 3–18: Example of a completed DA Form 2397–U, Unmanned Aircraft System Accident Report (UASAR)—continued, page 103
- Figure 4-1: Example of completed DA Form 285, Technical Report of U.S. Army Ground Accident, page 150
- Figure 4–1: Example of completed DA Form 285, Technical Report of U.S. Army Ground Accident—continued, page 151
- Figure 4-1: Example of completed DA Form 285, Technical Report of U.S. Army Ground Accident—continued, page 152
- Figure 4-1: Example of completed DA Form 285, Technical Report of U.S. Army Ground Accident—continued, page 153
- Figure 4–1: Example of completed DA Form 285, Technical Report of U.S. Army Ground Accident—continued, page 154
- Figure 4–2: Sample of a narrative investigation and findings and recommendations, page 155
- Figure 4-2: Sample of a narrative investigation and findings and recommendations—continued, page 156
- Figure 4-2: Sample of a narrative investigation and findings and recommendations—continued, page 157
- Figure 4-2: Sample of a narrative investigation and findings and recommendations—continued, page 158
- Figure 4-2: Sample of a narrative investigation and findings and recommendations—continued, page 159
- Figure 4-2: Sample of a narrative investigation and findings and recommendations—continued, page 160
- Figure 4-2: Sample of a narrative investigation and findings and recommendations—continued, page 161
- Figure 4-3: Example of completed DA Form 285-W, Summary of Witness Interview, page 167
- Figure 4-3: Example of completed DA Form 285-W, Summary of Witness Interview—continued, page 168

- Figure 4-4: Example of completed DA Form 285-A, Index A, page 170
- Figure 4-5: Example of completed DA Form 285-B, Index B, page 171
- Figure 4-6: Example of completed DA Form 285-O, Statement of Reviewing Officials, page 173
- Figure 4-7: Example of a U.S. Army Abbreviated Ground Accident Report (AGAR), page 175
- Figure 4-7: Example of a U.S. Army Abbreviated Ground Accident Report (AGAR)—continued, page 176
- Figure 4-7: Example of a U.S. Army Abbreviated Ground Accident Report (AGAR)—continued, page 177
- Figure C-1: Relationship of velocity of impact and declarative distance to force, page 224
- Figure C-2: Aircraft Design Load Factors and Landing Sink Rates, page 225
- Figure C-3: Typical body crash impacts. Values are for no serious injury, page 226
- Figure C-4: Lap Belt-Only Extremity Strike Envelope-Top View, page 227
- Figure C-5: Lap Belt-Only Extremity Strike Envelope-Side View, page 228
- Figure C-6: Lap Belt-Only Extremity Strike Envelope-Front View, page 229
- Figure C–7: Full-Restraint Extremity Strike Envelope-Top View, page~230
- Figure C-8: Full-Restraint Extremity Strike Envelope-Side View, page 231
- Figure C-9: Full-Restraint Extremity Strike Envelope-Front View, page 232
- Figure D-1: Metal fatigue, page 233
- Figure D-2: Fatigue fractures, page 234
- Figure D-3: Propagation of fatigue crack and ductile-type failure of instantaneous zone, page 235
- Figure D-4: Fatigue failure, no stress, and high stress concentration, page 235
- Figure D-5: Fatigue failure under torsion loading, page 236
- Figure D-6: Torsion load failure, page 236
- Figure D-7: Bending load failure, page 237
- Figure D-8: Deformation and fracture due to tension and compression, page 237
- Figure D-9: Failure characteristics of ductile metal, page 238
- Figure D-10: Failure characteristics of brittle metal due to tension load, page 238
- Figure D-11: Static tension failure, page 239
- Figure D-12: Pure shear failure, page 239
- Figure D-13: Compression buckles and tension shear failure due to shear loads, page 240

Glossary

Chapter 1 Introduction

1-1. Purpose

This pamphlet provides implementation instructions for the investigation and reporting of Army accidents and incidents, as directed by AR 385-10.

1-2. References

Required and related publications and prescribed and referenced forms are listed in appendix A.

1-3. Explanation of Abbreviations and Terms

Abbreviations and special terms used in this pamphlet are explained in the glossary.

1-4. Methodology

- a. Accidents should be investigated to the degree necessary to identify the immediate mistake(s)/error(s)/failures(s), and system inadequacy(ies) which may have caused, or contributed to, the accident being investigated. The techniques and procedures contained in this pamphlet and AR 385–10 will be used in preparation of all accident reports. Appropriate forms (DA Form 2397 Series, (Technical Report of U.S. Army Aircraft Accident), DA Form 2397–AB (Abbreviated Aviation Accident Report (AAAR)), DA Form 2397–U (Unmanned Aircraft System Accident Report (UASAR)), DA Form 285 (Technical Report of U.S. Army Ground Accident) or DA Form 285–AB (Abbreviated Ground Accident Report (AGAR) will be used for reporting the results of accident investigations.
- b. Recommendations will be provided that will remedy the causes and minimize the chances for similar recurrences. If the Army accident investigation reveals unsafe conditions or practices affecting an item of equipment or technical publication, the safety of an entire model or series of an Army item of equipment may be involved. The appropriate commander should be notified immediately; and the U.S. Army Combat Readiness Center (USACRC) contacted telephonically.

1-5. Concept

Accidents are caused by adverse interactions of man, machine, and environment. Investigation and assessment of these elements should reveal human, materiel, and/or environmental factors that caused or contributed to the accident. These factors can be attributed to one or more system inadequacy (or sometimes referred to as "root cause"). The system inadequacies responsible for human error are categorized as leader, standards, training, individual, or support failure. Although an accident investigation occurs "after the fact," its primary focus must be on identifying what happened and why it happened. Once this has been accomplished, the appropriate activity(ies) responsible for correcting each identified system inadequacy can be notified. This procedure is called the "3W" approach to information collection, analysis, and corrective actions (see fig 1–1). The procedures used throughout this pamphlet are designed to assist the investigator in answering the following three basic questions:

- a. What happened (mistake/error/failure). Identify key factors (human, materiel, environmental) which caused or contributed to the accident. In the case of injuries, explain how they happened.
- b. Why it happened (system inadequacy(ies)/root cause(s)). Identify the system inadequacy that permitted the accident to occur. Explain how and under what conditions those mistakes/errors/failures occurred.
- c. What to do about it (recommendations). Identify the recommended actions and identify the proponent activity or lowest level of command that is most responsible for correcting the deficiency.

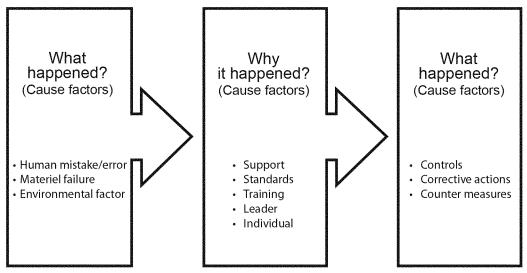


Figure 1-1. "3W" Approach to Information Collection, Analysis and Recommendations

1-6. Safeguarding Personally Identifiable Information and Accident Information

a. PII is information which can be used to distinguish or trace an individual's identity, such as his or her name; social security number (SSN); date and place of birth; mother's maiden name; and biometric records, including any other personal information which is linked or linkable to a specified individual. Individuals collecting and handling PII must ensure that any personal information contained in a report of an accident, of which they have access to and are using to conduct official business, shall protect that information so that the security and confidentiality of the information is preserved. Individuals with access to this information must not disclose any personal information contained in any report of an Army accident, except as authorized by Army or Department of Defense (DOD) regulations. Personnel willfully making such disclosure when knowing that disclosure is prohibited are subject to possible criminal penalties and/or administrative sanctions.

b. The Army will capture SSNs for only those individuals who have been injured or have had an occupational illness or those individuals who are identified as having a finding that was present and contributing to the accident or present and contributing to the severity of the injury or equipment damage. The SSN of investigation board members, subject matter experts, or organizational points of contact, witnesses, or other personnel not directly linked to the accident must not be captured on any document in Army accident reports. The SSN for those individuals who have had an occupational illness/injury or who are culpable in the accident must be included on certain forms only. The SSN is captured on the DA Forms 2397–8 (Technical Report of U.S. Army Aircraft Accident, Part IX, Personnel Data), DA Form 2397–9 (Technical Report of U.S. Army Aircraft Accident, Part X, Injury/Occupational Illness Data), (AAAR), and Unmanned Aircraft System Accident Report (UASAR) for aviation accidents and on the DA Form 285 and Abbreviated Ground Accident Report (AGAR) for ground accidents. Security of the SSN is particularly important as the accident investigation report is being assembled. Be extremely careful not to compromise the SSN on any draft document that is later discarded.

1-7. Use of forms and reports

The report of an Army accident investigation, citing findings and recommendations, will be completed using the appropriate forms prescribed in this pamphlet and AR 385–10. Additional attachments, drawings, extracts, or other supportive media are encouraged if the investigation board president determines they are needed to support the findings, recommendations, and analysis. Detailed instructions for preparation and completion of these forms are contained in chapters 3 and 4 of this pamphlet and apply to accidents involving military and Army civilian, contractor, and visiting civilian personnel. Reports can be submitted to USACRC through the automated reporting system, via e-mail, fax or the postal service.

1-8. Occupational Safety and Health Administration recordkeeping requirements

Occupational Safety and Health Administration (OSHA) recordkeeping requirements for military and Army civilian personnel are outlined in AR 385–10 and appendix I of this pamphlet.

1-9. Types of accidents and incidents

The various types and specific exceptions follow: When two or more types of Army vehicles, such as an Army motor vehicle (AMV) and an Army combat vehicle (ACV) are involved in an accident, the type of equipment operated by the individual deemed most responsible will determine the accident type. This process is also true for other types of accidents (for example, fire, marine, and explosives).

- a. Army aircraft accident.
- (1) Flight accidents. Those accidents in which intent for flight exists (as defined in the glossary), and there is reportable damage to the aircraft itself. (Explosives, chemical agent, or missile events that cause damage to an Army aircraft with intent for flight are categorized as flight accidents to avoid dual reporting.)
- (2) Flight-related accidents. Those aircraft accidents in which there is intent for flight and no reportable damage to the aircraft itself, but the accident involves a fatality, injury to aircrew, ground crew, passengers, or other injury or property damage. These accidents are not to be used in the calculation of flight accident rates. For example, unintentional cutting of a hoist cable; failure or malfunction of a hoist system to include related equipment; unintentional jettisoning of cargo hook load or external stores.
- (3) Aircraft ground accidents. Injury or property damage accidents involving Army aircraft in which no intent for flight exists and the engine(s) is in operation (an installed aircraft auxiliary power unit (APU) is not considered an aircraft engine). In the case of an Aerostat balloon accident there must be no intent for flight and the system must be operational. See the definitions of intent for flight and operational Aerostat balloon in the Glossary, Section II Terms, of this pamphlet.
 - b. Army Motor Vehicle accidents.
- (1) An accident involving a motor vehicle owned by the Army may be classified as an AMV accident if the vehicle meets the following criteria:
 - (a) The vehicle is primarily designed for over-the-road operation.
- (b) The vehicle's general purpose is the transportation of cargo or personnel (for example, passenger cars, trucks family of medium tactical vehicles (FMTVs), high-mobility multipurpose wheeled vehicle (HMMWV), ambulances, buses, motorcycles, fire trucks, and refueling vehicles).
 - (2) Army motor vehicle accidents involve the operation of an AMV when one or more of the following occurs:
 - (a) Collision with other vehicles, objects, or pedestrians.
 - (b) Personnel injuries or property damage due to cargo shifting in or falling from a moving vehicle.
 - (c) Personnel injuries occurring in moving vehicles or caused by falling from moving vehicles.
 - (d) Accidents occurring when a vehicle is being towed or pushed by an AMV.
 - (e) Other injuries and property damage as described in AR 385-10.
- (3) Accidents involving AMVs not reportable as AMV accidents. The following accidents, although reportable, are not considered AMV accidents. They are reportable under other accident types.
- (a) Personnel injuries that occur while loading or unloading or mounting or dismounting a motor vehicle that is not moving.
- (b) Injury/occupational illness or property damage occurring solely from repair or service work (for example, a vehicle falling off a jack or hoist, a tire explosion during inflation, or a finger cut off by a fan belt).
 - (c) Damage to a properly parked AMV unless it is damaged by another AMV.
 - (d) Cargo directly damaged by environmental factors.
 - (e) Damage to an AMV resulting solely from environmental factors (act of nature).
- (f) Damage to an AMV being handled as a commodity and not being operated under its own power (excludes towing or pushing accidents).
 - (g) Damage to a moving or parked AMV caused by objects thrown or propelled into it.
- (h) Damage to an AMV by fire when no AMV accident occurred (where the primary cause of the damage is the fire) when the vehicle was not in operation.
 - (i) Malfunction or failure of component parts, if that is the only damage.
- (4) Accidents involving a privately owned vehicle/private motor vehicle (POV/PMV) and an AMV in which the AMV driver is not at fault will be reported to the local safety office. However, these accidents will not be recorded in the Army Safety Management Information System (ASMIS) unless recordable injuries are incurred by Army personnel or recordable Army damage occurs. (If recordable injuries or damage to Army equipment occur, report in accordance with AR 385–10, chap 3.)
- c. Army Combat Vehicle accidents. These accidents occur during the operation of an ACV or combat equipment, such as a tank, self-propelled weapon, armored personnel carrier, Stryker, Mine Resistant Ambush Protected (MRAP), or amphibious vehicle ashore. Additionally, injuries and property damage incurred during operation of installed ACV armament systems also qualify as an ACV accident (even if the vehicle is not in motion).
- d. Other Army Vehicle accidents. Other Army Vehicle (OAV) accidents involve the operation of an Army vehicle other than those cited in paragraphs a through c, above; (for example, aircraft tugs, motorized scooters, Gators, bulldozers, forklifts, trains, and similar vehicles). These are included in AMV accident statistics.

Note. For Army train/rail and vessel accidents, additional technical information and assistance is available from the U.S. Army Transportation School (Safety Office), Defense Service Network (DSN) 826–6619, COM (757) 878–6619; vessels: DSN 827–1327, COM (757) 878–1327.

- e. Army Operated Vehicle accidents. Accidents that involve vehicles that are leased, such as, General Services Administration (GSA) and government-owned, contractor-operated vehicles that are under full operational control of the Army (for example, hand receipt or like document) or vehicles rented by DA for official business, to include U.S. Army Reserve (USAR) components. These are included in AMV accident statistics.
- f. Privately owned vehicle accidents. These accidents involve the operation of a motor vehicle that is privately owned by an individual that results in any injury/occupational illness to Army military personnel. This category also includes Army personnel operating a POV/PMV on official business.
 - g. Marine accidents (see para 5-1).
- h. Fire. A fire is the unintentional, destructive, and uncontrolled burning of combustible solids, liquids, or gases. Fire accidents involve—
- (1) Equipment fires. Units will ensure that all fires are reported to the installation safety office. AR 420–1 requires all fires that cause damage to Army equipment to be reported through National Fire Incident Reporting System (NFIRS) by the installation fire department. In addition, the unit will submit the appropriate DA Form 285-series form on those equipment fires and explosions listed below if there is fire damage to—
 - (a) Wheeled vehicles or components thereof.
 - (b) Tracked vehicles or components thereof.
 - (c) Aircraft (ground) (excludes those reported on the DA Form 2397-series or DA Form 2397-AB.)
 - (d) Ammunition/explosive fires (production, use, and storage).
 - (e) Missiles, to include subsystems.
 - (f) Tents.
 - (g) Space heaters.
 - (h) Generators.
 - (i) Other equipment (masks, weapons, and so forth).
- (2) Facility fires. Army Fire and Emergency Services organizations will report all fire department responses using the NFIRS as required by Department of Defense Instruction (DODI) 6055.06 and AR 420–1. Although all explosion and aircraft impact losses are reported whenever a fire department responds, they are not considered fire losses unless an ensuing fire causes injuries/facilities/ materiel losses. Fire accidents involving Army-owned or -leased fixed facilities will be reported through NFIRS except where the fire was willfully and maliciously ignited (arson) (AR 385–10). A DA Form 285 will not be submitted for fires listed below unless those fire accidents result in medical treatment beyond first aid or greater injury, occupational illness, or damage to equipment as described in (1) above.
 - (a) Family quarters (rent free, mobile home, leased).
 - (b) Bachelor enlisted quarters, bachelor officer quarters, barracks.
 - (c) Industrial buildings.
 - (d) Public assembly buildings and areas.
 - (e) Grass, forests, and ranges.
 - (f) Warehouse and storage buildings.
 - (g) Administrative offices.
 - (h) Schools.
 - (i) Health care and day care facilities.
 - (j) Vacant structures.
 - (k) Aircraft hangars.
 - (1) USAR centers (leased or government-owned).
 - (m) Area maintenance support activities (leased or government-owned).
 - i. Chemical agent events. (see para 5-2).
 - j. Explosives accidents. (see para 5-3).
 - k. Ionizing and nonionizing radiation accidents and incidents. (see para 5-4).
 - l. Nuclear accidents. (see para 5-5).
- m. Personnel injury-other. These accidents involve injury/occupational illness to Army personnel, Army direct contractors, contractors and subcontractors contractually required to report accidents, and non-Army personnel as a result of Army operations not covered by any other accident type and injury to off-duty military personnel not covered by any other accident type.
- n. Property damage-other accidents. These accidents involve property damage not covered by any other accident type.
 - o. Commercial carrier/transportation accidents. These accidents involve the operation of a commercial motor

vehicle, plane, helicopter, train, or vessel (including those under contract to the Army) which transport Army personnel and result in—

- (1) Any injury beyond first aid to Army military personnel, on or off duty.
- (2) Injury/occupational illness to Army civilian personnel while performing duties in a work-compensable status.
- p. Biological mishaps. (see para 5-6).
- q. Fratricide or friendly fire. Fratricide and friendly fire accidents are special situations that must be reported promptly and thoroughly investigated.
 - (1) These accidents will be reported and investigated as an accident under the provisions of AR 385-10.
- (2) These accidents must also be reported and investigated as a legal accident investigation under the provisions of AR 15-6 and AR 385-10.
 - r. Visiting public. (AR 385-10, para 3-5).

1-10. Accident costs

- a. Army accident costs are based on the severity of injury, occupational illness, or property damage (Army and non-Army) resulting from Army operations. For accident reporting purposes, the logistical disposition of damaged property/equipment (whether or not it is repaired or replaced) will not negate the requirement to report the accident.
- (1) *Injury and illness costs*. These costs are used solely to provide total accident cost since cost is generally proportional to severity of injury/occupational illness. They are not used for determining accident classifications (see AR 385–10). Actual time lost may not be known at the time the accident report is submitted. If it is not known, an official estimate of days away from work, made by a competent medical authority, will be used in computing the cost. The cost data in table 1–1 is used to compute the cost of injuries and occupational illnesses to Army personnel for safety/accident reporting purposes only.
- (a) The figures include the cost of pay while away from work, medical treatment, hospitalization, dependent survival, unused training costs, gratuities, compensation, disability retirement, and burial.
- (b) The figures do not include indirect costs associated with the accident such as wages lost to employees not injured (production loss), cost of hiring and training new employees, cost of investigating the accident, public liability costs, and costs to lease equipment if available.
- (2) Damage costs. Costs of damage to Army property and equipment will be computed using criteria in the Army Master Data File (AMDF), to include such things as actual cost of new or used parts or materials and labor cost at the standard rate of 41 dollars per hour, unless the actual labor cost rate is available within the reporting time limits. When Army property, other than aircraft, is damaged to the extent it cannot be repaired, or the cost of repair exceeds the cost specified in Federal logistics Record(FED LOG) or the property book, the accident cost will be the property cost listed in FED LOG or the property book, plus any additional equipment not included in the original property cost. When damaged equipment or facilities will not be repaired or replaced, the cost reported will be the acquisition cost AMDF, plus the estimated cost to clean up the site. For destroyed equipment, the estimated scrap value or residual value of the parts may not be used to reduce the accident classification.
 - b. Costs peculiar to aircraft accidents include—
- (1) Destroyed, missing, or abandoned aircraft cost. The cost of destroyed, missing, or abandoned Army aircraft is to be computed per aircraft replacement cost figures obtained from Technical Bulletin(TB) 43–0002–3, tables 3–1 and 3–2. The cost of aircraft repair will be updated if the depot's estimated cost of damage (ECOD) is significantly different (10 percent or non-repairable) from the initial or reported ECOD. Include the cost of all modifications. Unmanned Aircraft System (UAS) cost to repair or replace will be computed by the appropriate Field Support Representative and obtained from the system program management office until such a time as UAS are included in TB 43–0002–3.
 - (2) Army parts cost. The cost will include—
- (a) For destroyed parts or components, the cost of replacement per current AMDF, this can be found in technical supply or direct support units. Unit turn-in credits will not be used to reduce the accident classification.
 - (b) The cost to repair damaged parts.
 - (3) Direct man-hour costs. Direct man-hours include—
- (a) The cumulative (estimated) man-hours required to remove, repair, and replace damaged aircraft assemblies, subassemblies, or components.
 - (b) Man-hours required to restore the aircraft to serviceable condition if economically repairable.
- (c) Man-hours expended in removing and replacing undamaged aircraft components in order to remove, repair, or replace damaged components.
 - (d) Man-hours required to remove and replace a part that is not economically repairable.
 - (e) Man-hours expended to determine damage amount.
 - (4) Man-hours not included in aircraft accident cost. The cost will include—
 - (a) Depot and contract overhaul man-hours.
 - (b) Time used in setting up equipment preparatory to actual repair of the aircraft.

- (c) Man-hours used in removing, replacing, and inspecting undamaged parts and components solely to satisfy technical manual inspection requirements.
 - (d) Indirect man-hours such as investigating, travel, test flights, and maintenance operational checks.
 - (e) Maintenance facility overhead cost.
- (5) Replacement of damaged components. Removing a damaged component and replacing it with a new component to decrease the number of man-hours and costs for purposes of accident classification is prohibited. If another like component is available, it may be installed so that the aircraft will be available for flight. However, the total best available estimated man-hour costs to remove, replace, and repair the damaged component will be included for accident classification.
- (6) Cost computation of aircraft engine. When an aircraft engine is damaged as a result of the accident sequence to the extent that it must be returned to a depot, the cost of such damage or inspection will be computed at 17 percent of the engine cost. Depreciation and/or turn-in credits will not be used when calculating damage costs to determine accident classification.
- (7) Cost computation of helicopter main or tail rotor blades and fixed wing propeller blades. Costs will be computed based on the following criteria:
- (a) Destroyed blades are to be calculated at the full unit cost per the AMDF. Depreciation and/or turn-in credits will not be used when calculating damage costs to determine accident classification.
- (b) Blades that are to be repaired locally will be the actual cost of damage (ACOD), if known, or the ECOD, if the ACOD is not known prior to the submission of the report. Early submission to reduce the blade cost is prohibited.
- (c) Blades sent to depot or contract rebuild facilities for repair or rebuild will be the ACOD, repair facility established cost, or 44 percent of the AMDF cost of the blade with no depreciation allowed. For example, if a repairable blade is returned to depot for repair and the AMDF cost of the blade is 100,000 dollars; the cost of the blade for classification and reporting would be 44,000 dollars. Depreciation and/or turn-in credits will not be used when calculating damage costs to determine accident classification.
- Note. 44 percent AMDF cost does not apply when a tip cap is the only damage.
- (8) Aircraft structural damage. When available, the actual cost of aircraft structural damage should be cited. When actual cost cannot be determined and the structural damage is repairable, use the following calculations:
- (a) For minor structural damage not requiring realignment (jigging), use 3 percent of the aircraft replacement cost in TB 43–0002–3. (UAS cost will be calculated using the current established cost at the time of the accident.)
- (b) For major structural damage (for example, extensive damage to fuselage or damage requiring structural realignment), use 6 percent of the aircraft replacement cost cited in TB 43–0002–3. (UAS cost will be calculated using the current established cost at the time of the accident.)
- (c) For structural damage deemed unrepairable, use the actual cost of the fuselage when available or 40 percent of the replacement cost for the aircraft, as cited in TB 43–0002–3, tables 3–1 or 3–2. (UAS cost will be calculated using the current established cost at the time of the accident.)
 - (d) Percentile calculations include man-hours, transportation, and inspection.
- (9) Cost computation of other aircraft components. When a major aircraft component (as defined in the appropriate maintenance technical manual (TM)) is damaged to the extent that it must be returned to depot for overhaul or inspection, the reported cost for repair will be computed at 15 percent of the component's cost. Depreciation and/or turn-in credits will not be used when calculating damage costs to determine accident classification.
- (10) Unmanned Aircraft System damage costs. Cost to repair or replace damaged UAS components or parts will be computed by the appropriate FSR and obtained from the systems program management office until such a time as UAS national stock numbers (NSNs)/part numbers are included in the AMDF. Reduction in UAS damage by applying the provisions of paragraphs b(6), b(7) and b(9), above are not authorized.
 - (11) Damage not included in aircraft accident costs.
 - (a) Fair wear and tear (FWT).
- (b) When a malfunction or failure of a component part results in damage to another component, the FWT exception does not apply.
- (c) Damage to helicopters incurred solely from flying debris during operations in confined areas and unimproved landing sites is considered FWT.
- (d) Discovery of cracks, breaks, wrinkles, or ruptures during required periodic or scheduled inspections is considered FWT. They will be reported per DA Pam 738–751.
- (e) Damage to an aircraft as a direct result of action by an enemy force or terrorist group (considered "combat loss").
- (f) Intentional in-flight controlled jettison or release of mission/activity/event essential, aircraft equipment/stores that is not essential to flight. For example, canopies, doors, drag chutes, hatches, life rafts, auxiliary fuel tanks, missiles, drones, rockets, non-nuclear munitions, and externally carried equipment. Intentional emergency jettison of cargo (internal or external) when aircraft control is essential. (There must be no injury or reportable damage to the aircraft or

other property. Also, intentional controlled jettison of missiles, drones, or non-nuclear munitions must not have resulted from their malfunction.)

- (g) Planned destruction of Army experimental or prototype aircraft during authorized testing or combat training.
- (h) Authorized intentional destruction of Army property or equipment.
- (i) Foreign object damage to aircraft, air-breathing missiles, or drone engines discovered during scheduled engine disassembly.
 - (j) The costs of any further Army property damage resulting from rescue or salvage.

Table 1–1 Cost Standards Table

Mishap Injury Cost Standards Table for use in FY15 (using FY14 CPI)								
	No Lost Time per Injury	Days Away from Work per Day	Day Hospital- ized per Day	Permanent Partial Disa- bility Injury	Permanent To- tal Disability In- jury	Fatality		
Flying, Sub, Medi- cal Officers	1,300 ¹	2,400 ¹	8,500 ¹	2,200,000²	2,900,000²	8,700,0004		
Other Officers	1,300 ¹	2,400 ¹	8,500 ¹	365,000 ²	1,100,000 ²	8,700,000 ⁴		
Enlisted Personnel/ Cadets	1,300 ¹	2,400 ¹	8,500 ¹	363,000 ²	1,100,000 ²	8,700,0004		
Civilian Employees	1,300 ¹	2,400 ¹	8,500 ¹	750,000 ³	1,100,000 ³	8,700,0004		

Legend for Table 1-1:

How to use this table:

A. This table should be used to determine mishap costs based on the injury sustained by each individual involved in the mishap. The injury costs do not determine accident class.

- B. Identify the severity of injury sustained for each individual.
- C. For fatal, permanent total disability, partial disability injuries, or those injuries that do not result in lost time, apply the associated cost listed in the table one time for each individual injured. No lost time injuries include needle sticks, loss of consciousness, and treatment beyond first aid.
- D. Injuries resulting in first aid treatment are valued at \$0.
- E. For lost time cases, multiply the number of days away from work beyond the day of the accident by the cost listed under Per Days Away from Work. For injuries that result in hospitalization, multiply the number of days hospitalized by the value listed under Per Day Hospitalized and add it to the Days Away from Work Injury Cost ((# of Days hospitalized * Costs) + Days Away from Work Injury Cost).
- F. Injuries that result in restricted duty or temporary reassignment apply the cost list under No Lost Time one time. Example: An individual loses consciousness at work and is returned to work on restricted duty for one day or more, the total cost of the injury is \$1300.
- G. To determine total injury cost for the mishap, add (sum) the injury costs for each individual.

Example: An individual is injured on the job and is hospitalized for one day, is then told to rest at home for two days, and is then put on restricted duty for three days after returning to work. The costs would be (1*8500) + (2*2400) + (1*1300)=\$14600 cost of the injury.

By the end of the fiscal year, USACRC/SC will update all costs for the next FY in this table with the inflation factor based on Consumer Price Index (CPI) formula (using the average CPI from September of previous year to August of current year) to calculate inflation rate and will then post the updated chart on the USACRC internet homepage. The chart posted on the USACRC homepage will take precedence over any other injury cost table.

Notes:

- ¹ Direct medical costs with a 1 to 1 indirect cost multiplier included. (Profiles, restricted duty, job transfers are included in No Lost Time cases.
- ² Permanent Partial disability costs of military personnel include: training costs + likely medical interventions (cost of average hospital stay) + base pay for hospital stay + partial disability payments over 30–year period. Permanent total disability costs of military personnel determined based on inclusion of: training cost + likely medical interventions (cost of average hospital stay) + base pay for hospital stay + total disability payments over 30–year period.
- ³ Direct wage and medical costs from FECA data.
- 1,2,3 Values updated from FY 2014 Updated cost per injury type estimate table in 2013 dollars using the average CPI from Sep 2013–Aug 2014.
- ⁴ Value of Statistical Life based on OSHA value of \$7.4M in 2006 dollars using the average CPI from Sep 2013-Aug 2014 to update.

1-11. Personnel classifications


The following personnel classifications are used in reporting Army accidents:

- a. Active Army personnel.
- b. Army civilian personnel.
- c. Army contract personnel.
- d. Army direct contractor personnel.
- e. Nonappropriated funds (NAF) employees.
- f. Other U.S. military personnel. This includes members of other DOD components on full-time duty in active military service.
 - g. Reserve Officer Training Corps (ROTC).
 - h. Military dependents. Army Family members.

- i. Army National Guard personnel.
- j. U.S. Army Reserve personnel.
- k. Direct hire foreign nationals.
- l. Foreign nationals, indirect hire.
- m. Foreign nationals, Korean Augmentation to the U.S. Army (KATUSA) (Korean nationals assigned to the U.S. Army in a military status).
 - n. Foreign military personnel assigned to Army units.
 - o. Public. This category includes all persons not specifically covered above.

1-12. Special notification and reporting requirements

Accident notification, investigation, and reporting requirements for marine, chemical agent, explosives, ionizing and nonionizing radiation, nuclear weapons, reactor accidents, and biological mishaps are contained in chapter 5 of this pamphlet.

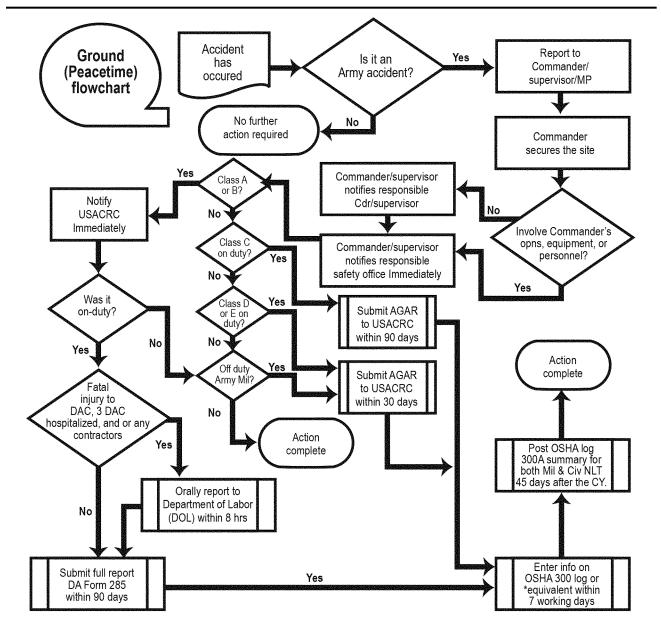


Note:

In the event a safety of use or ground precautionary issue is suspected or identified, notify USACRC immediately.

Class Property damage and/or injury/occupational Illness

- A > \$2M or more. Fatality or permanent total disability.
- B > \$500K but< \$2M; permanent partial disability, or 3 or more hospitalized as in-patients.
- C > \$50K but< \$500K; days away from work or training day case.
- D > \$2K but< \$50K; A non fatal injury or illness resulting in restricted work, transferred to another job, medical treatment greater than first aid, needle stick injuries and cuts from sharps that are contaminated from another persons blood or other potentially infectious material, medical removal under medical surveillance requirements of an OSHA standard, occupational hearing loss, or a work-related tuberculosis case.
- · Military will maintain separate but equivalent OSHA 300 logs for injuries and illnesses.

Figure 1-2. Ground Accident Reporting (Peacetime)

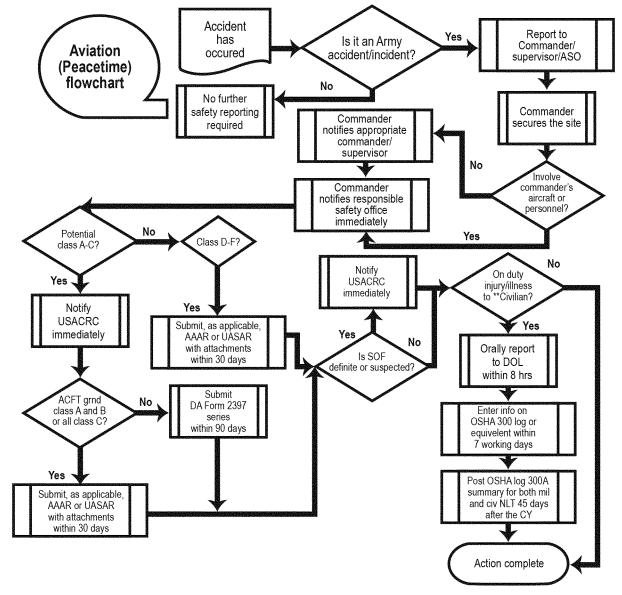


Class Property damage and/or injury/occupational Illness

- A \$2M or moreand/or Army aircraft, missle, or spacecraft missing, destroyed, or abandoned. Fatality or permanent total disability.

 Note: a destryed, missing, or abandoned UAS will not constitute a Class A accident unless to replace or repair is \$2,000,000 or more.
- B > = \$500K, but < \$2M. Permanent partial disability and/or three personnel are hospitalized as in-patients.
- C > = \$50K but < \$500K. Non-fatal injury or occupational illness resulting in days away from work beyond the day/shift when the injury occured.
- D > \$2K but < \$50K; a non fatal injury or illness resulting in restricted work, transferred to another job, medical treatment greater than first aid, needle stick injuries and cuts from sharps that are contaminated from another persons blood or other potentially infectious material, medical removal under medical surveillance requirements of an OSHA standard, occupational hearing loss, or a work-related tuberculosis case.
- E < \$2K and/or an operational or maintenance mission is interrupted or not completed (intent for flight may or may not exist) due to fair wear and tear or malfunction of a component or part.
 - F Incident: Unavoidable aircraft turbine engine damage as a result of internal/external FOD.
- Military will maintain separate but equivalent OSHA 300 logs for injuries and illnesses.
- ** 3 DAC hospitalized, and or any contractors

Figure 1-3. Aviation Accident Reporting (Peacetime)

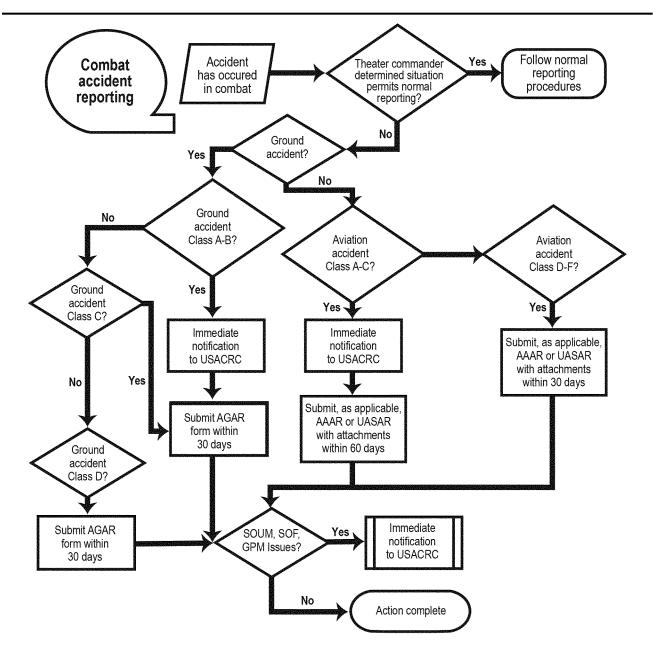

Notify by the most immediate means possible through the chain of command to USACRC (preferably via the IN Tool).

If OSHA rules apply and DACs are injured in a work related mishap, in addition to the required Army reporting forms, post to the OSHA log within 7 days and initiate the appropriate forms (OSHA 300, OSHA 300A). Orally report fatalities to DOL within 8 hours.

Figure 1-4. Combat Accident Reporting

Chapter 2 Investigation Procedures and Techniques

Section I Procedures

2-1. Organization and planning

- a. Introduction. The successful accomplishment of an accident investigation will depend upon how well it is planned, organized, and conducted. The techniques and procedures described here apply to all accident investigations. The investigating officer/board president is responsible for organizing and directing the efforts toward a thorough and comprehensive investigation. The board will be established according to AR 385–10 (see fig 2–1). Board members will give priority to the accident investigation and reporting duties to ensure prompt completion of the accident report.
- b. Investigation plan. The investigation plan is a systematic procedure that will ensure continuity of effort from the preliminary examination of the accident site to the submission of the final report. The plan is divided into four phases: organization and preliminary examination, data collection, analysis of the data, and completing the technical report.
- (1) Phase 1-Organization and preliminary examination. During this phase, the board president organizes the board for the investigation in a board meeting before departing for the accident scene. This meeting should ensure that every board member understands the areas of the investigation for which he or she is responsible, the initial tasks to be accomplished, and the data elements to be collected to complete the report. The board should also be briefed by the unit/installation safety director/officer on the status of preliminary actions. Once the board arrives at the accident site, members of the board should make a preliminary examination of the accident site to get a "mental picture" of the physical layout as an early step in their individual tasks. However, caution must be used to ensure the site, to include ground scars/marks, is not disturbed. If the board cannot arrive at the scene with adequate daylight remaining, the preliminary examination should be delayed until the following morning.
- (2) *Phase 2–Data collection.* Human, materiel, and environmental factors are interrelated as each influence the performance of man and machine. Divide data collection into the following areas:
- (a) Human factors. Human factors are primarily concerned with gathering data necessary to evaluate the actions of all personnel who influenced the operation which resulted in the accident. Paragraph 2–4 of this chapter is devoted to human factors investigation. The sources of human factors information may include, but are not limited to—
 - 1. Personnel involved, witnesses, supervisors, peers, and personnel from operations, training, and maintenance.
 - 2. Individual records, to include training, qualification, personnel, and/or medical records.
- 3. Data for the evaluation of the command influence, such as unit policy for risk management, hazard analysis, accident prevention plans, mission/activity/event briefings, crew rest/sleep (both long and short term), utilization of personnel, and driver selection/training.
- 4. Data for evaluation of the structure/system/equipment crashworthiness, personnel restraint systems, and personal protective clothing and equipment as related to injury/occupational illness causation or prevention.
 - 5. Data for the evaluation and reporting of problems encountered in egress, survival, and rescue.
- (b) Materiel factors. The materiel factors portion is primarily concerned with gathering data necessary to evaluate the performance and design of the vehicle, ground support equipment, land/or other materiel. Some sources for this information are the equipment historical, modification and inspection records, operator's manuals, manufacturer's specifications, fluid analysis, teardown analysis (TDA), wreckage distribution, photographs, and the failed part(s). The board president is encouraged to engage a system safety engineer from the command safety office(s) to gather data necessary to evaluate the performance and design of the materiel involved in the accident. Also, excellent sources of materiel information include equipment project managers (PM), manufacturers, equipment operators, and maintenance personnel. Data concerning how environmental conditions have affected vehicle/system/equipment performance must be acquired and evaluated. Paragraph 2–5 of this chapter is devoted to materiel factors investigation.
- (c) Environmental factors. Collect environmental data to evaluate its impact and influence on the performance of the individuals involved. Collection of environmental evidence is simultaneous and inclusive with the human and materiel factors evidence collection. Paragraph 2–6 of this chapter is devoted to environmental factors investigation.
- (3) Phase 3-Analysis of data. The analysis function is an ongoing process throughout the data collection phase. Conclusions derived from the analysis will be the basis for developing findings and recommendations. The analysis should be thorough and focus on determining why the accident occurred. This will drive the analytical effort throughout the investigation so that findings and recommendations can be developed, which have the best potential for preventing similar accidents. Paragraph 2–8 of this chapter addresses accident data analysis in greater detail.
- (4) Phase 4-Completing the technical report. In this phase, the board must ensure that all relevant evidence gathered is carefully recorded. It is not unusual for some of the evidence to be contradictory. Contradictory evidence will be discussed and resolved in the analysis to the greatest extent possible.

- c. Duties. Accident investigation boards will be established according to AR 385–10. When more than one individual is appointed to an investigation board, a board president, recorder, and other personnel (as required) will be designated. In some cases, the board will consist of one individual. This individual is responsible for all aspects of the investigation and report processing. As needed, technical advisors, equipment operators, support personnel, and other personnel will be made available to the board, regardless of its composition.
- (1) President. The duties of the president of an accident investigation board include, but are not limited to, the following:
 - (a) Managing the investigation according to this pamphlet.
 - (b) Convening the board at the earliest possible time after notification that an accident is to be investigated.
 - (c) Organizing the board and assigning areas of investigative responsibility to each member.
- (d) Taking control of the accident site upon arrival and after the area is declared safe for entry by rescue, explosive ordnance disposal (EOD), chemical, and firefighting personnel.
- (e) Verifying that adequate guards are on site or other engineering or administrative controls are in place to ensure the preservation and protection of evidence, to include site, equipment, separated parts, impact scars, resulting from the accident.
 - (f) Coordinating for all required investigating equipment necessary to conduct the investigation.
 - (g) Dispatching members of the board to perform their duties.
 - (h) Evaluating the need for and request additional technical assistance as required.
 - (i) Ensuring all available pertinent data is gathered before closing the field portion of the investigation.
- (j) After coordination with the legal accident board, authorizing recovery of the wreckage from the accident site when the field examination is complete and releasing wreckage/equipment for disposition to the owning organization when the investigation is completed.
- (k) Conducting frequent meetings of the board to ascertain progress, exchange information, and adjust assignments as necessary.
- (1) Ensuring accident information is released only to appropriate authorities, such as appropriate command, staff safety personnel concerned, and USACRC personnel.
- (m) Advising appropriate safety officer/public affairs officer (PAO) to contact local legal advisors in cases involving potential claims against the U.S. Government for personal injury/occupational illness or property damage.
 - (n) Conducting witness interviews as necessary for inclusion in the technical accident report.
 - (o) Ensuring data is correctly analyzed and conclusions are supported by evidence.
- (p) Ensuring suitable recommendations are made and that a thorough and accurate report is completed and submitted according to AR 385–10 and this publication.
 - (q) If applicable, coordinating with the local Criminal Investigation Division (CID) handling the case.
 - (r) Writing the history of flight/event, findings and recommendations, and analysis for the technical report.
- (2) Recorder. When possible, the recorder will be a safety trained individual. Physicians will not be assigned this duty. The duties of the recorder are listed below.
 - (a) Receiving and administratively processing information gathered by the members of the board.
 - (b) Monitoring report processing requirements and stages of completion.
 - (c) Assigning tasks and monitoring work of supporting clerical personnel.
 - (d) Ensuring all necessary substantiating data are collected and posted to the technical report.
 - (e) Assembling the final technical report.
 - (f) Performing other duties as assigned by the board president.
- (g) Completing/helping with preparation of the human, materiel, and/or environmental narrative of the technical report.
 - (h) Conducting and summarizing witness interviews as necessary for inclusion in the technical accident report.
- (3) *Maintenance officer*. A qualified maintenance officer or technician will be assigned to the board when materiel is involved. The duties of the maintenance member(s) are as follows:
 - (a) Evaluating all maintenance forms/records to determine the pre-accident status of the equipment.
 - (b) Determining if equipment failed and could have contributed to or caused the accident.
 - (c) Identify design deficiencies.
- (d) Researching equipment records for adequacy of inspections and correction of discrepancies and determining if discrepancies existed that may have caused or contributed to the accident.
 - (e) Supervising preparation and shipment of items selected for TDA.
 - (f) Monitoring equipment recovery if accomplished before completion of the investigation.
 - (g) Reviewing the unit's maintenance procedures and record discrepancies.
 - (h) Completing all maintenance/materiel factor requirements for the technical report.
 - (i) Preparing or helping with the preparation of accident scene diagram(s).
 - (j) Performing other duties as assigned by the board president.

- (k) Writing the materiel factors narrative for the technical report.
- (4) Medical officer. The duties of the medical officer board member are listed below.
- (a) Helping in the medical, physiological, and psychological aspects of the human factors portion of the investigation. AR 40–21, AR 40–3, and appropriate chapters of this pamphlet govern the investigation and reporting of these factors.
- (b) Helping with and conducting the accident survival, emergency egress, and survival/rescue portions of the human factors investigations according to paragraph 2-4 of this chapter.
- (c) Ensuring the board is advised of medical/human factors related to the cause(s) of the accident, the reason(s) therefore, and recommendations for corrective action.
- (d) In case of off-post accidents where the local coroners or medical examiners have jurisdiction. Ensure coordination with the Armed Forces Medical Examiner System (AFMES) prior to the autopsy, serve as an observer during the autopsy, and assist in transfer of the remains once they are released to the Army.
 - (e) Investigating and reporting data concerning personnel injuries.
 - (f) Collecting and evaluating life support equipment (LSE), and personal protective equipment (PPE).
 - (g) Helping with or completing human factors narrative for the technical report.
 - (h) Determining the medical qualification/status of the personnel involved and rescue personnel.
 - (i) Performing other duties as assigned by the board president.
- (5) Other board members. Other board members consist of individuals who have considerable knowledge and expertise in the required field. For example, instructor pilot, system safety engineer, master/senior/equipment operator, industrial hygienist, environmental health specialist, and others as required. The duties of other board members are as assigned by the board president. Other duties are, but not limited to, the following:
- (a) Examining and recording all factors involving operations of the equipment, to include assignment of personnel, mission/activity/event planning, and the history of events from mission/activity/event assignment to the time the accident occurred.
- (b) Investigating and recording the status of personnel/individual training, experience, operating regulation, instructions, and unit directives. Recommending and preparing changes to ARs, TMs, and other published guidance, if required.
- (c) Investigating the activities of all personnel who were victims, had an influence on the mission/activity/event, or played a role in the accident.
 - (d) Preparing a sketch of the accident site.
 - (e) Conducting and summarizing witness interviews as necessary for inclusion in the technical accident report.
 - (f) Completing/helping with the writing requirements of the technical report.
 - d. Support plan.
- (1) Safety representative. Commanders assigned responsibility for the conduct or support of accident investigations will ensure that a local safety professional is available from the local safety office to assist the accident investigation board. Duties of the safety representative include—
- (a) Providing the local investigation board with an accident investigation kit (see para 2–9 for a recommended listing of accident investigation kit contents) and/or other equipment necessary to conduct the investigation.
 - (b) Advising the board on technical aspects of the investigation and reporting of the accident.
 - (c) Helping the board in obtaining other technical assistance as required.
- (d) Advising the board of administrative procedures concerning accident reports. For example, command channel review and forwarding correspondence.
 - (e) Providing regulatory documents and directives pertaining to accident investigation and reporting.
 - (f) Providing necessary interpretation of local regulations and directives.
 - (g) Helping the board president in obtaining administrative support. For example, work space, typist, and drafting.
 - (h) Providing initial classification for the accident, such as Class A and B.
- (2) Commanders assigned responsibility for the conduct or support of an accident investigation will ensure that the following assistance is provided to the president of the investigation board, if needed.
- (a) Engineer. Provide surveying and mapping the debris pattern and preparation of required sketches. The engineer may also provide technical engineering review of the accident.
- (b) Local training and audio support center/public affairs activity. Primary photographic assistance provided by the local Training and Audiovisual Support Center (TASC), or from public affairs if a TASC is not available.
 - (c) Public affairs officer. Handle press representatives and public information releases.
- (d) Military treatment facility commander. Provide treatment and examination of personnel, identification of fatalities, facilities and support for conducting autopsies, lab support, and other medical support as necessary; for example, the preparation and shipment of body fluid samples and specimens to the AFMES for analysis.
 - (e) Provost marshal office. Provide guards, traffic control, and site security for the accident scene. As required,

serve as liaison with local law enforcement, provide accident information from DA Form 3946 (Military Police Traffic Accident Report), traffic citation history, traffic flow information, and daily blotters.

- (f) Weather officer. Obtain complete weather information for the time and location of the accident. (g) Maintenance support facility commander. Provide recovery of wreckage, disassembly and removal of components, and preparation for shipment of items selected for TDA. The maintenance support facility commander will also, provide preparation of ECOD to help in classifying the accident. (See para 2–2e.)
- (g) Transportation officer. Provide assistance in transportation to and from the accident site and expeditious shipment of components selected for TDA.
- e. Additional technical assistance. The board president should ascertain what additional specialized technical assistance may be necessary. Aside from the normal assignments of technical assistance, the more complex accident may require professional skills to help in the data collection and analysis. The board president has the authority to call for technical assistance from all agencies available to the local commander. Experts may include metallurgists, power plant engineers, fuel and oil analysts, and others as the circumstances dictate. If assistance is needed that is outside the local commander's span of control, assistance, such as manufacturer's representative(s), should be requested through the USACRC.
 - f. Legal accident investigations interface.
- (1) Legal accident investigations are used to make a record of the facts for use in litigation, claims, and other administrative and disciplinary actions, whereas the safety investigation (hereinafter referred to as the accident investigation) is conducted solely for accident prevention purposes. Legal accident investigations are conducted independently and apart from the accident investigation. They are appointed and conducted by local commands as required by DODI 6055.07, AR 385–10, and DA PAM 385–40 and use guidance contained in AR 15–6 and AR 27–20. Personnel serving in designated Safety positions or serving as a member on the safety accident investigation board will not participate in the conduct or formal review of legal accident investigations.
- (2) Safety accident and criminal investigations take priority over legal accident investigations for purposes of access to evidence, witnesses, and the accident scene; however, a spirit of cooperation is also required to ensure that the legal accident investigation board will have equal access to the evidence.
 - (3) The safety accident investigation board—
- (a) May only provide the legal accident investigator with copies of common source, factual information; (for example, technical data, maintenance records, photographs (as taken), maps, diagrams, lists of witness names).
- (b) Will not provide the content of witness statements, findings and recommendations, and analysis, to the legal accident investigator.
- (c) May provide access to transcripts of portions of intra-cockpit voice recordings included in the safety accident report in accordance with AR 385-10.
- (d) Will also allow the legal accident board a reasonable amount of time to perform an accident scene investigation before disturbing the evidence by movement and/or disassembly. If this cannot be accomplished due to the urgency of the situation, then the safety accident board must ensure that the scene is documented with photographs and a wreckage distribution (accident site) diagram, which will be made available to the legal accident board.
 - (e) Advise the legal accident board if the safety accident board removed components for analysis.
 - g. Criminal investigation interface.
 - (1) Contact with the local CID office should be made as soon as practical for the following:
- (a) Determine if the CID has assumed criminal investigative authority over the accident scene, initiated an investigation, removed any evidence, or completed/terminated its investigation of the accident site.
 - (b) The CID should determine as quickly as possible if a crime has been committed.
- (c) The criminal investigation will take priority over all other investigations, and the accident investigation will be discontinued if the evidence indicates that the incident was the result of a criminal act (see AR 385–10) for nonrecordable events) other than negligence, dereliction of duty, or disobedience of an order.
- (d) Once criminal activity is determined not to be a factor, the CID will release control of the investigation to the accident investigation board.
 - (2) During the period where criminal intent is being determined, both investigations will proceed.
- (a) Both the CID and the accident investigation board will cooperate with one another in order to ensure that each is able to effectively perform its mission/activity/event.
- (b) Information gained in the CID investigation can be released to, and used by, the accident investigation board. CID will, for example, provide the accident investigation board with copies of their report, to include witness statements and photographs.
- (c) However, the accident investigation board may release only those factual, non-privileged portions of its report to CID.
- h. Minority report. The official accident report will be the one signed by the board president. The board will make every effort to resolve differences in opinion. However, if differences cannot be resolved, the disagreeing board member(s) may submit a minority report. In this report, it is not necessary to repeat evidence presented in the accident

report. As a minimum, the minority report will include an analysis paragraph explaining the disagreement and a signature block of the minority member(s). Attach the minority report as a continuation of the DA Form 2397–3 narrative.

2-2. Preliminary accident site procedures

- a. Overview. This paragraph outlines actions that normally occur according to the unit pre-accident plan. Since several of these actions may have to be accomplished prior to the arrival of the safety accident investigation board at the accident site, the unit/installation safety officer must ensure they are accomplished. The safety officer will be the officer in charge of the accident site as soon as EOD, chemical, firefighting, and rescue personnel and military police/CID/civilian police have completed their duties and the fire chief has declared the area safe for entry. When the board president arrives, he will take charge of the accident site for the remainder of the investigation.
 - b. Actions to be taken.
- (1) The first priority at every accident site is the safety of victims/personnel involved. These personnel include, but are not limited to, the occupants of the vehicle, fire and rescue personnel, security personnel, witnesses, bystanders, and the investigators.
- (a) All personnel involved in the accident must be transported to a medical facility for examination, and, if necessary, treatment of injuries. All personnel must be evaluated by a physician or licensed health care professional, since some injuries may not be immediately apparent due to the stressful nature of the situation.
- (b) Key personnel involved in the accident must have the appropriate specimens collected in order to analyze for the presence of alcohol, carbon monoxide and drugs, according to AR 385–10. When applicable, the chain of custody of the specimens must be ensured.
 - (c) Specimens taken must be sent to AFMES for analyses and evaluation.
- (d) When the victims are obviously deceased, the bodies should not be removed before being photographed and examined by the medical officer if he is reasonably available (can be on site within 2 hours), except to protect from further damage.
- (e) If the accident occurred off the military reservation, the local coroner/medical examiner has jurisdiction on removal of the bodies. Therefore, his permission is required before the military removes the bodies.
- (f) If the coroner or medical examiner performs an autopsy, the board president must request that a military forensic pathologist or a physician approved by the AFMES be present during the autopsy.
- (2) Immediate steps must be taken to prevent injury/occupational illness to personnel from fire, ammunition cook-off, hazardous material, burnt carbon fiber exposure (present for fires involving composite materials), and other potential hazards present at the accident site. The most effective means of providing security in these cases is to rope off the area and place guards around the scene at a distance sufficient to ensure protection for personnel.
 - (a) In cases where the hazard is an explosive device, an EOD unit will be alerted.
- (b) Also, since composite materials (burnt or fragmented) are present in most modern aircraft, tactical wheeled and tracked vehicles, and equipment, safety personnel must evaluate all accidents (both aviation and ground) for the presence of composite materials to prevent unnecessary exposure or endangerment of rescue, firefighting, and investigative personnel.
- (c) Safety measures and procedures for handling accidents involving composite materials should be included in all pre-accident plans and incorporated in local crash rescue and firefighting training.
- (d) Assistance for establishing a composite material standing operating procedure (SOP) can be obtained by contacting USACRC at DSN 558-3410/2660 or COM (334) 255-2660.
- (e) Even after the scene has been declared safe for entry by the fire chief, fire and other hazards will usually continue to exist and all personnel entering the area must be so advised.
 - c. Preservation of accident site.
- (1) As soon as the accident scene is declared safe for entry, the next task is to ensure the wreckage and other physical evidence is safeguarded from bystanders and sightseers. This includes—
 - (a) Military and civilian personnel who have no official business at the scene, according to AR 385-10, chapter 3.
- (b) The local safety representative must ensure that guards remain on duty to keep unauthorized personnel outside the roped-off area and upwind of hazardous composite material.
- (c) An entry point will be established where authorized personnel (personnel essential to the preservation of life, property, and evidence) can present their identification for entry clearance.
- (d) Authorized personnel entering the immediate accident site area before the arrival of the board will be escorted by the safety officer. Limited access is essential to protect physical evidence, such as ground scars, vegetation, which is easily destroyed.
- (2) When the evidence must be removed (clear a highway) before the investigation by the board, the local safety representative must—
 - (a) Ensure the original accident scene is documented.

- (b) This includes preparation of an accurate wreckage distribution diagram along with a photographic record of the accident scene.
 - (c) Every effort must be made to preserve the evidence when it must be moved or disturbed.
 - (d) A record of any subsequent damage to the equipment during rescue or recovery must be maintained.
 - d. Preservation of evidence.
- (1) The local safety representative must identify as many witnesses (by name, address, and telephone number (duty/work) to the accident as possible.
- (a) Witnesses must be asked not to discuss the accident with other witnesses and informed that they could be contacted for an interview by the accident investigation board.
- (b) If it appears that a witness may not be available for an interview by the board, the safety representative will conduct the interview for the board.
- (c) He/she should take as many written statements as possible and deliver them to the board president upon his arrival.
- (d) The local safety representative will determine if any of the witnesses has video or photographic evidence that may be useful to the board. If such evidence exists, he/she should acquire a copy of it for the board.
- (2) Records pertaining to the accident equipment and its crew/personnel must be gathered and secured. These records include—
 - (a) The logbook.
 - (b) Historical records.
 - (c) The appropriate inspection and maintenance records.
 - (d) Individual/crew member records, to include personnel, medical, dental, and training records.
 - (e) Documents pertaining to the mission/activity/event must also be gathered.
 - (f) A weather observation for the time of the accident from the closest weather reporting facility.
- e. Classification of the accident. The local safety officer has responsibility for initially classifying the accident according to AR 385-10.
- (1) To help the safety representative in accomplishing this task, the supporting maintenance facility will provide the safety officer with an ECOD (a UAS contract may require the ECOD(s) be provided by the contractor and/or manufacturer).
- (2) The supporting medical activity will provide an assessment of the degree of injuries according to AR 385–10, if applicable.
- (3) The accident classification is necessary to determine the required notifications of the accident according to AR 385-10 and local command procedures.
- f. Press relations. If the PAO is not available, the local safety representative may have to handle press relations at the accident scene. The safety officer should be aware of the following:
- (1) No attempt should be made to tell a reporter what they should write in a story or to restrict them from interviewing civilian witnesses. Military personnel should be cautioned against making statements, expressing opinions, or giving out information concerning the accident. A few moments of calm conversation with the reporter can usually prevent a great deal of misunderstanding.
- (2) In most cases, news reporters will understand the truth of the statement that the accident investigation has just begun and that it is impossible to make statements with incomplete information. Without giving the appearance of trying to conceal anything or pass the reporters' questions off lightly, the safety officer should advise media that the post or local PAO will have a statement as soon as the exact events leading up to the accident are known. The safety officer and accident investigation boards are not authorized to issue news releases, but it usually will help press relations at an accident scene if they do not quote regulations as the reason why they cannot disclose accident details.
- (3) In many instances, the news reporters are able to provide a great deal more information than they receive. Sometimes reporters are among the first persons to arrive at the accident site and they may have talked to several witnesses before the rescue party arrives. This fact may not be apparent from their conversations, which probably will consist primarily of questions. In most cases, the reporters will be happy to pass their information along and give the investigator further assistance if they understand the value of their efforts to the safety program. If the news agency is asked to provide photos or film clips, be advised that a fee will usually be involved, so arrangements for financing should be made before making this kind of request for assistance. The same caution applies to other nonmilitary agencies, such as police and fire departments.
- (4) When an accident occurs on nonmilitary property, media personnel should be allowed complete freedom in taking photographs, after being requested not to disturb physical evidence consistent with procedures. If classified material is involved, the photographer should be advised of such. If necessary, the photographer may further be advised that the photographing of classified material may constitute a violation of Federal law. Any such classified material should be either covered or removed before photographs are taken. Although no restriction is placed on the photographic

pher, a tactful request will usually prevent the use of gruesome photos. Media personnel should also be advised that the notification of next of kin may not have been accomplished.

Section II

Techniques and Procedures

2-3. Witness interviews

- a. Introduction.
- (1) *Purpose.* In all accidents, witnesses will be advised that the sole purpose of the investigation is accident prevention. This means that, within the DOD, their statement may not be used as evidence or to obtain evidence in connection with any legal, disciplinary or adverse administrative action. Their statements cannot be used by the Army against them or anyone else.
- (2) *Interview*. The witness interview is an extremely important part of the investigation. Witnesses may provide clues that can help identify material failures/malfunctions, environmental conditions, and/or human errors. In the case of human error, the interview may provide the only evidence available to identify the error(s) and its cause(s). To obtain this type of information, the interviewer must be skilled in interview techniques.
- (3) Statement. A witness statement will not be a verbatim or edited transcript of all that was stated. Summarizations of the witness's testimony will be used, but these will not exclude any information that helps in explaining why the accident occurred. These summarizations should be written in the third person ("the witness said," "They saw,"), not in the first person ("I saw," "I observed,"). The testimony of a witness will not be made under oath. The accident investigation board must obtain complete and candid information regarding circumstances surrounding the accident to determine the actual cause factors.
 - (4) Promise of confidentiality.
- (a) Limited use reports. Witnesses in a Limited Use investigation may be given a promise of confidentiality per AR 385–10. This promises that the Army will not voluntarily release their statement outside the DOD, either to members of the public, the press, state or local governments, or other Federal agencies. Such confidential witness statements are also protected from public release under the Freedom of Information Act (FOIA). The U.S. Army promises to oppose in court any attempt to get a legal order to release their statement and to use the Army's best efforts to appeal any court order to release their statement.
- (b) General use reports. Witnesses in General Use accident investigations will not be given a promise of confidentiality unless approved by the Commander, USACRC. Typically, these promises are requested in cases where key witnesses choose not to provide information unless they are given the promise of confidentiality or for cases listed in AR 385–10, chapter 3. Upon approval by the Commander, USACRC, that accident report would then be deemed Limited Use.
- (5) Specific procedures governing advice to witnesses and promises of confidentiality. In both Limited Use and General Use investigations, it is important that witnesses understand the restrictions on the use of their interviews within DOD, as well as the release of their interviews to the public (under the FOIA). This is especially true in Limited Use investigations when a promise of confidentiality has been given to a witness. In Limited Use investigations, a promise of confidentiality will routinely be offered to the following categories of witnesses:
 - (a) Accident aircraft crew members (pilot, maintenance test pilot, crew chiefs).
 - (b) Technical inspectors and maintenance personnel (typically for aircraft accidents).
- (c) Witnesses questioned in Limited Use investigations may be offered confidentiality at the discretion of the investigator. Specific forms and procedural guidelines for their completion are at paragraph 3–7 and paragraph 4–5.
 - b. Locating witnesses.
- (1) Since witness information is based on recall and perception, it is advisable to interview all available witnesses. Witness statements may prove to be as valuable as physical evidence. Both types of evidence must be considered together in determining cause factors, as one may complement or clarify the other.
- (2) Witnesses must be located and interviewed as soon as possible. Evaluation of their statements may tell the investigator(s) what particular area of the investigation should be emphasized, thus reducing the time it will take to determine the cause(s) of the accident.
- (3) It is reasonable to assume that spectators and sightseers, who are at the scene when the investigator(s) arrives, heard or saw something that attracted their attention to the accident and brought them to the scene. Talking to these people immediately may give the investigator information regarding the directions, actions, and sounds of the accident. *Note.* Children should not be discounted as a potential source of information.
- (4) In many cases, especially with aviation accidents, efforts to locate witnesses should not be confined to the actual scene of the accident. It may happen that a person many miles from the accident site has some relevant information to give. Evidence of smoke, fire, unusual maneuvers, erratic engine operation, structural failure, and loss of control may be obtained from observers along the route who were not necessarily witnesses to the actual accident. Other personnel, (for example, crews of other vehicles/aircraft in the vicinity at the time of the accident) may be particularly helpful in

establishing actual weather conditions. The operators of other vehicles may also be helpful in relating transmitted messages of vital importance.

- (5) Statements taken from witnesses located immediately after the accident, before they have time to compare stories with other witnesses, are the most reliable. Get a statement, regardless of how brief, from all witnesses as soon as they can be located. Witnesses can always be visited again at a later time, if additional information or clarification of their statements is needed. However, the human mind has a tendency to fill gaps in recollection with logic and the longer a witness has to reconsider the events, the more he or she will subconsciously tend to do this.
- (6) Local police and news media personnel can often be helpful in locating witnesses. These people, particularly reporters, are interested in interviewing witnesses, and it is quite possible that they will have found some witnesses having valuable information before the investigator arrives.
- c. The witness. It is very important that the interviewer(s) establish a good rapport and gain the confidence of witnesses. It is not unusual to have to re-interview key personnel as more information becomes available from other sources or when the board begins analyzing data. Most witnesses can be placed in one of the following categories:
- (1) Individual personally involved. Generally, these are the individuals actually involved in the accident; (for example, pilot, copilot, driver, paratrooper, and diver.) However, other individuals having knowledge related to the cause of the accident must also be considered; (for example, the spouse of the pilot involved in an accident could be interviewed for information). Note. Interviews conducted to ascertain sensitive information pertaining to the mental state of the pilot should be conducted by the board president.
- (2) Supervisory and support personnel. This category includes those personnel whose job performance could have affected the outcome of the mission/activity/event or the performance of personnel. It is also important to gain the confidence of these witnesses since questions relating to their performance will be asked.
- (3) Eyewitnesses. This category includes not only persons who actually saw or heard things associated with the accident but also persons who saw or heard anything relevant to the subject matter of the investigation. The important point here is to try to separate what was actually seen or heard from what the witnesses may think they saw or heard.
- d. The interviewer. The number of investigators present during the interview is at the discretion of the board president.
 - (1) More than two or three investigators could intimidate some witnesses.
 - (a) One investigator should conduct the interview and maintain eye contact with the witness.
 - (b) Another investigator can monitor the tape recorder and take notes on areas for further questioning.
 - (2) When tape recordings are to be used, the witness must first consent to the electronic recording of the statement.
- (3) When the first investigator has completed his/her questioning, he/she should then allow the other team member(s) to continue with further questions, if necessary.
- (4) Once a summarization of the witness's interview has been prepared, preservation of the actual recording is not necessary and will be disposed of.
 - e. Interviewing techniques.
- (1) Planning the interview. Initial questioning should focus on general areas rather than relying on a prepared list of questions that can be answered by a "yes" or "no." Subsequent questions should focus on key areas of interest. In addition to eliminating the tendency of the person being interviewed to answer "yes" or "no," planning has the following advantages:
 - (a) It allows the witness to do most of the talking.
 - (b) It permits the witness to elaborate on pertinent details that a planned list of questions may fail to elicit.
 - (c) The interview is less formal and rigid.
- (2) The interviewer should have the person being interviewed do most of the talking. One method for keeping a witness talking without a direct question from the interviewer is the pause. The pause is best employed following an assertion by the witness.
- (3) The use of a tape recorder is the preferred method of recording witness interviews. It allows interviewer and witness to focus on the content of the interview.
- (a) An alternate method is to take notes during the interview. However, this method should be used only when the witness objects to the use of a tape recorder.
- (b) Although the first few minutes of a taped interview may make the person being interviewed feel "on the spot" or awkward, this is usually a transient condition and the remainder of the interview will be as candid as if unrecorded.
- (c) If a tape recorder is used as the sole means of recording a witness statement, the interviewer should take a few simple precautions to guarantee that the interview will be recorded with sufficient clarity.
- 1. Become familiar with, and test the recording equipment before the interview. If the recording unit must be operated on its internal batteries, replace the batteries with fresh ones before the interview.
- 2. Environmental noise, such as aircraft operating nearby or windy conditions when a recording is made outdoors, may seriously impair the clarity of what is being said by the interviewer and witness. Therefore, it is preferred that interviews be conducted at locations free of this kind of distraction.
 - 3. When several witness interviews are taken via tape recorder, the interviewer will find it useful to begin each

recording by taping the information required by the heading blocks of the summary of witness interview. This not only allows each witness time to relax in the presence of the recorder, but it will ensure the proper identification of each witness and will complement the transcribing process when it becomes necessary to summarize witness interviews in the accident report.

- 4. If there is no tape recorder available, or if a witness seems hesitant about talking while being recorded, an alternate procedure is to take as few notes as possible during the interview, filling in the planned areas of interest immediately after the interview.
 - (4) Other considerations when conducting witness interviewing are as follows:
- (a) Witnesses should be encouraged to speak of matters that they have personal knowledge of; in this instance, what the witness saw or heard, not what he or she may have heard other witnesses say they saw or heard.
- (b) Witnesses should be encouraged to tell in their own words all they know about the accident. Do not attempt to lead the witness.
- (c) While talking, witnesses should not be interrupted except to prevent them from going too far into irrelevant matters.
- (d) After the witness has finished giving an interview, questions should be asked to clarify doubtful points that may arise during the interview. Questions should not be phrased in such a manner as to suggest the answer. Get name, phone number, and address for follow-up. Ask about eyeglass usage or hearing aid devices. Frequently, if these questions are not asked at this time, the information may not be captured.
- (e) The use of highly technical terms should be avoided when asking questions of a witness who may have no knowledge of the terms.
 - (f) A witness should be treated with utmost courtesy at all times and any semblance of coercion avoided.
- (g) A witness may be able to express a statement better by sketches than words. Such sketches are acceptable as clarifications of the evidence. A scale model of the type of equipment involved in the accident is also useful as an aid in obtaining more details from a witness.
- (h) When a witness refers to maps or photographs, these should be identified in the summary of the interview. The points mentioned should also be cross-referenced on the map or photograph.
- (i) A witness may be able to give a clearer statement if interviewed in the same location where he observed the accident.
- f. Interviewing injured witnesses. The techniques for interviewing witnesses injured and hospitalized because of their involvement in an accident are not unlike those previously discussed for uninjured personnel. There are a few special considerations, however, as follows:
- (1) The medical facility admitting and treating the injured survivors of an accident is responsible for their well being. Therefore, interviews with injured survivors while they are in an inpatient status will be—
- (a) Coordinated with the medical facility and attending physician(s) so as not to conflict with the injured survivor's medical needs.
 - (b) Utilize the board physician as an interface with the hospital/attending physicians.
- (2) Timeliness in interviewing hospitalized witnesses, though desired, is not an overriding requirement. There are cases, however, that because of the nature and degree of injuries involved, may require subsequent evacuation of an injured key witness to another medical facility far removed from where the board is conducting its investigation. If this happens before the witness is interviewed, it may be necessary to have a board member conduct the interview(s) at the other medical facility later. If this is not feasible, then it may be possible to solicit the services of a physician stationed at or near the other medical facility to act as a proxy interviewer for the board.
- (3) The physician member of the board is the logical person to represent the board when it is necessary to interview hospitalized personnel because of their involvement in the accident. In this case, it may be better to prepare questions in advance. They should be tailored to obtain responses essential to the investigation.
- (a) In cases where the person being interviewed is under the influence of medications, it is the physician member's responsibility to qualify the credibility of information obtained under these circumstances.
- (b) Two or three short interviews with certain injured survivors may be more beneficial and may minimize any negative affect on their emotional state than conducting one lengthy session. Each case should be handled on the basis of its own circumstances. In any case, the well-being of the witness is paramount at all times and will govern the board's conduct of this type interview.
- (c) It is not unusual for an injured survivor of an accident to initially be unable to recall details of the accident that would be useful to the board. The cause of this condition is usually temporary and medically valid, and the inability of the witness to recall details should never be interpreted as a lack of cooperation. Patience and empathy on the part of the interviewer under these circumstances may eventually result in obtaining the desired information, whereas persistence and impatience may not.
- g. Evaluating witness evidence. All witness interview results should be subjected to evaluation since a witness may be honestly mistaken about actions they took or observations they made. Also, some witnesses may have a personal interest in the matter and may have a motive to intentionally distort the information they provide. When the interviews

are numerous, complex, or contradictory, the board should evaluate each witness interview for credibility. In general, very specific information about speeds or maneuvers provided by an eyewitness should be considered as approximations since even eyewitnesses with experience have difficulty with these estimates.

2-4. Human factors investigation

- a. Introduction. This section provides procedure and format to perform a systematic and comprehensive investigation of human factors. For discussion purposes, the human factors assessment will be addressed within the context of the following areas: human error, accident survival, emergency egress and rescue/survival, autopsy procedures, PPE, and facilities/services. The objectives of the human factors investigation is to identify system inadequacy(ies) within the interactions of man, machine, and environment (see fig 2–2).
 - b. Human influence.
- (1) Recording accident data. Accident data recorded to date indicate most accidents can be ultimately traced to human errors. When an accident investigation board lists human error(s) as causal, it does not necessarily mean the Soldier/individual did something intentionally to cause the accident (as the use of the term "human error" might imply). For this reason, the human factors investigation must be broad in scope.
 - (2) Identifying human error(s).
- (a) The first step in identifying human error(s) is to develop a chronology of events before, during, and when appropriate, after the accident (see fig 2–3). The need for placing events in order is to view human performance in the context that it occurred. The logical sources of information are the individuals involved in the planning, preparation, supervision, and execution of the mission, event, task, or activity. All of these individuals should be interviewed using the techniques discussed in paragraph 2–3.
- (b) During these interviews, the operational expert may detect possible errors or at least suspect errors on the part of the individual being interviewed or the individual who is being discussed. Some errors may not become evident until much later in the investigation when the relevant chronology has been developed. For example, investigation into the causes of materiel failures may ultimately be traced to a human error. An error by an individual may be traced to other errors committed by supervisors and instructors. Regardless of when or how factor(s) are detected, it is important that the investigator get all the available information about those factor(s). Without this information, it will be difficult for the board to "define" the factor(s) and identify its cause(s).
- (c) Recent improvements in training publications have made the process somewhat easier since most operator and mechanic tasks have been defined in TMs and Soldier manuals. These task definitions include requirements and performance standards that will aid the investigator in identifying how the task was improperly performed. Other individual, supervisory, and support personnel tasks are identified in less specific terms in other publications or SOPs.
- (3) Explaining human error(s). Regardless of the task involved (for example, flight planning, installing a tail rotor, and changing brake pads/shoes), the explanation of how it was improperly performed should identify the directive, standard, and the performance deviated from or not complied with. The fact that an error occurred in itself has little meaning until its consequence(s) and relevance to the accident are also explained. Therefore, the defining and explanation process for human errors is not complete or meaningful until—
 - (a) The duty position of the individual involved is identified.
 - (b) The task the individual performed improperly in the context of the accident sequence is explained.
 - (c) The human error(s) is identified.
 - (d) The proper procedure for performing the task is identified.
 - (e) How the human error(s) caused or contributed to the accident is identified.
 - c. Causes of human errors.
- (1) *Theory*. The basic belief behind the investigation of human errors is that there is some reason for all human behavior. Once this reason is identified and sufficiently defined, it can be modified/improved, thus reducing the probability of similar human errors and their consequences in the future. Therefore, the causes of human errors should be identified in terms of one or more system inadequacies.
 - (2) Identifying system inadequacy(ies) (why the mistake/error/failure occurred).
- (a) The best way to identify system inadequacy(ies) is to work backward from a mistake/error by asking questions aimed at "illuminating" the error (see fig 2–1). The most direct source of information is the individual who made the error. It is especially important to follow the procedure of paragraph 2–3 and not lead or intimidate this individual. The interviewer will have to use his judgment on how best to phrase the questions.
- (b) The most practical approach is to establish the circumstances for the witness and allow him/her to recognize the error. If the witness acknowledges the error, the simplest method will probably be to come straight to the point and ask why. Asking "why" can be extremely helpful in identifying the cause(s) of his/her improper task performance.
- (c) On the other hand, if the witness does not recognize or acknowledge the error, it may be best for the interviewer to continue with other questions to avoid making the witness defensive or uncooperative. The interviewer can continue by asking questions intended to identify possible system inadequacy(ies) which caused or allowed the error.
- (d) After this indirect questioning, the interviewer can return to more direct questions about the error. This approach will usually produce the most reliable information.

- (e) The human factors investigator will also have information from other sources. These include individual records, unit records, and other individuals who may have knowledge about the individual or the accident. A post-accident medical examination may identify physiological factors, (for example, acute fatigue, alcohol, carbon monoxide, drugs, and impaired vision).
- d. Accident survival investigation. The purpose of the accident survival portion of the investigation is to identify preventable injuries and report them in a format that will help in an injury prevention program. To accomplish this, the types of injuries must be defined and related to the impact, design, and other conditions to determine underlying causes. This investigation normally will be performed by the medical officer.
- e. Emergency egress investigation. Egress associated with an accident is usually in response to an emergency situation. Information to be reported will include—
 - (1) Where the individual was located when the initial attempt to exit the equipment occurred.
 - (2) Any delays in attempting the egress; (for example, turn off fuel or battery).
- (3) Where the individual exited the equipment. Ascertain any difficulties encountered due to obstructions, opening the exit, or in using the exit after it was open.
- (4) Any assistance that an occupant required in exiting the equipment that could indicate a deficiency in emergency exit design or operation.
 - (5) Equipment and material used during the egress that failed to function or functioned improperly.
 - (6) Any other difficulties encountered during egress.
- f. Survival/rescue investigation. The survival/rescue sequence of an accident includes that period of time from the onset of the accident to the time rescue personnel reached the individual or the individual reached a facility that provided medical care. Throughout the investigation, it is important to examine factors that may have contributed to or inhibited the success of the survival situation.
 - (1) Consider methods used and time taken for actions.
- (2) The methods survivors used to help in survival should be evaluated to determine if these methods were adequate or inadequate and why.
- (3) The methods and equipment rescue parties used in locating, recovering, and rescuing survivors should be examined to determine their adequacy.
 - g. Autopsy procedures.
- (1) Requirement for autopsy. A requirement that an autopsy be performed on the remains of air crew members is contained in AR 40–21 and AR 385–10. In other cases, to specifically include cases where Soldiers on "active duty" or "active duty for training" are fatally injured, the Commander, USACRC, in consultation with the commander of the medical treatment facility (MTF) nearest the scene of the accident or where the body is located, may authorize an autopsy on the remains.
- (a) This authority applies to those cases where an autopsy is deemed necessary for safety reasons in order to determine the true cause of death.
- (b) The pathologist must obtain permission to perform an autopsy from the appropriate military/civilian authority having jurisdiction over the body as it is recovered.
- (c) In the above cases, investigation of a fatal accident is not complete without an autopsy, special body fluid, and tissue studies. Detailed instructions regarding collection and shipping of material for these studies can be found in appendix E.
 - (d) Every effort will be made by the medical investigator to obtain an autopsy report according to Army regulations.
- (2) Armed Forces Medical Examiner System. AFMES may provide on-site assistance for fatal accidents. When Army equipment and personnel are involved, requests for such assistance may be made through the USACRC. Telephone number COM (302) 346–8648, DSN 285–8648. AFMES, can provide the following types of assistance.
 - (a) Collecting information that may show a correlation between pathological evidence and accident cause factors.
 - (b) Determining causes of unexplained accidents by detailed pathological study.
- 1. Using pathological correlation to improve personnel and passenger restraint systems, PPE, and equipment crashworthiness.
 - 2. Accumulating pathological data from a wide variety of cases.
 - 3. Studying psychological and physiological factors that cause stress and may result in pathological changes.
- (c) The pathologist/physician should examine the results of the autopsy for evidence that may help to explain the cause of the accident. This information is needed to determine the exact traumatic changes that occur. Specify the causes of each and differentiate whether they occurred before or after death. These determinations should not be used solely to determine the cause of death. They should also be used to—
 - 1. Establish time and cause relationship between preexisting disease and the accident.
 - 2. Correlate injuries with various factors in equipment design.
- 3. Determine all pathological evidence that might lead to an accurate analysis of the chronology of events surrounding an accident.
 - (3) Conduct of gross autopsy. Procedures for conducting gross autopsies are contained in appendix E.

- h. Life support equipment and personal protective equipment.
- (1) It is the responsibility of the investigator to analyze how well LSE, or other PPE, did the job for which it was intended. If the investigator determines the equipment did not operate as designed, the investigator must further determine if the item of equipment contributed to, or caused injury/occupational illness.
- (2) All LSE and/or PPE that is in any way implicated in the cause or prevention of injury will be recorded in the accident report. Both air and ground items that caused injury, failed to function as designed, or were significant in preventing injury will be shipped to the U. S. Army Aeromedical Research Laboratory (USAARL) for further analysis. This equipment includes, but is not limited to, helmets, survival vests and components, body armor, crashworthy seat system, restraint harnesses, inertial reels, seat belts, and air bag systems.
- (3) Contact USAARL concerning which items of LSE/PPE that should be shipped and the supporting documentation required. Call telephone number DSN 558-6960/6920, COM (334)255-6960/6920.
- (4) Before completion of the field investigation, the president of the investigation board will arrange for shipment of the equipment for laboratory analysis to: Commander, USAARL (Crew Injury/Life Support Equipment Branch), Bldg. 6901, Andrews Avenue, Fort Rucker, AL 36362–0577.
- (5) Equipment items sent to USAARL for laboratory analysis will be noted in the technical report of accident investigation.
- (6) For personal LSE/PPE sent, identify the wearer/user of each item. For items sent such as a survival vest, count vest and components as one item, unless a component is torn free or separated during the accident sequence.
- (7) Upon completion of the laboratory analysis, USAARL will dispose of unserviceable items and return serviceable items to the unit of origin or the supply system.
- (8) Upon request by the USACRC, a copy of the completed laboratory analysis performed under the provisions of this paragraph will be furnished for inclusion in the final report of the accident.
- *i. Narrative reporting.* Paragraphs 3–6 and 4–4 provide instructions for narrative reporting the human factors investigation.

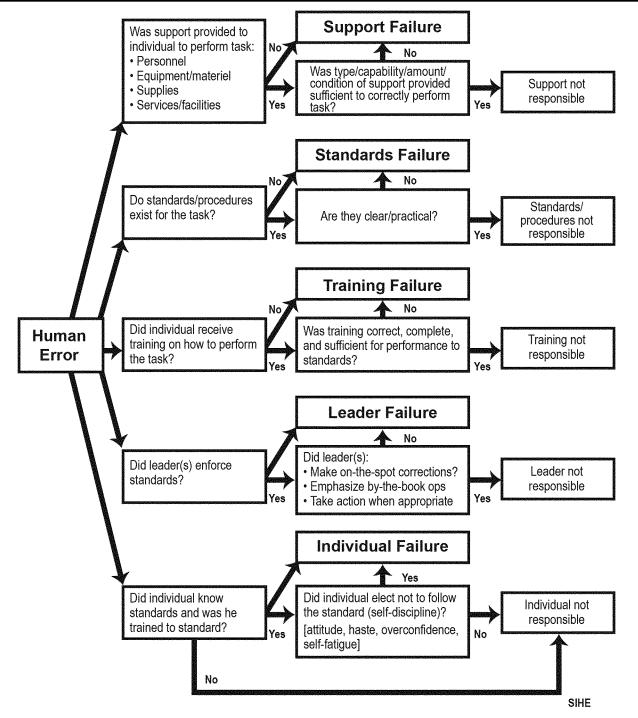


Figure 2-1. Determining System Inadequacy(ies) Responsible for Human Error

Sequence of Events 1. (When did error/failure/environment factor/injury occur?)									
a. Selection and training of personnel or design and manufacture of equipment	b. Mission, task, activity, event	c. Mission planning	d. Actions during mission	e. Accidents	f. Egress, survival, rescue				
(What happened?) Human factors, material factors, environmental factors, injury (Why did it happen?) System inadequacy(ies)/root cause(s)									
4. (What should be done about it?) Remedies for system inadequacy(ies)/root cause(s)									

Figure 2-2. Methods to Place Each Factor in its Proper Perspective in Relation to Other Events

2-5. Materiel factors investigation

a. Introduction.

Note. In this paragraph, the term "equipment" is utilized to indicate the piece of equipment involved in an accident investigation, such as aircraft, vehicle, structure, weapon system, component, and part.

- (1) This paragraph provides procedures for performing a systematic and comprehensive investigation of materiel factors associated with an accident. The objectives of the materiel factors investigation are as follows:
 - (a) To establish the equipment's condition at the time of the accident.
 - (b) To describe the damage that occurred during the accident sequence.
 - (c) To identify material failures/malfunctions that resulted in an accident (what happened).
 - (d) To identify the system inadequacy(ies) for the materiel failure(s)/malfunction(s) (why it failed).
- (2) The investigation of materiel factors requires, as a minimum, the assistance of a maintenance or technically qualified individual.
 - b. Materiel failure(s)/malfunction(s).
 - (1) Equipment, or a part thereof, is considered to have failed or malfunctioned when one of the following occurs:
 - (a) Becomes completely inoperable.
 - (b) Is still operable but no longer able to perform its intended function satisfactorily.
 - (c) Has deteriorated to the point where it is unreliable or unsafe for continued use.

Note. This explanation does not apply if the equipment achieves any of these three states because the required operational situation/condition that it was employed in exceeded its design capability or operating limits.

- (2) The success of the materiel factors investigation is dependent upon determining the difference between failures/malfunctions that may have caused the accident and damage caused by the accident. The procedures to be followed are generally the same for all accidents, regardless of damage.
- (3) The first step in identifying materiel failure(s)/malfunction(s) is to document the most obvious evidence available at the accident site by taking notes, photographs, and drawing diagrams. By the time these tasks have been completed, the human factors investigation will usually have some preliminary information from witnesses that may further indicate the most probable failure/malfunction. These possibilities should be carefully examined.
- (a) Even though the investigation begins by examining components that probably failed, this examination is not complete until all major components and systems have been examined for evidence of failure/malfunction.
- (b) In cases where preliminary evidence (for example, witness statements) indicates no failure/malfunction occurred, the examination is still required. The purpose of the examination in this case would be to describe damage along with substantiating the lack of evidence supporting a failure/malfunction.

- (4) The next step is the shipment of the material to a TDA facility of those components that the board identified or suspected of having failed/malfunctioned. The TDA is important since the board may not have the capability to determine how and why a component failed.
- (5) The last step for the materiel factors investigation is to determine the cause of the failure/malfunction. Assistance can be obtained from the following facilities by coordinating with USACRC operations at DSN 558–3410.
- (a) Aircraft. Corpus Christi Army Depot, Corpus Christi, TX 78419–6020, telephone DSN 861–2902/2903, COM (361) 961–2902/2903.
- (b) Ground vehicles. Tank-Automotive and Armaments Command, Warren, MI 48397–5000, telephone DSN 786–6194/6121, COM (313) 574–6194/6121.
 - (c) Parachutes. Natick Labs, Natick, MA, telephone DSN 256-5208, COM (508) 233-5208.
- (d) Life Support Equipment/Personal Protective Equipment. U.S. Army Aeromedical Research Laboratory, Bldg 6901, Andrews Avenue, Fort Rucker, AL 36362–0577, telephone DSN 558–6960, COM 334–255–6960.
- (e) Ammunition/Explosives. U.S. Army Technical Center for Explosives Safety, 1 C Tree Road, McAlester, OK 74501–9053, telephone DSN 956–8756/8919, COM (918) 420–8756/8919.
 - c. Causes of materiel failure/malfunction.
- (1) Overview. As in the case of human error, the causes of materiel failure/malfunction can usually be traced to an inadequate systems element. (See App D for examples of metal fatigue and load stress failures.) Once identified, corrective action can be taken to prevent the probability of similar materiel failure accidents in the future. Thus, the causes of materiel failure/malfunction will be identified in terms of one or more system inadequacy(ies). A materiel system inadequacy is defined as a tangible or intangible element that did not operate as intended or designed and caused, allowed, or contributed to a materiel failure or malfunction. Material failure system inadequacies may be characterized as Design, Manufacture, Fair Wear and Tear and Maintenance. If system inadequacy(ies) identifying improper maintenance where the Army has control are selected, such as system inadequacies codes 13 and 14, and the duty code of the individual(s) can be identified, a resultant finding must be written as a human mistake/error and consider the failure/malfunction as a result of human mistake/error instead of a materiel failure.
- (2) *Identifying system inadequacy(ies)* (why did it happen). Once the materiel factors investigation team has identified or suspects a failure/malfunction, it must continue the search for evidence to substantiate the cause of the failure. For example, could unit maintenance have caused a failure of this part, component, or system? To answer questions like this, the investigator must—
 - (a) Examine records and unit operating procedures.
- (b) The materiel factors investigation must interface with the human factors investigation to search for errors/mistakes that may have resulted in the materiel failure.
- (c) The investigator should try to gather evidence that will substantiate or eliminate each of the system elements that is within his capability to investigate. Thus, the procedure can be described as a process of elimination.
- (d) If the investigation is unable to uncover evidence of a system inadequacy locally, the determination of the cause should be delayed until a thorough teardown and analysis can be completed.
- d. Accident scene. The investigation of the equipment and the components must begin at the scene of the accident. It is here investigators get an overview of the accident pattern, degree of damage, direction traveled, and velocity when the accident occurred. This overview will play an important part in reaching decisions concerning all aspects of the investigation. Therefore, it is necessary to carefully document the scene of the accident as outlined in the following paragraphs.
- (1) Reconstruction of the accident sequence. The goals of the investigator(s) include determining how and why damage, separations, and injuries occurred. The best way to initiate this effort is to begin at the point of first contact with objects in the path or with the ground and follow the path to its final resting place. During this survey, the investigator(s) will—
- (a) Observe the condition and location of the various parts of the equipment and mentally begin the process of reconstructing the sequence of events that occurred during the accident.
- (b) If relevant, the location of human bodies and their disembodied parts should also be located on the diagram. This process will not be completed until near the end of the investigation when sufficient information has been assembled to answer the questions of how and why damages and injuries occurred the way they did.
- (c) Once the sequence of events has been established, the investigator(s) should then reconstruct the maneuvers or actions of the individuals or equipment just before the accident. If the accident sequence can be established back to the point where the difficulty began, the causes of the accident will be more clearly defined. The application of knowledge of the performance of the individual, or equipment under various sets of conditions, plus the use of basic controllability, will greatly help in making these determinations.
- (2) Accident site/wreckage distribution diagram. An accurate, detailed diagram of the accident site will help the investigator(s) develop the actual sequence of events. This work may be done by the post engineer. However, in the absence of this expertise, the materiel factors investigator should accomplish this task. A field compass, measuring tape, protractor, rule, inclinometer, and writing materials are necessary to do the job.

- (a) A polar diagram is a simple and effective method of diagramming the accident site.
- 1. The top of the diagram will represent north.
- 2. The main body of the wreckage (center of mass) can serve as the beginning or pole of the diagram.
- 3. Choose a scale that will allow plotting of the total scene on the chart.
- 4. Determine the compass heading of the equipment at its final resting place and place a semblance of the equipment on the diagram in such a position as to be able to plot the other debris from that point.
- 5. Determine the direction from the equipment to the outlying items and scar marks. Measure the distance from one central point of the wreckage to these items/marks. Plot them on the diagram as to their positions relative to the main wreckage.
- 6. Letters or numbers may be used on the plot so that a legend can be created to give the identification and the locations of the items in reference to the main wreckage.
 - (b) Grid method is another technique for detailing an accident site.
- e. Techniques of obtaining photographs. Photographs are the best means of preserving physical evidence for study and evaluation.
 - (1) The local safety representative should obtain a photographer from nearest post/installation assets.
- (2) It is important that photographs be of good quality and composition. High definition digital photographs are preferred.
 - (3) All photographs used in the report must be numbered and captioned.
 - (a) Captions should explain in detail what the picture is supposed to show.
 - (b) Captions will include type equipment, date of the accident, and location of the accident.
- (4) The direction toward which the photograph was taken may be included; (for example, NE or SW). A photograph without a proper caption is confusing and of little value.
 - (5) Photographs taken at the accident scene should include the following:
- (a) An overall view of the accident site (wreckage) taken from a minimum of four directions. Take photographs from the four cardinal directions (N, S, E, W) and four photographs from the midpoints between (NE, SE, SW, NW).
- (b) A view of the ground path of the equipment from point of initial and major impact to the place where it came to rest. Impact marks are vulnerable to rain and traffic; therefore, a photographic record of this type of evidence should be accomplished promptly.
 - (c) Aerial views of the accident scene (equipment and weather permitting).
 - (d) Photos of objects struck by the equipment.
 - (e) Larger portions of the equipment wreckage.
 - (f) Detailed photographs of suspected failed parts that contributed to the accident.
 - (g) Photos of failed PPE and the agents causing the failure or injuries.
 - (h) Photograph and measure skid marks and ground scars.

Note. Put an object of known size along side an object whose size may be distorted by the photograph; (for example, a pen or ruler next to a small piece of equipment or scar).

- (i) Any other photographs deemed of interest to the investigation board.
- (j) When taking digital photographs, if possible, include digital copies of the photographs as well as hard copy.
- f. Protection and identification. Parts or subassemblies suspected of failure/malfunction must be wrapped or boxed to prevent loss or further damage. Suspected metal failure surfaces should be coated with uncontaminated grease to prevent corrosion. Carefully tag and mark all parts so that they can be readily identified with the accident (place, date, and serial number of equipment) and their location at the accident scene. The tag should contain a brief statement regarding the suspected relationship of the parts to the causes of the accident. Examples of parts that may be preserved for more detailed examination are—
 - (1) Parts suspected of failure.
 - (2) Parts that appear to be improperly designed or contain faulty workmanship.
 - (3) Lines, fittings, wiring, or controls not properly supported and subjected to excessive strain or vibration.
 - (4) Ruptured plumbing or fittings.
 - (5) Faulty wiring, electrical, or radio equipment.
- (6) Defective engines, drive shafts, transmission, and accessories such as carburetors, fuel controls, governors, and generators.
 - (7) Defective hydraulic system components.

Note. Do not attempt to mate separate items together. This action could destroy evidence.

g. Disassembly. Extreme discretion must be used in disassembling parts or components in the field. If it is known that parts and components will be submitted for TDA, disassembly should be avoided as it tends to compromise the analysis by destroying or obliterating bits and shreds of evidence the value of which may be known only to the analyst. However, when detailed disassembles are made, all parts must be tagged with complete information to include nomenclature, part number (PN), locations, and any other significant information. Document all disassembly with

photographs. Assistance in disassembly and inspection of components, parts, fuel, and oil may be obtained from the next higher echelon of maintenance or U.S. Army depots or other experts identified by the USACRC.

- h. Equipment records.
- (1) As a minimum, the previous 6-month historical records, such as DA Form 2408 series (Aircraft Operational and Maintenance Forms), the periodic inspection records, and the other relevant records, such as manufacturer recalls, should be reviewed.
- (a) Check component times and replacement schedule. Review for compliance or noncompliance with modification work order(s) (MWO)(s).
- (b) Check for compliance with safety-of-use messages, safety advisory messages, safety-of-flight messages, ground precautionary messages, maintenance advisory messages, and TBs.
 - (c) Review current and delayed discrepancies records.
- (d) Document all deficiencies and discrepancies noted for correlation against other materiel/maintenance factors uncovered during the investigation.
- (2) Any modification or alteration of the equipment should be checked against applicable technical publications to ensure proper authorization.
- (a) When alteration or modification of the equipment is suspected, a thorough investigation must be made to determine how these alterations or changes may have contributed to the accident (document with photos).
- (b) Inspection should be made of structural repairs for quality of workmanship in fittings, welds, stitching, and, cables. This inspection will disclose whether improper materials and workmanship contributed to the accident.
- (3) It may be necessary to investigate possible cause factors that were not originally considered. Parts must be carefully preserved and protected.
- (4) Historical records may be electronic (downloadable data) or paper. Care must be taken to protect from loss or corruption of data when downloading files and records onto computers or electronic log books.
- i. Reassembly of wreckage. It may be necessary to reassemble wreckage to determine accident causes or to support a theory in an accident that is difficult to evaluate. When the entire system has been reconstructed, it may afford positive proof of the accident causes. Wreckage layout should resemble the original equipment as closely as possible. This gives the investigator a better overview of separations, fire damage, and control systems. A detailed and documented inspection of the wreckage layout will often lead the investigator to the areas or systems that played a role in the accident. The layout also helps the investigator in developing the sequence of events that occurred in the accident.
- *j. Failed parts.* Unless there is conclusive evidence that a failure occurred during the operation, it is necessary to make a detailed inspection of each suspected failed part. In many cases, failure of the primary structure was caused by faulty design (improper material, incorrect assembly, previously weakened parts). The maintenance records and operating history of the equipment must be reviewed for conditions that may have initiated or contributed to the failure. Suspect failed parts that may have contributed to the accident should be selected for laboratory analysis to determine the type and mode of failure. The investigation board must then fit that evidence into the total evidence to determine whether the failure contributed to the accident.
 - k. Special investigations.
- (1) Highly technical aspects of the accident investigation will require further study and special analysis. In many cases, this cannot be accomplished in the field, and the work must be continued by technically qualified personnel at a laboratory, depot, or factory. If mechanical failure occurred or is suspected—
 - (a) Adequate photographic coverage must be provided and the suspected failed parts retained for further evaluation.
- (b) Sketches, history, and explanatory material must accompany the parts and should contain enough information to give a clear picture of what happened.
- (c) If a control switch, handle, or knob, were used improperly because of its design, or if one control was mistakenly operated when the operator intended to use another, the location, size, shape, method, or operation of the control may prove to be an underlying cause and must be examined in the human factors investigation as well as the materiel factors investigation. Operator's deficiencies relative to design issues should also be included in the human factors investigation.
- (d) Different equipment may have controls or instruments in reversed positions from others operated by the operator and this could contribute to the accident.
 - (2) For example, night vision devices require a special investigation.
- l. Power plants. When power plant failure is the known or suspected accident cause, the investigator(s) should make every effort to obtain samples from the lubricating and fuel systems. These samples should be taken from several sources to ensure capture of any foreign substance that may be in the system. Inspect the power plant to determine if all debris caused by the failure was contained within the engine case. If not contained, every effort should be made to recover the missing pieces. All locations and impact marks should be marked and photographed. This information is needed to determine at what point in the accident sequence the power plant failed.
- (1) Field examination. When the power plant is examined in the field, obtain the serial number of the engine, manufacturer, type, model, and all pertinent information from maintenance and inspection records. In addition—

- (a) Locate all engine accessories and components.
- (b) Check the position of primary and secondary controls to determine the position of the various valves controlling the flow of fuel to the engine.
 - (c) Obtain pertinent engine operation data prior to the accident.
 - (d) Obtain information from witnesses about engine operation such as smoke, fire, explosion, and unusual noises.
 - (e) If fire was a factor, determine the origin/location (see para 2-5n for details).
 - (f) Check the fuel system for leaks or obstructions from fuel tanks to combustion chamber.
 - (g) Check fluid carrying lines for improper installation or signs of malfunction.
 - (h) Check for water, corrosion, or sediment in the fuel and oil systems.
 - (i) Obtain samples of fuel, oil, and hydraulic fluid for laboratory analysis.
 - (j) Check oil filters and pumps for foreign particles.
 - (k) Check sources of fuel (including storage tanks, pumps, and fuel service trucks) for contamination, if necessary.
 - (1) Check the ignition system to include switches, spark plugs/igniters, and leads.
- (2) Analyze failures. A review of the maintenance and inspection forms for operating time, malfunction, and TM compliance will often provide a lead to possible engine failures.
- (a) The position of engine controls and readings on engine instruments should be carefully recorded. However, these readings may be affected by the accident forces and are not conclusive indications of the position prior to impact.
 - (b) If structural parts of the engine failed, these parts must be identified with a description of the failure.
- (c) Sketches and/or photographs showing the failure are important in evaluating the cause. All accessories should be inspected and bench checked if malfunction is suspected.
- m. Transmissions. The same investigation and analysis procedures identified in paragraph 2–5k apply. In addition, check transmission case for cracks, distortion, and corrosion. If severity of impact broke the case open, check condition of gears and bearings for abnormal patterns or discontinuity, such as gears out of mesh.
 - n. Fires.
 - (1) Symptoms.
- (a) Fire frequently destroys or consumes clues that could readily disclose the accident cause. (For example, ruptured or chafed fuel lines may be the origin of the fire and the cause of the accident and then subsequently be consumed by fire).
- (b) Fire that is a result, rather than a cause, of an accident also hampers the investigator by the destruction or damage of evidence.
 - 1. If a fire occurred, determine when, where, and how the fire originated.
- 2. A fire originating during movement will generally leave obvious traces, such as molten metal flow marks that will conform to the airflow pattern of the component concerned.
- 3. A fire resulting from impact with the ground will often leave imprints of twigs, grass, or leaves in the soot pattern on the burned parts of the wreckage. Any folded, smoked, or blackened pieces of wreckage that, when unfolded, show shiny metal would indicate that the burning had followed the accident.
- 4. Locate parts that separated from the equipment after the accident. If these parts also show signs of burning, then the fire existed before the accident.
- 5. A minor fire will frequently burn undetected until a larger source of fuel is supplied. A large fuel-fed fire may result from a smaller fire that was started by hydraulic oil, engine oil, or other flammable material.
 - 6. Remember that fluid vapors can travel long distances before reaching a point of ignition.
- (2) Flammable fluids. All flammable fluid-carrying lines should be traced and inspected for breaks, cracks, chafing, and loose fittings. Identify the tubing by reference to the color code or the schematic drawings in the applicable TM.
- (3) Witness information. Witnesses are especially important in establishing certain facts about the fire. A burning piece of equipment immediately attracts attention and can be seen from many miles away. Normally, smoke from burning oil is blue-white in color; smoke from hydraulic fluid is white; and fuel (gasoline, jet fuel) smoke is black. However, the color and density will vary with changes of intensity of the fire.
- (4) Warning systems. Determine how personnel were warned that a fire was in progress and how effective extinguishing attempts were. Record a complete step-by-step description of the procedure used for extinguishing the fire and compare it with the TM.
- o. Communications/navigation equipment. The requirement to determine the functioning capability and selected frequency of the communication/navigation equipment may vary depending upon the circumstances surrounding the accident. Normally, it is possible to determine the selected frequency/station regardless of the extent of component damage.
- (1) The control/dash panel normally contains various functional select switches, volume control, digital readout channels, or frequency.
- (a) Determine if equipment or vehicle operators, crew members, crash rescue personnel, or early arrivals at the scene moved any of the controls or switches.

- (b) Index all movable switches and volume control before any changes are made from the position found.
- (c) Analyze all toggle and rotary switches to determine if they show evidence of having changed positions as the result of impact/crash. If the indicators are missing, examine the rotary switch, determine which frequency is selected, and compare the position with a like serviceable unit.
 - (2) Obtain the assistance of communications, avionics, or electronics experts for additional assistance if necessary.
- p. Tear down analysis request. TDA request, processing, shipment, and disposition—
- (1) Request. The Analytical Investigation Division (AID), Corpus Christi, TX, is the prime recipient and evaluator of all Army aircraft components/parts selected for TDA. The Commander, USACRC; Commander, U.S. Army Aviation and Missile Command (AMCOM); commanders of field organizations/units; aviation safety officers; maintenance officers; and presidents of accident investigation boards are authorized to select components/parts for TDA. Requests for TDA will be made in the interest of establishing or discounting material deficiencies, regardless of accident/incident classification. The results of TDA are for use in accident prevention or to establish causes of accidents.
- (a) Control numbers. Before shipping any components/parts to AID (Q99745), a product quality deficiency report/equipment improvement report (PQDR/EIR) will be submitted on the components/parts according to the instructions in DA Pam 738–751. Ground EIRs are submitted in accordance with DA Pam 750–8. The Analytical Investigation Division Q99745 is the Department of Defense activity code (DODAC) for AID and should be used anytime components are shipped to that organization. Authorized personnel must coordinate their requests for TDA with Operations, USACRC, DSN 558–3410/2660, COM (334) 255–3410/2660. Approved requests will receive a USACRC control number which will be placed on the DA Form 2407 (Maintenance Request), block 3a, and must be included in the address to AID.
- (b) Data requirement. To obtain USACRC control numbers, the following information will be submitted to the USACRC:
- 1. Point of contact (POC), who is knowledgeable of why the request for TDA is being made. Identify the unit to which the equipment is assigned and the unit's address.
 - 2. Telephone number(s) (military/commercial) of the POC(s).
- 3. Materiel identification data for each item, to include noun nomenclature of the component(s)/part(s), serial number(s), PN(s), national stock number(s) and, when applicable, the time since new, time since overhaul, number of prior overhauls, overhaul activity, and date of last overhaul.
 - 4. AMCOM PQDR/EIR control number for component(s)/part(s) as appropriate.
- 5. Accident/Incident data, to include complete aircraft/ground vehicle serial number from which component(s)/part(s) are removed, Army mishap classification, mishap date, how the defect was found, description of the required analysis, and whether or not a written, electronic, or telephonic report has been provided to the USACRC, or any other technical data that may be of assistance to the materiel analysis personnel.
 - (2) Processing.
- (a) The processing of the item(s) to be shipped for TDA will be accomplished by the nearest activity having a packing, crating, and shipping capability.
- (b) The item(s) to be shipped will be cleaned and decontaminated to the degree necessary to preclude the possibility of generating a health hazard or crop infestation. However, the cleaning process must not distort or remove evidence such as heat discoloration, abrasion, stress and torsion splinters, and corrosion.
- (c) All traces of foreign matter such as vegetation, human/animal tissue, insects, dirt/soil, or contaminated water must be removed. This is especially required when items are shipped from outside the continental United States (OCONUS).
- (d) When contamination, loose ordnance, tools, or other foreign materiel are suspected as the cause of an accident or malfunction, photographs must be taken before cleaning and forwarded with the item(s) as evidence for study by the analyst.
 - (3) Shipment.
 - (a) DA Form 2407 will accompany each component/part.
 - (b) Insert the USACRC control number in the first line of DA Form 2407, block 3a.
 - (c) The description of the analysis desired will follow the USACRC control number.
- (d) DA Form 2410 (Component Removal and Repair/Overhaul Record), when required, and DA Form 2408–16, Aircraft Component Historical Record, will accompany the aviation item(s) as appropriate.
- (e) Also, arrange for the most expeditious delivery/shipment of item(s) for TDA to Analytical Investigation Division (Q99745), Bldg 1880 Ocean Drive, Naval Air Station, Corpus Christi, TX 78419–5260, telephone DSN 861–2902, COM (361) 961–2902.
- (f) Container(s) will be clearly, permanently, and conspicuously marked in red on a white background and in sufficient size to allow for ease of visual identification. If container is too small, follow the PQDR/EIR procedures contained in DA Pam 738–751.
 - (4) Disposition of TDA report.

- (a) AID/contractor/manufacturer will provide four copies of the final report to Commander, AMCOM; Commander, USACRC, (CSSC-O) (six copies if USACRC conducts the accident investigation).
 - (b) One copy each to the applicable theater/command aviation safety officer.
 - (c) Four copies to the commander of the unit/activity that requested the analysis.
- (d) Component(s) or part(s) submitted for TDA on USACRC control numbers will be held until disposition instructions are issued by Commander, USACRC.

2-6. Environmental factors

- a. Environmental factors are those environmental elements or conditions such as noise, illumination, space and weather conditions (For example, precipitation, temperature, humidity, pressure, wind, and lightning) having an adverse effect on the performance of the individual or equipment so that an accident results or could result.
- b. Assessment of environmental elements (For example, contaminants, noise, vibration, artificial illumination, acceleration, deceleration, radiation, adequacy of work surface/space, and weather conditions) should be accomplished to determine their influence on human and/or materiel performance.
- (1) Contaminants (fumes, chemicals) can lead to respiratory problems; noise (radio static, engine, and transmission noise) can distract attention, interfere with effective communications and lead to fatigue.
 - (2) Inadequate illumination can cause reduced visibility.
- (3) Inadequate work space (cluttered, poorly designed driver compartment) can contribute to procedural errors or limit outside visibility.
- (4) Knowledge of environmental elements does not eliminate them as factors influencing errors, injuries, or failures. To determine if an environmental factor should be assessed as a casual factor, the central questions to ask are: did this factor adversely influence human and/or equipment performance and was the environmental element unknown or unavoidable at the time of the accident/injury/occupational illness?
- c. Environmental factors can be divided into those which could not have been avoided, and those which could have been avoided or precautions implemented to reduce or eliminate its adverse effects on personnel and/or equipment. An environmental deficiency should not be assessed as a causal factor if it was known and could have been avoided before the accident.

2-7. Accident investigation techniques for electromagnetic environmental effects

- a. Electromagnetic environmental effects (E3), formerly known as electromagnetic interference (EMI), is a recognized potential accident cause factor and should be thoroughly evaluated during all accident investigations to determine whether it influenced the operation of the equipment involved.
 - b. The following E3 list is recommended for use—
 - (1) During the initial phase of the investigation—
 - (a) Try to determine if there is any evidence of an external energy influence on the equipment or its subsystems.
- (b) Consider cockpit/instrument indications reported by surviving crew members, eyewitness reports, and other physical evidence. This is especially important where the physical evidence indicates that the equipment was out of control or malfunctioning prior to the accident.
 - (c) Apply the current AMCOM criteria concerning the reporting of suspected E³ encounters, for aviation accidents.
- (2) If E3 can be ruled out as a causal factor during this stage, then note the actions taken to eliminate E3 as a causal factor. For all accidents where E3 could have played a role but was ruled out, document "E3 was considered but ruled out for the following reasons" in the narrative or accident summary.
- (3) If E3 cannot be eliminated early on, or there are positive indications of an external energy influence, advise the USACRC immediately, DSN 558-3410/2660, and request technical assistance. In addition, perform the following:
 - (a) Check for high-intensity radio transmission areas (HIRTAs) in the area of the accident.
- (b) Note visual flight rule (VFR) sectional or tactical maps for large towers (transmitters) in proximity to the accident site.
 - (c) Identify mobile transmitters operating within the area at the time of the incident.
- (d) For aviation accidents, apply HIRTA standoff criteria contained in current AMCOM messages (HIRTA guidance).
- (e) While taking aerial photographs of the accident site, review the area surrounding the accident for large towers (transmitters) such as radio/television, telephone microwave, and radar.
- 1. All towers (transmitters) are considered a potential source and should be plotted on a diagram in relation to the accident site.
- 2. Contact owners of the towers (transmitters) to determine the hours of operation, nature of transmission(s) (signal power level, antenna gain, and frequency), signal beam width, and azimuth(s) of transmitter signal(s).
- c. For aviation accidents, gather any and all available Air Traffic Control (ATC) tapes, to include radar and voice, for later review.
 - (1) If there are surviving crew members, record all cockpit/instrument indications, such as, caution/warning/advisory

light illumination, audio warning tones, degradation/loss of flight controls, and stiffness of pedals, experienced during the accident. To compare cockpit/instrument indications with the data base of known type aircraft responses to E3, call Aviation and Missile Research, Development and Engineering Center, Aviation Engineering Division, telephone DSN 879–8403 or COM (256) 313–8403.

- (2) If there are no surviving crew members, analysis of the above data plus any additional information gained from flight data recorders (if so equipped) will indicate possible contribution of E3.
- (3) If E3 is considered a potential causal factor due to accident circumstances, TDA and review of acceptance test procedures for affected systems/components may be required.
- d. Close coordination with the USACRC will be maintained throughout the E3 investigation. E3 can be eliminated as a causal factor only if accident circumstances (physical evidence, equipment maintenance history, witness statements) indicate a suspected materiel failure or human error was the primary cause or if subsequent investigative actions described above have been completed.
- e. Contact the USACRC office for additional technical aspects concerning this information at DSN 558–3410/2660, COM (334) 255–3410/2660, or the Army Safety Office for policy aspects of this information, DSN 227–1267, COM (703) 697–1267.

2-8. Analysis

- a. Documentation. A systematic analysis of the data collected during an accident investigation is required. The accident causes identified in the analysis will become the basis for developing findings and recommendations contained in the technical report of the accident. Findings and recommendations cited in the technical report will have an impact on remedying system inadequacy(ies). The written analysis must fully support each finding. Therefore, the analysis shall be thorough, logical, and conclusive.
- b. Concept. The reasons people make errors, materiel fails, environmental conditions contribute, or injuries occur in an accident are the keys to accident prevention. The rationale behind this premise is that if the reasons (system inadequacy(ies)) can be dealt with effectively, then the probability of similar deficiencies causing future accidents or injuries can be reduced.
- c. Scope. The accident analysis function inherently requires that the accident data be examined in detail to determine how man, machine, and environment interacted. The scope of the analysis will not necessarily be limited to the field investigation of the accident and may extend beyond the tenure of the investigator/board. The contents of the report will subsequently be reviewed and analyzed by the USACRC and other agencies responsible for the management of resources.
 - d. Objectives.
- (1) Analysis of the data collected during the investigation permits the board to reach a consensus. The objectives are as follows:
 - (a) Establish a chronology of events as they relate to the accident.
- (b) Identify human errors, materiel failures, and/or environmental conditions that caused or contributed to the accident (what happened).
- (c) Identify system inadequacy(ies) that caused or permitted errors/failures/injuries to occur or environmental factors to contribute (why did it happen).
 - (d) Determine adequacy of LSE/PPE in terms of minimizing/preventing injuries (how injuries occurred).
- (e) Provide corrective actions (what to do about it) having the best potential for remedying the system inadequacy(ies) (why did it happen). Identify design deficiencies in the materiel/equipment/system. Once design deficiencies in the materiel system are eliminated (designed out) that hazard will no longer exist to Army personnel.
 - (2) Each objective has related tasks as follows:
- (a) The scope of the chronology may include events that occurred before, during, or after the accident. The need for placing events in a chronological order is to view human error, materiel failure, environmental conditions, and injuries in the context that they occurred.
- (b) To identify factors (errors/failures/environmental) that caused or contributed to the accident, it will be necessary for the board to evaluate each factor in terms of its relationship with the accident cause. When it is determined an error/materiel failure/environmental factor caused or contributed to the accident, it should be defined as follows:
 - 1. When the error/failure/environmental condition occurred in the context of the accident sequence of events.
 - 2. Who (duty position) erred, what (part component, system) failed, or what environmental factor contributed.
 - 3. The task or function required of the person, part, component, or system when the accident occurred.
- 4. How performance of the task/function deviated from published orders, SOPs, directives, standards, or common practice, or how the materiel failure deviated from design limits, specifications, and/or performance standards.
 - 5. The effect/results(s) of the error/failure/environmental condition.
- (c) To determine adequacy of LSE/PPE, the board must evaluate injuries in terms of whether they could or should have been prevented.

- (d) To identify system inadequacy(ies) that caused or permitted an error/failure/injury or occupational illness to occur.
- (e) To provide corrective actions having the best potential for remedying the system inadequacy(ies), the board must—
 - 1. Tailor, specifically, the corrective actions to the system inadequacy(ies).
- 2. Recommend corrective actions to the activities and/or levels of command most capable of correcting the system inadequacy(ies).
- e. Credibility. The credibility of the findings and recommendations presented in the technical report will depend largely on how completely the board analyzes the accident data. The conclusions resulting from the analysis should be fully supported by evidence whether it be direct, circumstantial, or a combination of both. A lack of evidence will make the analytical task more difficult. In this case, it may become necessary for the board to develop hypothetical explanations of what may have caused the accident. When the hypothetical approach is used, the hypotheses should be developed and discussed in terms of why certain explanations are or are not supported by the evidence. Through deductive reasoning and a process of elimination, the most probable cause(s) can be established.

f. Coordination.

- (1) All board members will frequently meet as a group to discuss mutual progress, trade information, reduce redundancy, resolve conflicting information, and redirect investigative efforts as appropriate. As these meetings grow in number, it will not be unusual to discover that data initially considered insignificant may prove to be important and vice versa. Also, preliminary data that may appear to be a cause of the accident may prove to be an effect or result. Therefore, board members should keep an open mind and stay flexible, receptive, and discerning throughout the investigation. Board members should not entertain preconceived ideas as to the cause of an accident.
- (2) A point will eventually be reached where the data collection phase is completed and there are no remaining sources of information or expected inputs. What remains are the tasks of finalizing the analysis effort and structuring the results in a format that clearly shows the interrelationships between cause-related factors and the system inadequacy(ies) that caused or permitted them to occur. When these tasks are properly accomplished, the final task of developing/writing findings and recommendations is greatly simplified.
 - g. Deliberations/analysis sessions.
- (1) When the investigators responsible for collecting and analyzing accident data have completed their tasks, the entire board should meet at a central location to collectively review the data and finalize the analysis. The facility used for the meetings should be secure and free from distractions and allow for privacy. The board president will chair the meetings and guide the proceedings. The investigator responsible for conducting the human and materiel portions of the investigation should present the factors he/she believes caused the accident, contributed to injuries, or had other significance. In presenting this information, the events directly involving each factor should be identified. This will help to place each factor in its proper perspective and relation to the other events. Factors associated with an event will usually fall into one of five categories—
 - (a) Factor(s) that definitely contributed to the accident (Present and Contributing).
 - (b) Factor(s) suspected to have contributed to the accident (Suspected Present and Contributing).
- (c) Factor(s) that did not contribute to the accident but contributed to the severity of the injuries (Present and Contributing to the Severity of the Injury/Occupational Illness or Extent of Property Damage).
- (d) Factor(s) that did not contribute to the accident but could adversely affect the safety of continued operations if left uncorrected (Present but Not Contributing).
- (e) Factor(s) that in no way contributed to the accident but identify local conditions or practices that should be corrected are special observations. Although these factors do not have to be addressed in the analysis or listed in the findings and recommendations part of the technical report of the accident, they should be subsequently briefed to the lowest level commander capable of taking corrective action; (for example, minor administrative errors in record keeping, inadequate procedures, and/or lack of required SOPs, directives).
- (2) The investigator(s) should next identify each system inadequacy(ies) that caused or permitted the factor to become causal.
- (a) The more specific the description of the system inadequacy is, the easier it is to identify effective corrective actions.
- (b) If a consensus of the board members agrees with the factors presented and their associated system inadequacy(ies), the process continues until the investigators have completed their presentations.
- (c) The board president should not allow unresolved issues to be debated indefinitely during deliberations. If a board consensus on an issue cannot be reached within a reasonable amount of time, the board president will decide the issue and continue with the proceedings. There are provisions for submitting a minority report as explained in paragraph 2–1h.
- (3) It may become apparent during the deliberations that evidence is conflicting. In such cases, the board usually has two choices—
 - (a) The board may further question personnel involved or other witnesses. If this approach is used, it is probably

best to come directly to the point, such as inform the personnel being questioned of the conflict and ask for an explanation.

- (b) If the first approach does not resolve the conflict, it may be possible to rationalize why the conflict exists and then develop a hypothetical explanation. In any case, the board is responsible for resolving conflicts and must carefully weigh the evidence and decide what is most credible.
- (4) When the board has reached a consensus on each significant factor involved in the accident, a concerted effort is necessary to develop corrective actions having the best potential for remedying each system inadequacy.
- (a) When a board consensus concerning remedies is achieved, the commands or activities having proponency for correcting the system inadequacy(ies) should be identified. When this is accomplished, the corrective actions proposed in the technical report can then be directed to the activities and levels of command best capable of accomplishing them.
- (b) To achieve the goal of accident prevention, recommendations should not focus on specific punitive or administrative actions that might deal with the shortcomings of a particular individual in a specific case. Rather, the recommendations should address the issue on a broader level.
- (c) Each recommendation will identify the actions to be taken at the appropriate level of command, such as unit level actions, higher-level actions, or DA-level actions most appropriate to correct the system inadequacy(ies). The recommendations will be written in conjunction with the findings and will be included in the technical report of the accident.
- (5) The final results of the total analytical effort will be summarized in the findings and recommendations, and analysis portion of the technical report.

2-9. Accident investigation kit

- a. This paragraph contains a list of items recommended for an accident investigation kit. It is neither all inclusive nor mandatory.
 - (1) Carrying case for kit contents.
 - (2) Laptop computer.
 - (3) Digital camera with large memory cards or sticks. Spare batteries for the camera.
 - (4) Digital voice recorder and batteries.
 - (5) Cell phone.
 - (6) Global positioning system.
 - (7) Flashlight (batteries).
 - (8) Magnetic compass.
 - (9) Inclinometer.
 - (10) Laser rangefinder.
 - (11) Tape measure, 100 foot (steel recommended).
 - (12) Small magnifying glass.
 - (13) Pocket/universal multi-tool with case.
 - (14) Steel ruler (1 foot) with large index.
 - (15) Screwdrivers (flat tip and cross tip).
 - (16) Pliers and crescent wrench (8 inch).
 - (17) Hearing and eye protection.
 - (18) Tyvek protective suit and high-efficiency respirator.
 - (19) Leather gloves.
 - (20) Telephone extension cord with male-to-male adapter.
 - (21) Power strip extension cords (2).
 - (22) Printer cable.
 - (23) Composite Materials/Bloodborne Pathogen Safety Kit.
 - (24) AR 385-10 (Chapter 3) and DA PAM 385-40.
- (25) Appropriate forms (DA Form 285, DA Form 2397-series, DA Form 285-AB (Abbreviated Ground Accident Report (AGAR)), DA Form 2397-AB (Abbreviated Aviation Accident Report (AAAR)).
 - (26) Additional references (TMs, Field Manuals (FMs), and local regs/SOPs).
 - (27) Marking/survey flags.
 - (28) Florescent orange paint.
 - (29) Tarp.
 - b. Each organization should assemble its accident investigation kit based on their mission and needs. Items (2), (5),

and (23) listed above, as well as the memory cards/sticks and batteries, should not be stored in kit, but obtained as needed.

Chapter 3 Aviation Accident Reporting

3-1. Introduction

AR 385–10 prescribes the classes of aircraft accidents that will be reported via DA Form 2397-series (Technical Report of U.S. Army Aircraft Accident), DA Form 2397–AB (AAAR), and DA Form 2397–U (UASAR). This chapter provides instruction for completing a full report of investigation and identifies the types of substantiating data that will be appended to each report, including instructions on how to process the data. This chapter also provides information for determining which forms of the DA Form 2397-series are required for each report (see fig 3–1). Detailed instructions are included explaining how to complete each form, including the DA Form 2397–AB and the DA Form 2397–U.

3-2. DA Form 2397-Series, Technical Report of U.S. Army Aircraft Accident

- a. Instruction. The DA Form 2397-series consists of 15 technical reporting forms, a command review form, and two index forms. The forms are required for reporting Class A and B Army aircraft flight or flight-related accidents. Not all forms are necessary for every technical report. See figure 3–1 for general information on the requirement for submitting each form of the series. Specific instructions concerning the submission of each form are given in this chapter in the paragraph relating to that form. They can be reproduced locally on 81/2 by 11-inch paper.
- b. Formats. The forms contained in the DA Form 2397-series are designed to provide three different accident report formats.
- (1) The first format is narrative in content and includes DA Form 2397, Part I, Statement of Reviewing Officials, and DA Form 2397–2, Part III, Findings and Recommendations, DA Form 2397–3, Part IV, Narrative, and DA Form 2397–4, Part V, Summary of Witness Interviews.
 - (2) The second format requires graphic information on DA Form 2397-5, Part VI, Wreckage Distribution.
- (3) The third format requires coded data on DA Form 2397–1, Part II, Summary, the bottom page of DA Form 2397–2, Part III, Findings and Recommendations, and DA Forms 2397–6, Part VII, In-Flight or Terrain Impact and Crash Damage Data, through DA Form 2397–12, Part XIII, Fire.
- (4) It is essential that the forms contain all information requested in the instructions and that the information provided is accurate.

3-3. DA Form 2397, Part I, Statement of Reviewing Officials

DA Form 2397 (see fig 3–2) will be submitted with the copy of the technical report forwarded through channels to the USACRC. If additional space is required, use letter-size paper for continuation sheets.

3-4. DA Form 2397-1, Part II, Summary

The DA Form 2397–1, Part II, Summary (see fig 3–3) will be completed for each aircraft accident requiring a technical report. (See tables 3–2 through 3–6 for additional information.) The purpose of the form is to summarize essential elements of information contained in other parts of the technical report.

- a. Accidents involving one aircraft require only one DA Form 2397–1. Accidents involving more than one aircraft may require an additional DA Form 2397–1, depending upon the circumstances.
- (1) A DA Form 2397-1 is required for each aircraft involved in a flight, or flight-related accident per DA Pam 385-40.
- (2) A DA Form 2397–1 will be completed in its entirety for the aircraft and crew deemed most responsible for the accident. This DA Form 2397–1 will be referred to as the "case aircraft."
- (3) Additional DA Forms 2397–1 identifying other aircraft involved in the accident will be completed as necessary to account for all aircraft, except inactive aircraft. These DA Form 2397–1; however, do not require a duplication of the information entered in blocks 1 through 7 and blocks 20, 23, and 24 of the "case aircraft" on DA Form 2397–1.
 - b. Damaged aircraft that were inactive (engines(s) not in operation) will be costed as "other damage military."

3-5. DA Form 2397-2, Part III, Findings and Recommendations

- a. DA Form 2397–2 (see fig 3–4) will be completed for all aircraft accidents requiring a technical report. (See tables 3–3 through 3–7 for additional information.) If additional space is required, use letter-size paper for continuation sheets.
- (1) This form is designed to provide a narrative and coded summary of accident cause factors, system inadequacies, and corrective actions.

- (2) Block 1 is used to explain block 2 in terms of what happened, why it happened, and what should be done to reduce the chances of it happening again ("3W" approach).
- b. An abbreviated list of the codes and associated mistakes/errors, materiel malfunctions, environmental conditions, system inadequacy(ies) and corrective actions is provided at table 3–7. Appendix B contains expanded descriptions and examples of the abbreviated codes.

3-6. DA Form 2397-3, Part IV, Narrative

DA Form 2397–3 (see fig 3–5) will be completed for all aircraft accidents requiring a technical report. The narrative includes the history of events, human factors, material factors, and analysis of the investigation.

3-7. DA Form 2397-4, Part V, Summary of Witness Interview

- a. Instruction. DA Form 2397–4 (see fig 3–6) will be completed for all aircraft accidents requiring a technical report. As a minimum, summaries of the interviews with surviving crew members aboard the aircraft will be included. The form will also be used to summarize interviews and statements of commanders, supervisors, maintenance and ground support personnel, and others who are able to contribute pertinent information concerning the accident. If additional space is required, use letter-size paper for continuation sheets.
 - b. Procedural guidelines. The procedural guidelines/instructions are as follows:
- (1) All witnesses will be interviewed according to chapter 2, paragraph 2–3. The investigator will emphasize to the witness that the sole purpose of the accident investigation is for accident prevention. The witness should be further informed that the U.S. Army seeks to isolate the cause(s) of the accident so it may take appropriate actions to avoid similar accidents. If the witness is a civilian, the investigator will avoid using Army terms and acronyms.
 - (2) The board president or recorder will brief all witnesses concerning the interview.
- (a) This will be done by reading to the witness the information on the back (page 2) of the DA Form 2397–4, contained in block 15 (see fig 3–6), the "General Witness Information Briefing." The purpose is to ensure that the witness understands the purpose of the interview, who will have access to the information, DOD restrictions on the use of the interview, and its public releasability. A promise of confidentiality cannot be offered unless the criteria are met as outlined in AR 385–10. Limited Use safety accident investigation reports are required for flight and flight-related accidents. Witnesses may be given the option of making their statements under a promise of confidentiality (see AR 385–10).
- (b) If a promise of confidentiality is to be offered, the interviewer will read the section, "Promise of confidentiality offered." This includes the specific categories of witnesses (crew members and maintenance personnel) to whom confidentiality will be routinely offered, and any other case in which the interviewer feels it is necessary to offer a promise of confidentiality (to include situations where the interviewer feels that the witness is not providing complete or accurate information). This explains to the witness that the interview may be used within DOD only for accident prevention purposes. Beyond that, it explains that nonconfidential interviews are publicly releasable and, to avoid that outcome, the interview must have been given under a promise of confidentiality.
- (c) If a promise of confidentiality is not offered to the witness, the interviewer will read the section, "No promise of confidentiality offered." It explains that within the military, the interview may only be used for accident prevention purposes. It also explains the rules governing the public releasability of the interview.
- (3) When a promise of confidentiality is offered, the witness will complete block 15, "Availability of Promise of Confidentiality for Limited Use Report of Investigation." The witness will initial section by indicating his/her choice, requesting or declining confidentiality.

Note. The exception for interviews under enhanced recall/hypnosis, which will automatically be deemed confidential and treated as such

- (4) If the witness is willing to be interviewed or make a statement, it will be summarized on DA Form 2397-4 in block 12.
- (5) The promise of confidentiality will be entered on DA Form 2397–4, block 11, and will be signed and dated by the interviewer. The promise is as follows: "The witness made this statement under a promise of confidentiality."
- (6) There is no requirement to have an interview signed by the witness, and such should not be done. The interviewer does not have to sign either, except as addressed above. To approach a witness for a signature may give the indication that the statement will be used for purposes other than accident prevention. Neither is it necessary to record explanations discussed in paragraph 3–7b on the DA Form 2397–4.
- (7) Witness statements should be summarized for inclusion in the report. The complete, verbatim account of all that was stated should not be included. A summarization is to be used, but it should not exclude any information that assists in explaining the circumstances of the accident.

3-8. DA Form 2397-5, Part VI, Wreckage Distribution

a. Instruction. DA Form 2397-5 (see fig 3-7) will be submitted with each technical report when needed to substantiate information that is not clarified by other data reported in the DA Form 2397-series. A decision to not

include this from should not be construed to mean diagramming of the crash scene will not be used as an investigation technique. The board may be required to furnish a copy upon request.

- b. Form terminology.
- (1) Wreckage distribution. The location of all aircraft components in their post-crash positions. The locations should be shown relative to the flight path of the aircraft with the azimuth and distance from a given reference point.
 - (2) Initial impact. The first contact of the aircraft with terrain or obstacles.
- (3) Secondary impact. An impact that is less severe than the major impact. Several secondary impacts may occur in an accident.
 - (4) Major impact. The impact causing the most severe crash forces.

3-9. DA Form 2397-6, Part VII, In-Flight or Terrain Impact and Crash Damage Data

- a. Introduction. DA Form 2397-6 (see fig 3-8) will be completed for the following (see table 3-6):
- (1) All technical reports involving in-flight collisions (see definitions below), excluding tail rotor strike accidents.
- (2) All technical reports involving aircraft damage excluding the following:
- (a) Aircraft ground accidents.
- (b) Flight-related accidents with no aircraft damage.
- (c) Rotor blade strikes (main and tail rotor) with no additional aircraft damage.
- b. Flight terminology.
- (1) *In-flight collision*. The aircraft collides with an obstacle while in flight (helicopters at an altitude greater than normal taxi-hover height).
 - (2) Terrain collision. The aircraft collides with the terrain.
- (3) Flight path. The profile motion of the aircraft center of gravity (CG) during flight relative to the horizontal, measured in degrees.
 - (4) Terrain slope. Slope of terrain measured in degrees.
- (5) Aircraft attitude. The orientation of the aircraft with respect to the horizontal at the instant of impact. The attitude is measured in degrees about the pitch, roll, and yaw axes.
- (6) *Impact angle*. The angle between the flight path and the terrain. This angle is identical to the flight path angle for level terrain. For an upslope impact, the terrain slope angle is added to the flight path angle. For a downslope impact, the terrain slope is subtracted. An upslope and downslope impact is shown in figure 3–8.
 - (7) Flammable fluid. Engine fuel, lubricating oil, and hydraulic fluid.
 - (8) Major impact. The impact causing the most severe crash forces.
- (9) Gravitational force (G-force). A downward force resulting from gravitational deceleration action on a mass (Newton's second law, F=Ma). This is normally expressed as a 1 G-force.
- (10) *Impact force*. A force in any direction resulting from the deceleration of an aircraft. These forces are usually expressed as multiples of the G-force such as, 1G, 2Gs. Impact forces are resolved into components relative to some reference such as the longitudinal and vertical axes of an aircraft.
 - (11) Airspeed. Indicated airspeed along the flight path (knots).
 - (12) Vertical velocity. Rate of ascent or descent in feet per minute (fpm).
 - (13) Ground speed. Ratio of distance covered to time required relative to ground (knots).

3-10. DA Form 2397-7, Part VIII, Maintenance and Materiel Data

DA Form 2397–7 (see fig 3–9) will be completed for each technical report, as applicable, when any of the following had a role (definite or suspected) as to the cause of the accident.

- a. An act of omission or commission at any maintenance level (to include manufacturing defects). State the specifics in block 6, "Remarks."
- b. The failure or malfunction of any system, major component, or part. A separate DA Form 2397–7 will be completed for each major component or part that failed or malfunctioned and contributed to the accident, or anytime an analysis is to be performed or requested on a part.
- c. Only DA Form 2397–7 pertaining to components or parts that contributed to the accident, or anytime an analysis is to be performed or requested on a part.
- d. When analysis of components/parts shows that there was no contribution to the accident, DA Form 2397–7 pertaining to these items will be retained as work copy documents, but will not be included in the completed Technical Report of U.S. Army Aircraft Accident.
 - e. If explanatory remarks are required, use block 6 and letter-size paper for continuation sheets.

3-11. DA Form 2397-8, Part IX, Personal Data

DA Form 2397–8 (see fig 3–10) will be completed for all aircraft accidents requiring a technical report (see tables 3–5, 3–6, 3–8, and 3–9). It will be submitted for—

a. Each rated crew member. Fill in block 1 through 4d, and 6 through 17.

- b. Each nonrated crew member and noncrew member performing nonrated crewmember duties. Fill in blocks 1a, 2, 3d, 3e, 3f, 3g, 3h, 3j, 3n, 3o, 3p, 3q, 4e, and 5 through 17.
- c. Support personnel and non-crew members whose contributory role in the accident was attributed to duties such as mechanic, petroleum, oils, & lubricants (POL) handler, air traffic controller, technical inspector, medical officer. For each of these individuals, fill in blocks 1a, 2a through i, 3g, 3n, 3p, 3q, 4e, 5, 6, 7, and 10 through 17.
- d. Supervisory personnel who may have contributed to the accident. For these individuals, fill in blocks 1a, 2a through 2i, 5, and 10 through 17.

3-12. DA Form 2397-9, Part X, Injury/Occupational Illness Data

- a. DA Form 2397–9 (see fig 3–11) will be completed for each individual who was injured or sustained an occupational illness as a result of the aircraft accident.
 - b. The accident investigation board shall reference and comply with AR 40-21.
- c. It is mandatory that autopsies be performed on all deceased crew members. The protocol will not be included or attached to the accident report when the report is forwarded through the command channels for review, but will be forwarded to the Commander, U.S. Army Combat Readiness Center (CSSC-O), Fort Rucker, AL 36362-5363, for inclusion into the historical copy of the report.

3-13. DA Form 2397-10, Part XI, Personal Protective Escape/Survival/Rescue Data

DA Form 2397–10 (see fig 3–12) will be completed for all crew members aboard an aircraft involved in an accident requiring a technical report. In addition a DA Form 2397–10 will be completed for all other personnel aboard the aircraft for which the following applies (see tables 3–5, 3–6, 3–8, 3–9, and 3–11 through 3–24 for additional information):

- a. Protective/restraint/survival equipment played a role in the causation/prevention/reduction of an injury(s) resulting from the accident.
 - b. Protective/restraint/survival equipment failed to function as designed or was required but not available or used.
 - c. Egress/rescue difficulties were encountered.

3-14. DA Form 2397-11, Part XII, Weather/Environmental

DA Form 2397–11 (see fig 3–13) will be completed for all aircraft accidents requiring a technical report. This form does not negate the requirement for the substantiating weather data addressed in paragraph 3–17. Weather/environmental information submitted on DA Form 2397–11 is the board's best estimate of the actual environmental conditions existing when and where the accident occurred and its role in the accident, if any. The information will be gathered from available sources, to include witnesses, and surviving crew members.

3-15. DA Form 2397-12, Part XIII, Fire

DA Form 2397–12 (see fig 3–14) will be completed for each technical report of aircraft accident in which fire occurs (see table 3–6).

3-16. DA Forms 2397-13, Index A and 2397-14, Index B

DA Form 2397-13 (see fig 3-15) and DA Form 2397-14 (see fig 3-16) will be completed for all aircraft accidents requiring a technical report.

3-17. Substantiating data

- a. Instruction. DA Form 2397–13, Index A, lists the information that will be appended to the technical report as substantiating data. See figure 3–15 for an example of DA Form 2397–13. The information attached to the left side of the report folder will aid in completing the remainder of the DA Form 2397-series.
- b. Requirements. TAB items 1, 2, 4, 6, 7, and 9 of DA Form 2397–13 will be submitted with all technical reports. Blocks 3, 5, 8, and 10 through 14 are also required, if necessary, to explain or substantiate other parts of the report. Additional instructions pertaining to applicability are contained in paragraph 3–17d.
 - c. Special considerations.
- (1) Social Security Numbers. None of the substantiating documents require an SSN. If any of the documents on the left side of the report have an SSN listed, black out the number with a black felt tip marker.
- (2) Legibility. Original copies of substantiating documentation are not required for this report. Duplicates that are completely legible and suitable for reproduction may be appended to the report.
- (3) Extracts. Extracts or concise quotes of regulations, tasks, performance standards, specifications, and other directives are preferred in lieu of whole source documents to minimize bulk. When used, extracts will include information as to where they appear in their source documents, titles, and dates of the documents.
- (4) Highlighting key words and phrases. Substantiating data referred to by other parts of the report will have key words, phrases, or passages underlined or annotated to facilitate the review of the accident report. Underline or annotating margins will be used in lieu of felt-tipped markers for this purpose because the fluid dispensed by many of

these devices may obliterate the legibility of subsequent copies if they are reproduced from an original marked in this manner.

- d. Information items at each TAB on the DA Form 2397-13.
- (1) TAB 1-Copy of orders appointing investigating board. A copy of the original signed orders appointing the board and any amendments will also be appended. (See AR 385-10).
- (2) TAB 2-Weather data. The relationship of weather or weather services to an accident is addressed in chapter 2 of this pamphlet. If weather or weather services had no bearing on the outcome of the accident, as a minimum append a brief synopsis of the weather existing before, during, and immediately after the accident, authenticated by the closest weather service. Otherwise, if weather or weather services are suspected, the information to be provided should include, but not limited to the following:
- (a) A certified narrative of weather provided by forecaster, briefer, or observer. *Note*. Weather data importance should be in consonance with the suspicion of weather as a factor.
- (b) A true copy of the forecast or observation from official files, (for example, DD Form 175–1, (Flight Weather Briefing)).
 - (c) Copies of pertinent weather advisories and related forms.
- (3) TAB 3-Certificate of damage/estimated cost of damage. If total estimated cost to repair the damage does not exceed the aircraft replacement cost specified in TB 43-0002-3, submit a complete ECOD for aircraft damage. The ECOD will include an itemized list of damaged components, cost to repair or replace each component, number and cost of man-hours, and total cost of repair. Refer to this DA Pam 385-40, chapter 1, paragraph 1-10 and the AMDF for aircraft component/part accident damage cost criteria. If the aircraft is damaged to the extent it is estimated to be a total loss, a certified statement to that effect, signed by a maintenance officer, will suffice in lieu of an ECOD. For other property damage provide a description of the property damage, and an ECOD, to include civilian property damage.
- (4) TAB 4-Diagrams and/or photographs. A map/sketch depicting the aircraft's flight path leading up to the accident site, preferably plotted on a large scale map, should be appended to the technical report if it will help to clarify the accident sequence of events.
- (a) Arrows should be placed on the face of the map depicting magnetic north and the wind, with numerical values, which existed a the time of the accident.
- (b) Should the section of map being used not include an obvious geographical reference and margin data such as distance scales, this type of information should be added.
- (c) Also, significant events occurring along the depicted flight path should be numbered at the point they occurred and explained by footnotes.
- (d) The number and types of photographs to be appended to the accident report will be determined by the accident circumstances. Additional guidance concerning photographic coverage of an accident is contained in chapter 2.
- (5) TAB 5-Copy of Product Quality Deficiency Report (SF 368). Include a copy of each deficiency report submitted as a result of the accident. All failed or suspected failed parts/systems must be reported on a PQDR. When a materiel failure is the sole cause of the accident and a PQDR is not submitted, the accident will be charged to the accident unit in accordance with AR 385-10.
- (6) TAB 6-Special technical reports and laboratory analyses. Append a copy of the results of all fluid sample analyses, teardown analyses, or other laboratory analyses of aircraft-related systems.
- (7) TAB 7-Weight and Balance Clearance Form F-Transport/Tactical (DD Form 365-4). A DD Form 365-4 showing the conditions existing at the time of the accident will be computed by the investigation board and also appended to the accident report at TAB 7. If weight and/or balance was a factor or suspected factor in the accident, also include a copy of the DD Form 365-4 used by the aircrew at the time of the accident and explain any significant differences in the analysis portion of the narrative.
- (8) TAB 8-Copy of directives, regulations, and so forth. Pertinent portions of written documents relating to cause factors will be extracted, underlined/annotated, and appended to the accident report.
- (9) TAB 9-Medical data. Toxicological reports, preferably done by the AFMES, autopsy protocols, and/or other medical data pertinent to the accident will be appended to the accident report. Autopsy protocols and pictures of deceased personnel will not accompany the technical report through review channels. This type of information will be handled in accordance with chapter 2, paragraph 2-4g of this pamphlet.
- (10) TAB 10-Flight planning data. Append a copy of the flight plan, local clearance forms, or unit's tactical flight log to the accident report if relevant to the accident.
- (11) TAB 11-Army Aviators Flight Record (DA Form 2408-12). A copy of the DA Form 2408-12 covering the accident flight will be appended to the technical report if it has any bearing on the accident. In cases where crew rest may be an accident cause-related factor, DA Form 2408-12 information pertaining to the same crew member for the appropriate period preceding the accident should be included.
- (12) TAB 12-Aircraft Status Information Record (DA Form 2408-13). Append a copy of DA Form 2408-13 to the accident report if maintenance or materiel deficiencies are discovered.

- (13) TAB 13-Uncorrected Fault Record (DA Form 2408-14). Append copies of DA Forms 2408-14 applicable to the accident aircraft if a material problem related to an uncorrected fault is involved.
- (14) *TAB 14–Equipment Modification Record (DA Form 2408–5)*. Append copies of applicable DA Forms 2408–5 when necessary to substantiate maintenance errors, omissions, which caused or contributed to the accident.
- (15) *TABs 15 through 18–Other*. Substantiating data that have a bearing on an accident and are not covered by other information items listed on DA Form 2397–13 should be appended to this part of the technical report or filed under an additional tab item (TAB 16). Examples include, but are not limited to the following:
- (a) If the training proficiency/level of an individual is an issue, a copy of the training record will be included. The area of deficiency will be annotated.
 - (b) Copies of crew member post-accident flight evaluations.
- (c) Copies of DA Form 2028 (Recommended Changes to Publications and Blank Forms) when changes in publications are recommended.
 - (d) Results of special investigations conducted by individuals/agencies in support of the accident investigation.
- (e) Portions of transcripts of ATC logs, tower tapes, media news accounts, fire, rescue and law enforcement reports, and relevant portions of intra-cockpit voice recordings.
- (f) Copies of DA Form 2408–18 (Equipment Inspection List) when necessary to show compliance or noncompliance with Safety of Flight messages and similar directives and publications.

3-18. Miscellaneous

A list may be beneficial to the local safety POC for actions required prior to the arrival/appointment of the accident investigation board. The guidelines in appendix G can be used to prepare this list.

3-19. Assembly of the accident folder

When all required forms in the DA Forms 2397-series have been completed and the necessary substantiating data have been collected, the recorder will assemble the information using the instructions listed below.

- a. Use a separate manila or similar folder to enclose the forms and substantiating data for each copy. It is suggested that the creases and edges of each folder be reinforced with tape to maintain the integrity of the folders during subsequent handling
- b. File substantiating data under the appropriate tab on the left side of the accident folder and the DA Forms 2397-series on the right. If the accident report will contain more than one DA Form 2397-series because of a multiple aircraft event, keep each DA Form 2397-1 and its associated forms together and file in a manner that will permit view of the "case aircraft" DA Form 2397-1 and its associated forms first.
 - c. Tab and index each item on the left and right sides of the folder as shown in figure 3-18.
- d. File the completed DA Form 2397–13, Index A, on top of substantiating data on the left side of the folder and file the completed DA Form 2397–14, Index B, on top of the DA Forms 2397-series on the right side of the folder. The items to be included as substantiating data are addressed in paragraph 3–17. Additional items may be included as determined by the board.
 - e. The front of the folder will be marked with the following information:
 - (1) "Limited or General Use."
 - (2) Safety Accident Investigation Report of U.S. Army Class (A D) Accident.
 - (3) Aircraft mission, type, design, and series (MTDS) and Serial No. (UH60LXXXXXXX).
 - (4) Date of accident: (mmddyyyy).
 - (5) Location of accident: (DA Form 2397-1, block 7).
 - (6) Unit: (DA Form 2397-1, block 9).

3-20. DA Form 2397-AB, Abbreviated Aviation Accident Report

DA Form 2397–AB, (AAAR) (see fig 3–17) is required for all manned aircraft ground accidents regardless of class and Class C, D, E, and F flight or flight-related accidents/incidents. (See tables 3–2 through 3–6 and tables 3–8 and 3–9 for additional information.) The AAAR only reduces the reporting requirements and should not affect the quality or extent of the accident investigation. This form may also be used to report aviation Class A and B accidents during combat operations when the submission of the DA Form 2397-series is deemed not practicable by the senior tactical commander (see AR 385–10).

- a. Investigation and submission of the DA Form 2397-AB will be according to AR 385-10.
- b. Submit AAARs in legible hand-printed or typed copy via mail, fax, courier, electronic mail (e-mail), or can be submitted through the automating reporting system. Work copies on plain paper will be acceptable, but each data element must reference the respective block of the DA Form 2397–AB.
- (1) The mailing address is as follows: Commander, U.S. Army Combat Readiness Safety Center, (CSSC-O), Quality Control Support Branch, Bldg 4905, 5th Ave, Fort Rucker, AL 36362-5363.
 - (2) The e-mail address is: usarmy.rucker.hqda-secarmy.mbx.safe-accident-information@mail.mil.

- (3) The automating reporting system allows for quick and easy reporting through the USACRC Web site: https://safety.army.mil.
- c. For Class A, B and C accidents (those reported on DA Form 2397–AB), attach all additional information or forms required or deemed appropriate. For example, summaries of witness interviews, expanded narratives, ECOD/ACOD, PQDR, lab/Corpus Christi Army Depot (CCAD) reports, other DA Form 2397-series, additional personnel information sections, and additional AAAR forms for involved aircraft other than the case aircraft.

		A	viatio	n Ac	cide	nt/In	cide	nt Re	port	ing F	Requ	irem	ents					
Accident/ Incident Class	Telephonic	A A A R	UASAR	2 3 9 7	-1	-2	-3	-4	-5	-6	-7	-8	-9	-10	-11	-12	-13	-14
Manned Acft Flt/Flt Related A, B	х			Х	х	х	х	Х	*	*	*	Х	*	Х	Х	*	х	х
Manned Acft Flt/Flt Related C	х	Х		*		*	*	*	*	*			*	*	*	*	*	*
manned Acft D, E, F		X											*					
Combat Manned Acft A, B¹	#	Х		*		*	*	*	*	*			*	*	*	*	*	*
Manned Acft Gnd A, B, C	х	X		*		*	*	*	*	*			*	*	*	*	*	*
UAS A, B, C²	х		Х	*		*	*	*	*	*			*		*	*	*	*
UAS D, E, F			X										*					

LEGEND:

- * As required by circumstances
- X Mandatory
- # If operational situation permits
- ¹ For combat operations where normal investigation and reporting procedures are deemed not practical by the senior commander

А	viation Accid	ent/Incident No	tification, Rep	orting Requi	rements and	Suspenses
		PEACETIN	∕IE¹		CON	∕IBAT²
Accident/ incident class	Telephonic notification worksheet	Abbreviated report AAAR	Unmanned Acft System Accident Report UASAR	Full Report DA FORM 2397	Telephonic Notifiction Worksheet	AAAR Only By Any Means Possible (On-line Tool, E-mail, Fax, Hand Carry, Mail)
A and B	Manned/ Unmanned/ Immediately ¹	Manned Acft Ground Accidents 90 days.	IAI/CAI-90 Days	Manned Acft Flt/Flt Related IAI/CAI-90 Days	Immediately ¹	As Time Permits (Not To Exceed 60 Days)
С	Manned/ Unmanned/ Immediately¹	Manned Acft Ground Within 90 Days	Within 90 Days	Not Required	Immediately ¹	As Time Permits (Not To Exceed 60 Days)
D, E, F	N/a (unless SOF issue)	Within 30 Days	Within 30 Days	Not Required	N/a (Unless Sof Issue)	As Time Permits (Not To Exceed 30 Days)

NOTE:

- USACRC must be notified *immediately* by phone at DSN 558-2660/3410 or COM (334) 255-2660/3410 or notify safety rep forward (during combat) When the senior tactical commander determined that the situation, conditions, or time does not permit normal peacetime investigation and reporting
- ³ Combat reporting requirements for UASA are the same as peacetime -
- All suspense days are calendar days.

Figure 3-1. Aviation Accident/Incident Notification, Reporting Requirements, and Suspenses

3-21. DA Form 2397-U, Unmanned Aircraft System Accident Report

DA Form 2397–U (UASAR) is required for all UAS aviation accidents (flight, flight-related, and aircraft ground) including Aerostats, regardless of the class. The UASAR provides a report form that is specific in the characteristics and operational parameters of UAS. The UASAR is required for accidents involving an UAS with an engine in operation or an operational Aerostat that results in injury or property damage. Aerostats are considered operational when the Aerostat system platform (or launch pad) is manned and power is applied to winches and other safety release devices as part of the launching process. If an engine is not in operation or the Aerostat is not operational at the time of the accident then the injury or property damage will be reported on the appropriate ground accident report (DA Form 285 or 285–AB). If a manned aircraft is involved in the same accident as an unmanned aircraft the accident will be investigated and reported as a manned aircraft accident using the DA Form 2397 Technical Report or DA Form 2397–AB AAAR; the DA Form 2397–U will be added to the manned aircraft report as the other aircraft involved. The manned aircraft will always be the case aircraft. Injuries or fatalities resulting from an operational UAS accident are reported on DA Form 285 or 285–AB, as appropriate.

- a. Investigation and submission of the DA Form 2397-U will be in accordance with AR 385-10.
- b. Submit UASARs in typed or legible hand-printed copy via mail, fax, courier, electronic mail (e-mail), or through the automated reporting system.
- (1) The mailing address is as follows: Commander, US Army Combat Readiness/Safety Center (G3, Data Quality Control Division), Bldg 4905, 5th Avenue, Fort Rucker, AL 36362–5363.
 - (2) The e-mail address is: usarmy.rucker.hqda-secarmy.mbx.safe-accident-information@mail.mil.
- (3) The automated reporting system allows for quick and easy reporting through the USACR/SC Website: https://safety.army.mil.
- c. Attach all additional information or forms required and/or deemed appropriate (for example, summaries of witness interviews, expanded narratives, PQDR, ECOD/ACOD, lab/CCAD reports, contractor reports, other DA Form 2397-series, additional personnel information sections, and, if applicable, additional UASAR forms for involved aircraft other than the case aircraft).
 - d. Detailed instructions for completing the UASAR are in paragraph 3-37 of this chapter.

3-22. Completion instructions for DA Form 2397, Part I, Statement of Reviewing Officials

TECHNICAL REPORT OF U.S. ARMY AIRCRAFT ACCIDENT PART I - STATEMENT OF REVIEWING OFFICIALS REQUIREMENTS CONTROL SYMBOL CSOCS-309 For use of this form, see DA Pamphlet 385-40; the proponent agency is OCSA. 1. INITIAL REVIEW (Include Name, Rank, Title and Organization. Use additional sheet if required) Comment 1: 1. Concur with the findings and recommendations of the accident investigation board. 2. Actions specified in recommendations pertaining to this level of command were implemented. RICHARD F. FOREMAN, LTC, AV, Commanding, 1-3 Calvalry Regt Comment 2: Concur with the findings and recommendations of the accident investigation board. JAMES T. SUPERVISOR, COL, AV, Commanding, 3rd Avn Bde (See continuation sheet) **DIGITAL SIGNATURE 123456789** 2. ARMY HEADQUARTERS REVIEWING AUTHORITY COMMENTS Concur with the findings and recommendations of the accident investigation board and comments of the initial reviewing officials. The command has no further recommendations. BRIAN D. DIRECTOR, GEN, Commanding, FORSCOM Signature **DIGITAL SIGNATURE 123456789** 3. DEPARTMENT OF ARMY REVIEW (USACRC) Findings and recommendations of the accident investigation board are considered correct and appropriate. DA level recommendations have been forwarded to the appropriate agency for action. Facts and circumstances pertaining to this accident were published in the Sep 07 Vol 9 issue of KNOWLEDGE magazine. The report data is approved for inclusion into the USACRC database HENRY P. PRESERVER, LTC, AV, XO, USACRC Signature 4. CASE NO. a. Date (YYYYMMDD) c. Acft Serial No. 20131106 2000 0100150 DA FORM 2397, FEB 2009 PREVIOUS EDITION IS OBSOLETE. APD PE v1.00ES

Figure 3-2. Example of a completed DA Form 2397, Part I, Statement of Reviewing Officials

- a. Also see paragraph 3-3.
- b. Complete instructions as follows:
- (1) Block 1. The initial reviewing official(s) will indicate the official's organization as follows:
- (a) State concurrence or nonconcurrence with the findings and recommendations. Any nonconcurrence will be fully explained.
- (b) Report actions taken as well as recommendations for additional action by higher headquarters or other Army commands. Attach, as enclosures to this form, copies of correspondence, forms, and other data requiring additional action.
- (c) Identify those area(s) recommended for improvement by the investigating board that are beyond the resources available to the command.
- (d) Authenticate comments with signature, appropriate signature block, organization, and date at the close of each reviewing official's remarks.
- (e) Higher command reviewing official(s) will indicate the official's organization and enter the same information as (a) through (d), (above), as comment number 2 and 3.
- (2) *Block 2.* Army Headquarters reviewing authority. Army Headquarters commanders or their designated representatives will provide written concurrence or nonconcurrence for each finding and recommendation made by the accident investigation board.
 - (a) Indicate reasons for nonconcurrence. Also, include any additional recommended actions.
- (b) The reviewing authority will make note of those areas recommended for improvement by the accident investigation board or subordinate reviewing officials on which action can or will be completed. If corrective action is beyond the purview or capability of the Army Headquarters reviewing authority, this will be stated.
 - (c) Authenticate comments with signature, appropriate signature block, and organization at the close of remarks.
- (3) *Block 3*. This block is reserved for USACRC use and will be completed by the USACRC to show coordination/follow-up taken in response to recommendations requiring DA-level action.
 - (4) Block 4. Enter the case number as shown in table 3-6.

3-23. Completion instructions for DA Form 2397-1, Part II, Summary

For	HNICAL REP	PART II	SUMMARY					REQ	UIRI		CONTR		мвоі	-
1. CLASSIFICATIO	N a. Type	√ A B	C b. C	ategory	✓ Flight	Flight Rela	ated 2.	TYPE EV	ENTS	3 a	51 b.	30	C.	
3. PERIOD OF DAY	Dawn	Day	Dusk	✓ Nigh	nt 4. a.	On Post	Yes	✓ No	t	o. On Airf	ield	Yes	V	No
5. NEAREST MIL IN	ISTALLATION C	amp Coin					6.	NO. OF A	CFT	INVOLV	ED 1			
7. LOCATION a.	City: Baghdad		b. State:	c. (Country: Ira	q	d	Grid or L	at./Lo	ong.: P.	1234567	8		
8. a. Acft MTDS:	OH58D(R)	b. (1) O	rgn Acft Asgd:			(2) UIC:	WABCC	0 c. Ir	stal	Acft Asgo	l: Fort Ca	mpbell	, KY	
9. a.		Orgn Invol						of Cmd	Т-	Chain a	f Cmd	· ·	······································	10
ORGN/Chain	(1) Uni			in of Cmd		n of Cmd Avn Bde		of Cmd v Div	+	Chain o	Gillu		Army F	
of Cmd Involved	(2) UIC		·	Calvary		BCFF		CGG	+-			-	YB/	
~~~	(2) 010			ABCCA					+-	Ohaina				
b. ORGN/Chain	(4) 11	Orgn Accour	itable Cha	in of Cmd	Chai	n of Cmd	Chain	of Cmd	+-	Chain o	⊬cma	<del>                                     </del>	Army F	14
of Cmd	(1) Uni								+	<del>-</del>		ļ	cris.	
Accountable	(2) UIC					l				<del></del>				
10. a. Estimated 0			otal Loss			11. SURVIV	ABILITY	12. IN-FL	TES	CAPE 1	3. FIRE	14. PO	STCR	
(1) Acft Damage		\$	6,250,000			Surviv			ction		None	DIF	FICU	LTIES
(2) Repair M/Hrs	···	\$		No. N		✓ Partial		Bail	out	Į.	Inflight	\ \\	Yes	
(3) Other Damag		\$		Owne	·	Surviv	able rvivable	Not	hmn	lished	Post- crash	1	No	THE PERSON NAMED IN
(4) Other Damage	e Civ	\$	75,000		er S	Aeff M	Seattle.	✓ NA	amp	naneu	Other		The Owner of	in.
(5) Injury Cost		\$	1,310,000	1,110,000,110,000			-29	7	J	<u> L</u>	····		NA	-
(6) Total Cost Thi	s Acft	\$	7,635,000		SABLE FUEL	a. At Takeo	ff: 540	1	lbs	b. At Tim	e of Emer	g: 400	No. of Lot, House, St. Lot, House, St. Lot, House, St. Lot, House,	Ik
b. Total Cost Mu	tiple Acft	\$			FT	c. At Acdt o	r Term: 40	0	lbs	d. Type F	uel: jpg	1	parties.	
16.	GENERAL DATA		Yes No 17. F	LIGHT 18	, MISSION	19. INJURIE		F	atal	Disabling	Nondisal	oling Mis	ssing	No injur
a. Fluid Spillage			✓ F	LAN a.	Туре	(Numbe	er)	<u> </u>	A)	(B - E)	(F-G)		H)	(1)
b. (1) Night Visua	l Aids Used		<b>V</b>	$\angle \downarrow$	Ċ.	a. Occup	ants Milita	ry	1	\1	market the same			
(2) Specify Typ	e AN/AVS-6(V	(3)	~~~	VFR	1	b. Occup	ants Othe	r		J. Salango				
c. (1) Digital Soul	ce Collector Insta	illed	<b>✓</b>	IFR b.	Operations	c. Non-O	ccupants	Mil						
(2) Specify Typ	e PC-DTS	190	77 -		Single-	d. Non-C	ccupants							
d. Field Training	Exercise Involved	Sprander		None	ship	e. Total T	his Acft	<b>N</b>	1	1				
e. Heads-Up Disj	olay In Use	1	_ X _	NA .	✓ Multi-	f. Multipl	e Acft Eve	nt	$\neg$		<u> </u>			
f. Emergency Lo	cator Transmitter	1		IVA	ship	1	Alexander and the second							
Installed	, washing	<u></u>	L. L. V.	100	1	$\wedge$								
20.		377	TERRAIN	OF CRASH		than one ma								
a. General Chara	3 6		1	The state of	j.	b. Surface a	t Crach Si							
	3	ain 🗸 Desert	Rolling 🗸		Water	P	repared	lce	<b>√</b> 8	Same 2	Snow	Soggy	***************************************	ater
c. Crash Site Gra	3	ain ✓ Desert ✓ Level	Rolling 🗸		Water cles at Cras	P				Same 2	Snow	Soggy Rocks/	***************************************	
c. Crash Site Gra	de					h Site S	repared	Ice		Same 2	2000		***************************************	
c. Crash Site Gra	de	✓ Level Degrees	Slope Phase of		cles at Cras	h Site S	repared tumps	Ice Trees Airspeed	He	Bldg 🗸	Wires	Rocks/	Bould	ers
21 FLIGHT DATA	de	✓ Level	Slope	d. Obsta	cles at Cras	h Site S	repared tumps ther	Ice Trees	He	Bldg 🗸	2000	Rocks/	Bould	ers
and the second second	de	Level Degrees Flight Duration Hr 2	Slope Phase of	d. Obsta	cles at Cras	h Site Si O	repared tumps ther	Ice Trees Airspeed	He (Co	Bldg 🗸	Wires	Rocks/ Weight	Bould	ers
21 FLIGHT DATA	de E	Level Degrees Flight Duration	Slope Phase of Operation	d. Obsta	cles at Cras	h Site Sico	repared tumps ther	Trees Airspeed TAS	He (Co	eading ompass)	Wires Aircraft	Rocks/ Weight	Bould	ers
21 FLIGHT DATA	de E	Level Degrees Flight Duration Hr 2	Slope Phase of Operation	d. Obstar	Alti	h Site Sice O tude MSL	repared tumps ther	Trees Airspeed TAS VAR	He (Co	eading ompass)	Aircraft	Rocks/ Weight	Bould	ers
21/FLIGHT DATA  a. Planned Data	de E	Level Degrees Flight Duration Hr 2 Tns 3	Slope Phase of Operation	d. Obstar	cles at Cras	h Site Sico	repared tumps ther	Trees Airspeed TAS	He (Co	eading ompass)	Wires Aircraft	Rocks/ Weight	Bould	
21/FLIGHT DATA  a. Planned Data	de E	Level Degrees Flight Duration Hr 2 Ths 3 Hr 0	Slope Phase of Operation G	d. Obstar	Alti AGL 95	Pi h Site	repared tumps ther	Trees Airspeed TAS VAR 50	He (Co	eading ompass)  VAR  270	Aircraft 50	Weight 83	Bould	ers
21 FLIGHT DATA  a. Planned Data  b. When Emergel	de	Level Degrees Flight Duration Hr 2 Ths 3 Hr 0 This 7	Slope Phase of Operation	d. Obstar	Alti	h Site Sice O tude MSL	repared tumps ther	Trees Airspeed TAS VAR	He (Co	eading ompass)	Aircraft	Weight 83	Bould	ers
21 FLIGHT DATA  a. Planned Data  b. When Emergel	de C	Level Degrees Flight Duration Hr 2 This 3 Hr 0 This 7 Hr 0 This 7	Slope  Phase of Operation  G  N  R	d. Obsta-	Alti AGL  95	MSL Site S O O tude MSL 450 220	repared tumps ther	Airspeed TAS  VAR  50	He	eading pompass)  VAR  270  360	Aircraft 50	Weight 83	Bould	ergro
21. FLIGHT DATA  a. Planned Data  b. When Emergel  c. Accident or Te	de C	Level Degrees Flight Duration Hr 2 This 3 Hr 0 This 7 Hr 0 This 7	Slope  Phase of Operation  G  N  R	d. Obsta-	Alti AGL 95 0 dentify defin	MSL Site S O O tude MSL 450 220	repared tumps ther	Airspeed TAS  VAR  50	He	eading pompass)  VAR  270  360	Aircraft 50	Weight 83	Bould	ergros N
21. FLIGHT DATA  a. Planned Data b. When Emerger c. Accident or Te 22. ACCIDENT CAL	ncy Occurred mination	Level Degrees Flight Duration Hr 2 This 3 Hr 0 This 7 Hr 0 This 7	Slope  Phase of Operation  G  N  R	d. Obsta	Alti AGL B000 95 0 dentify defin U Perso	Prince   Simple   S	repared tumps ther	Ice Trees Airspeed TAS VAR 50 50	He	eading pompass)  VAR  270  360	Aircraft 50	Weight 83	Ove	ergros N
a. Planned Data b. When Emerger c. Accident or Te 22. ACCIDENT CAL a. Personnel	ncy Occurred mination	Level Degrees Flight Duration Hr 2 This 3 Hr 0 This 7 Hr 0 This 7	Slope  Phase of Operation  G  N  R	A A 3 3 Diocks to its D, S, or	Alti AGL B000 95 0 dentify defin U Perso	h Site Stude  tude  MSL  450  220  125  ite, suspecteonnel (Continuo	repared tumps ther	Airspeed TAS  VAR  50  50	He	eading pompass)  VAR  270  360	Aircraft 50	Weight 83	Ove	ergros N
a. Planned Data b. When Emerger c. Accident or Te 22. ACCIDENT CAL a. Personnel	ncy Occurred Traination SE FACTORS (E	Level Degrees Flight Duration Hr 2 This 3 Hr 0 This 7 Hr 0 This 7	Slope  Phase of Operation  G  N  R	A A A A A B B B B B B B B B B B B B B B	Alti AGU  Alti AGU  Alti AGU  AGU  AGU  AGU  AGU  AGU  AGU  AGU	h Site Stude  tude  MSL  450  220  125  ite, suspecteonnel (Continuo	repared tumps ther  dd, or under  Duty	Airspeed TAS  VAR  50  termined	He	eading pompass)  VAR  270  360	Aircraft 50	Weight 83	Ove	ergros N
21. FLIGHT DATA  a. Planned Data  b. When Emerger  c. Accident or Te  22. ACCIDENT CAL  a. Personnel  (1) Flight Crew	ncy Occurred Traination SEE FACTORS (EDuty PCDuty PIDuty	Level Degrees Flight Duration Hr 2 This 3 Hr 0 This 7 Hr 0 This 7	Slope  Phase of Operation  G  N  R	A A A A A B B B B B B B B B B B B B B B	Alti AGU  B000  000  000  000  000  000  000	h Site Site Site Site, suspecteonnel (Continue Supervisory)	tumps ther  d, or under  Duty Duty Duty	Airspeed TAS  VAR  50  termined	He	eading pompass)  VAR  270  360	Aircraft 50	Weight 83	Ove	ergros N
a. Planned Data b. When Emerger c. Accident or Te 22. ACCIDENT CAL a. Personnel	ncy Occurred  mination  SSE FACTORS (E  Duty PC  Duty PI  Duty  ww. Duty	Level Degrees Flight Duration Hr 2 This 3 Hr 0 This 7 Hr 0 This 7	Slope  Phase of Operation  G  N  R	A A A A A B B B B B B B B B B B B B B B	Alti AGL AGO AGO Adentify defining U Persc (3) (4) b. Ma	h Site Site Site Site Site Site Site Site	tumps ther  d, or under  Duty Duty Duty	Airspeed TAS  VAR  50  termined	He	eading pompass)  VAR  270  360	Aircraft 50	Weight 83	Ove	ergros N
21. FLIGHT DATA  a. Planned Data  b. When Emerger  c. Accident or Te  22. ACCIDENT CAL  a. Personnel  (1) Flight Crew  (2) Ground Cre	mination  SEFACTORS (EDuty PC Duty PI Duty Duty Duty Duty	Level begrees Flight Duration Hr 2 This 3 Hr 0 This 7 Hr 0 This 7 Inter a D, S, or U	Phase of Operation  G  N  R  in appropriate	d. Obsta	Alti AGL A000  95  0  dentify defin U Perso (3)  (4) b. Ma c. En	h Site Site Site Site Site Site Site Site	tumps ther  d, or under  Duty Duty Duty Malfunctic	Airspeed TAS  VAR  50  termined	He	eading pmpass) VAR 270 360 es)	Aircraft 50	Weight 83	Ove	ergros N
21. FLIGHT DATA  a. Planned Data  b. When Emerger  c. Accident or Te  22. ACCIDENT CAL  a. Personnel  (1) Flight Crew  (2) Ground Cre  23. SEQUENCE (F.	mination  SE FACTORS (E  Duty PC  Duty PI  Duty PV  Duty Duty  Duty Cactual accident see	Level begrees Flight Duration Hr 2 Ths 3 Hr 0 Ths 7 Hr 0 Ths 7 Inter a D, S, or U	Phase of Operation  G  N  R  in appropriate	d. Obsta	Alti AGL A000  95  0  dentify defin U Perso (3)  (4) b. Ma c. En	h Site Site Site Site Site Site Site Site	tumps ther  d, or under  Duty Duty Duty Malfunctic	Airspeed TAS  VAR  50  termined	He	eading pmpass) VAR 270 360 es)	Aircraft 50	Weight 83	Ove	ergros N
21. FLIGHT DATA  a. Planned Data  b. When Emerger  c. Accident or Te  22. ACCIDENT CAL  a. Personnel  (1) Flight Crew  (2) Ground Cre  23. SEQUENCE (F. SEE A	mination  SEFACTORS (E  Duty PC  Duty PI  Duty PI  Duty  W: Duty  actual accident se	Level begrees Flight Duration Hr 2 Ths 3 Hr 0 Ths 7 Hr 0 Ths 7 inter a D, S, or U	Phase of Operation  G  N  R  in appropriate	d. Obsta	Alti AGL A000  95  0  dentify defin U Perso (3)  (4) b. Ma c. En	tude  MSL  450  220  125  ite, suspecteonnel (Continue Supervisory)  Other teriel Failure/vironmental of flight. Use	d, or under	Airspeed TAS  VAR  50  termined of the sheet if received the sheet	He	eading pmpass) VAR 270 360 es)	Aircraft 50	Weight 83	Ove	ergros N
21. FLIGHT DATA  a. Planned Data  b. When Emerger  c. Accident or Te  22. ACCIDENT CAL  a. Personnel  (1) Flight Crew  (2) Ground Cre  23. SEQUENCE (F.	mination  SSE FACTORS (E  Duty PC  Duty PI  Duty  W: Duty  Duty  actual accident se  TTACHED SH  a. Name, Rank,	Level begrees Flight Duration Hr 2 Ths 3 Hr 0 Ths 7 Hr 0 Ths 7 Inter a D, S, or U	Phase of Operation  R  In appropriate of emergence of eme	d. Obsta	Alti AGL A000  95  0  dentify defin U Perso (3)  (4) b. Ma c. En	tude  MSL  450  220  125  ite, suspecteonnel (Continue Supervisory)  Other teriel Failure/vironmental of flight. Use	tumps ther  d, or unde und)  Duty Duty Malfunctic additional	Airspeed TAS  VAR  50  termined of the sheet if received the sheet	Heerocause	eading pmpass)  VAR  270  360  ess)	Aircraft 50 49	Rocks/ Weight 83 43 43	D, S,	ergross N
21. FLIGHT DATA  a. Planned Data  b. When Emerger  c. Accident or Te  22. ACCIDENT CAI  a. Personnel  (1) Flight Crew  (2) Ground Cre  23. SEQUENCE (F.  SEE A  24. AVN SAFETY	mination  SSE FACTORS (E  Duty PC  Duty PI  Duty  W: Duty  Duty  actual accident se  TTACHED SH  a. Name, Rank,	Level begrees Flight Duration Hr 2 Ths 3 Hr 0 Ths 7 Hr 0 Ths 7 inter a D, S, or U	Phase of Operation  N  R  in appropriate of emergence  C Troop. 1-3 0	d. Obsta	Alti GGL  900  95  0  dentify defini U Perso (3)  b. Ma c. En	tude  MSL  450  220  125  ite, suspecteonnel (Continue Supervisory)  Other teriel Failure/vironmental of flight. Use	tumps ther  d, or unde und)  Duty Duty Malfunctic additional	Airspeed TAS  VAR  50  termined of the state	He (CC	eading pmpass)  VAR  270  360  ess)	Aircraft 50 49	Rocks/ Weight 83 43 43 11234	D, S,	ergross N

Figure 3-3. Example of a completed DA Form 2397-1, Part II, Summary

DA Form 2397-1 (Cont'd)

Sequence.

While conducting a night reconnaissance using night vision goggles, Chalk 1 in a flight of two OH-58ds struck the second of two 1/2-inch diameter ridge wires at approximately 115-120 feet AGL midway between the two stanchions. At least two of the main rotor blades struck the wires. The second rotor blade was severed approximately halfway from the blade tip to the hub after impacting the wire. As a result, the aircraft spun to the right approximately 360 degrees and fell diagonally approximately 150 feet before impacting a 3-foot-high earthen bank that paralleled the two-lane hard-surface road. The aircraft hit nose first and flipped tail over nose, coming to rest on its right side. The aircraft was destroyed and one of the crew members received fatal injuries.

Figure 3-3. Example of a completed DA Form 2397-1, Part II, Summary-continued

- a. Also see paragraph 3-4.
- b. Complete instructions as follows:
- (1) Blocks 1a and 1b. Check the appropriate box to indicate the appropriate classification and category for the accident. Accident classifications and categories are defined in AR 385–10 and chapter 1 of this DA Pam.

Note. Accident classification is based solely on property damage or injury/illness severity. For example, fatal, permanent partial disability. In accordance with AR 385-10, not injury cost.

- (2) *Block* 2. Refer to table 3–2 for accident event codes. Appendix F contains explanations of events listed. Select the type event(s) that best categorize(s) the accident and enter code(s) in space(s) provided. More than one event may apply and up to three may be recorded. The event that best describes the accident should be listed first.
- (3) *Block 3*. Check the appropriate box. Dawn is that period of time between beginning morning nautical twilight and official sunrise. Dusk is that period of time between official sunset and end evening nautical twilight.
- (4) Block 4. Check the appropriate box. Tactical landing zones under positive ATC. For example, Corps' instrumented airfield, Division's VFR helipad, stagefields, and support bases are considered "on post" and "on airfield" for reporting purposes. Also, aircraft accidents occurring on joint-use civil airports and on civilian airports with USAR component facilities are considered "on post" and "on airfield" when there is intent to use the military facilities on that airport, (for example, visit the unit, acquire fuel, and conduct training).
  - (5) Block 5. Enter name of military installation where the accident occurred or the nearest military installation.
- (6) *Block* 6. Enter the number of aircraft that were involved in the accident. Do not include damaged aircraft that were not being operated at the time of the accident. Ensure that the number entered in this block corresponds with the number of DA Forms 2397–1 submitted with the technical report. Paragraph 3–4 specifies when additional DA Forms 2397–1 are required.
- (7) Block 7. Enter the name of the closest city, state, and country to the accident site. Enter the military grid reference or latitude/longitude.
- (8) Block 8. Enter appropriate information for the aircraft addressed by this form. Organization aircraft assigned and unit identification code (UIC) pertaining to the organization which has the aircraft in its inventory as recorded in the property records or a hand receipt, whichever is applicable. Enter the installation's name where the aircraft was assigned.
  - (9) Block 9.
- (a) Block 9a. Beginning in the left column under "Organization Involved," enter the six-digit UIC and abbreviated titles of the lowest level aviation unit and chain of command involved in the accident up through the Army Headquarters command.

Note. For U.S. Army Reserve (USAR) or Army National Guard (ARNG) units on active duty status, if the unit of assignment is other than the USAR or ARNG, enter the unit of assignment chain of command in block 9b. Enter the AGR or (ARNG) unit chain of command in block 9a.

(b) Block 9b. If it is determined that an activity other than the involved unit is deemed the accountable for the

accident, enter the six-digit UIC and abbreviated title of that unit and chain of command up through the Army Headquarters command and explain in the analysis paragraph of DA Form 2397–3. If the accident unit is the same as listed in block 9a, leave blank. Further guidance for determining accountability is contained in AR 385–10, paragraph 3–9.

- (10) Block 10.
- (a) Block 10a. If the aircraft identified in block 25c was damaged beyond economical repair limits, missing, or abandoned, check the box indicating "total loss." Insert the replacement cost of the aircraft obtained from TB 43–0002–3 in the space provided for the aircraft damage cost and leave the spaces for aircraft repair man-hours and cost blank. If the aircraft was repairable, enter in the spaces provided an estimated materiel cost of damage, number of man-hours, and a dollar amount for total man-hours to repair the aircraft, based on the standard labor rate per hour specified in paragraph 1–10. The ECOD and man-hours required to repair the aircraft should be obtained from the organization's support maintenance. When more than one aircraft is damaged and the other aircraft is not operational, enter the total dollar cost of damage and man-hours to repair the other aircraft or other military property in the "Other Damage Mil" space. Report dollar value of civilian property damage (For example, damaged buildings, destroyed crops, broken utility poles and lines, livestock) in the space "Other Damage Civ" provided. Report the total dollar value of all injuries for this aircraft, as recorded in block 19, DA Forms 2397–9, Part X, Injury/Occupational/Illness Data. The cost is computed using the standard injury and illness costs contained in table 1–1 of this pamphlet. Injuries or fatalities to non-DOD personnel (For example, private citizens) are not included in accident injury/occupational illness cost. Show ownership of all damage by entering one of the codes listed in table 3–3.
- (b) Block 10b. Complete this block only for accidents involving a multiple aircraft event. The information will be entered only on the DA Form 2397–1 applying to the "case aircraft" identified in block 25c. The cost entered in block 10b will show the total cost of all aircraft, property damage, injury, and occupational illness attributable to the accident.
- (11) Block 11. Check the appropriate box. Two factors are required for an accident to be survivable. Crash forces imposed upon the inhabitable area of the aircraft must be within the limits of human tolerance (see app C), and all portions of the inhabitable area must remain reasonably intact and occupiable. If these criteria are met for at least one, but not all seat/litter positions, the accident is partially survivable. If no seat positions meet the criteria, the accident is nonsurvivable. Fatal injuries or occupancy of an inhabitable area is not the criteria for determining survivability of an accident.
- (12) *Block 12*. Check the appropriate box to indicate the method or attempted method of in-flight escape. This block does not apply to occupants who fell out of the aircraft or were ejected/thrown out without a parachute. Check "NA" if the crew/aircraft is not equipped with parachutes/ejection seats.
- (13) *Block 13.* For fires beginning before initial impact or breakup of the aircraft, check "in-flight." For fires beginning after the initial crash impact has begun, check "post-crash." Check both boxes if in-flight and post-crash fires occurred. If "in-flight," "post-crash," or "other" boxes is checked, ensure that a DA Form 2397–12 is completed. For the purpose of this block, movement of the aircraft under its own power is considered in-flight. If other is checked, explain in narrative (DA Form 2397–3).
- (14) Block 14. Check the "Yes" block if any occupant had difficulty or required assistance during egress. Leave blank for nonsurvivable accidents with no survivors.
- (15) Block 15. Enter in blocks a, b, and c the total amount of fuel on board within the aircraft fuel system, in pounds, for the times indicated. Enter in block d the type fuel with which the aircraft was last serviced.
  - (16) Block 16. Check appropriate blocks and record supporting data on appropriate forms.
  - (a) Block 16a. If "Yes," enter types and quantity in block 9e of DA Form 2397-6.
- (b) Block 16b. If "Yes," identify the type night visual aid used in block 16b(2). If night visual aids were a factor in the accident, discuss in the findings (DA Form 2397–2) and "special investigation" portion of the narrative (DA Form 2397–3).
- (c) Block 16c. Check "Yes" if a Digital Source Collector (DSC) was installed, specify type in 16c(2). Explain in the narrative (DA Form 2397–3) portion of the report.
- (d) Block 16d. If "Yes," explain and enter name of field training exercise in "the preflight phase" of the narrative (DA Form 2397–3).
  - (e) Block 16e. Check "Yes" only if heads-up display was in use at the time of accident.
- (f) Block 16f. If an emergency locator transmitter was installed, check "Yes." Explain any malfunctions in the narrative (DA Form 2397-3).
- (17) *Block 17*. Check the appropriate box to indicate under what flight rules the aircraft was being operated at the time of the accident. Check "none" if the aircraft was operated without a flight plan or without being recorded on appropriate flight dispatch records.
  - (18) Block 18.
- (a) Block 18a. Use the mission symbols on DA Form 2408–12 or as specified in AR 95–1. For maintenance operational checks enter "S." If none, enter "NA." If the mission was classified, enter "Z." If the mission symbol is undetermined, enter "U."
  - (b) Block 18b. Check the appropriate box to indicate if the mission was a single- or multi-aircraft operation.

- (19) Block 19. Enter the number of personnel in the appropriate boxes.
- (a) Columns B through E (Disabling) combine the injuries reported in blocks 1b through 1e of DA Forms 2397–9.
- (b) Columns F through G (Nondisabling) combine those injuries reported in block 1f and 1g of DA Forms 2397–9. Ensure the number of personnel reported as injured agrees with the number of injured personnel reported on DA Forms 2397–9 for this aircraft.
- (c) Block 19f, "Multiple Acft Event," is completed only on the DA Form 2397-1 for the "case aircraft" when reporting accidents involving multiple aircraft.
  - (20) Block 20. This block is used to describe the terrain at and around the crash site.
- (a) Block 20a. "General characteristics" pertains to the dominant terrain features surrounding the accident site. More than one may apply.
- (b) Block 20b. Refers to surface conditions on which the aircraft made its ground run and/or came to final rest. More than one type surface may apply.
- (c) Block 20c. Pertains to the terrain grade on which the aircraft came to final rest. If "slope" is checked, specify degrees. Leave blank if not applicable.
- (d) Block 20d. Pertains to obstacles located in the vicinity of the accident site that may have influenced the accident. More than one may apply.
- (21) *Block 21*. Flight Data. For "Flight Duration," enter hours and tenths of hours, and for "Phase of Operation," enter appropriate code(s) (maximum of three) from the list at table 3–4. "Over gross" determinations are not in reference to design gross weight, but are in reference to the conditions under which the aircraft was being operated at the time of the accident.
- (a) Block 21a. For planned data, enter the flight parameters that were used during preflight planning for that segment of the mission profile in which the emergency or accident occurred. "Variable" (VAR) may be used where heading, altitude, and airspeed are constantly changing due to mission requirements. Aircraft weight is the estimated take-off weight.
- (b) Block 21b. For emergency data, enter the actual flight parameters at the time of the emergency. Note. The use of the term "Emergency" in this pamphlet refers to "any occurrence/situation wherein the personnel involved sense a need to take appropriate measures to reduce the effects of the occurrence/situation or prevent injury/occupational illness, property damage, or further materiel failure.
- (c) Block 21c. For accident or termination data, enter flight parameters at the time when the major impact/accident occurred or accident sequence stops if no major impact occurred (could be same as emergency data).
- (22) *Block 22.* Place a "D," "S," or "U" in the appropriate space provided if personnel, materiel, or environmental factors definitely contributed, are suspected to have contributed, or the role in the accident could not be determined. Identify personnel by duty codes from the list at table 3–5. It is essential that each entry in block 22 be supported by the present and contributing findings reported in blocks 1 and 2 of the DA Form 2397–2, the analysis portion of the DA Form 2397–3, and the cause relationship block elements checked on DA Forms 2397–7, Part VIII, Maintenance and Materiel Data, 2397–8, Part IX, Personal Data, and 2397–11, Part XII, Weather/Environmental.
- (23) Block 23. Enter a concise summary of the accident sequence of events from the first indication of the emergency through termination of the accident sequence. Avoid conclusions of the investigation as to the cause of the accident. Continue on letter-size paper as necessary; however, do not exceed a total of 15 lines of typewritten information.
- (24) *Block 24*. The aviation safety officer (ASO) of the unit involved in the accident will normally review the completed report and sign in this block. The ASO's signature does not indicate or imply his concurrence or nonconcurrence with the report but only that he has reviewed and is aware of the contents of the report.
- (25) *Block* 25. Enter the case number. The case number is a 19-digit numerical entry consisting of an 8-digit date (Block 25a), 4-digit hour of the day (Block 25b), and the 7-digit tail number of the "case aircraft" (Block 25c). This case number will be placed on each form of the DA Form 2397-series accompanying the report, as indicated in table
- (26) *Block* 26. Block 26. If the accident involves a multiple aircraft event, block 26 will be completed only on additional DA Forms 2397–1, addressing the other aircraft. Leave blank if it is a single aircraft accident.

Table 3–1A			
Elements of a human error	present and	contributing	findina

FINDING (Present and Contributing: Human Error – Individual Failure	FINDING	(Present and	Contributing:	Human Frror -	<ul> <li>Individual Failure)</li> </ul>
---------------------------------------------------------------------	---------	--------------	---------------	---------------	-----------------------------------------

FINDING (Present and Contributing: Human Error - Individual Faile	ure):
Required Information	Example
1. Explanation of when and where the mistake/error occurred in context of the accident sequence of events.	While conducting day, nap-of-the-earth aircrew training at 50 feet above ground level (AGL) and 10 knots indicated air speed (KIAS)
2. Aircraft and individual involved by duty position.	the Pilot in Command (PC) and Pilot (PI) of the UH-60
3. Identification of mistake made (ref aviation-specific mistakes/errors in DA PAM 385-40, Table B-1) and an explanation of how task/activity was performed improperly. NOTE: Only one mistake/error per finding.	improperly scanned. That is, both crewmembers failed to properly scan for obstacles when they both became visually fixated on an animal on the ground
4. Directive (ATM, SOP, FM, TM, and so forth) or common practice governing performance of task/activity.	in contravention of TC 1-237, Task 2026.
5. Consequences of mistake/error.	As a result, the aircraft main rotor blades were damaged when they made contact with a tree at approximately 50 feet AGL. There were no injuries.
6. Identification of reasons (root causes/system inadequacies) for the mistake/error {ref System Inadequacies in Table B-5 of DA PAM 385-40}. NOTE: The finding may contain multiple System Inadequacies (Individual, Standards, Leader, etc.)	The PC's and Pl's actions were a result of overconfidence in each other's ability to clear the aircraft and maintain obstacle clearance.
7. Brief explanation of how each reason (root cause/system inadequacy) contributed to the mistake/error.	The PC and PI allowed the aircraft to fly too close to known obstacles resulting in damage to the main rotor blades.

#### Notes:

¹ FINDING 1: (Present and Contributing: Human Error- Individual Failure): While conducting day, nap-of-the-earth aircrew training at 50 feet AGL and 10 KIAS, the PC and PI of the UH-60L improperly scanned. That is, both crewmembers failed to properly scan for obstacles when they both became visually fixated on an animal on the ground in contravention of TC 1-237, Task 2026. As a result, the aircraft main rotor blades were damaged when they made contact with a tree at approximately 50 feet AGL. There were no injuries. The PC's and PI's actions were a result of overconfidence in each other's ability to clear the aircraft and maintain obstacle clearance. The PC and PI allowed the aircraft to fly too close to known obstacles resulting in damage to the main rotor blades.

Table 3–1B Elements of a materiel failure present and contributing finding

FINDING (Present and Contributing: Materiel Failure):

FINDING (Present and Contributing: Materiel Failure):	
Required Information	Example
1. Explanation of when and where the materiel failure/malfunction occurred in the context of the accident sequence of events.	During engine run-up of the CH-47D with rotor blades turning
2. Name and PN or NS of the part, component or system that failed.	the retention bolts (P/N NAS624H-5) securing the fixed droop stop to the aft rotor system red blade pitch shaft
3. Mode of failure (corroded, burst, twisted, decayed, etc.)(see DA PAM 385-40, Appendix B, Table B-3 for definitions and examples) NOTE: Only one failure per finding.	1
4. Consequences of materiel failure.	The pressure on the engaged threads allowed the threads to strip from the nuts. This failure allowed the fixed droop stop and bolts to separate from the aircraft. As a result, during shutdown, with both engine condition levers at stop and the main rotor blades coasting slowly, the aircraft red main rotor blade contacted the fuselage
5. Identification of reasons (root causes/system inadequacies) materiel failure/malfunction caused or contributed to accident. NOTE: The finding may contain multiple System Inadequacies (Design, Manufacture, and so forth).	The droop stops failed due to improper installation by the manufacturer during aircraft overhaul.

## Table 3–1B Elements of a materiel failure present and contributing finding—Continued

6. Brief explanation of how each reason (root cause/system inadequacy) contributed to materiel failure/ malfunction.

That is, the bolts (P/N NAS624H-5) installed in the separated fixed droop stop, though nearly identical in appearance, were 1/8-inch shorter than the bolts (P/N NAS624H-7) required by TM 55-1520-240-23P1.

#### Notes:

¹ FINDING 1 (Present and Contributing: Materiel Failure). During engine run-up of the CH-47D with rotor blades turning, the retention bolts (P/N NAS624H-5) securing the fixed droop stop to the aft rotor system red blade pitch shaft failed. The pressure on the engaged threads allowed the threads to strip from the nuts. This failure allowed the fixed droop stop and bolts to separate from the aircraft. As a result, during shutdown, with both engine condition levers at stop and the main rotor blades coasting slowly, the aircraft red main rotor blade contacted the fuselage, resulting in minor fuselage and main rotor blade damage. The droop stops failed due to improper installation by the manufacturer during aircraft overhaul. That is, the bolts (P/N NAS624H-5) installed in the separated fixed droop\stop, though nearly identical in appearance, were 1/8-inch shorter than the bolts (P/N NAS624H-7) required by TM 55-1520-240-23P1.

## Table 3–1C Elements of an environmental factor present and contributing finding

FINDING (Present and Contributing: Environment):

Required information	Example
Explanation of when and where the environmental factor occurred in the context of the accident sequence of events.	While ground-taxiing to the parking ramp
2. Aircraft and if applicable, the individual(s) involved by duty position.	the AH-64D
3. Description of environmental factor encountered(see DA PAM 385-40, Appendix B, Table B-4 for definitions and examples). NOTE: Only one failure per finding.	encountered an unforecast sudden microburst with winds exceeding 80 knots.
4. Consequences of environmental effect.	As a result, the aircraft became airborne in a nose-low condition and subsequently entered a right spin from which the crew was unable to recover.
5. Explanation/identification of reason(s) environmental conditions caused the accident.	Microbursts are environmental events that cannot be seen or fore- casted with present meteorological measuring equipment nor are they visible to aircraft crewmembers. They are normally a phenome- non associated with thunderstorms; however, there were no thun- derstorms reported or visible in the vicinity.

#### Notes:

## 3-24. Completion Instructions for DA Form 2397-2, Part III, Findings and Recommendations

¹ FINDING 1 (Present and Contributing: Environment). While ground-taxiing to the parking ramp, the AH-64D encountered an unforecast sudden microburst with winds exceeding 80 knots. As a result, the aircraft became airborne in a nose-low condition and subsequently entered a right spin from which the crew was unable to recover. The aircraft struck the ground causing aircraft damage and injuring one crewmember. Microbursts are environmental events that cannot be seen or forecasted with present meteorological measuring equipment nor are they visible to aircraft crewmembers. They are normally a phenomenon associated with thunderstorms; however, there were no thunderstorms reported or visible in the vicinity.

## TECHNICAL REPORT OF U.S. ARMY AIRCRAFT ACCIDENT

PART III - FINDINGS AND RECOMMENDATIONS

For use of this form, see DA Pamphlet 385-40; the proponent agency is OCSA.

REQUIREMENTS CONTROL SYMBOL CSOCS-309

APD PE v1.00

1. FINDINGS AND RECOMMENDATIONS (Use additional sheet if required.)

Finding 1 (Present and Contributing: Human Error-Individual Failure):

While conducting night reconnaissance operations using night vision goggles (NVGs) and the mast-mounted sight (MMS), the PC and PI of the OH-58D(R) did not properly coordinate. That is, the crew did not indicate to each other when they were inside or outside the aircraft as prescribed in TC 1-248, paragraph 6-3. The Board concluded that the PC was flying and looking out of the right side of the aircraft and the PI was looking inside the aircraft. Neither pilot confirmed where he was looking. As a result the PC flew the aircraft into wires that were depicted on the wire hazards map and were known to be present by the crew. The aircraft was destroyed, the PI received serious injuries, and the PC received fatal injuries.

The Board concluded that the crew's actions were a result of overconfidence and excitement. The crew knew the area very well and had almost completed a tour of duty flying combat missions in theater. The accident crewmembers had flown together often and were overconfident in each other's abilities. The Board also concluded that the crew was concentrating so intensely on supporting the ground element that they forgot where they were relative to the wires.

#### RECOMMENDATION 1:

- a. Unit Level Action: Commander, C-Troop, 1-3 Calvary, 3d Aviation Brigade, 17th Cavalry Division:
  - (1) Brief all assigned and attached personnel on the facts and circumstances surrounding this accident.
  - (2) Ensure all assigned and attached pilots adhere to all published aircrew taining manual procedures.
- b. Higher Level Action: Commander, 3d Aviation Brigade, 17th Calvary Division: Continue enforcing the published risk management procedures, policies, and guidance on proper crew coordination.
- c. DA Level Action: None

**DA FORM 2397-2, FEB 2009** 

(See continuation sheet)

	S		- 3	. 3 &								
2. CODED SUMM	ARY OF AC	CIDENT FINDINGS, SYSTE	M INA	DEQUACIES, AND RECO	ИΜЕ	NDATIONS						
a. Personnel	1		(5)	Mistake/Error Code	8	System Inadequacies		Remedia	Me	asures/Recomn	nenda	itions
(1) Duty PC		(2) Role 🗸 D 💍 S	100		1	16	1	U05	2	U06	3	H06
(3) Phase of Oper	ration N	(4) ATM Task No. 1026	7	P08	2	15	1		2		3	
					3	***************************************	1		2		3	
b. Personnel			(5)	Mistake/Error Code								
(1) Duty PI	Shang parented a standard	(2) Role 🗸 D S			1	16	1	U05	2	U06	3	H08
(3) Phase of Open	ration N	(4) ATM Task No. 1026	7	P08	2	15	1		2		3	
	***				3		1		2		3	
c. Personnel	1	) V	(5)	Mistake/Error Code								
(1) Duty	South	(2) Role D S			1		1		2		3	
(3) Phase of Opera	ation	(4) ATM Task No.	1		2		1		2		3	
					3		1		2		3	
d. Materiel			(4) f	Failure Code								
(1) Role D	s	(2) Phase of Operation			1		1		2		3	
(3) Failed Part Numb	ber				2		1		2		3	
					3		1		2		3	
e. Environmen	ital		(3)	Condition Code								
(1) Role D	s	(2) Phase of Operation			1		1		2		3	
					2		1		2		3	
					3		1		2		3	
3. CASE NO.	a. Date (	YYYYMMDD)		b. Time		c. Acft Serial	No.					
		20070626		2121				001	00	31		

Figure 3-4. Example of a completed DA Form 2397-2, Part III, Findings and Recommendations

PREVIOUS EDITION IS OBSOLETE.

DA Form 2397-2 (Cont'd) - 20060210194010010031

THE FINDING LISTED BELOW DID NOT CONTRIBUTE TO THIS ACCIDENT; HOWEVER, IF LEFT UNCORRECTED, IT COULD HAVE AN ADVERSE EFFECT ON THE SAFETY OF FUTURE OPERATIONS.

FINDING 2 (Present but Not Contributing):

The Multi-National Corps-Iraq Helicopter Procedures Training Guide (HPG) has a requirement that no Army helicopter will go below 50 feet AGL. Paragraph 3-5 of the HGP states that the minimum operating altitude for all rotary-wing aircraft is 50 feet AGL, unless deviations are required for weather or are directed by the command based on mission requirements. Airspeeds will be consistent with safe operations for altitude, obstacle avoidance, and environmental conditions. The Board determined that the flight hazards are so numerous that the 50 foot AGL limit should be raised to 150 feet AGL except for enemy situations or if directed by the command.

#### **RECOMMENDATION 2:**

- a. Unit Level Action: None.
- b. Higher Level Action: Commander, Multi-National Corps-Iraq, consider changing the HGP from 50 feet AGL minimum altitude to 150 feet AGL minimum altitude.
  - c. DA Level Action: None.

Figure 3-4. Example of a completed DA Form 2397-2, Part III, Findings and Recommendations—continued

- a. Also see paragraph 3-5.
- b. Complete instructions as follows:
- (1) Block 1. Instructions for reporting findings and recommendations. Each finding must be substantiated by the written analysis portion of the narrative (DA Form 2397–3). Findings fall into one of five categories:
  - (a) Present and contributing.
  - (b) Suspected present and contributing.
  - (c) Present and contributing to the severity of the injury/occupational illness or extent of property damage.
  - (d) Present but not contributing.
  - (e) Special observations. (This is noted at the end of the narrative only.)
- 1. Findings. As a minimum, the following elements of information will be addressed for each Present Contributing, Suspected Present Contributing, and Present Contributing to the Severity of Injury/Occupational Illness or Extent of Damage finding in the order stated. See table 3–1.
- a. An explanation of when and where the error, materiel failure, or environmental factor occurred in the context of the accident sequence of events. For example, "During preflight," "During takeoff," "While employing."
- b. Identification of the individual involved by duty position; or the name and PN or NSN of the part, component, or system that failed; or a description of the environmental factor, as appropriate.
- c. For human error, identification of the task or function the individual was performing and an explanation of how it was performed improperly. Refer to appendix B, table B–1 for mistake/error categories. The error could be one of commission or omission. For example, an individual performed the wrong task, incorrectly performed the correct task, or failed to perform a required task or function. In the case of a material failure, identify the mode of failure. Refer to appendix B, table B–3 for material failures/malfunctions. For example, corroded, burst, twisted, decayed. Enter only one task error, malfunction or environmental condition code per present and contributing factor.
  - d. Identification of the directive, (for example, ATM, SOP, Field Manual (FM)) or common practice governing the

performance of the task or function. In lieu of a written directive, the error may represent performance that is contrary to common practice.

- e. An explanation of the consequences of the error, materiel failure, or environmental effect. An error may directly result in damage to equipment or injury/occupational illness to personnel, or it may indirectly lead to the same end result. A materiel failure may have an immediate effect on equipment or its performance, or it may create circumstances that cause errors resulting in making further damage/injury or occupational illness inevitable.
- f. Identification of the reasons (system inadequacy(ies)) the human, materiel, environmental conditions contributed to the accident. Refer to the list and examples of system inadequacy(ies) provided in appendix B, table B–5. The present and contributing finding may contain multiple system inadequacies (training, individual, leader, and so forth).
  - g. A brief explanation of how each reason contributed to the error, materiel failure, or environmental factor.
- h. In addition, for Present and Contributing to the Severity of Injury/Occupational Illness or Extent of Damage findings, the board should also: (1) Report those factors that contributed to the severity or injury or extent of damage; (2) Summarize personnel injuries attributable to the defects in support equipment, PPE or crashworthiness design as findings in this category; (3) Address injuries sustained from failure to provide equipment; for example, seatbelts; (4) Separate the findings and recommendations in this category from those that caused the accident and precede them with the following statement: "THE FINDING(S) LISTED BELOW DID NOT DIRECTLY CONTRIBUTE TO THIS ACCIDENT; HOWEVER, IT/THEY DID CONTRIBUTE TO THE (SEVERITY OF INJURIES) OR (ACCIDENT DAMAGE)."
- i. Present but Not Contributing findings are those that did not cause or contribute to the accident or to the severity of injuries: (1) The board should report errors, materiel failures, or other hazards that did not contribute to the accident, but have a high potential for causing other accidents or adversely affecting the safety of personnel and equipment if not corrected. Reporting these deficiencies will ensure they receive command attention throughout the chain of command to include DA-level action; (2) The findings and recommendations in this category will be separated from those that caused the accident or those that did not cause the accident but contributed to the severity of injuries, and will be preceded by the following statement: "THE FINDING(S) LISTED BELOW DID NOT CONTRIBUTE TO THIS ACCIDENT; HOWEVER, IF LEFT UNCORRECTED, IT/THEY COULD HAVE AN ADVERSE EFFECT ON THE SAFETY OF FUTURE OPERATIONS."
- 2. Recommendations. Each finding will be followed by recommendations having the best potential for correcting or eliminating the reasons (system inadequacy(ies)) for the error, materiel failure, or environmental factor that contributed to the accident and for each Present but not Contributing finding that might have an adverse effect on the safety of future operations. Recommendations will not focus on punitive steps addressing an individual's failure in a particular case. To be effective at preventing accidents in the future, recommendations must be stated in broader terms. Refer to the list of remedial measures in Appendix B. The board should not allow the recommendation to be overly influenced by existing budgetary, material, or personnel restrictions. In developing the recommendations, the board should view each recommendation in terms of its potential effectiveness. For example, design improvement of a part that has a history of recurring failure is a better solution than recommending procedures to accommodate the deficiency. Each recommendation will be directed at the unit, command, or activity having proponency for and which is best capable of implementing the actions contained in the recommendation. The actions required at unit level (company, troop, battalion), higher level (brigade, division, corps, Army Headquarters), and DA (to include Army Headquarters with Army-level proponency) levels of command will be addressed by each recommendation. If one or more of these three command levels had no action requirement, a negative report is required. For example, "DA Level Action: None," "Unit Level," "Higher Level," and "DA Level" of action, as used in this context, respectively refer to the unit deemed most responsible for the accident (the unit's chain of command, up to and including Army Headquarters, and DA-level activities.) In cases where an Army Headquarters is the highest level proponent for a recommended action having Army-wide application, the Army Headquarters will be listed in the "DA Level" category.
- (2) *Block* 2. Enter a coded summary of the present and contributing findings and recommendations to include duty, role, phase of operation, mistake/errors, ATM tasks, system inadequacy(ies). Blocks 2a, 2b, and 2c pertain to personnel error, block 2d pertains to materiel failure or malfunction, and block 2e pertains to environmental effects or influence. All entries in block 2 will be consistent with and supported by the present and contributing findings reported in block 1 or the continuation sheet.
- (a) Block 2a(1), Duty. Enter the code for the individual's duty position at the time the mistake/error was made. Refer to table 3-5 for codes to be used.
  - (b) Block 2a(2), Role. Check "D" for definite or "S" for suspected to indicate the contributing role of this individual.
- (c) Block 2a(3), Phase of Operation. Enter the code for the phase of operation that was in progress at the time the mistake/error occurred (may be different from emergency or accident phase of operation). Refer to table 3–4 for codes to be used.
- (d) Block 2a(4), Aircrew Training Manual Task No. Enter the ATM task number being performed at the time the mistake/error was made. Enter "NA" if no ATM task applies.
- (e) Block 2a(5), Mistake/Error. In the space provided, enter the code of the mistake/error that best categorizes the error made by this individual. Enter only one code.

Note. An abbreviated list of codes and associated mistake/errors, system inadequacy(ies), corrective measures, materiel failures, and environmental conditions is provided at table 3–7 and/or appendix B, which contains expanded descriptions and examples of the abbreviated codes. Also, prefix corrective codes with "U" for unit, "H" for higher, and "A" for DA to indicate the level of command to which the remedial action is directed.

- (f) System inadequacy(ies). In the spaces provided, enter the numerical codes of the system inadequacy(ies) that caused or permitted the mistake/error to become an accident cause factor. If there are more than three system inadequacy(ies) associated with the first mistake/error, skip the second duty and mistake/error entries and continue to list the additional system inadequacy(ies) spaces. (See table 3–7 and app B).
- (g) Remedial corrective measures/recommendations. In the spaces provided to the right of each system inadequacy(ies), enter the codes for the corrective measures selected to correct that specific system inadequacy. (See table 3–7 and app B).
- (h) Continue entries. Continue the entries in blocks 2a, b, and c until all personnel who made errors contributing to the accident, specified in the present and contributing findings of block 1 above, have been coded. If number of entries exceeds space available, use blocks 2a, b, and c of an additional DA Form 2397–2 to continue entries. For each duty code entered in blocks 2a, b, and c, ensure that a DA Form 2397–8 is completed for each individual.
- (i) Block 2d, Materiel. An entry is required for all materiel failure(s)/malfunction(s) that caused or contributed to the accident as specified in the present and contributing findings of block 1 above. If more than one materiel failure was involved, use block 2d of an additional DA Form 2397–2 to continue entries.
  - (j) Block 2d(1), Role. Check "D" for definite, or "S" for suspected to indicate the material role in the accident.
- (k) Block 2d(2), Phase of Operation. Enter the code for the phase of operation that was in progress at the time of failure/malfunction. Refer to table 3-4 for codes to be used.
- (1) Block 2d(3), Failed part number. Enter the manufacturer's PN. The number should coincide with the PN listed in block 3c of DA Form 2397–7.
- (m) Block 2d(4), Failure code. Enter the code that best describes the material failure category. (See table 3–7 and app B).
- (n) System inadequacy(ies). Enter the codes of the system inadequacy(ies) that caused or permitted the materiel failure/malfunction to become an accident cause factor. If system inadequacy(ies) identifying improper maintenance are selected, such as system inadequacies 13 and 14, and the duty code of the individual(s) can be identified, a resultant finding should be written as a human mistake/error and consider the failure/malfunction as a result of human mistake/error instead of a materiel failure. The mistake/error would then be recorded in block 2a, b, and/or c.
- (o) Remedial corrective measures/recommendations. Enter codes for corrective measures in the spaces located to the right of each system inadequacy(ies).
- (p) Block 2e, Environmental. This block is to summarize causal environmental conditions that had an adverse effect on human or equipment performance as related to the accident. Examples include unpredictable weather phenomena (wind/turbulence) resulting in airframe damage; bird strikes damaging aircraft. For the environment to be considered to have caused or contributed to an accident, it must have been unavoidable or unknown at the time of the accident. If the environment does not meet the criteria, a human mistake/error of failure to compensate for known or suspected conditions must be considered. If more than one environmental factor was involved, use block 2e of an additional DA Form 2397–2 to continue entries.
  - (q) Block 2e(1), Role. Check "D" for definite, or "S" suspected to indicate the environmental role in the accident.
- (r) Block 2e(2), Phase of Operation. Enter the code for the phase of operation that was in progress at the time the environmental factor caused or contributed to the accident.
  - (s) Block 2e(3), Condition code. Enter the code for the environmental factor. (See table 3–7 and app B).
- (t) System inadequacy(ies). Enter the code of the system inadequacy that caused or permitted the environmental factor to become an accident cause.
- (u) Remedial corrective measures. Enter corrective measure codes in the spaces located to the right of each system inadequacy(ies).
  - (3) Block 3. Enter the case number as shown on the DA Form 2397-1 (see table 3-6).

#### 3-25. Completion instructions for DA Form 2397-3, Part IV, Narrative

## TECHNICAL REPORT OF U.S. ARMY AIRCRAFT ACCIDENT PART IV - NARRATIVE

For use of this form, see DA Pamphlet 385-40; the proponent agency is OCSA.

REQUIREMENTS CONTROL SYMBOL CSOCS-309

APD PE v1.00

1. NARRATIVE ACCOUNT OF INVESTIGATION (Use format shown in DA Pamphlet 385-40.)
I. History of Flight.

a. Preflight Phase. The mission was a night reconnaissance mission. The mission involved area reconnaissance, route reconnaissance, heavy lift aircraft escort, and enemy troop and ground target engagements. The 17th Cavalry Division tasked the 3rd Aviation Brigade who then tasked Task Force Arrow with the mission. The mission was considered a standard combat mission and was authorized by the 3rd Aviation Brigade commander. The mission had been scheduled on the squadron flight log 3 weeks prior to its execution. There was no undue sense of urgency to complete the mission and no unexpected delays in the mission.

The accident aircraft was an OH-58D(R), serial number 00-10031. It was one of eight OH-58D(R)s assigned to C Troop, 1-3 Cavalry Regiment, 3rd Aviation Brigade, 17th Cavalry Division, Camp Coin, Iraq. C Troop was one of two scout troops assigned to the 3rd Aviation Brigade.

For the night mission conducted on 26 June 2007, the crew of chalk 1, OH-58D(R) 00-10031, was CW2 Joe Toms, the pilot-in-command (PC) in the right seat, and CPT Ronald L. Smith. the pilot (PI) in the left seat. (Describe the second crew in a similar manner.)

On 26 June 2007, the two aircrews' duty day began at 1500, when they arrived at C Troop Operations. At approximately 1600, CPT Simmons, who was also the brigade battle captain, briefed both crews and gave the crews their flight packets for the night's mission. The flight packets included the weather briefing, the flight profile, and the supported unit's contact information.

The weather was updated at 1900, at which time visibility in some areas was forecasted to be 1 to 3 miles with fog. The battle captain was authorized to brief and approve low- and medium-risk missions. The PC calculated the risk-assessment worksheet for a medium-risk mission. At approximately 1800, the aircrews preflighted the aircraft. At approximately 1900 chalk 2, with the air mission commander (AMC) on board, called the tactical operations center (TOC) and opened the flight log.

b. Flight Phase. At approximately 1900, both aircraft departed Camp Coin and proceeded to their assigned area of operations. At approximately 1920, the AMC in chalk 2 received a fragmentary order (FRAGO) from the brigade TOC stating that they were to escort a convoy moving through an area of suspected enemy activity. The AMC made contact with the ground unit, and the two aircraft turned south and then west, linking up with ground unit and providing over-watch aerial cover.

At approximately 2120, the aircraft were flying along a two-lane hard-surface road bordered on both sides by low-lying open fields. There was a 30 foot-high set of electrical wires running parallel to the north side of the road. A set of high tension power lines stretched across the road between two stanchions 125 feet above ground level (AGL). The crew of chalk 2 saw chalk 1, which was flying at approximately 270 degrees, hit a set of high-tension power lines that crossed the road. Chalk 1 struck the second of two ridge wires at approximately 95 feet AGL midway between the two stanchions. The wires were 1/2 inch in diameter and were part of the high-tension power lines. The aircraft then descended vertically and impacted the ground.

e. Post-flight Phase. At approximately 2121, the AMC. in chalk 2, made a Mayday radio call to Flight Following and then called the brigade TOC to notify them of the accident. The PC of chalk 2 made a radio call to the ground unit to advise them of the situation. The PC then landed chalk 2 approximately 300 meters from the accident aircraft in an open field. As the PI of chalk 2 was getting out of the aircraft, the AMC contacted the MEDEVAC aircraft and also monitored the TOC radio frequency. The PC ran to the left side of the accident aircraft to check the crew's condition. The convoy that the accident aircraft had been supporting stayed with the aircraft until rescue personnel arrived. The accident crew was removed from the aircraft wreckage and transported to the closest available hospital. The remains of the aircraft were transported to Camp Coin that night.

(See continuation sheet)

**DA FORM 2397-3, FEB 2009** 

L			
2. CASE NO.	a. Date (YYYYMMDD)	b. Time	c. Acft Serial No.
	20070626	2121	0010031

Figure 3-5. Example of a completed DA Form 2397-3, Part IV, Narrative

PREVIOUS EDITION IS OBSOLETE

	onnel Background Information, block 1 (cont'd). 2 Toms received the Army Achievement Medal (AAM) (3), National Defense Service Medal, Global War
	sm Expeditionary Medal, Global War on Terrorism Service Medal, and the Army Service Ribbon. CW2
Toms had	a total of flight hours, of which were in the OH- 58D(R). He had hours with NVGs and
	ombat time.
completed only duty he	Smith entered the Army in He graduated the U.S. Army IERW Course on He then the OH-58D AQC on He was promoted to CPT on 16 December 2001. CPT Smith's first and assignment was to where he served as the CPT Smith completed Course and A review of CPT Smith's personnel file and IFRF revealed no errors. His IATF
	date and revealed very few administrative errors. All DA Form 7122-R write-ups for progressions and
	s were very positive and
	ighly on CW2 Jones's flying ability and maturity. There were no unsatisfactory evaluations. His APART
	d due to being deployed to Iraq. CPT Smith received numerous awards, to include the CPT Smith
	of flight hours, of which were in the OH- 58D(R). He had NVG hours and
	ombat time. onnel Management.
	2 Toms was assigned to on He was designated as a unit PC on His primary duty
was progression Readiness	CW2 Toms' DA Form 7122-R, Crew Member Training Record, indicated that he had completed RL 1 n training in the OH-58D(R) on and was current and qualified as a Flight Activity Category 1, Level 1 aviator for day, night, and NVG operations. CW2 Toms' peers and chain of command regarded
	a very competent and professional officer. His subordinates also spoke very highly of him and said he
	I leader. A review of CW2 Toms' medical records indicated that he had no waivers or medical es. He was not taking any prescribed medications. He was physically qualified to perform his assigned
	dicated by his flight physical examination completed in March 2004. Interviews with other members of
	licate that he complied with the unit's crew endurance policy. He had no reported social, family, or
	roblems. CW2 Toms received fatal injuries in the accident. The cause of death was determined to be
	unt force injuries. Toxicology results are pending.
-	ude similar information for all crewmembers and other personnel involved in the accident.)
	aft Suitability. The OH-58D(R) was designated to perform reconnaissance and security missions in
upport o	coalition forces. The accident aircraft, serial number 00-10013, was properly prepared for the mission.
	ent performance planning completed by the Board indicated that the helicopter's maximum gross weight
	tude, weather, and aircraft performance conditions present at the time of the accident was 5,200 pounds.
	ent weight and balance calculations indicated that the accident aircraft was within allowable gross weight
	requirements for the assigned mission.
	munications/Air Traffic Services. Air traffic services functioned as designed.
	prological Information. Weather observation was recorded by the U.S. Air Force, at Camp Coin, Iraq. The
	eather was ational Aids. The investigation revealed not a factor.
	nd Support Services. The investigation revealed not a factor.
h. Cras	Survival. This accident was partially survivable. After hitting a single ridge wire on a set of high-tension
	s, the aircraft fell and .
	gency Egress, Survival, and Rescue. This accident was partially survivable. The PI was able to extricate
imself b	fore rescuers arrived.
j. Spec	al Investigation. None conducted.
k. Witr	ess Investigation. The Board interviewed 10 witnesses, including the crew of chalk 2. Summaries of six
	are at Tab E.
	riel Factors Investigation.
	aft Airworthiness. The accident aircraft was an OH-58D(R), serial number 00-10013, assigned At
ircraft w	The accident, the aircraft had total flight hours. A review of the historical records indicated that the sairworthy. DA Form 365-4 in the weight and balance records and DA Form 365, Chart C, indicate that
	was within CG and did not exceed maximum gross weight. All applicable modification work orders were
	d the unit complied with all safety-of-flight messages.

Figure 3-5. Example of a completed DA Form 2397-3, Part IV, Narrative—continued

(2) The preflight inspection was completed with no discrepancies noted. There were no reported in-flight problems or unusual noises. b. Digital Source Collector. The aircraft was equipped with a data transfer module (DTM), but it was not recovered due to the post-crash fire. c. Airframe. (1) Fuselage Structure. The aircraft fuselage sustained extensive damage due to contact with a ridge wire located approximately 90 feet above the ground. (Add as much information as necessary to describe the damage to the structure.) (2) Cockpit. The post-crash fire mostly consumed and destroyed the cockpit structure. (3) Tail boom. The tail boom was broken off during the accident. (4) Landing Gear. d. Systems. (1) Flight Controls. All visible aircraft flight controls had nuts and cotter pins securing them. All accessible broken tubes, bell cranks, and supports were examined at the breaks; all had failed from overstress mechanisms. (Add as much information as necessary.) (2) Armament systems. The aircraft had seven-shot rocket pods mounted on both the left and right armament (3) Night Vision Systems (NVS). No NVS anomalies were reported during the mission or prior to takeoff. Both pilots were wearing Night Vision Goggles (NVGs) that had been checked at the Aviation Life Support Equipment (ALSE) Shop. Both sets of NVGs had been working properly. (4) Fuel Systems. The crashworthy fuel cells (5) Warning System. No warning system anomalies were reported to the ground crew prior to flight. No warning systems were reported to the other aircraft (chalk 2) during the flight. (6) Hydraulic System. The hydraulic reservoir was . The mount for the three flight control servos was . All control hardware on the servos was secured with the proper safeties. (7) Electrical System. The crew reported no anomalies with the electrical system prior to the accident. (8) Stability and Augmentation System (SAS). The crew reported no anomalies with the aircraft SAS prior to the accident. e. Power plant. The engine was torn from the airframe during the accident. The engine separated f. Rotor Systems. One main rotor blade separated at the main rotor hub yoke. The yoke was broken off, and g. Transmissions/Gearboxes and Drive Train. (1) Main Rotor Drive/Transmission. The transmission was intact and (2) Tail Rotor Drive/Gearboxes. The tail rotor gearbox was not damaged. The gearbox rotated freely by hand. h. Laboratory Analysis. Fluid samples were taken and sent to the local laboratory for analysis. Results still i. Crash Site Information. The accident occurred at grid coordinates . The terrain along the road and . The stanchions are located approximately meters apart. i. Fire. There was a small fire that extinguished itself shortly after ground impact. k. Emergency Locator Transmitter (ELT). None installed. 4. Analysis. After analyzing the human, materiel, command, and environmental data collected during the investigation, the Accident Investigation Board concluded human error caused this accident. Rationale for this conclusion is as follows: a. Accident Sequence. The Board reconstructed the accident sequence using numerous witness statements, interviews, photographs, video, and the accident site. The accident sequence determine by the board is described below. (Start the accident sequence with the mission planning through the entire accident sequence, including the board's determination of what happened and why). b. Environmental Factors. Environmental factors were evaluated and determined no environmental condition was causal in this accident. (1) Meteorological conditions: The conditions at the time of the accident were . The lunar illumination (2) Non-meteorological: The wires had been erected years prior to the accident. While the darkness made the wires the crew struck less visible, the Board determined the crew had marked the wires on their maps and knew the wires were there. The support stanchions were clearly visible under NVGs.

Figure 3-5. Example of a completed DA Form 2397-3, Part IV, Narrative—continued

- c. Materiel Factors. The Board evaluated materiel issues and determined there were no materiel issues in this accident. Based on witness interviews, photo analysis of the accident site, and inspection of the aircraft components, the Board determined that the aircraft was operating within normal parameters prior to the accident sequence.
- (1) The Board downloaded the DTM data and determined that all engine indications were normal at the time of the accident.
- (2) The Board recovered both sets of AN-AVS-6(V3) NVGs used by the crew. One set was badly damaged and one set was fully functioning. The Board carefully examined the surviving set of NVGs and determined that they were functioning normally. The Board sent the parts of the other set of NVGs to the Night Vision Laboratory for evaluation. Results are pending.
- d. Human Factors. The Board evaluated all human factors and determined that human error caused this accident. This conclusion was the result of a review of the environmental conditions existing on the night of the accident, the maintenance history of the aircraft, numerous witness interviews, and the personal and professional background of both pilots. Additionally, the Board considered the statements of the two crewmembers in chalk 2 who witnessed the accident.
- (1) Support. The Board evaluated support issues as listed in Table B-5 and determined none contributed to this accident. The accident unit is properly resourced to accomplish their mission. The accident aircraft was properly maintained.
- (2) Standards. The Board evaluated standards and determined there were no short comings in this area. The unit SOP addressed all areas associated with the accident mission. Installation and Army-level guidance was also considered adequate. The operator's manual was also considered adequate. The Board assessed the theater aviator procedures guide and concluded that the wire avoidance procedures listed there were adequate. The Board concluded that had the crew complied with those procedures, the accident would have been avoided.
- (3) Training. The Board evaluated training issues and determined none applied in this accident. The Board evaluated all of the unit-level training and determined the training is being conducted in accordance with Army regulations and training circulars. The accident crew had received all appropriate training for conducting this mission. The crew was also well experienced in the mission and was familiar with the area of operations.
- (4) Command/Leader. The Board evaluated leader issues and determined none contributed to this accident. The unit is conducting Risk Management in accordance with DA policy. Through witness interviews and document review, the Board determined the appropriate unit leaders reviewed all mission planning documents; risk assessment worksheets were properly completed; the mission was approved and briefed at the appropriate level; and the crew selection fit the mission.
- (5) Individual. The Board evaluated individual failure issues and determined the flight crew did not properly coordinate their actions because of excitement and over confidence in each other's abilities. Through interviews with the surviving PI, the Board determined that both crewmembers were fixated on the threat and were aggressively forcing the attack. The Board concluded that had this flight crew conducted crew coordination as indicated in the aircrew training manual, there would have been more division of attention and the crew would not have descended below the published altitude floor.

Figure 3-5. Example of a completed DA Form 2397-3, Part IV, Narrative—continued

- a. Also see paragraph 3-6.
- b. Completion instructions. Block 1. Narrative account of investigation. The board will report, in narrative form, the facts, conditions, and circumstances as established during the investigation and present this information in four sections (history of flight, human factors, materiel factors, and analysis). The first three sections will contain factual data. The analysis section is reserved for the board's documentation of its conclusions/opinions concerning the accident cause relationships. Chapter 2, paragraph 2–8, explains procedures for development of formal written analysis. Additional subheadings may be added as deemed necessary. It is important that the narrative address all of the chronological events and evidence that had a bearing on the cause of the accident and/or have the potential for adversely affecting safety of future operations. For accidents in which the investigation board determines that human error, materiel failure/malfunction or environmental conditions were a factor, that portion of the narrative will be completed in its entirety, as specified in the instructions below. The history of flight, personnel background, personnel management, meteorological, airworthiness, laboratory analysis, and analysis portions will be completed for all accidents. For the remaining subheadings which the investigation board determines were not a factor, enter after the subheading "Investigation revealed not a factor" and proceed to the next subheading. Opinions concerning the accident cause relationship of

evidence cited throughout the narrative will be discussed only in the analysis section. Use letter- size paper for continuation sheets as required.

- (1) History of the flight.
- (a) Preflight phase. Report type of mission involved, its purpose, how the unit became tasked with the mission and who or what activity authorized it. Identify the crewmembers selected for the mission by duty assigned and crewmember station, and indicate when and how they were informed of the mission. Describe the actions of the crewmembers in preparing for the mission to include preflight planning, weight and balance determinations, briefings, filing flight plan, inspecting aircraft, etc. Describe facts which may indicate whether or not a sense of urgency was associated with the mission and if there were any delays prior to flight departure.
- (b) Flight phase. Indicate when the aircraft departed on the mission. If the mission involved more than one routine flight segment and there were interim ground stops before the accident occurred, concisely summarize these events until addressing the flight segment involving the accident. If the flight segment involving the accident contained an in–flight emergency, give a detailed description of the onset of the emergency to include where and when it occurred, symptoms, warnings, instrument readings, etc. Also, describe actions/reactions of aircraft and crewmembers between the time of the emergency and when the aircraft came to final rest at the conclusion of flight.
- (c) Post flight phase. Briefly describe condition of aircraft, to include whether or not engine(s) was still operating, and condition of occupants immediately after the accident. Reserve details of injuries, impact conditions, kinematics, and crash forces for the crashworthiness part of the narrative. Reserve details of damage to various aircraft components for the materiel factors part of the narrative. If a post crash fire occurred, so indicate and explain how and when it was extinguished, if applicable. Briefly summarize egress of occupants from aircraft, survival, and rescue; reserve details for the part of the narrative devoted to egress, survival, and rescue.
- (2) *Human factors*. For accidents resulting from causes other than human factors, the human factors part of the narrative may be sharply reduced by making a statement like "none" for the subheadings except for subheadings addressing personnel background information, personnel management, and meteorological conditions.
- (a) Personnel background information. This part of the narrative is extremely important in terms of providing a complete and informative profile of the principal persons involved. It should be a joint effort of reporting on the part of the instructor pilot/standardization pilot (IP/SP) and flight surgeon members of the board. The sources of information will include, but are not limited to, personnel, flight and training records, friends, peers, subordinates, superiors, and the persons themselves. Background information should primarily address the experience and qualifications of the individual upon arrival at the unit to which assigned at the time of the accident. For each crewmember who had a contributing role in the accident, briefly summarize service background to include date of service entry, initial flight training, type of assignments, and aviation qualifications acquired prior to joining current unit. Report crewmembers' background to include evidence of flight safety violations, flight evaluation boards, and history of prior aviation accident involvement. If the latter applies, explain role in the prior accident. Describe experience in mission aircraft relative to how initially qualified, total flight time to date, and amount of flight time in past 3 months. The same scope of information is usually not necessary for non-rated crewmembers and/or passengers. If it is suspected or known that a non-rated crewmember or passenger was at the controls, or was functioning as an aerial observer, or in another possible cause-related role, summarize background and qualifications. This part of the narrative should also address the background and qualifications of personnel not aboard the aircraft if they played a part in causing the accident. It can involve commanders, operations personnel, ATC and weather personnel, maintenance personnel, and others if applicable.
  - (b) Personnel management.
- 1. Individual. Personnel management should primarily address how the individual was managed by the unit to which assigned at the time of the accident. Review how the unit has managed each individual involved. Begin with the date of assignment to current unit and report how the individual was tasked, trained, and otherwise managed up to the date of accident. Describe aviation qualifications and readiness to perform the mission. Indicate whether or not each aviator was qualified and current in the MTDS aircraft assigned to the mission. Explain irregularities in the individual's training folder.
- 2. Discuss additional duties and the percentage of time given them versus their primary duty. Report qualifications acquired since assignment to unit such as checkouts in additional aircraft, appointments as IP, SP, PC, Instrument Examiner (IE), Unit Trainer (UT), and so forth. Review the procedures involved in selecting the crew for the mission. Describe timeliness of notification, compatibility of crew with mission, and the relative flight experience of the pilots if more than one was assigned to the mission. Describe aviator crewmembers in terms of their professional reputations in unit, opinions of peers, subordinates, and others who have flown with them, and so forth. Describe crewmembers' sleep and dietary habits and use of alcohol and nicotine. Review unit crew rest policy. Report whether or not a crew rest policy was in effect, being monitored and complied with. If post-accident flight evaluations were administered, summarize results. Highlight weaknesses in proficiency if appropriate, especially the performance of tasks duplicating those involved in the accident.
- 3. Report whether or not aviator crewmembers were physically qualified to perform mission. Discuss currency of flight physical. Explain waivers and other irregularities in medical history that may be relevant. Review results of the

post accident blood and urine specimen analyses and describe irregularities. If none, so state. If an aviator crewmember was receiving medication before the accident, report type, source, dosage, side effects, and possible effect on performance. Summarize the findings of the post-accident medical examination. If an aviator crewmember sustained injuries, give a brief description of the injuries and how they occurred. If an aviator crewmember sustained fatal injuries, briefly summarize autopsy report to include cause of death.

- 4. Aircraft suitability. Describe suitability of the accident aircraft to perform the mission. Consider flight and navigation instrumentation in light of prevailing weather conditions, fuel consumption in relation to range, power available in relation to planned gross weight and density altitude, aircraft design limitations as found in applicable operators manual, configurations, and so forth.
- 5. Communications/air traffic services. Describe evidence relating to communications equipment (adequacy of visual and electronic signals, and so forth.) and the communication that occurred or failed to occur among the crew, between crew and passengers, and between crew and outside services; for example, ATC, operations, flight service station (FSS), command and control, pathfinders, etc. Consider language difficulties, clarity of spoken words, adequacy and precision of instruction, etc. Summarize tape recordings of communications between crewmembers and ground stations, if applicable.
- 6. Navigation aids. Describe adequacy of navigation aids (very high frequency omni-directional range (VOR), non-directional beacon (NDB), instrument landing system (ILS), and so forth.) Consider Federal Aviation Administration (FAA) or other agency publications, Notices to Airmen, pilot reports, and so forth.
- 7. Meteorological information. Describe weather conditions that prevailed throughout the mission and conditions that existed at the accident site at the time of the accident. Include sky condition, visibility, winds, icing, turbulence, and any significant weather conditions. Consider weather observations made by trained weather observers and/or witnesses in the area.
- 8. Ground support services. Describe evidence that relates to the role of ground support services in the accident. Consider POL personnel, ground guides, fire guards, and so forth.
- 9. Crash survival. Report results of crash survival investigation. Discuss crashworthiness of the aircraft in terms of crash sequence, impact conditions, kinematics, and crash impact forces. Include the performance of the restraint systems and the adequacy of the aircraft structure to maintain occupiable space and attenuate crash forces. Explain occupant injury relationship to crashworthiness. Explain if injuries occurred during or after the crash sequence. Also include the performance of PPE; for example, helmet, visor, clothing, survival vest components, and so forth.
- 10. Emergency egress (including ejection or bailout), survival, and rescue. Discuss details of egress, survival, and rescue investigations. Describe where individuals were located in aircraft, how and where they exited aircraft, difficulties encountered, and position of aircraft at time of egress. Describe factors that may have enhanced or inhibited the success of the survival/rescue situation. Report when and how rescue personnel were notified and how long it took rescue personnel to respond to the initial notification, arrive at accident site, and evacuate the survivors. Explain problems associated with delays in rescue.
- 11. Special investigation. Report results of any special investigations that were conducted because of the accident. If, for example, during the investigation, it is found that helmet mounted display or night vision systems were a factor in the accident, the applicable agency/program manager should be notified and a determination made as to their involvement.
- 12. Witness investigation. Briefly indicate number of witnesses interviewed and identify duty position. Summarize pertinent witness observations and indicate whether or not witnesses generally agreed concerning accident events. Describe major conflicts in the provided information. Resolution of inconsistencies in the information should be discussed in the analysis portion of the report. Opinions regarding witness credibility should also be reserved for the analysis section.
- (3) Materiel factors. Report results of materiel factors investigation in the appropriate subparagraphs. Those accidents that do not involve materiel failure/malfunctions may be abbreviated to include negative reports, if applicable, for all subheadings except aircraft airworthiness and laboratory analysis. Identify and discuss damage resulting from precrash materiel failures/malfunctions and omit damage that resulted from crash forces exceeding design limits. References can be made to the wreckage distribution diagram, photographs, reports, records, and so forth. Include the following areas:
- (a) Aircraft airworthiness. Describe the airworthiness of the aircraft. Investigation should include, but not be limited to, maintenance records, historical records, interviews with maintenance personnel, weight and balance records, conduct of preflight, etc. Identify all deficiencies/discrepancies that had a role in the accident. Discuss those technical publications not complied with or inadequate in any manner.
- (b) Digital source collectors. Report information obtained from digital source collectors, if applicable. The board's analysis of this data, however, should be included in the analysis portion of the report.
- (c) Airframe. Use subparagraphs to report evidence obtained in the examination of the airframe structure and landing gear components.
  - (d) Systems. Use subparagraphs to report evidence obtained in the examination of fuel, warning, flight control,

hydraulic, electrical, stability augmentation/autopilot, and other aircraft systems. Note all discrepancies and their effects on the operation of the aircraft.

- (e) Power plant. Report the evidence obtained during examination of the engine(s). Include indications of power at impact. List all discrepancies noted and their effect on engine operation.
- (f) Rotor systems or propellers. Report the evidence obtained during the examination of rotor systems or propellers. Describe any faults noted and their condition as a result of strikes/impact.
  - (g) Transmissions/gearboxes and drive train. Report condition and describe any faults noted and cause, if known.
- (h) Laboratory analysis. Report the results of aircraft fluids, components, and parts submitted for laboratory analysis.
- (i) Crash site information. Describe adequacy of the crash site/airfield (heliport, helipad, pick-up zone (PZ), landing zone LZ), and so forth), to include dimensions, lighting and marking, obstructions, type and condition of surface, slopes, and so forth.
- (j) Fire. Discuss the role of fire to include when it occurred, manner in which the fire was detected, ignition source, combustible material, location, propagation, and degree of success in extinguishing.
  - (k) Analysis.
- 1. The analysis paragraph should summarize the first three paragraphs of the narrative, to include the opinions and conclusions of the board, and must conclusively show the cause and effect relationship of the evidence gathered during the accident investigation. The analysis should also discuss those potential factors considered but not supported or determined not to be factors by investigation board. The analysis discusses the influence of command activity or lack thereof in the occurrence or potential prevention of accidents. Subparagraph headings in the analysis may coincide with pertinent subparagraphs in the first three sections of the narrative, with the exception of command influence, which is reserved for the analysis paragraph only. As a minimum, the analysis part of the narrative will provide the following information:
- a. Identify the human errors, materiel failures, or environmental factors involved in the accident in the context of the accident sequence of events. The explanations, examples, and key words are contained in Appendix B.
  - b. Discuss the results/effects of the errors/materiel failures/environmental factors.
- c. Identify the system inadequacy(ies) that caused or permitted the errors/materiel failures/environmental factors or injuries to occur. The definitions, examples, and key words are contained in Appendix B.
  - d. Report preventable injuries in the context of crash survivability/ egress/rescue, and explain how they occurred.
  - e. Discuss the command influence in the accident sequence of events, or the prevention of potential accidents.
- 2. To fulfill these information requirements, the board should review all the evidence relating to the accident disclosed during the human, environment and materiel factors investigations. This may require readdressing specific paragraphs contained in the narrative and indicating the relationships between the facts disclosed and the errors/failures/environmental factors that occurred. From this review, the board should consider a logical development of the various circumstances and events that may have existed. This process of deductive reasoning should lead to the formulation of an explanation (or explanations) concerning what caused the accident and preventable injuries, if they occurred, and why they happened. The explanation(s) should be discussed and tested against the evidence gathered during the investigation. If it is necessary to develop hypotheses, it is important for the board to state why a particular hypothesis was or was not supported by the evidence.
- 3. To initially outline and structure the correlation of cause-related errors/materiel failures/environmental factors and associated system inadequacy(ies), the board will find it useful to review the definitions and examples of mistakes/errors, system inadequacy(ies), and corrective measures at Appendix B, before composing the narrative part of the analysis. When the outline has been completed, the narrative rationale and conclusions should be composed using the following examples as a guide:
- a. Begin the paragraph by specifying the scope and conclusions of the investigation. In all cases, begin the paragraph with these words: "After analyzing the human, materiel, and environmental data collected during the investigation, the board concluded the accident was caused by..." Complete the sentence by specifying the factor(s) (human, materiel, or environment) which caused the accident; for example, "...human error-leader failure."
- b. Describe when or where the error/failure/injury/environmental factor occurred in the context of the accident chronology of events; for example, "before the mission," "during takeoff," "during a nap of the earth (NOE) deceleration," "while installing a hydraulic line," "during the in-flight ejection," "during the crash sequence," and so forth.
- c. Identify the duty position of the person who erred, became injured, or the name and PN or the NSN of the part, component or system that failed; for example, "the pilot"; "the mechanic"; "the fuel control, NSN 2915-00-157-2313"; "the input bevel gear, PN 2040405009;"and so forth.
- d. Identify the error in the context of a listed mistake/error category; for example, "incorrectly diagnosed the emergency at hand," "failed to assign responsibilities," failed to detect," and so forth. If a materiel failure is being reported, explain the type of failure; for example, "overheated," "vibrated, "frayed," "decayed," and so forth. If an injury/occupational illness is being reported, explain if the individual "struck" or "was struck by" the injury-causing agent. See Appendix B for explanations.

- e. Cite the directive or standard the mistake/error category failed to comply with; for example, "contrary to standard and description for task 1411, TC 1–251;" and so forth. In the absence of written guidance/standards for a mistake/error, evaluate the task in terms of how other equally qualified and prudent personnel would perform the same task under similar circumstances. If the error represents performance that is unacceptable, it is contrary to common practice.
- f. Describe the specifics of the error; for example, "He failed to initially increase collective to maintain the altitude of the tail rotor"; "He excessively torqued the nut, PN 12345," and so forth.
- g. Describe the consequences of the error, materiel failure, environmental factor, or the resulting injury/occupational illness; for example, "As a result, when he applied aft cyclic to slow to a full stop, the tail rotor struck the ground, damaging the tail rotor blades and causing a loss of anti-torque control"; "As a result, the aircraft landed hard"; "As a result, the pilot sustained a compression fracture of the T12–L1 vertebrae," and so forth.
- h. A complete error statement could read as follows: "During an NOE deceleration, the pilot improperly responded to the emergency as described for standard, task No. 1411, TC 1–251. That is, he failed to initially increase collective to maintain sufficient altitude for tail rotor clearance of the terrain. As a result, when he applied aft cyclic to slow to a full stop, the tail rotor struck the ground damaging the tail rotor blades and causing a loss of effective antitorque control."
- *i.* A complete materiel failure statement could read as follows: "During cruise flight, a section of the input bevel gear, PN 2040405009, eroded through. As a result, the continuity of the tail rotor drive system was interrupted, causing a loss of effective anti-torque control."
- 4. Each statement of error, materiel failure, environmental factor or injury/occupational illness will be followed by statements identifying the system inadequacy(ies) that caused or permitted the error/failure/injury or occupational illness to occur or an environmental factor to become a cause. The system inadequacy(ies) statements are the most important part of the analysis. The system inadequacy(ies) causing or permitting an error, failure, or injury/occupational illness to occur or an environmental factor to become a cause are more important from a remedial standpoint than the error, failure, injury/occupational illness, or environmental factor itself. Each system inadequacy(ies) statement will contain the following information:
- a. A transition phrase to tie the system inadequacy(ies) to the error/failure/injury or occupational illness; for example, "The pilot improperly responded to the emergency because..."; "The bevel gear eroded to a point of failure because..."; "The pilot sustained the back injury because...," and so forth.
- b. Identification of the system inadequacy(ies) category(ies); for example, "...because of inadequate motivation/mood (attitude)," "...inadequate supervision by the unit operations officer," "...because of inadequate quality control on the part of the manufacturer," "...because of inadequate seat design," and so forth.
- c. An explanation of how or why each system inadequacy(ies) caused or permitted the error/failure/injury/environmental factor: For example, "During the pilot's last standardization flight evaluation, the IP told the pilot he did not perform the NOE deceleration properly and needed additional dual instruction. Regardless, the pilot chose to practice the maneuver by himself before he was given additional training. The IP contributed to the error because he graded substandard performance of the maneuver satisfactory during the standardization flight evaluation and he did not follow up the additional training. The unit operations officer contributed to the error because, after the IP recommended the additional training, he scheduled the pilot for a tactical training mission before ensuring the pilot had received the additional training"; "The manufacturer's quality control procedures failed to detect a machining defect on the surface of the gear that became the source of progressive fatigue mechanisms," and so forth.
- 5. Once the preceding elements of information are reported for each error, failure, injury/occupational illness, or environmental factor in the manner stated, the resulting conclusions (findings) can stand on their own. The example of human error used in these instructions ties three system inadequacy(ies) to the error. There would be more or less system inadequacy(ies) depending upon the circumstances. The point to be made is that system inadequacy(ies) causing or permitting an error, failure, or environmental cause must be made visible before effective corrective actions can be recommended.
- 6. The analysis part of the narrative does not have to be limited to explaining and concluding what caused or contributed to the accident or injuries. The analysis may also address present but noncontributing hazards if they could adversely affect the safety of aviation operations. There are provisions for reporting non-cause-related hazards. They are contained in the instructions for completing the DA Forms 2397–2.

## 3-26. Completion instructions for DA Form 2397-4, Part V, Summary of Witness Interview

	ECHNICAL REPORT OF U.S. AF PART V - SUMMARY OF WI For use of this form, see DA Pamphlet 385-4	TNESS INTERVIEW		S CONTROL SYMBOL OCS-309
	TNESS (LAST, FIRST, MI)	2. OCCUPATION/TITLE	3. GRADE	4. DATE OF BIRTH
Smith, Rona		Army Aviator/Pilot	03	19800101
	Include ZIP Code) (If military, include organi.	zation)	6. TELEPHONE NUMB	
	alvary, 17th Calvary Division ell, KY 27555		7. DATE OF INTERVIEN	10-1234 W (YYYYMMDD)
EVERNICALICE	AND BACKGROUND	9. LOCATION AT TIME OF ACCIDENT	10. INTERVIEWER (A	0070628
	or 4 years, 700 total flight hours	Left seat of accident aircraft	Horacio Leader, 0	
	of confidentiality.		- de la constantina della cons	And the state of t
	promise of confidentiality offered no, read blk 14b to the witness.)	to the witness? Vyes No (If year	s, read blk 14a to the и	vitness and complete
b. Confid	dentiality was requested by the wit	ness. Ves No (If Yes, intervie	ewer sign and date stat	tement below.)
		THIS STATEMENT UNDER A PROMISE O	1	70.00
		DF MAJOR LEADER 123456789  NATURE OF INTERVIEWER	. 2	70628 YYYMMDD)
12 SIIMMADV	OF INTERVIEW	The state of the s	PAIL (1	
Smith was a approximate CPT Smith h			he was a company c	ommander for
overhead se	ission scheduled for that evening veurity and performing security for	vas to support the 14th Infantry and the airlift support aroud Baghdad Internation	e III Mountain Divisi tional Airport (BIAP)	ion by performing  ). The mission focus
overhead se was on the u Once the flig night need a fragmentary	ission scheduled for that evening security and performing security for apcoming elections and providing security for the security for a security for the securi	vas to support the 14th Infantry and th	te Ill Mountain Divisi tional Airport (BIAP) which were typically re informed via radio Soon afterward, the	ion by performing ). The mission focus school buildings.  that an Iraqi soldier !light received another
overhead se was on the u Once the flig might need a fragmentary they recover The !light m unit, and the unit's depart	ission scheduled for that evening curity and performing security for apcoming elections and providing so that the same security for a providing so that the same security of the same security and capacity of the same security of the same sec	was to support the 14th Infantry and the airlift support aroud Baghdad Internateurity for district election offices.  The Airlield for the mission, they we thereafter that no action was needed, at a unit had been ambushed earlier in then departed for the new mission.  The flight tablished radio contact with the suppote the suppote that it is not the suppote that it is not the suppote that is not that is not the suppote that is not the suppote that is not tha	e Ill Mountain Divisi tronal Airport (BIAP) which were typically re informed via radio Soon afterward, the the day and needed or at then established vis orted unit and began	ion by performing ). The mission focus school buildings.  I that an Iraqi soldier light received another werhead security while sual contact with the coordination of the
overhead se was on the u Once the flig might need a fragmentary they recover The llight munit, and the unit's department department department only 15 mint only	ission scheduled for that evening security and performing security for apcoming elections and providing security for apcoming elections and providing security for approximate the second of the secon	was to support the 14th Infantry and the airlift support aroud Baghdad Internateurity for district election offices.  The Airlield for the mission, they we thereafter that no action was needed, at a unit had been ambushed earlier in then departed for the new mission.  The flight tablished radio contact with the suppote the suppote that it is not the suppote that it is not the suppote that is not that is not the suppote that is not the suppote that is not tha	tional Airport (BIAP) which were typically which were typically re informed via radio Soon afterward, the the day and needed out then established visorted unit and began on time of 2100. CPT of flight to the closest the lead for a departure of the transfer of the closest the closest the transfer of the closest the closes	ion by performing ). The mission focus school buildings.  In that an Iraqi soldier exercised another werhead security while sual contact with the coordination of the T Smith relayed that the trefuel point. With
overhead se was on the u Once the flig might need a fragmentary they recover The !!light munit, and the unit's depart needed addit CPT Smith only 15 minuinformed CP CPT Smith a would preven	ission scheduled for that evening security and performing security for appropriate propriate providing security and performing security for appropriate providing security for appropriate providing security for a providing security for the security of the security of the security for the securit	vas to support the 14th Infantry and the airlift support aroud Baghdad International Properties of the mission, they we thereafter that no action was needed, at a unit had been ambushed earlier in then departed for the new mission. The flight had been hit by the ambush. The flight had been hit by the ambush the suppose of the new mission with the suppose of the properties of the new mission. The flight had been hit by the ambush the suppose of the new mission. The flight had been hit by the ambush the suppose of the new mission because they had to refuel.  The maining, time on station, and route of the new mission because they had to refuel.	e Ill Mountain Divisitional Airport (BIAP) which were typically re informed via radio Soon afterward, the the day and needed out the established visorted unit and began on time of 2100. CP of flight to the closest the lead for a departuear the area.	ion by performing ). The mission focus school buildings.  In that an Iraqi soldier light received another verhead security while sual contact with the coordination of the T Smith relayed that the trefuel point. With the time. Plight lead an and that any longer
overhead se was on the u Once the flig might need a ragmentary hey recover The !light m nit's depart needed addit CPT Smith only 15 min nformed CP CPT Smith a would preven check again The !light de	ission scheduled for that evening security and performing security for appropriate propriate pro	vas to support the 14th Infantry and the airlift support aroud Baghdad International Properties of the mission, they we thereafter that no action was needed, at a unit had been ambushed earlier in then departed for the new mission. The flight had been hit by the ambush. The flight had been hit by the ambush the suppose of the new mission with the suppose of the properties of the new mission. The flight had been hit by the ambush the suppose of the new mission. The flight had been hit by the ambush the suppose of the new mission because they had to refuel.  The maining, time on station, and route of the new mission because they had to refuel.	e Ill Mountain Divisitional Airport (BIAP) which were typically re informed via radio Soon afterward, the state day and needed out then established visorted unit and began on time of 2100. CP of flight to the closest the lead for a departuear the area.	ion by performing ). The mission focus school buildings.  In that an Iraqi soldier light received another verhead security while sual contact with the coordination of the T Smith relayed that the trefuel point. With the time. Plight lead in and that any longer tion and that he would
overhead se was on the u Once the flig might need a fragmentary they recover The !light munit, and the unit's departmeded addit CPT Smith only 15 minu informed CP CPT Smith a would prevenence again The !light dapproximate	ission scheduled for that evening security and performing security for apcoming elections and providing settle that the security for a sessistance. They were told shortly order (FRAGO) informing them the ed a destroyed vehicle. The flight hade radio contact with the unit that it lead aircraft (accident aircraft) escure route. At that time, the flight retional time to accomplish the next mand CW2 Toms discussed the fuel routes of on station lime CPT Smith of Smith that the supported unit nearly secure route that the supported unit nearly security is the security of the security of the supported unit nearly security that the supported unit nearly security of the supported unit for an update eparted the area at approximately 20.	vas to support the 14th Infantry and the airlift support aroud Baghdad Internateurity for district election offices.  Trimy Airt'ield for the mission, they we thereafter that no action was needed, at a unit had been ambushed earlier in then departed for the new mission. The flight tablished radio contact with the suppose of the suppos	e Ill Mountain Divisitional Airport (BIAP) which were typically re informed via radio Soon afterward, the state day and needed out then established visorted unit and began on time of 2100. CP of flight to the closest the lead for a departuear the area.	ion by performing ). The mission focus school buildings.  In that an Iraqi soldier light received another verhead security while sual contact with the coordination of the T Smith relayed that the trefuel point. With the time. Plight lead an and that any longer tion and that he would
overhead se was on the u Once the flig might need a fragmentary they recover The !light munit, and the unit's departmeded addit CPT Smith only 15 minu informed CP CPT Smith a would prevenence again The !light dapproximate	ission scheduled for that evening security and performing security for appropriate propriate pro	vas to support the 14th Infantry and the airlift support aroud Baghdad Internateurity for district election offices.  Trimy Airt'ield for the mission, they we thereafter that no action was needed, at a unit had been ambushed earlier in then departed for the new mission. The flight tablished radio contact with the suppose of the suppos	e Ill Mountain Divisitional Airport (BIAP) which were typically re informed via radio Soon afterward, the state of the day and needed of the day and neede	ion by performing ). The mission focus school buildings.  In that an Iraqi soldier light received another verhead security while sual contact with the coordination of the T Smith relayed that the trefuel point. With the time. Plight lead an and that any longer tion and that he would

Figure 3-6. Example of a completed DA Form 2397-4, Part V, Summary of Witness Interview

#### 14. GENERAL WITNESS INFORMATION BRIEFING (Interviewer must read appropriate instructions to the witness)

#### a. Promise of confidentiality offered.

- (1) This accident investigation board has been convened under the provisions of Army Regulation 385-10 for the purpose of conducting a safety investigation.
- (2) This may be just one of a number of investigations being conducted regarding this accident; collateral or legal investigations may be ongoing as well. Those investigations are entirely separate from a safety investigation and are also required to inform you of their purpose and of your legal rights.
- (3) This safety investigation is being conducted for accident prevention purposes only. Within the military, pursuant to AR 385-10, it cannot be used for any other purpose, to include any future disciplinary actions against any individuals. Therefore, the interview you are being asked to provide will be used by the Army in the interest of safety and accident prevention only.
- (4) Nonconfidential witness interviews may be released to the public pursuant to a Freedom of Information Act request. If you wish to protect your interview from public release outside the military, then your interview must be pursuant to a promise of confidentiality. Confidentiality means that your interview will not be released to the public or outside DOD safety channels.
- (5) Whether your interview is confidential or not, the chain of command will review the final accident report, which may include a summary of your interview, but the chain of command may only use the investigation report and the interviews for safety and accident prevention purposes.
- (6) If you ever have knowledge that your witness interview was used by the Army for anything other than accident prevention purposes (for example, disciplinary action against an individual), you should consult with your local Judge Advocate Defense Counsel Office and request that the Command Judge Advocate, U.S. Army Combat Readiness Center, be notified at DSN 558-2924 or commercial (334) 255-2924.
- (7) The promise of confidentiality is available to you if you desire it. Do you desire

#### b. No promise of confidentiality offered.

- (1) This accident investigation board has been convened under the provisions of AR 385-10 for the purpose of conducting a safety investigation.
- (2) This may be just one of a number of investigations being conducted regarding this accident; collateral or legal investigations may be ongoing as well. Those investigations are entirely separate from a safety investigation and are also required to inform you of their purpose and of your legal rights.
- (3) This safety investigation is being conducted for accident prevention purposes only. Within the military, pursuant to AR 385 -10, it cannot be used for any other purpose, to include any future displainary actions against any individuals. Therefore, the interview you are being asked to provide will be used by the Army in the interest of safety and accident prevention only.
- (4) The chain of command will review the final accident report, which may include a summary of your interview, but the chain of command may only use the investigation report and the interviews for safety and accident prevention purposes. The interview summary may be released to the public pursuant to a Freedom of Information Act request.
- (5) If you ever have knowledge that your witness interview was used by the Army for anything other than accident prevention purposes (for example, disciplinary action against an individual), you should consult with your local Judge Advocate Defense Counsel Office and request that the Command Judge Advocate, U.S. Army Combat Readiness Center, be notified at DSN 558 -2924 or commercial (334) 255-2924.

#### 15. AVAILABILITY OF PROMISE OF CONFIDENTIALITY FOR "LIMITED USE" REPORT OF INVESTIGATION

- a. Pursuant to AR 385-10, witness interviews may only be used within the military for purposes of accident prevention, and may not be used as evidence in connection with any administrative or disciplinary proceeding. This protection alone does not prevent release of the interview outside of the military (to the public, newspapers, attorneys, etc.) under the Freedom of Information Act. If you wish to protect your interview from release outside of the military, then your interview must be pursuant to a promise of confidentiality.
- b. If you do not wish a promise of confidentiality, you may decline such below. In that case, your interview will still be used in the military only for purposes of accident prevention, but it may be released outside of the military in response to a Freedom of Information Act request. Please indicate which option you desire by initialing one of the choices below:

I request a promise of confidentiality. I understand that the results of the interview will be used within the military only for the purposes of accident prevention, and will also be protected from public release outside of the military under the Freedom of Information Act.

I decline a promise of confidentiality. I understand that the results of my interview will be used within the military only for purposes of accident prevention. I also understand that the results may be publicly released outside of the military under the Freedom of Information Act.

Smith, Ronald L.

Name of witness (Print Name - do not sign)

DA FORM 2397-4, FEB 2009

PAGE 2 OF 2 APD PE v1.00

Figure 3-6. Example of a completed DA Form 2397-4, Part V, Summary of Witness Interview—continued

- a. Also see paragraph 3–7.
- b. Complete instructions as follows:
- (1) Block 1. Self-explanatory.
- (2) *Block 2*. Enter general occupation of the witness and duty being performed at time of the accident, if applicable. Use duties listed at table 3–5.
  - (3) Block 3. Enter the grade of witness. Use one of the codes at table 3-8.
  - (4) Blocks 4 and 5. Self-explanatory.
  - (5) Block 6. List DSN number if applicable.
  - (6) Block 7. Enter date(s) statement(s) was/were made.
- (7) *Block 8.* Summarize aviation experience and background. For example, "Army aviator 10 years. Total flight hours 3,500 (RW 3,000; FW 500)." Indicate FAA ratings and approximate flight hours for non-military pilot witnesses. Indicate Military Occupational Specialty (MOS) and approximate total flight hours for non-aviator crew members drawing flight incentive pay.
  - (8) Block 9. Enter location of witness at the time of the accident relative to flight path/impact of aircraft.
- (9) Block 10. Enter rank/grade and last name of person in charge of interview. If witness is interviewed by different persons in charge on separate occasions, list all interviewers in charge and prefix each name with "1st," "2d," "3d," to designate which interview session the interviewer conducted.
- (10) Block 11. Check the appropriate box to indicate if the individual "was/was not" offered a promise of confidentiality. Also, check the appropriate box to indicate whether or not the witness requested a promise of confidentiality. The interviewer will sign and date the confidentiality statement if "Yes" was checked that a promise of confidentiality was offered and "Yes" was checked that a promise of confidentiality was requested by the witness.
  - (11) Block 12. Complete the summary of interview block as follows:
- (a) Multiple interviews, same witness. Prefix the summary of each interview with the date and indicate if the statement is the 1st, 2d, 3d.
- (b) Comprehensiveness. As a general rule, the interview summaries of persons occupying crew stations aboard the aircraft during the accident should be summarized in greater detail than the statements of others. This is because the crew members are the best source of information pertaining to the accident chronology of events. The chronology for the "History of Flight," DA Form 2397–3, will most often be obtained from the crew and should be used as a guide in determining what elements of information to include in the interview summaries. If crew error appears to be involved in the accident, the mistake/errors and system inadequacy(ies) listed in the instructions for completing the DA Form 2397–2 are useful for determining what should be addressed in the crew member witness summaries.
- (c) Consolidating. When several witnesses, other than crew members, provide essentially the same observations, it is not necessary to prepare a separate DA Form 2397–4 for each witness except for statements made with a promise of confidentiality. In cases where the summarized statements of several witnesses can be consolidated, it is appropriate to leave blocks 1 through 9 blank. In block 12, list the names of the witnesses and then summarize their collective observations.
- (d) Format. The proper format is a concise summary of information elements. An example is as follows: "This witness was occupying a passenger seat (identify location in passenger compartment) in the aircraft at the time of the accident. His account of the accident essentially agreed with the "History of Flight" portion of DA Form 2397–3. Additionally, he heard a grinding noise in the area of the aircraft's transmission and felt a high-frequency vibration where his boots contacted the floor of the airframe in the passenger's compartment." In cases where such is essential, limited direct quotes of a witness (together with the specific questions they are in response to) may be used. This, again, should be done sparingly and only when necessary. It is important that the statement be the investigator's summarization and not an exact verbatim transcript of what the witness said. The summary should be written in the third person ("The witness said...," "He said...,") and not the first person ("I saw...," "I heard...").
  - (12) Block 13. Enter the case number shown on DA Form 2397-1.
- (13) Block 14. Interviewer will read block 14a or 14b to each witness, depending upon the category and/or circumstances of the witness.
- (14) *Block 15*. Those witnesses who were offered a promise of confidentiality must indicate acceptance or refusal by initialing the appropriate statement. The witness giving the statement will print his/her name directly above the "Name of witness" line.

### 3-27. Completion instructions for DA Form 2397-5, Part VI, Wreckage Distribution

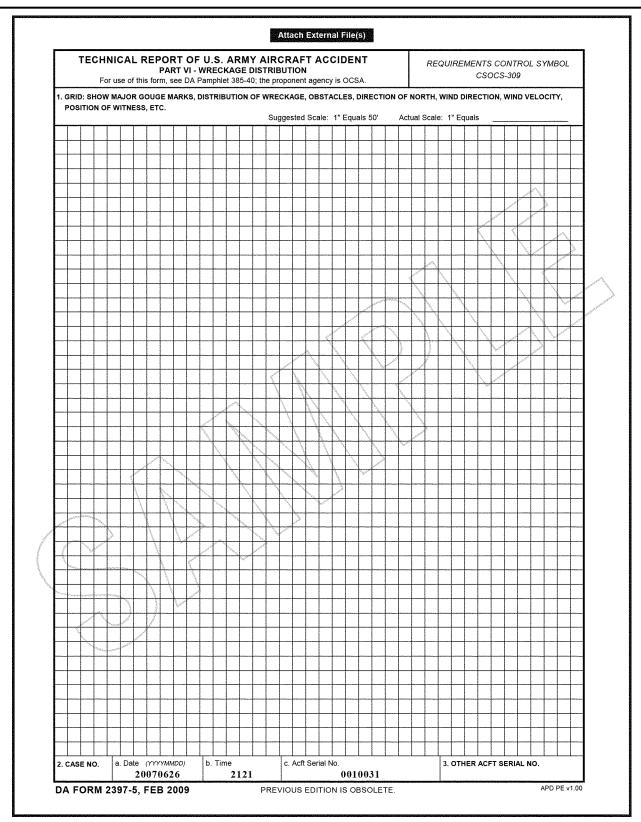


Figure 3-7. Example of a completed DA Form 2397-5, Part VI, Wreckage Distribution

a. Also see paragraph 3-8.

*Note.* The current electronic version of DA Form 2397–5 does not allow the entry of information in block 1 of the form itself. An alternate method for submission of block 1 information is to attach an appropriate diagram containing the block 1 information (for example, Word, PowerPoint). The actual DA Form 2397–5 with block 2 information should be included in addition to the attached document. The electronic version of the form provides a dropdown menu, allowing the attachment of external files to the form. Click on the dropdown window located at the center top of the form and follow the dropdown display.

- b. General. Orient the flight path (at instant of initial impact) along the horizontal or vertical axis of the grid and show the direction of true north, oriented to the top of the page, with an arrow. This procedure eases the task of locating the aircraft component(s) laterally and longitudinally along the crash path. A suggested scale of 40 feet per inch is shown. Actual scale used is to be entered. Show wind direction with an arrow pointed in the direction of the wind flow. Identify wind direction in degrees and velocity in knots.
  - c. Complete instructions as follows:
  - (1) Block 1. Use grid to show the following information:
  - (a) Location of all aircraft major and significant components.
  - (b) Obstacles struck by aircraft in crash sequence. For example, structure, trees, power lines.
- (c) Terrain marks made by aircraft in crash sequence. For example, earth gouge length, width, and depth, snow or earth pushed in front of aircraft.
- (d) A profile view of the wreckage distribution, especially if the impact occurs on sloped terrain or on obstacles in the flight path.
- (e) If necessary, use more than one form to show the profile view of the crash sequence, especially if the initial impact occurs on a tall tree or power line where a large vertical axis is needed.
- (f) For midair collisions, construct a composite diagram (wreckage distribution of both aircraft superimposed on the same plot).
- (g) For a widely scattered wreckage distribution, use a larger grid sheet if needed, and attach it to this form.
- (h) If the aircraft rolls over or noses over one or more times along the crash path, so indicate by use of curved arrows.
  - (i) Identify initial, major, and secondary impact points, as applicable.
  - (j) Show location of key witnesses.
  - (k) Show location of personnel thrown or ejected from the aircraft.

Note. A polar diagram is another acceptable method of diagramming rotary-wing or fixed-wing accident sites. The top of the diagram can represent north. A readily identifiable portion of the wreckage, for example, fuselage, nose, wing, can serve as a point of origin or pole for the diagram. Choose a scale that will allow plotting of the whole accident scene. Determine the compass heading of the aircraft at its final resting place and position a semblance of the aircraft on the diagram so debris can be plotted from that point. Determine the compass heading and distance of pieces of wreckage from the main body of the wreckage. Number the location of each piece of wreckage at the position it was found relative to the main wreckage. Define the numbers with a legend that identifies each piece of wreckage and shows its direction and distance from the main wreckage.

- (2) Block 2. Enter the case number as shown on the DA Form 2397-1, block 25.
- (3) Block 3. Use only for aircraft other than "case aircraft" in accidents involving more than one aircraft. Enter serial number of other aircraft to which the form applies.

# 3-28. Completion instructions for DA Form 2397-6, Part VII, In-flight or Terrain Impact and Crash Damage Data

	T VII - IN-FLIGHT OR TEI use of this form, see DA Pa	RRAIN IMPACT		AGE DATA	REQUIREMENTS CO CSOCS	
1.		IN-FLIGHT	COLLISION KINEMATIC	S AT INSTANT OF IM	PACT	
a. Airspeed a	t Impact (knots)			f. Obstacle Strik	se Sequence (Enter 1, 2, 3, etc. t	to show sequence of strike)
		50		1 Pro	p/Rotor	Landing Gear
	eed (feet per minute)	30	****	2 Rot	or Mast	 Wing
Up	✓ Down				Rotor	Empennage
	Angle (degrees)	5			-	WSPS
Up	✓ Down					
a. In-Filght At	titude At Impact				ndscreen	FLIR
(1) Pitch		(2) Roll	\ <b>&gt;</b> <	LW	R Nose/Gun Turret	Other (Specify)
Angle	5 <b>V</b> Ho	Angle	es0 Left	(1) Compl	conspicuity (Within accident dis in its surroundings was obscured letely (2) Partially	stance from pilot's position,
Degrees _	Up Down	Degree	Right	t n. Wire or Ca	ble Description  e Dia In Inch	ès No. Struck
e. Obstacle lo	dentity And Collision Height			1,70	e Dia in inch	es IVO. GILLICK
		Collisio	n Height Above Ground	(1) Power Tra	ansmission 0.5	Î,
	Obstacle	1	(feet)	(2) Telephone	e or TV	
(1) Birds	***************************************		~~~	(3) Bracing (g	guy/support)	
(2) Aircraf				(4) Other (Spe		
(3) <b>V</b> Wires.			95	i WSPS (1)	) Installed ✓ Yes ) Cut Wire Yes ✓	No No
(4) Vehicl	les			<del>1 1 1</del>	Struck Other Than Wire (dian	·
(6) Other	······································	+		—\ '' -\		Mandal Comment
	AIN COLLISION KINEMATIC	S AT INSTANT C	F MAJOR IMPACT			
c. Flight Path Up f. Attitude at M	<b>✓</b> Down	1-1	70 (degre	e. Impact Ang	70	(degrees)
1. Attitude at it	(1) Pitch		(2) Roll		(3) Yaw	
		2	-8-			
Degree	S 5 V Up	Down		✓ Left □ Right	Degrees 10	. V Left Right
3.	necessary of the second of the		ROTATION AFTER MA	AJOR IMPACT	B091003	. Left Right
3.	Rotate About Any Axis After		ROTATION AFTER MA	AJOR IMPACT	B091003	. Z Left Right
3. a. Did Aircraft	Rotate About Any Axis After	The Above Majo	ROTATION AFTER MA	AJOR IMPACT	B091003	. Z Left Right
a. Did Aircraft	Rotate About Any Axis After	r The Above Majo Unknown c. Ya	ROTATION AFTER MA or Impact (If yes, comp	AJOR IMPACT	)	Left Right  Degrees 0
a. Did Aircraft  7 Ye b. Roll Degre	Rotate About Any Axis Affees No	The Above Majount of the Above	ROTATION AFTER MA or Impact (If yes, comp aw Degrees Left Right FORCES RELATIVE TO	AJOR IMPACT blete items b, c, and d Degrees 0	d. Pitch Degrees Up Down	
a. Did Aircraft   v  Ye b. Roll Degre  v  Left	Rotate About Any Axis Afferes No Degrees Right Degrees	The Above Maje Unknown  c. Ya  IMPACT F  b. Lc	ROTATION AFTER MA or Impact (If yes, comp aw Degrees Left Right	AJOR IMPACT blete items b, c, and d Degrees 0	d. Pitch Degrees	

Figure 3-8. Example of a completed DA Form 2397-6, Part VII, In-flight or Terrain Impact and Crash Damage Data

Collapse	a. Roof	Deformation or			irmation or C					
a Roof Up to 1 Foot		Conapse		Cabin	Mid Cabin	Rear Cabin		Forward	Mid Cabin	Rear Cabin
a. Roof   Up to 1 Foot   More Than 1 Foot But			(1)				(5)			
More Than 3 Feet		Up to 1 Foot			1 1		1 1	1 :	1 1	
D. Left Side  Were Than 1 Foot More Than 1 Foot More Than 1 Foot More Than 1 Foot  I. Roof (local deformation under seats)  I. Floor (local deformation under seats)  Sideward  Sideward  B. LARGE COMPONENT DISPLACEMENT (Check appropriate boxes).  Component  Component  Component  Component  LARGE COMPONENT DISPLACEMENT (Check appropriate boxes).  Component  Component  Component  Component  Displaced (1)  Torn Free (2)  Costpit Penetrated/Entered (3)  Reversal	1	More Than 1 Foot But	~			L	✓		Li	
D. Left Side  Were Than 1 Foot More Than 1 Foot More Than 1 Foot More Than 1 Foot  I. Roof (local deformation under seats)  I. Floor (local deformation under seats)  Sideward  Sideward  B. LARGE COMPONENT DISPLACEMENT (Check appropriate boxes).  Component  Component  Component  Component  LARGE COMPONENT DISPLACEMENT (Check appropriate boxes).  Component  Component  Component  Component  Displaced (1)  Torn Free (2)  Costpit Penetrated/Entered (3)  Reversal	l-	More Than 3 Feet	1 11	1 1	177	177	1.1	6.1	Fil	1
More Than 1 Foot						H				
C. Right Side	ļ-		7-1		1111					100
d. Nose   Up to 1 Foot   More Than 1 Foot					Li		L			$\Delta$
e. Floor   Up to 1 Foot   V   V   V   V   V   V   V   V   V		More Than 1 Foot	✓	L	Li	Li	✓	Li	Light	<b>A</b>
E. Floor	d. Nose	Up to 1 Foot								
Sideward										
F. Floor (local deformation under seals)   Sideward   Floor (local deformation under seals)   Floor (local u	<b>⊢</b>	<del></del>	<b>-</b>				✓			
8. LARGE COMPONENT DISPLACEMENT (Check appropriate boxes)  Component  Component  Displaced (1)  Cockpit Penetrated/Entered (3)  A. Transmission (forward or main) b. Transmission (rear) c. Rotor Blade (rear or tail) d. Rotor Blade (rear or tail) e. Landing Gear (specify location) f. Other (specify)  9.  FLUID SPILLAGE a. Equipped With Crashworthy Fuel System  Breakaway Valves Separate as Designed  V Yes No  C. Flammable Fluid Spillage Occurred Yes No Internal External Crashworthy Yes No  10.  SPILLAGE SOURCE  Part  A. Part Name/Nomenclature  Displaced Torn Free (1) (2) Cockpit Penetrated/Entered (3) Penetrated/Entered (4) Penetrated/Entered Cabin Penetrated/Entered (4)  Cabin Penetrated/Entered (4)  Cabin Penetrated/Entered (3)  Cabin Penetrated/Entered (4)  Cabin Penetrated/Entered (3)  Cabin Penetrated/Entered (4)  Cabin Penetrated/Entered (3)  Cabin Penetrated/Entered (4)  Cabin Penetrated/Entered (4)  Cabin Penetrated/Entered (4)  Cabin Penetrated/Entered (3)  Cabin Penetrated/Entered (4)  Cabin Penetrated/Entered (3)  Cabin Penetrated/Entered (4)  Cabin Penetrated/Entered (3)  Cabin Penetrated/Entered (4)  Cabin Penetrated/Entered (4)  Cabin Penetrated/Entered (3)  Cabin Penetrated/Entered (3)  Cabin Penetrated/Entered (4)  Cabin Penetrated/Entered (3)  Cabin Penetrated/Entered (3)  Cabin Penetrated/Entered (4)  Cabin Penetrated/Entered (5)  Cockpit Penetrated/Entered (6)  Co							57		1	3
8. LARGE COMPONENT DISPLACEMENT (Check appropriate boxes)  Component  Displaced (1)  Cockpit Penetraled/Entered (3)  A. Transmission (forward or main)  b. Transmission (rear) c. Rotor Blade (forward or main) d. Rotor Blade (rear or tail) e. Landing Gear (specify location) f. Other (specify)  9. FLUID SPILLAGE  a. Equipped With Crashworthy Fuel System  Displaced (1) (2) Cockpit Penetraled/Entered (3) Penetraled/Entered (4) Penetraled/Entered (3) Penetraled/Entered (4) Penetraled/Entered (4) Penetraled/Entered (5) Penetraled/Entered (6) Penetraled/Entered (7) Penetraled/Entered (8) Penetraled/Entered (9) Penetraled	deformation		<b>-</b>				Y	1		1 1
Component	ander seats)									
a. Transmission (forward or main) b. Transmission (rear) c. Rotor Blade (forward or main) d. Rotor Blade (rear or tail) e. Landing Gear (specify location) f. Other (specify)  9. a. Equipped With Crashworthy Fuel System  Breakaway Valves Separate as Designed  V Yes No  C. Flammable Fluid Spillage Occurred  V Yes No  C. Flammable Fluid Spillage Occurred  V Yes No  Rotor Blade (forward or main)  J (2) (3) (4)  (4)  Auxiliary Fuel Tanks Installed  Do 1  Auxiliary Fuel Tanks Installed  Do 1  Yes No  Rotor Blade (forward or main)  J (2) (3) (4)  Auxiliary Fuel Tanks Installed  Do 1  J (1) (2) (3) (4)  Auxiliary Fuel Tanks Installed  External  Do 1  To 20  JP8  To National Stock No.  10.  SPILLAGE SOURCE  Part   Auxiliary Fuel Aircraft   Auxiliary Fuel Tanks Installed   Description   Description	8.		ARGE COM	PONENT DIS	PLACEMENT	(Check ap	propriate boxe			1 100
a. Transmission (forward or main) b. Transmission (rear) c. Rotor Blade (forward or main) d. Rotor Blade (rear or tail) e. Landing Gear (specify location) f. Other (specify)  9.  a. Equipped With Crashworthy Fuel System  b. If So Equipped, Did Breakaway Valves Separate as Designed  V Yes No  V Yes No  Auxiliary Fuel Tanks Installed Occurred V Yes No  Internal External Crashworthy, Yes No  10.  SPILLAGE SOURCE  Part  a. Part Name/Nomenclature  Part  a. Part Name/Nomenclature  D. Part Number C. National Stock No.  (1) Cell/Tank/Reservoir C) Filting C) Filti		Component			1	ed	74		tered Penet	rated/Entered
b. Transmission (rear)  c. Rotor Blade (forward or main)  d. Rotor Blade (rear or tail)  e. Landing Gear (specify location)  f. Other (specify)  9.	a Transmission	(forward or main)			(1)		(2)	(3)		(4)
d. Rotor Blade (rear or tail) e. Landing Gear (specify location) f. Other (specify)  9. FLUID SPILLAGE  a. Equipped With Crashworthy Fuel System  b. If So Equipped, Did Breakaway Valves Separate as Designed  V Yes No NA 1, 2  c. Flammable Fluid Spillage Occurred Ves No No NA 1, 2  c. Flammable Fluid Spillage Occurred Ves No		<del></del>				1			- Variable	
e. Landing Gear (specify location) f. Other (specify)  9.  a. Equipped With Crashworthy Fuel System  b. If So Equipped, Did Breakaway Valves Separate as Designed  V Yes No NA > 1 - 2  c. Flammable Fluid Spillage Occurred V Yes No Internal External Crashworthy Yes No  SPILLAGE  e. Amount and Type Fluid Spilled Gallons Fuel (Type) Oil (Type) Hyd Fluid (Type) Other (Specify Oil (Type))  October (Specify Oil (Type))  Internal External Crashworthy Yes No  SPILLAGE SOURCE  Part a Part Name/Nomenclature  D. Part Number c. National Stock No.  (1) Cell/Tank/Reservoir Tank, Fuel Aircraft 4060606010895 1560011646785  (2) Filter  (3) Fitting (4) Fluid Line (5) Value	c. Rotor Blade (f	orward or main)		No. of Street, or other Persons		1	\.Z		i marier	
f. Other (specify)  9.	d. Rotor Blade <i>(r</i>	ear or tail)		Marine .				LJ		la sen'
9. FLUID SPILLAGE  a. Equipped With Crashworthy Fuel System  b. If So Equipped, Did Breakaway Valves Separate as Designed  V Yes No NA 1 - 2  c. Flammable Fluid Spillage Occurred  Y Yes No No NA 1 - 2  Crashworthy Yes No No NA 1 - 2  JP8  10. SPILLAGE SOURCE  Part   A. Part Name/Nomenclature   B. Part Number   C. National Stock No.  (1) Cell/Tank/Reservoir   Tank Fuel Aircraft   4060606010895   1560011646785  (2) Filter  (3) Fitting  (4) Fluid Line  (5) Value					A II	1			A	
a. Equipped With Crashworthy Fuel System  b. If So Equipped, Did Breakaway Valves Separate as Designed  V Yes No NA > 1 - 2  C. Flammable Fluid Spillage Occurred V Yes No The Internal External Crashworthy Yes No  Designed  Tank Fuel Aircraft  A 060606010895  Designed  E. Amount and Type Fluid Spilled  Gallons Fuel (Type) Oil (Type) Hyd Fluid (Type) Other (Specification of the Company of the Co			100			1 1	<u> </u>			
Breakaway Valves Separate as Designed			<u> </u>	71	<del></del>		<del>\</del> \			
as Designed  O-1  Yes No NA > 1-2  C. Flammable Fluid Spillage Occurred  Yes No   NA   1-2  Occurred  Yes No   NA   1-2  Jesternal   20   Jp8  Crashworthy Yes   No   No   Spillage Source  Part   a. Part Name/Nomenclature   b. Part Number   c. National Stock No.  (1) Cell/Tank/Reservoir   Tank, Fuel Aircraft   4060606010895   1560011646785  (2) Fitting   (4) Fluid Line   (5) Value					3	-		inna)   Hud E	Juid (Type)	Other (Checifu)
✓ Yes         No         NA         2,1-2           c. Flammable Fluid Spillage Occurred         d. Auxiliary Fuel Tanks installed         > 22,10           ✓ Yes         No         > 10 - 20           ✓ Yes         No         Internal External           Crashworthy         Yes         No           10.         SPILLAGE SOURCE           Part         a.         Part Name/Nomenclature         b.         Part Number         c.         National Stock No.           (1) Cell/Tank/Reservoir         Tank, Fuel Aircraft         4060606010895         1560011646785           (2) Fitter         (3) Fitting         (4) Fluid Line           (5) Value         (5) Value	•			Anna Talana	<u></u>	ruei (/)	pe) Ole(1	ype) nyur	Tulu (Type)	Julei (Specify)
Occurred         Yes         ✓ No         ≥ 10 - 20         > 20         JP8            Yes         No         Internal         External         > 20         JP8            10.         SPILLAGE SOURCE         SPILLAGE SOURCE           C. National Stock No.           (1) Cell/Tank/Reservoir         Tank, Fuel Aircraft         4060606010895         1560011646785           (2) Filter         (3) Fitting         (4) Fluid Line         (5) Value	✓ Yes	No 🔨 🗸 Y	es No	NA NA	* Independent	1	<u> </u>			
✓ Yes         No         Internal External Crashworthy Yes         No         JP8         JP8           10.         SPILLAGE SOURCE           Part         a.         Part Name/Nomenclature         b.         Part Number         c.         National Stock No.           (1) Cell/Tank/Reservoir         Tank, Fuel Aircraft         4060606010895         1560011646785           (2) Filter         (3) Fitting         (4) Fluid Line         (5) Value		uid Spillage d. Auxil	ary Fuel Tan	ks installed	> 2 - 10					
Crashworthy Yes   No		1 %		1	> 10 - 20	A. Carlo				
10.   SPILAGE SOURCE     Part   a.   Part Name/Nomenclature   b.   Part Number   c.   National Stock No.     (1) Cell/Tank/Reservoir   Tank, Fuel Aircraft   4060606010895   1560011646785     (2) Fitter   (3) Fitting   (4) Fluid Line   (5) Value   (5) Value   (5) Value   (5) Value   (6)   Value   (7) Val	Y Yes	1 1 1	Tage .	A	> 20	JP8				
Part   a.   Part Name/Nomenclature   b.   Part Number   c.   National Stock No.	The state of the s	Clasiiwo	nully 165		<u> </u>	L				
(1) Cell/Tank/Reservoir Tank, Fuel Aircraft 4060606010895 1560011646785 (2) Fitter (3) Fitting (4) Fluid Line (5) Value		To Par	Name/Nome				rt Number		National Sto	alc No
(2) Filter (3) Fitting (4) Fluid Line (5) Value					- J.			0.		
(4) Fluid Line (5) Value			700	, Table 1					***************************************	
(5) Value	<u> </u>									
	(4) Fluid Line									
(6) Breakaway Valve 31 3°										
	(6) Breakaway Va									
(7) Other (Specify)										
(8) Other (Specify) (9) Other (Specify)						***************************************	***************************************		***************************************	***************************************
11. REMARKS		′′ [								

Figure 3-8. Example of a completed DA Form 2397-6, Part VII, In-flight or Terrain Impact and Crash Damage Data—continued

- a. Also see paragraph 3–9.
- b. Complete instructions as follows:
- (1) *Block 1*. This block is required for in-flight collisions, such as a midair collision, wire strike, bird strike, or tree strike. If doubt exists as to whether this block or block 2 should be used, both blocks can be completed. For example, the aircraft may strike a structure during an approach and continue under control some distance forward and crash; thus, in-flight and terrain collisions are involved. Near simultaneous impacts with trees, structures, and the ground require only block 2 to be completed. In other cases, such as a bird strike, in which a subsequent routine landing is made, only block 1 would be checked. If the information desired in these blocks cannot be determined, so state in the box(es) provided for the information.
- (a) Block 1a. Estimate or analytically determine and enter the knots indicated airspeed or true airspeed just before impact.
- (b) Block 1b. Estimate or analytically determine and enter the vertical speed (feet per minute) just before impact, and check whether "Up" or "Down." If zero, enter "0" in space provided and do not check "Up" or "Down" box.
  - (c) Block 1c. Enter the flight path angle (degrees) at major impact and check whether "Up" or "Down."
  - (d) Block 1d. Enter the pitch and roll angles (degrees) at moment of impact and check the appropriate direction.
- (e) Block 1e. Check obstacle(s) struck while aircraft was in flight. For example, contact with a hangar building would be checked as "Other." Specify in the block. Also enter collision height above the ground.
- (f) Block If. Check box to identify area of aircraft that sustained the strike. If aircraft sustained a strike at more than one location, check several boxes and indicate 1st, 2d, 3d, to show strike sequence.
- (g) Block 1g. Check the appropriate box to reflect the wire/cable(s)/obstacle conspicuousness to the pilot under the environmental conditions and terrain at the time of the accident.
- (h) Block 1h. Enter the outside diameter for the type cable/bundle struck. The outside diameter of the wire bundle/cable including insulation is desired, not the individual wire inside the bundle or cable. Enter the number of wires struck in the impact. For example, in a five-cable power transmission line, only three cables may be struck.
- (i) Block 1i. Check whether or not a Wire Strike Protection System (WSPS) was installed. Also check whether or not the WSPS cut the wire.
  - (j) Block 1j. Enter outside diameter of tree limb, pole, bush that was struck, if applicable.
- (2) Block 2. Complete this block to show terrain collision kinematics at instant of major impact. If block 1 was filled out and aircraft continues under control after in-flight collision and then sustains further damage upon ground impact, complete block 2 also. If aircraft sustains in-flight damage such as from a bird strike and then makes a routine landing, block 2 does not have to be filled out.
- (a) Block 2a. Estimate or analytically determine and enter the ground/horizontal velocity (knots) at the instant of the major impact. The horizontal velocity is desired. This value is not to be confused with airspeed or resultant velocity. The ground speed vector combined with the vertical speed vector can be used to determine the resultant velocity as shown for sample high-angle and low-angle impacts.
- (b) Block 2b. Estimate or analytically determine and enter the vertical speed (feet per minute) just before impact and check whether "Up" or "Down." The vertical speed at impact can be combined with ground speed to yield the resultant velocity as discussed above.
  - (c) Block 2c. Enter the flight path angle (degrees) just before impact and check whether "Up" or "Down."
- (d) Block 2d. Indicate by check marks which two of the three parameters above are the most accurate. Since any two items can determine the third, it is necessary to determine which two (a and b, b and c, or a and c) the investigator feels are most accurate. Check only two boxes.
  - (e) Block 2e. Enter the impact angle (degrees).
  - (f) Block 2f. Enter the pitch, roll, and yaw attitude (degrees) of aircraft at the instant of impact.
  - 1. Pitch. Enter degrees and check "Up" or "Down" pitch in appropriate box.
  - 2. Roll. Enter degrees and check "Left" or "Right" roll in appropriate box.
- 3. Yaw. Enter degrees and check "Left" or "Right" yaw as appropriate. If nose is to left of flight path, check "Left" box; if nose is to right, check "Right" box.
  - (3) *Block 3*.
  - (a) Block 3a. Check the appropriate box.
- (b) Block 3b. Enter the roll in degrees for the appropriate direction if the aircraft rolled significantly after the major impact. A value should be entered even if the aircraft comes to rest in the original attitude after it has rotated during the crash sequence.
  - (c) Block 3c. Enter the yaw in degrees for the appropriate direction if the aircraft yawed significantly after the major

impact. A value should be entered even if the aircraft comes to rest in the original attitude after it has yawed during the crash sequence.

- (d) Block 3d. Enter the pitch in degrees from the horizontal (level) attitude if the aircraft pitched (nose up or down) after major impact, and check the appropriate box to indicate if the pitch was up or down. For example, if an aircraft rotates forward about the nose as a fulcrum or a forward pitching motion, check "Down."
  - (4) Block 4.
- (a) Block 4a. Estimate or analytically determine and enter the vertical force (Gs) at the aircraft CG. Check whether the force was "Up" or "Down."
- (b) Block 4b. Estimate or analytically determine and enter the longitudinal force (Gs) at the aircraft CG. Check whether the force was "Fore" or "Aft."
- (c) Block 4c. Estimate or analytically determine and enter the lateral force (Gs) at the aircraft CG. Check whether the force was "Left" or "Right."
  - (5) Block 5. Enter the case number as shown on the DA Form 2397–1 (see table 3–16).
- (6) *Block* 6. Use only for aircraft other than "case aircraft" in accidents involving more than one aircraft. Enter serial number of other aircraft only on each DA Form 2397–6 that applies to other aircraft.
- (7) *Block* 7. This block shows fuselage structural deformation or collapse and its relation to personnel impact injuries. The areas of fuselage most likely to be deformed are stated in items a through f. The location of the deformation is indicated in the four columns labeled cockpit, forward, middle and rear cabin. If the deformation or collapse caused injuries to personnel, the appropriate box of item (5), (6), (7), and (8) should be checked. Information in this block shall agree with the injury/occupational illness mechanism identified in DA Form 2397–9 and the LSE failure modes identified in DA Form 2397–10, Personal Protective/Escape/Survival/Rescue Data.
- (a) Blocks 7a-e. Check column(s) 1 through 4 to show the location of deformation for each fuselage area. As a general rule, deformation of 3 inches or less is not enough to be recorded because injuries are not likely to result from such movement. If personnel injuries were caused by fuselage structural deformation, columns 5 through 8 should be checked in the appropriate box. Injuries caused by nonuse of restraint and seat failure and other injuries not related to fuselage deformation are not to be recorded here.
- (b) Block 7f. Check box to indicate whether the floor was deformed locally under the seat structure. This type deformation may occur as a result of external rock or tree stump impact. For example, if one seat leg floor fitting is pushed upward by at least 2 inches with respect to the other three fittings, check the box. The same applies to sideward or fore-aft movement of the seat leg floor fittings.

Note. Photographs should be made of the deformed areas checked under items a through f. At least two photos should be obtained, and they should be taken along mutually perpendicular axes to help offset the effect of distortion.

- (8) *Block* 8. This block indicates the displacement of heavy aircraft components so their potential for injury/occupational illness or for ignition of fires may be evaluated. Only those components expected to be a major hazard are listed under items a through e. Block f provides for the displacement of other heavy components, such as engines, prop blades, electrical boxes, which could be a hazard to personnel. Columns 1 through 4 describe the displacement of the components from their normal position.
- (a) Blocks 8a-d. These components are potentially the most hazardous on rotary-wing aircraft. Displacement of single rotor transmission and/or rotor blades are to be checked in items "a" and "c" while tandem rotor aircraft are to be checked in items a, b, c, and d as appropriate. If the main rotor hub(s) remain attached to their blades, the hub is assumed an integral part of the blade(s) and is checked under item c or d. If the hub(s) remain attached to the transmission(s), the hub is assumed an integral part of the transmission and displacement is checked under item "a" or "h."
- (b) Block 8e. Check landing gear displacement. Specify which landing gear, wheel, or skid displaces by simply stating the location on the aircraft. For example, left front, center front, right front, left rear, center rear, right rear. If more than one gear displaces, continue the identities shown above in remarks block (block 11) to indicate the displacement.
- (c) Block 8f. Check this box(es) to identify displacement of heavy component(s) not shown above. If more than one mass is involved, explain in block 11.
- 1. Column 1. Check box(es) in this column if sufficient displacement has occurred to cause the component to be hazardous even though injuries may not be present. For helicopter transmissions, it is probable that a 10-degree tilt of the transmission and rotor mast will result in a hazardous condition due to fuselage rotor blade strike potential. Likewise, a 6-inch displacement of the transmission, along any axis, will probably result in a hazardous condition. Check the box for rotor blade(s) (item c or d) if it is determined that further blade rotation would result in an occupiable volume blade strike.
- 2. Column 2. Check box if a major component is separated completely from its normal structural attachment even though the component may still be held by flexible attachments such as control cables or rods and electrical wires.
- 3. Column 3. Check this box if component actually deformed or penetrated the cockpit "container" sufficiently to create a hazard.

- 4. Column 4. Check this box if component actually deformed or penetrated the cabin "container" sufficiently to create a hazard. Photographs should be made of the displaced components checked under items a through f. At least two photos should be obtained, and they should be taken along mutually perpendicular axes to help offset the effect of distortion.
  - (9) Block 9.
  - (a) Block 9a. Check whether or not aircraft is equipped with crash-resistant fuel system.
- (b) Block 9b. If aircraft is equipped with crashworthy fuel system, check to determine whether the breakaway valves in the fuel system did separate.
  - (c) Block 9c. Check whether or not flammable fluid spillage occurred. If "Yes" box is checked, complete block e.
- (d) Block 9d. Check whether or not aircraft was equipped with auxiliary fuel tanks and indicate if the tanks were internal or external. Also, check the appropriate box which best describes the crashworthiness of the tanks. If the tanks are partially crashworthy, check "No" and explain in the remarks.
- (e) Block 9e. In the space corresponding with the amount of flammable fluid spilled, enter the type of fluid which was spilled. For example, JP-8, 7808. For example, 15 gallons of JP-8 fuel were spilled so enter "JP-8" under the fuel column, adjacent to the 10-20 amount line. The amount of spilled fluid can be estimated by:
  - 1. The difference between quantity of liquid remaining and fluid before accident.
- 2. A knowledge of the probable mode of failure in the fluid system. For example, did fluid trickle out at slow rate, or did it gush out all at once?
- (10) *Block 10.* Identify one or more spillage sources by writing the name of the part causing or permitting leakage. Rows 7, 8, and 9 may be used to list other sources such as coolers, accumulators. Also, write in the manufacturer's PN and the NSN. The exact identity of the part causing leakage is desired, not the component or assembly. State the cause of fluid spillage in Remarks. For example, a shift of cargo may have crushed the internal auxiliary fuel tanks.
  - (11) Block 11. Explain in remarks any additional data the investigation board deems appropriate.

### 3-29. Completion instructions for DA Form 2397-7, Part VIII, Maintenance and Materiel Data

	PART VIII - MA of this form, see DA	INTENANCE AN	D MATERIEL DA	TA		REQUI	REMENTS CS(	CON CS-3		MBOL
1. AIRCRAFT HISTO		· · · · · · · · · · · · · · · · · · ·		<u> </u>		2. CAUSATI	VE [	,	s	U
a. Hours Since Ne				1,0	570	ROLE	Defi		uspected	
b. Hours Since Las	st Major Repair			1	15	a. Materiel		/		
c. Last Phase Insp	ection (YYYYMMD)	D)		060	511	b. Maintena	nce			
d. Hours Flown Si	nce Last Phase Insp	ection		2	00	c. Design				
e. Organization Co	ompleting Last Phas	e Inspection (UIC	C)	WAI	CDE	d. Manufact	ure			
3.			FAILED OR MALFU	NCTIONED N	IATERIEL	,				
Identification	Major Cor	mponent	Part		Ident	ification	Major Con	ponen	t l	Part
a. Nomenclature	Gear B	ox, Int	Gear, Be	evel	h. TAMMS	Data				
b. Type, Design, Series					(1) No. of (		0	.// 	,52 enter	0
c. Part Number	70357-06	314-101	70357-0630	00-042	(2) Date of Overhau	Last il (YYYYMMDD)	A	·		$\triangle$
d. NSN	1515-01-0	074-5152	3020-01-11	2-3065	(3) Hrs Sin	ce Overhaul		1		parent de la company
e. MFG Code	7822	286	78228	6	(4) Hrs Sin		1,67	0	1	670
f. Serial Number	ABC-	0714			(5) Hrs Sin Installe		1,67	0	1,	,670
g. TM Data					(6) Date La Installe	ast d (YYYYMMDD)	1		1	The second second
(1) TM Number	55-1520-2	37-23P-2			(7) Last Ov Facility	erhaul	1	Sand Section of the S		~
(2) Date (YYYYMMDI	20020	0214			(8) Last Sp (Type)	ecial Insp		and the second		
(3) Functional Group			06			I Inspection	7	galage.		
(4) Figure Number	35	9	359		(10)Date o	f Last Spec tion IMDD)				
(5) Item Number	10	5 (	13	i. Type/Mode of Failure/Malfunction						
					j. Cause of Malfuncti	Failure/ on				
					k. QDR/EI	R Number	W	DOD.	A07020	02
Status of Aircraft	Warning System for					UNCTION Failure/Malfun	ction C	orrect		correct
c. Initial Indication	of T	(1) Vibration	✓ NA (3) Attitude	(5) O	lor	(7) Smok	e or Fire	✓ N	one 9) Warnin	a System
Failure/Malfunct	ion	(2) Noise	(4) Inspection	(6) FI			Personnel	Linguist 1	10) None/	<del></del>
5. TEARDOWN a	Organization Perfo			1 (0)11		· · · · · · · · · · · · · · · · · · ·	SACRC Co	1:3		
ANALYSIS	CAD	part of the state	States			1	302			
6. REMARKS (Use a Block 3: No spo	The state of the s	1	nistorical record	ds for com	ponent or	part.				
	ate (YYYYMMDD)	T	1			la ===				
7. CASE NO. a. Da	20070101	b. Time 1011	c. Acft Seria	99111	11	8. OIH	ER ACFT S	ERIAL I	NO.	

Figure 3-9. Example of a completed DA Form 2397-7, Part VIII, Maintenance and Materiel Data

- a. Also see paragraph 3-10.
- b. Complete instructions as follows:
- (1) *Block 1*. Applies to the aircraft and not the component or part that failed. Enter data from aircraft records. If additional DA Forms 2397–7 are needed for multiple failed parts from the same aircraft, it is not necessary to duplicate this information.
- (a) Block 1a. Enter the total time on the airframe until the time of the accident. Obtain data from DA Form 2408–13, Status Information.
  - (b) Block 1b. Obtain data from DA Form 2408-15 (Historical Record for Aircraft).
  - (c) Block 1c. Enter the date of the last phase inspection. Obtain data from DA Form 2408-15.
  - (d) Block 1d. Enter the hours flown since the last phase inspection.
  - (e) Block 1e. Enter the 6-digit UIC for the organization that performed the last phase inspection.
- (2) *Block 2*. This block shows the causative role of materiel, maintenance, design, and manufacture as they pertain to the major component/part reported in block 3 of this form.
- (a) Block 2a. Check the appropriate box to show whether or not material failure/malfunction of the component/part in block 3 had a causative role in the accident.
- (b) Block 2b. Check the appropriate box to show whether or not a maintenance act of omission or commission had a causative role in the accident.
- (c) Block 2c. Check the appropriate box to show whether or not design had a causative role in the accident. Design is a factor when the component/part failed to perform its specified function because of design inadequacies.
- (d) Block 2d. Check the appropriate box to show whether or not manufacture had a causative role in the accident. Manufacture is a factor when the component/part was not manufactured to meet proper design specifications.

*Note.* If maintenance was checked as a cause factor in block 2, explain in block 6 or continuation sheet. Provide the TM or other directive requirement for the maintenance and how the error was committed or the omission of a requirement(s) related to the major component/part shown in block 3. Complete a DA Form 2397–8 for person(s) committing the error.

- (3) *Block 3*. Fill out major component and part columns in complete detail for each item of materiel whose failure or malfunction contributed or is suspected of contributing to the cause of the accident. Blocks a through k applies to the component or part, not the aircraft.
- (a) Blocks 3a and b. Obtain from appropriate parts manual. When the major component is an engine, transmission, or gearbox and the aircraft is equipped with more than one like item, identify which major component is listed. For example, No. 1 engine, forward transmission, 42-degree gearbox.
- (b) Block 3c. The PN should be taken from the part or component if possible. The TM will be used as a source for the PN only if it cannot be determined from the part.
  - (c) Blocks 3d and e. Obtain from appropriate TM.
- (d) Block 3f. Enter the serial number from the item of materiel. If the number differs from that contained in the DA Form 2408–16, state this fact in block 6 or on a continuation sheet.
  - (e) Block 3g. Obtain from appropriate TM.
- (f) Block 3h. Extract this information from DA Form 2408–16 and DA Form 2410 (Component Removal and Repair/ Overhaul Record). Enter the type, date, and hours since the last special inspection on the listed item of materiel, For example, "overspeed," "hard landing." For components/parts installed during aircraft production, enter "N/A."
  - (g) Blocks 3i and j. Enter the type and cause of failure codes from DA Pam 738-751, table 1-2.
  - (h) Block 3k. Obtain from Standard Form 368, Deficiency Report.
  - (4) Block 4.
- (a) Block 4a. Check the appropriate block to show status of aircraft warning system(s) for the failed part at time of emergency. If inoperative is checked, explain in block 6 or on a continuation sheet.
- (b) Block 4b. Check the appropriate box to indicate if the warning systems indication of the failure/malfunction provided to the crew was correct for the failed part. If incorrect, explain in block 6 or on a continuation sheet. (c) Block 4c. Check the appropriate block to indicate the initial indication of the failure. For example, a hydraulic warning light illuminates followed by stiffness in the controls. Check the "Warning System" block to indicate what first alerted the crew to a failure/malfunction.
  - (5) Block 5.
  - (a) Block 5a. Specify the organization/laboratory that performed the TDA.
  - (b) Block 5b. Enter the USACRC control number, if applicable.

- (6) *Block 6*. Explain delays in shipment of failed part, fluid samples, or any other materiel related data deemed appropriate by the board president. If additional space is required, attach continuation sheet.
  - (7) Block 7. Enter the case number shown on the DA Form 2397-1.
- (8) *Block* 8. Use only for aircraft other than "case aircraft" in accidents involving more than one aircraft. Make entry only on the form identifying the maintenance and materiel data for other aircraft.

## 3-30. Completion instructions for DA Form 2397-8, Part IX, Personal Data

TE		P	ART IX - PE	RSONAL DA	IRCRAFT A TA proponent agen		Т	REQ	UIREMEI	NTS CON CSOCS-3		SYMBOL
1.					OLE OF THIS I							
	hat Caused/Co	ontributed to	Accident				ntrols Whe	en Accident	Occurred			
✓ Defir		uspected	None	Undet	termined		Yes	No		termined		
2.					BACKGROUN	D DATA	.,					
a. Age					27	g. Hours \	Norked La	st 24 Hour	S			6
b. Hours A	wake Prior to A	Accident			6	h. Hours \	Vorked La	st 48 Hour	s			15
c. Hours D	uration Last Si	leep Period			8	i. Hours \	Vorked La	st 72 Hours	<b>S</b>			25
d. Hours S	lept Last 24 H	ours			8	j. Hours F	lown Last	24 Hours				3
e. Hours S	lept Last 48 H	ours			16	k. Hours f	lown Last	48 Hours				3
f. Hours SI	ept Last 72 Ho	ours			24	I. Hours F	lown Last	72 Hours	7	A STATE	1	<i></i> 6
3.					CREW MEMBI				4			
a. Primary				OH-58D	(R)	j. NVG Quali		✓ Yes	No			
	Acft MTDS					k. Date Qualit				1	20	0030626
	al Acft MTDS					<ol> <li>ATM Task Indication of</li> </ol>			Vith Initial	1		1408
d. FAC	10 11-					Last Perfor	-	1/2	Trans.	9	21	0070624
<b>√</b> 1	2 3						- Contraction		_	···	<del>- }-</del>	
P. 1921 1.1	cident Acft MT	/*************************************				m. ATM Task To Emerg		nvolved in	Response		1	
√ 1 1 ADADT	2 3	NA		200610	15	Last Perfo	•	YYMMDD)	i.	1	27	1
	Completed (Y			200610		n. Medical W		Yes	J No	$\rightarrow$	4	
h. Most Re	cent Evaluation	n Flight In	MINIDU)	200610		o. Post-Accid	-					
	ft Flown In Las		(1)	) OH 5	8D(R)	p. Post-Accid		al Exam/Au	topsy		20	0070627
			(2)	)	1 /	g. Required I		Accomplial				_
			(3)	)	1 //	q. Required i	W	Accomplisi No	neu			
						r. Last redep	<del></del>	<del></del>	at theater	OVVVVIAME	101	BUOMS BEEFE
4.					CONTRACTOR OF THE PARTY OF THE	<del></del>		<u> </u>	at theater	(TTTTMWC	2)	
		Nagari Pa		17.5	TY EXPERIENC	E (Round off	3			Τ Δ	cdt Aircr	aff Hrs
a. Type Exp	perience And T	ime	Rotary Wing	Pix		Total	Imminer Danger		ombat	Desi		Series
(1) Militar	у	-	872	1 1	The same of the sa	872			172	72	2	670
(2) Civilia	ın \	1/	100	1		plant of the second						
(3) Total	Hours	J. Jak	872	_ \	1	872						
b.	1			September 1	Duty Exper	ience						
D	uty	CP	PI	PC	UT	IP	ΙE	SP	MP	١	ΛE	XP
Total	Hours	N ,	591	281								
1			1	V								
C.			<b>\</b>		ight Condition							
Con	dition	D	N	Н	W	NG	DG	NS	DS		R	AA
Total	Hours	490	36	20		326						
	<u> </u>	ļ						<u> </u>				
- 1	onthly Flight Ho					e.	1 05	1	w Duty Exp	1	F.	1 0:
Date	: /-	rev 90	Prev 60	Prev 30	This Mo.	Duty	CE	OR	AO	MO	FI	SI
Hour	S.	70	50	20		Total Hou	s					
				L	I		1	.1	1	L		
5				MAINTENANO	E AND SUPPO	DT DEPOANA	EL DATA					
a. PMOS	Τ ₊	itle		MAINTENANC	L MIND SUPPU		Job Serie	s or Title				
b. SMOS		itle	<del></del>			- C. Civillai	300 06116	O THE				
c. DMOS		itle				f. Perform	nance Star	dards Met	For This T	ask		
d. Deficient						1 1 1 Y		No				
6. CASE	a. Date (YYY	YMMDD)	b. Tir	ne	c. Acft Seria				7. OTH	ER ACFT	SERIAL	NO.
07.02	1	70626		2121	0. 7 1011 00110	0010	031					
	400	,,0020	1	4141	1	0010	001		1			

Figure 3-10. Example of a completed DA Form 2397-8, Part IX, Personal Data

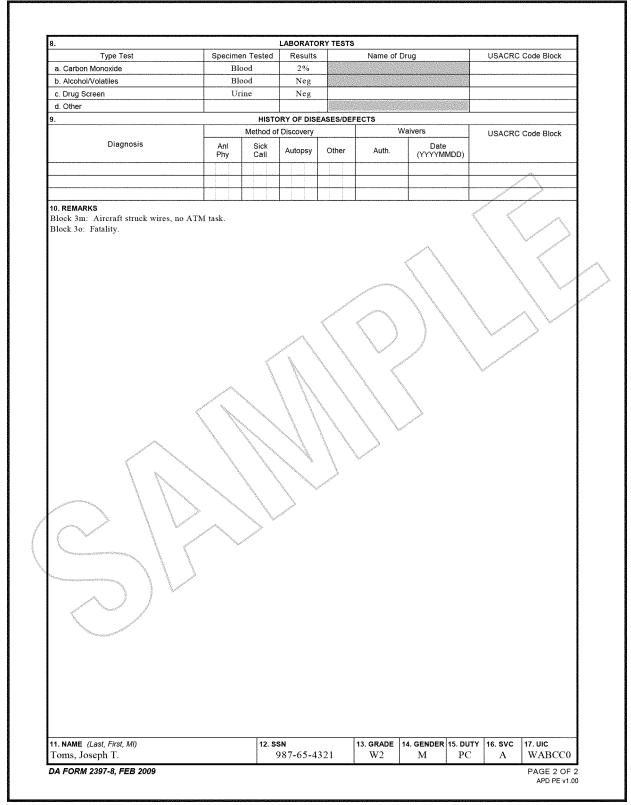


Figure 3-10. Example of a completed DA Form 2397-8, Part IX, Personal Data—continued

- a. Also see paragraph 3–11.
- b. Complete instructions as follows:
- (1) Block 1.
- (a) Block 1a. Check "Definitely" box if person made an error that caused or contributed to the accident. Do not check the "Definitely" box unless the relationship of the error to the accident is fully substantiated in the present and contributing findings of DA Form 2397–2 and analysis part of the DA Form 2397–3. Check the "Suspected" box if the individual committed an error that is suspected to have caused or contributed to the accident. Suspected factors must also be fully substantiated in the present and contributing findings of the DA Form 2397–2 and the analysis of the 2397–3. Check "None" or "Undetermined" box, as appropriate.
  - (b) Block 1b. Check the appropriate box.
- (2) *Block 2.* Most items are self-explanatory. Record hours as appropriate. For items d through 1, the 24-, 48-, and 72-hour periods are calculated to the time of the accident.
- (3) *Block 3*. Most items in block 3 are self-explanatory. The sources for this information will be the individual's individual aircrew training folder (IATF) folder and DA Form 759 (Individual Flight Record and Flight Certificate-Army). Those items requiring further explanation are indicated below.
  - (a) Blocks 3a-h. Can be obtained from Part III of the individual's DA Form 759.
  - (b) Blocks 3i-k. Can be obtained from Part II of the individual's DA Form 759.
- (c) Block 3l. Enter the ATM task number that best describes flight profile (takeoff, climbs, turns, straight and level, hovering autorotation) that was in progress when the emergency situation developed. An event becomes an emergency whenever an error by the crew, a materiel failure, an obstacle strike, or other unpredictable event creates a need for an emergency response. If no ATM task applies, leave blank and explain the flight profile/activity in block 10.
- (d) Block 3m. Pertains to the ATM task required to cope with the emergency. A tail rotor strike may result in a loss of antitorque control, thereby requiring the performance of the task procedures prescribed for an antitorque malfunction. If no ATM task applies, leave blank and explain the flight profile/activity in block 10.
- (e) Block 3n. If "Yes" box is checked, identify in block 9 the condition for which the waiver was granted and the headquarters authorizing the waiver (DA, U.S. Army Medical Department Activity (MEDDAC)). If waiver data clarification is needed, enter a brief explanation in block 10.
- (f) Block 3o. Report an "S" for satisfactory or "U" for unsatisfactory. If result is "U," enter a brief explanation in block 10. If the evaluation has been delayed, enter a "dash" to indicate information is not available and explain delay in block 10.
- (g) Block 3p. Enter date of post-accident medical examination or admission to a medical facility for treatment of injuries resulting from the accident. For non-survivors, enter date of autopsy.
- (h) Block 3q. Check the appropriate box to indicate if the blood and urine laboratory test required by AR 385–10, paragraph 3–16, were accomplished.
  - (i) Block 3r. Enter the individual's date of redeployment from a combat theater, if applicable, (yyyymmdd).
- (4) *Block 4*. Flight and crew duty experience will be completed for all crew members specified in paragraph 3–11, requiring a DA Form 2397–8. The source of this data is the individual's DA Forms 759 and 759–1. Flight experience will be recorded to the nearest hour (no tenths).
- (a) Block 4a(1). Pertains to flight experience, involving military operations, by category of aircraft. Combat, imminent danger, and flight experience in accident MTDS aircraft is also recorded in this block.
- (b) Block 4a(2). Civilian. Civilian flight experience regardless of duty, not involving military operations (For example, flying clubs, instructional, hobby, pleasure, commercial) is to be entered in this block by category of aircraft.
  - (c) Block 4a(3). Total time. Self-explanatory.
- (d) Blocks 4b and e. Duty experience. Block b pertains to rated aviator duties and item e pertains to other crew duty experience. Enter the total time for the duty listed. The source of this information is the individual's DA Form 759–1.
- (e) Block 4c. Flight condition experience. Enter the total flight hour experience in block 4c(1) for flight conditions listed. The source of this information is the individual's DA Form 759–1.
- (f) Block 4d. Monthly flight hours. Pertains to flight time in accident MTDS aircraft for the current calendar month plus the preceding 30, 60, and 90 days up to and including the accident flight.
  - (5) Block 5. Pertains to maintenance, medical, support, and other non-rated personnel only.
- (a) Blocks 5a, 5b, and 5c, Enter the individuals MOS designation and title. The information source is the individual's personnel qualification record.
- (b) Block 5d. Enter the task number associated with the error the individual committed. The source of the task number will be the Soldier's Manual, ATM, or TC 1–210 (the Commander's Guide) that addresses the task.
  - (c) Block 5e. Self-explanatory.

- (d) Block 5f. Applies to government civilian employees. Source of information is the individual's job description and performance standards. If "No" box is checked, enter a brief explanation in block 10.
  - (6) Block 6. Enter the case number shown on DA Form 2397-1 (see table 3-6).
- (7) Block 7. Complete block 7 only if form applies to personnel associated with an aircraft other than "case aircraft" in accidents involving a multiple aircraft event.
- (8) *Block 8.* Record toxicological laboratory analysis results. In the "Specimen Tested" column, enter "blood," "urine," to indicate the source of the specimen. If no specimen was tested, enter "None." If carbon monoxide is detected, enter a % in the results block. If not present enter a "Neg" in the results block. Enter "Pos" or "Neg"in the results block for other drugs identified as present and the drug name in the appropriate box. If a drug(s) was administered by medical personnel following the accident but prior to collection of the test specimen, record this information in block 10. Use standard terminology to report methods and results. In accordance with AR 385–10, chapter 3, the tests listed as items a, b, and c, are MANDATORY for ALL crew members and/or any fatality even if there seems to be no apparent likelihood of positive results. Timelines of the test is important and the specimens should be acquired as soon as possible following the accident. Significant results should be briefly explained in block 10 and thoroughly discussed in the analysis part of the narrative (DA Form 2397–3). If specimen testing was required by AR 385–10 but not accomplished, explain why it was not accomplished in block 10, remarks.
- (9) *Block 9.* Complete block 9 if block 3n is checked "Yes" or autopsy report reveals significant findings of preexisting diseases/defects. For waivers, enter the approval authority for the waiver and the date of issuance in the appropriate block.
- (10) *Block 10.* Significant medical history pertinent to the accident investigation should be briefly explained in block 10. Medical history that contributed to the accident or may have had bearing on the accident will be explained on the DA Form 2397–3.
  - (11) Block 11. Self-explanatory.
  - (12) Block 12. Enter the individual's social security number.
  - (13) Block 13. Enter grade code. Select code from Table 3-8.
  - (14) Block 14. Enter "M" to indicate male or "F" to indicate female.
- (15) *Block 15*. Enter duty code. For crew members enter the duty code recorded on the DA Form 2408–12. For other personnel, select code from list at table 3–5.
  - (16) Block 16. Enter personnel service code. Select service code from list at table 3-9.
  - (17) Block 17. Enter a 6-digit UIC of unit to which this individual was assigned at time of accident.

#### 3-31. Completion instructions for DA Form 2397-9, Part X, Injury/Occupational Illness Data

			PAR	T X - IN	JURY	OCCUPAT	IONAL I	LLNESS	FT ACCIE DATA agency is OC			REQU		S CONT	TROL SYMBOL 09
1.						DEC	REE OF I	NJURY (Ch	eck only the m	ost seve	ere injury)				
		nane	ent Total Di ent Partial [	-		e. Rest	Away Fro ricted Wor cal Treatm		First Aid			Aid Only ing and P	resumed D	ead	
2. N	UMBER C	FLO	OST WORK	DAYS	a. Day	s Away Fro	n Work	-	b. Days Hos	pitalize	ed		c. Days of F	Restricted	d Activity
3. U	NCONSC	ous	;	Hrs		Min		Nor	e 4. Al	INESI	4	Hrs	М	in	None
	JURIES				ries	· · · · · · · · · · · · · · · · · · ·	_	Mec	hanism				Cause F	actors	
No. a.	Body Reg b.	gion	Primary Aspect c.	As	ondary pect d.	Inj Type/Res e.	ult	Action f.	Qualif g.	er		ject n.	Actio	on	Qualifier j.
	B 0	6	0 3	0	4	<del>-}</del>	4 0	4	0	1	1	4	0	6	1 3
1	Skull		Both	Cent	ral	Crush		Against	Aircraft		Impact		Collapsed		Occupiable Space
	D 4	9	0 9	0	4		8 0	4	0	11	1	4	0	6	1 3
2	Aorta		Midline	Cent	ral	Trans-cc on	i Strucl	C Against	Aircraft	gh week service and	Impact		Collapsed		Occupiable Space
					<u></u>	4-4-4				- Marian Carlotte	1	1			
	kannasa makanana kannasa makanana kannasa kannasa kannasa kannasa kannasa kannasa kannasa kannasa kannasa kanna										Samuel Sa	and the second		And the state of t	and the state of t
					<u></u>			1/		À					
					<u> </u>										
						The same of the sa						•			
Section of the second		7		1			1						ļl.		<u> </u>
The state of the s		ana an	enconcentral of												
311/01/01/	EMARKS	(Us	e additiona.	\ \		,	TE OF DE	A.T.I.					9. DUTY	STATIS	s ✓ On Duty
	ERFORM	<b>D</b>	No			DEATH / DA juries/2007		1111					J. DUIT	SIAID	Off Duty
	NAME (La ns, Josep	-						- 1	<b>SSN</b> 987-65-4321	- 1	2. GRADE W	2	13.GEND M	ER 14.	
15a	. svc A		b. HOME A			nsville, K	7			C.	DOB (Y	YYYMMDD) 101	d. DATE		(YYYYMMDD) 20101
e. T			EE BEGAN		-	f. WAS EM			Yes 🗸		ADDRESS		OF HOSPIT	AL	
h. A			HYSICIAN all			i. LOG NUN	1BER	16.	UIC WABCC0		Baghdad, I				
			Date (YYY	YMMDD) 0626		b. Time	121	C. A	cft Serial No.	1	8. OTHER A	CFT SER	IAL NO.	1	JURY COST ,100,000.00

Figure 3-11. Example of a completed DA Form 2397-9, Part X, Injury/Occupational Illness Data

- a. Also see paragraph 3–12.
- b. Complete instructions as follows:
- (1) Block 1. Check the appropriate box to indicate the highest degree of injury/occupational illness for this individual. Degrees of injury/occupational illness are defined below:
  - (a) Block 1a. Self-explanatory.
- (b) Block 1b. Permanent Total Disability. Any nonfatal injury or occupational illness that in the opinion of competent medical authority, permanently and totally incapacitates a person to the extent that he cannot follow any gainful employment.
- (c) Block 1c. Permanent Partial Disability. Any injury or occupational illness that does not result in death or permanent total disability, but in the opinion of competent medical authority, results in permanent impairment through loss or loss of use of any part of the body, with the following exceptions: Loss of teeth; Loss of fingernails or toenails; Loss of tips of fingers or tips of toes.
  - (d) Block 1d. Days Away from Work (Days lost).
  - (e) Block 1e. Workday(s) of Restricted Work Activity.
  - (f) Block 1f. Medical Treatment Beyond First Aid.
  - (g) Block 1g. First aid only.
  - (h) Block 1h. Missing and Presumed Dead. Individual not located at the time of the report.
- (2) *Block* 2. If block "d" and "e" was checked in block 1, enter number of days away from work, the number of days hospitalized, and days of restricted work activity in spaces provided. Ensure that days away from work (2a) is not inclusive of the days hospitalized (2b).
- (a) Block 2a. Days Away From Work. The actual or estimated number of days lost that the individual could not work excluding the day of the injury/occupational illness. Include quarters, bed rest, convalescence leave, or time that a physician indicated the individual could not work regardless of whether the individual was scheduled to work. Count all calendar days including weekends and holidays. For example, if the individual was injured on Friday and the individual could work on Monday, if the physician or licensed health care professional indicated they should not work over the weekend, enter 2 days. If there is no information from the physician, enter 0 days. Enter the appropriate number in block 2a.
- (b) Block 2b. Days Hospitalized. The actual or estimated number of days the individual was hospitalized as an inpatient/admitted receiving treatment. Days hospitalized for "observation only" are only included if a workday is missed. Enter the appropriate number of days hospitalized in block 2b.
- (c) Block 2c. Days of Restricted Activity. (Person is temporarily unable to perform regular duties; job transfer, light duty/profile.) Enter the actual or estimated number of days the individual was unable to perform one or more routine job functions (regularly performed by the individual at least once per week), or could not work a full workday they would otherwise have been scheduled to work; or a physician or licensed health care professional recommends that the employee not perform one or more routine functions of his/her job, or unable to work a full workday they would otherwise have been scheduled to work. Enter the number of days of restricted activities in block 2c. The day count may be stopped if the employee leaves the job for a reason unrelated to the injury or illness or the count reaches the cap of 180 days.
- (3) *Block 3*. If the person was unconscious, enter the duration in hours and minutes, and show the cause and mechanism, if known, in block 5. If none, check none.
  - (4) Block 4. If amnesia was present, show duration and explain in block 6. If amnesia was not present, check none.
- (5) Block 5. Describe individual injuries in descending order of severity and associated cause factors, using the applicable information codes following these instructions.
- (a) Column a. Enter number "1" for most severe injury/occupational illness followed by "2," "3," until all injuries have been listed. Only six injuries can be recorded per individual per form. Use additional DA Forms 2397–9 when greater than six injuries are coded.
- (b) Columns b through e. Using information codes at table 3–10 following these instructions, enter the appropriate numeric and/or alpha numeric code in each column. In the appropriate space below the code, enter the word(s) describing the injury/occupational illness.
- (c) Columns f and g. Enter the action code and qualifier code from table 3–10 that best describe the injury/occupational illness mechanism (how the injury/occupational illness occurred).
- (d) Columns h, i, and j. Enter the subject, action, and qualifier codes from table 3–10 which best describe, from an engineering viewpoint, what aspects of the aircraft contributed to the injury/occupational illness cause factors (why injury/occupational illness occurred). The purpose of these columns is to select those subjects, action, and qualifier codes that form a sentence or phrase that describes what aspect of the engineering/design of the aircraft should be

looked at for potential modification to avoid a similar injury/occupational illness in a future similar accident. For example, if the occupants of an aircraft sustained post-crash burns due to fuel lines breaking in the crash sequence, one could code: Subject: "10, Fuel lines," Action: "03, Broke," Qualifier: "07, Improperly."

- (6) *Block* 6. Enter any additional information which further clarifies information coded on the DA Form 2397–9. For instance, if the flight surgeon thinks the available codes do not describe the injuries, the mechanism of injury/occupational illness, or the injury/occupational illness cause factors, this block provides the opportunity for further description. It is imperative that any additional information be linked to a specific block/column on the form.
- (7) Block 7. Check the appropriate box to indicate whether or not an autopsy was performed. If an autopsy was not performed on a fatally injured Soldier, civilian, or Army contractor, explain why in block 6.
  - (8) Block 8. Report the official cause and date of death, based on an autopsy report, if possible.
  - (9) Block 9. Check the appropriate duty status for government personnel.
  - (10) Blocks 10 through 14. Enter appropriate information for the individual concerned.
  - (11) Block 15. Block 15a through 15i entry are required for all injured individuals.
  - (12) Block 16. Enter individual's unit UIC.
  - (13) Block 17. Enter the case number shown on DA Form 2397-1.
- (14) *Block 18*. Use only in cases involving more than one aircraft. Enter the serial number of other aircraft only on the DA Form(s) 2397–9 that pertains to personnel injuries associated with the other aircraft.
  - (15) Block 19. Enter the injury or occupational illness/fatality cost in accordance with DA Pam 385-40, table 1-1.

# 3-32. Completion instructions for DA Form 2397-10, Part XI, Personal Protective Escape/Survival/Rescue Data

PART XI - F	AL REPORT ( PERSONAL PRO his form, see DA F	TECTIVE	E/ESCA	PE/SUR	VIVAL/R	ESCUE	DATA		REG		NTS COI CSOCS-	NTROL S' 309	YMBOL
1. DID THIS INDIVIDUAL SU (NOTE: If "yes" box is								ENT?	<b>√</b> Ye	sn	10		
2.		PERSO	NNEL PI	ROTECTIV	VE/REST	RAINT/St	JRVIVAL	EQUIPME	NT				
Item	Туре	Re- quired	Avail- able	Used	Pro- duced Injury	Al- lowed Injury	Pre- vented Injury	Re- duced Injury	Func- tioned as De- signed			ion Codes	i
	(1)	(2)	(3)	(4)	(5)	(6)	(7)	(8)	(9)		·	10)	<del></del>
a. Helmet	HGU-56P	Y	Y	Y	N	Y	N	N	Y	1057	1099		
b. Visor				1								$\angle \lambda$	
c. Glasses											April Printer	and the second	
d. Flight Suit											A Partie	and the state of t	
e. Flight Gloves										1			
f. Flight Jacket											<u> </u>		1
g. Boots											1	300	Control of the last
h. Other Clothing								and the second			3/2/6		
i. Lap Belt									1		1	1	
j. Shoulder Harness								-				1	$\mathbb{A}_{\geq}$
k. Gunner Harness							a state of the sta	and the same of th	1	1		1	1
I. Inertia Reel						and the same		1	1				
m. Seat/Litter					-		and the second	1	1	1			and the same
n. Survival Equipment			~~~~~	<b>†</b>	1	1		İΥ	Table 1	1	N. Jacobson		1
0.					$\wedge$		1	/	7		je.	and the same	
p	***************************************	<b>†</b>	<u> </u>	1	1	1	1	33/10	f	1	100	1	<b>†</b>
3.	PERSON	NEI EVA	CUATIO	N/ESCAPI	F .	<del></del>		artes referen		Infi	ormation (	Codes	1
a. Method of Escape	, 2,1,00,11		00,0.	7	7	1	1	<del>\</del>	1				
b. Location in Aircraft		- Andrew Co	<i>&gt;</i>		+>		_	-	1	1	3	1	2
c. Exit Attempted		Salah Mir	37		11	1		1	0	-		1	2
	<del></del>			$\overline{}$	$\rightarrow$	<del></del>	1	\ .	0				
d. Exit Used	<u></u>	1	7	10 F	<del>\</del>	- A	- 1	Jan Marie	+				
e. Aircraft Attitude During		7	1 37	100	1	1			A0				
f. Cockpit/Cabin Condition	ins 🔪	<del></del>	<del>\</del>		1/2	$\leftarrow$	- Aleksan		4			1	
g. Escape Difficulties		1	<u> </u>	1 1/2		<u> </u>	**		98				
4. LAPSED TIME FO			Date		Hour of I		Lapsed					ENT TO AC	
N. C. C. C.		MM	/ L	DD \	HR	MIN	HR	MIN	-				0.52.11.
a. Notification of Rescue		270	-		<u> </u>				a. Ic	Aircraft ii	n Nautical	Miles	
b. Individual Physically R	<del></del>		7						ļ <u>.</u>		21		
c. Individual Actually Abo	1 300	9		460.					b. To	Ground \		Statute Mil	es
d. Rescue Completed/At								~~~			24		
The Control of the Co	SONNEL SURVIVA	L/RESCÜ	JE						Informat	ion Code	5		
a. Survival Problems End	<del></del>												
b. Means Used to Locate	Individual												
c. Rescue Equipment Us	sed \												
d. Factors That Helped F	Rescue												
e. Factors Complicating	Rescue												
f. Individual Physical Col	ndition					4							
g. Vehicles Actually Perfo		(Specify	')										
h. Other Vehicles Assistin	ng in Rescue (Sp	ecify)											***************************************
7. REMARKS (Use addition	nal sheet if require	d)											
8. NAME (Last, First, MI)				10.0	RADE	44 0	ENDER	12 0	UTY	13. 8	VC	14. UIC	
Toms, Joseph T.				,,,,	W2	11.6	M	12. 6	PC	1.5. 8	A	Į.	BCC0
, <u>r</u>												!	
15. CASE NO. a. Date	(YYYYMMDD) b	. Time		A A -4	ft Serial N	lo.			16 0	THER ACT	T SERIAL	NO	

Figure 3-12. Example of a completed DA Form 2397-10, Part XI, Personal Protective Escape/Survival/Rescue Data

- a. Also see paragraph 3-13.
- b. Complete instructions as follows:
- (1) Block 1. Check the appropriate box. If the "Yes" box is checked, ensure that a DA Form 2397-9 is completed for this individual.
- (2) *Block* 2. Personal protective/restraint/survival equipment. The first column lists the major, common items of equipment worn/used by aircrew members and passengers. Report ONLY those items which had a role in the cause/prevention/reduction of an injury/occupational illness or failed to function as designed. Also list in block 2(o) or 2(p) other protective/survival items of equipment which, if available, could have prevented/reduced an injury/occupational illness or assisted in the rescue and survival efforts. Complete the columns to the right of each item that had a role in the accident, as follows: For columns (2) (9) enter "Y" for "yes," "N" for "no," and "U" for "unknown." For column 10, select the appropriate equipment information codes from table 3–11.
- (a) Column (1). Type. Enter the type of equipment in the "Type" column. For example, helmet-enter HGU-56P; visor-enter clear, or tinted, or anti-laser; glasses-enter prescription, nonprescription, tinted, untinted, contact lenses, inserts, anti-laser, and flight suit-enter aircrew combat uniform (ACU).
- (b) Column (2). Required. Enter "Y" for items that were required for the mission by directives. For example, Army regulations, major command/unit SOPs, or "N" for items not required, but which could have reduced the injury/occupational illness severity.
  - (c) Column (3). Available. Make appropriate entry for each applicable item that was available to the individual.
- (d) Column (4). Used. Make appropriate entry for each applicable item used. Just because an item was available does not mean it was used. Used pertains to the use of an item as intended for the condition/situation.
- (e) Column (5). Produced injury/occupational illness. An item of equipment may have produced an injury/occupational illness by its use or by its malfunction. For example, a lapbelt may have produced an injury/occupational illness to the individual (bruise on hip) but still may have prevented or reduced further injuries.
- (f) Column (6). Allowed injury. An item of equipment may have allowed injury due to the forces of the accident exceeding the design of the equipment, or an individual not properly wearing or utilizing the item. For example, the chin strap of the helmet not being secured.
- (g) Column (7). Prevented injury/occupational illness. An item may have prevented an injury by its use even though the item received damage; for example, damage was done to the helmet, but the individual did not receive an injury. If no injury occurred to the area protected by the item then enter "Y."
- (h) Column (8). Reduced injury/occupational illness. An item may have reduced the severity of an injury/occupational illness. For example, the individual received a severe blow to the head and incurred a head injury, but the helmet reduced the severity of the injury.
- Note. Columns (6) and (7) cannot be marked "Y" for the same item. An item cannot allow and prevent an injury at the same time. Likewise columns (7) and (8) cannot be marked "Y" for the same item. If an injury is prevented, there is nothing to reduce.
- (i) Column (9). Functioned as designed. This column is used to indicate the performance of equipment during the accident sequence to include rescue and survival. For example, if it is determined that the item performed the job for which it was intended, enter "Y" for "yes." If the item was damaged, explain the damage in the "Information Codes" column. For all items that did not perform their intended function, enter "N" for "no" in the "functioned as designed" column and explain in the "Information Codes" column with the appropriate codes.
- (j) Column (10). Information codes. The four columns under this title are used to report equipment problems/conditions pertaining to the performance of personnel, protective, restraint, and survival equipment. There are four blocks provided for each item of equipment to permit the identification of up to four separate problems/conditions. Each item with a problem/condition will be coded with a four-digit information code from table 3–11. For example, if a helmet dislodged and the individual received a head injury/occupational illness due to its loss, enter "N" in columns (7), (8) and (9) for the helmet row and enter the code 1122 in the "Information Codes" column. For example, 11 (dislodged), 2 (nape strap), 2 (loose). All undamaged items that performed their job do not require codes in the "Information Codes" column.
- (k) Survival equipment components. The empty spaces in block 2 (o and p) are to be used to report problems/conditions with specific items of survival equipment/components. These are to be entered in the "Information Codes" columns using four-digit codes. More than one problem/condition may apply to any of the survival equipment/components. The first two digits are obtained from the survival equipment/component list and the second two digits are obtained from the problem/condition code at table 3–12. Examples are—
- 1. An aviator's SDR-5/E strobe light failed during use because the battery became inoperative. Enter "Strobe light" in one of the empty spaces (o or p). The "Type" would be entered as "SDR-5/E." Any other column across the page

may be used as applicable. The first four-digit code entered in the first "Information Codes" column should be "8438"; the second four-digit code should be "8440."

- 2. An aviator could not get a survival radio before the mission because the radios were locked up in supply. Enter "survival radio" in an available empty space (o or p). The "Type" would be entered as "PRC-112." The four-digit code entered in the "Information Codes" column would be "8101."
- 3. In the event of a non-survivable accident in which there were no attempts to use the survival equipment/components, no entry is required unless the accident investigation board feels such reporting would benefit accident research/analyses.
- 4. If an item of equipment is used that is personal property (non-issue), such as, pocket knife or plastic compass, and a problem/condition exists (For example, "lost"), enter the item in blank spaces o or p (block 2) as "Pocket knife" and "Personal" in the "Type" column. The four-digit code in the "Information Code" column should be "9936."
  - (3) Block 3. Personnel evacuation/escape.
  - (a) Block 3a. Method of escape. Enter the appropriate information codes from table 3-13 in the space provided.
- (b) Block 3b. Location in aircraft. Enter individual's location in the aircraft at the time of the accident in the boxes provided using the codes at table 3–14. For example, an aviator was in the cockpit, forward section, left side, facing forward, in his seat. Code in sequential blocks 1, 1, 2, 1, 2 (one number per block).
  - (c) Block 3c.
- (d) Block 3d. Exit attempted. Enter information code(s) from table 3–15 in order and in sequence if more than one exit attempt was made. The last coded entry, if more than one exit was attempted, will be the exit used by the individual to egress. For example, the normal exit was tried but it jammed, so exit was made through an opening in the aircraft wreckage. Code "1" in the first box and code "3" in the second box.
- (e) Block 3e. Aircraft attitude during escape. Enter information code from table 3–17 to best describe the attitude of the aircraft at time of escape.
- (f) Block 3f. Cockpit/cabin condition. Enter the cockpit/cabin condition code from table 3–18. Consider only that portion of the aircraft this individual occupied at the time of the accident. Disregard post crash fire damage.
- (g) Block 3g. Escape difficulties. From table 3–19 select those difficulties the individual experienced. A total of six may be selected. Enter only one two-digit code per block. Occupants fatally injured during the mishap do not require an entry.
- (4) *Block 4*. Cumulative lapsed time for rescue. Enter local time in the appropriate blocks using the 24-hour clock. Lapsed time will be the cumulative number of hours/minutes from time of the accident for each phase. Leave blank if fatally injured at impact.
- (5) *Block 5*. Distance from accident site to actual rescue vehicle at time of accident. Enter nautical miles for airborne rescue vehicles or statute miles for ground rescue vehicles.
- (6) *Block* 6. Personnel survival/rescue. Enter the appropriate information codes in the spaces provided. Use one two-digit code per block.
- (a) Block 6a. Survival problems encountered. Review the list at table 3–20 for potential problems this individual may have encountered and enter codes sequentially in the boxes provided. Occupants fatally injured during crash do not require an entry for items a through e.
- (b) Block 6b. Means used to locate individual. Enter, in sequence, information codes from table 3-21 for means used to locate individual.
  - (c) Block 6c. Rescue equipment used. Enter code in sequence of items used from table 3-22.
  - (d) Block 6d. Factors that helped rescue. Enter codes from table 3-23 which assisted in the rescue of the individual.
- (e) Block 6e. Factors that complicated rescue. Enter the code from Table 3-24 which complicated the rescue of the individual.
- (f) Block 6f. Individual's physical condition. Enter the code from table 3-25 which best describes the individual's physical condition.
- (g) Block 6g. Vehicle(s) actually performing evacuation. Enter the type vehicle(s) performing the evacuation. If the vehicle is an aircraft, enter the mission, type, design and series. For example, UH–1H, if vehicle is a motor vehicle, state vehicle type; military ambulance, civilian ambulance, private auto.
- (h) Block 6h. Other vehicles assisting in rescue. Refer to "g" above and enter the type vehicle(s) which assisted in the rescue.
- (7) *Block 7*. Remarks. Explain failures, malfunctions, injuries, and other problems not adequately defined by code terms. When "other" is coded, use this block to explain details.
  - (8) Blocks 8 and 9. Self-explanatory.
  - (9) Block 10. Enter grade code. Select code from table 3-8.
  - (10) Block 11. Enter "M" to indicate male or "F" to indicate female.
- (11) *Block 12*. Enter duty code. For crew members, enter the duty code recorded on the DA Form 2408–12. For other personnel, select code from list at table 3–5.
  - (12) Block 13. Enter service code. Select service code from list at table 3-9.

- (13) Block 14. Enter a 6-digit UIC of unit to which this individual was assigned at time of accident.
- (14) Block 15. Enter the case number shown on DA Form 2397-1 (see table 3-6).
- (15) *Block 16*. Uses only in cases involving more than one aircraft and make entry only on the form identifying personnel from the other aircraft.

# 3-33. Completion instructions for DA Form 2397-11, Part XII, Weather/Environmental

THER ENVIRONMENTAL ACCIDES  a. Animals b. Fowl c. Surface d. Noise e. Chemicals f. Radiation g. Glare	h. Fo i. Te j. Vil k. Du	JENCE reign Ob mperatur pration	ESENT DUR	ing
ACCIDEI a. Animals b. Fowl c. Surface d. Noise e. Chemicals f. Radiation	h. Fo i. Te j. Vil k. Du l. Ot	JENCE reign Ob mperatur pration ist	ects	ing
b. Fowl c. Surface d. Noise e. Chemicals f. Radiation	i. Te j. Vil k. Du l. Ot	mperatur oration ist		
c. Surface d. Noise e. Chemicals f. Radiation	j. Vil k. Du l. Ot	oration est	e	
d. Noise e. Chemicals f. Radiation	k. Du	ıst		
e. Chemicals f. Radiation	I. Ot			
f. Radiation	<del></del>	her (Spe		
	m. N		cify)	
g. Glare		one		
J				
). AIRCRAFT ICING		Icing	Severity	ji.
None Yes	Trace	Light	Moderate	Se
Name of the second	(1)	(2)	(3)	
a. Main Rotor Blades		1		
b. Wings		/	202	100
c. Propellers		1	V 3	
d. Control Surfaces			1	N
e. Rotor Head	N			1
f. Tail Retor	1		1	
g. Fuselage				
h. Pitot Static System	1	N		1
i. Aileron	1		1 2	
j. Engine Air Inlet			and the state of t	
k. Fuel Vents			d d'	
I. Antenna				
m.Windscreen				
n. Other				
1. MOON ILLUMINATION	DATA (i	or night a	iccidents)	
a. Moon Above Horizon	Yes	✓ No		
b. Moon Visible	Yes	✓ No		
		n		
d. Percent of Moon Illumination				
·				
			ises 200	L
		tinuous, "		- 1
				C
				4
b. Moderate			1	-
				4
e. None			1	
b c d e f. g h i. k l. m n 1 e b c c e f 2	Degrees About De	(1)  Main Rotor Blades  Wings  Propellers  Control Surfaces  Rotor Head  Tail Rotor  Fuselage  Pitot Static System  Aileron  Engine Air Inlet  Fuel Vents  Antenna  Mindscreen  Other  MOON ILLUMINATION DATA (fa. Moon Above Horizon  Percent of Moon Illumination 0  Moon O'clock Position From  Time (LCL) of Moon Rise and Set 2  TURBULENC  None (If "Yes" check "C" for con and "O" for occasional)  Light  Moderate  Severe  J. Extreme	(1) (2)  Main Rotor Blades  Wings  Propellers  Control Surfaces  Rotor Head  Tail Rotor  Pfuselage  Pitot Static System  Aileron  Engine Air Inlet  Fuel Vents  Antenna  Mindscreen  Other  MOON ILLUMINATION DATA (for night each of the continuous)  Moon Visible  Percent of Moon Illumination  Percent of Moon Rise and Set  Turbulence  None  (If "Yes" check "C" for continuous, "and "O" for occasional)  Light  Moderate  Severe  J. Extreme	(1) (2) (3)  Main Rotor Blades  Wings  Propellers  Control Surfaces  Rotor Head  Tail Rotor  Fuselage  Pitot Static System  Aileron  Engine Air Inlet  Fuel Vents  Antenna  Mindscreen  Other  MOON ILLUMINATION DATA (for night accidents)  Moon Visible  Yes ✓ No  Moon Visible  Yes ✓ No  Moon Degrees Above Horizon  Percent of Moon Illumination  Percent of Moon Rise and Set 2300 L Rises 200  TIME (LCL) of Moon Rise and Set 2300 L Rises 200  TURBULENCE  None (If "Yes" check "C" for continuous, "I" for interm on the continuous of the

Figure 3-13. Example of a completed DA Form 2397-11, Part XII, Weather/Environmental

- a. Also paragraph 3–14.
- b. Complete instructions as follows:
- (1) *Block 1*. Check the appropriate box to indicate if weather or other environmental condition caused or contributed to the accident. Weather is a definite or suspected factor only when not forecast, improperly forecast or when it was unavoidable in the accident sequence of events. Weather must be supported in the present and contributing findings of the DA Form 2397–2 and the analysis of the DA Form 2397–3. See chapter 2, paragraph 2–6, for a complete discussion on determining the environmental role in the accident.
  - (2) Block 2.
  - (a) Block 2a. Specify in degrees centigrade. If the temperature is actual, line out "est."
- (b) Blocks 2b and 2c. Enter the altimeter setting in inches of mercury (Hg) and altimeter reading in feet at the time of the accident. This must be taken as soon as possible from the accident aircraft's altimeter. If the altimeter was damaged so that the setting cannot be determined, enter "unknown" and explain in block 14 or continuation sheet. Do not use estimates.
  - (c) Block 2d. Prefix the pressure altitude with a plus or minus.
- (d) Block 2e. Check the appropriate box which reflects the general weather conditions at the time and location of the accident.
- (3) Block 3. When a scattered, broken, or overcast sky condition is checked, specify the altitude in the space provided.
  - (4) Block 4. Check the appropriate box.
  - (5) Block 5. Enter visibility in nautical miles.
- (6) *Block 6.* Obstructions to visibility are shown in the two basic categories of "natural" and "induced." If visibility was restricted, it is extremely important to accurately distinguish between natural and induced.
- (a) Block 6a. More than one may apply. For example, both haze and smoke may have existed at the same time during the accident sequence; therefore, both would be checked.
- (b) Block 6b. Check the induced obstructions to visibility that existed during the accident sequence. For example, if the crew lost all reference when they came to a hover due to rotor wash picking up and circulating a large cloud of dust, check block 6b(3), "Blowing Dust."
  - (7) Block 7. Use existing winds at the time of the accident.
  - (a) Block 7a. Enter the winds aloft at the assigned or en route altitude.
- (b) Block 7b(1). Enter surface wind direction in degrees magnetic. If wind direction is varying, (For example, "360 variable 010,") then enter the average wind direction on this line "360/10."
- (c) Block 7b(2). Enter surface wind velocity in knots and gust spread. If surface winds are gusty, enter the surface winds as reported. For example, for winds reported as 20 knots gusting to 38 knots, enter as "20G38" (gust spread of 18)
- (8) *Block* 8. Indicate significant weather present at the time of the accident. A maximum of three conditions may be checked.
- (9) *Block 9.* Indicate other environmental factors that caused, contributed to, or may have influenced human performance that caused or contributed to the accident.
- (10) *Block 10*. If aircraft icing was present during the accident sequence, place an X in the "Yes" block and indicate those portions of the aircraft affected by placing an X in the appropriate severity column.
  - (11) Block 11. To be completed for night accidents only. If item "a" is checked "No," no other entries are required.
- (12) *Block 12*. If turbulence existed, check the appropriate block. C–Continuous (More than two-thirds of the time.); I–Intermittent (One-third to two-thirds of the time.); O–Occasional (Less than one-third of the time.). If no turbulence existed, check "None."
  - (13) Block 13. Check whether forecast was correct or incorrect. If not known, check "unknown" box.
  - (14) Block 14. Discuss other environmental factors not covered by this form or items that need further explanation.
  - (15) Block 15. Enter the case number shown on the DA Form 2397-1, table 3-6.

## 3-34. Completion instructions for DA Form 2397-12, Part XIII, Fire

TECHNICAL REPO PART XIII - FIRE For use of this form, se	(To be complete	d for all	events ir	nvolving fire)	REQUIREME	ENTS CC CSOCS		M
1. FIRE STARTED (Check D - Definite	e S - Suspected)	D	s	4. IGNITION SOURCE (Continu	ed)		D	
a. Inflight				Static Electricity				7
b. Upon Impact (Less than 1 minu	ıte)	<b>V</b>		m. Other (Specify)				-
c. Upon Impact (More than 1 minu				n. Undetermined				
d. During Refueling				5. COMBUSTIBLE MATERIAL			D	
e. Other (Specify)				a. Main Fuel			7	-
f. Undetermined				b. Auxiliary Fuel		****************		
INDICATIONS OF FIRE     (More than one may apply. Enter 1.	2, or 3 to show sequ	uence)		c. Hydraulic Fluid			IĮ.	
	1	7		d. Engine Oil				7
a. Fire Warning System d.	Smell g.	Other (S	(pecify	e. Transmission Oil f. Electrical Insulation		and the second		-
b. Other Instruments e. 2	Explosion (Sound)			g. Acoustical Materials		-		-
c. 1 Sight f.	External Commo					<del>\</del>		
3. INITIAL AND PRINCIPAL LOCATIO	<u> </u>	T	T	h. Metal (Specify)			-	-
(Enter 1 to indicate initial location, 2 to		D	s	i. Explosives j. Upholstery Materials	_			_
location) a. Engine Section		1	<del> </del>	k. Cargo	n. 3			1
b. Transmission Section		<del>  '</del>	$\vdash$	I. External Material (Specif	<i>A</i>		-+	1
c. Cockpit				m. Other (Specify)	<del>\</del>			+
d. Tail Assembly		-		n. Undetermined	+	\.		+
e. Passenger Section		<del> </del>		6. FIRE EXTINGUISHING SYST	FM	a. Gnd	b. Aircra	ل ش
f. Baggage Compartment		<del> </del>	-			a. Ond	Inst	-
g. External Stores			100	(1) No Effect When Dischar	har	1	mat	_
h. Ammunition Stores			and the state of t	(2) Activated, But Did Not Di		4	and the second	
i. Avionic Section		1	1	(3) Reduced Fire	scrarge	1	ři	-
j. APU			1	(4) Extinguished Fire		76		-
k. Wheel Well		<u> </u>		(5) Not Activated And Not No	ar Fire	1		_
I. Wheel Brake	- A STANDARD		1	(6) Not Activated, But Near F	1	Longon I	1	_
m. Tail Pipe	- ( )	31		(7) Not Installed	<u> </u>		1	_
n. Instrument Panel	1		1 2	(i) (or include	~		<b>.</b>	
o. Battery Compartment		1000	1	7. FIRE SMOKE DETECTION S	YSTEM	Yes	No	8863
p. Heater Compartment		19	7/2	a. System Installed		1 100	1	
q. Fuel Cell (Specify)		1	200	b. Warning System Operate	d Properly			PONUM
r. Wing	The state of the s	1	1	c. Sensors Within Range of				_
s. Gun Turret	1	1	1	8. EFFECT OF EMER SHUTOF				
t. Tail Boom	1	100		(Enter D, S, or U)		Eng	Fuel	
u. Cargo Section	$\rightarrow$	1	a contraction	a. Extinguished Flame				
v. Tires	and the second			b. Reduced Fire				
w. Other (Specify)	Jan Sant			c. No Effects				
x. Undetermined	1			d. Not Accomplished		D	D	_
4. IGNITION SOURCE		D	S	e. Used Faulty Procedure				
a Exhaust Flames				9. GENERAL DATA		<del></del>	L	_
b. Sparks, Friction, e.g., Skidding				a. Est of Aircraft Fire Damag	e (Excl of impa	ct damag	e)	
c. Electrical Sparks				<b>✓</b> 0-25% 26-5	50% 51-75	5%	76-100%	
d. Hot Surfaces, e.g., Exhaust Duc	ets	<b>V</b>		b. Fire Dimension: To Clear	Fire.			
e. Aircraft Subsystem	**************************************			Aircraft Occupants Had To		20		
f. Aircraft Occupant, e.g., Lighted	Cigar			c. Toxicity: Was There Evide	nce of Toxic Proc	iucts?		_
g. External of Aircraft, e.g., Grass F	ire			Yes ✓ No				
h. Cargo				d. Distance To Nearest Ava	lable Military Fire	fighting E	quipment	
i. Explosives				(1) Air Miles (NM):	21 (2) F	Road Mile	s (SM)	2
j. Short Circuit				e. G-Force Activated Fire Ex	tinguishing Syste	em Function	oned As Des	sia
k. Lightning				Yes No	✓ NA			
10. REMARKS (Use additional sheet	if required)	***************************************				***************************************		
11. CASE NO. a. Date (YYYYMMD)	b. Time	C.	Acft Seri	al No.	12. OTHER ACE	FT SERIAL	NO.	

Figure 3-14. Example of a completed DA Form 2397-12, Part XIII, Fire

- a. Also see paragraph 3-15.
- b. Complete instructions as follows:
- (1) Block 1. Check the appropriate box to indicate when the fire started.
- (2) Block 2. Enter a "1" in the appropriate block for the initial indication of fire. Enter "2," "3," for additional indications.
- (3) *Block 3*. Enter a "1" in the definite or suspected block to show the first location of the fire. When the principal location of the fire is different, enter a "2" to show the principal location. For example, ignition might occur at a broken fuel line to the engine. The fire might then spread to a ruptured fuel cell, causing it to become the principal location of the fire.
- (4) Block 4. Check the appropriate box to show the ignition source. If a definite source is not known, investigators are urged to indicate a suspected source. In all cases where a suspected source is indicated, explain in block 10.
  - (5) Block 5. Check the materiel(s) that were the principal source of the fire.
- (6) Block 6. Check the appropriate box(es) to report on the adequacy of ground and aircraft fire extinguishing systems. Ground (Gnd) extinguisher systems include fire trucks, ramp extinguisher. Aircraft fire extinguishing systems include those that are integrally installed (INST) in the aircraft. For example, engine fire extinguishing systems; and/or portable bottle (PORT). Explain in block 10 all malfunctions and failures of the extinguishers/systems. Include nomenclature, NSN, size of extinguisher, type of agent, reason for failure and EIR number.
- (7) Block 7 Check the appropriate box to indicate if a fire/smoke detection system was installed and its function. If "undetermined" is checked, explain in block 10.
  - (8) Block 8. Enter effectiveness of the engine, fuel, and/or electrical shutoff procedure(s).
  - (9) Block 9.
- (a) Block 9a. Check percentage of damage caused by fire. In cases where an in-flight fire results in the crew ejecting from the aircraft, only the fire damage prior to impact should be recorded. The objective of this item is to distinguish between fire damage and impact damage.
- (b) Block 9b. The purpose of this item is to determine the occupant's exposure to fire during the emergency evacuation. Complete the items in all cases, even those in which the occupants were trapped or incapacitated and thus unable to escape. Since it is unlikely that the dimension of the fire will be uniform around the aircraft, select the avenue of greatest distance an occupant will have to traverse to escape.
- (c) Block 9c. In addition to consumption of available oxygen, aircraft fires generate toxic gases such as carbon monoxide, acrolein, and phosgene. These toxic gases may seriously affect aircraft occupants in two ways: severe contamination, irritation of the mucous membrane of the eyes and respiratory passages, and systemic absorption in sufficient quantity to produce varying degrees of incapacitation. If toxic products are suspected to have affected occupants, record on a DA Form 2397–9 for the affected occupant.
- (d) Block 9d. Complete the item even though the equipment was not at the scene of the fire. The objective of this item is to determine the distribution of available firefighting equipment relative to the location of the fire accidents.
- (e) Block 9e. If the impact-activated fire extinguishing system was installed on the accident aircraft, check the appropriate block to indicate its function. If not installed checked, "NA."
- (10) *Block 10*. Enter explanations or clarifications of other items on the form and continue remarks on letter-size paper.
  - (11) Block 11. Enter the case number shown on DA Form 2397-1.
- (12) Block 12. Use only in cases involving more than one aircraft and make entry only on the form applying to the other aircraft. For example, other than the one identified in block 11c.

### 3-35. Completion instructions for DA Forms 2397-13 and 14, Index A and Index B

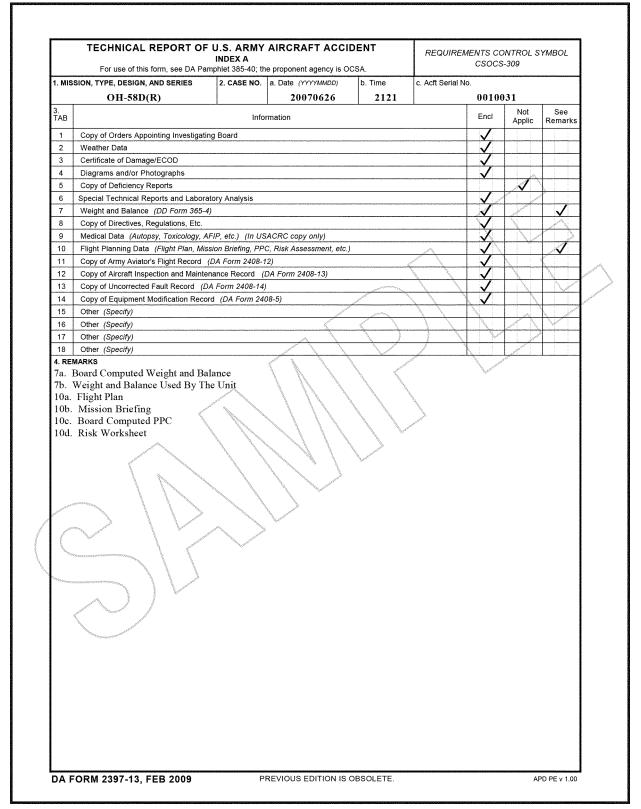


Figure 3-15. Example of a completed DA Form 2397-13, Index A

	TECHNICAL REPORT OF U.S INI For use of this form, see DA Pamphle	DEX B				REQ		ITS CONTR SOCS-309	OL SYMBOL
1. MISSI	ON, TYPE, DESIGN, AND SERIES	2. CASE NO	a. Date (YY	YYMMDD) b	. Time	c. Acft S	erial No.		
	OH-58D(R)		20070	626	2121		•	0010031	
3. TAB		Title			DA F	orm No.	Encl	Not Appl	See Remark
a.	Statement of Reviewing Officials (In Ch	annel Copy Or	nly)		23	97	<b>✓</b>		
b.	Summary				23	97-1	<b></b>		
C.	Findings and Recommendations				23	97-2	<b>√</b>		
d.	Narrative				23	97-3	<b>✓</b>		
e.	Summary of Witness Interviews				23	97-4	<b>√</b>	100	
f.	Wreckage Distribution				23	97-5	<b>√</b>		
g.	In-Flight or Terrain Impact and Crash Da	amage Data			23	97-6	V		
h.	Maintenance and Materiel Data				23	97-7		$ extstyle \checkmark$	
i.	Personal Data				23	97-8	V,		4
j.	Injury/Occupational Illness Data				23	97-9	<u> </u>	47500	
k.	Personal Protection/Escape/Survival/Res	scue Data			23	97-10	✓,	V K	
1.	Weather/Environmental					97-11	✓,	/ '	Y J
m.	Fire				23	97-12			
5. a. Presid	dent (Name and Signature)	IG	BOARD ME	MBERS Branch	Rating	Addre	ss and Tel	I. No.	
			04	AV	SRARA	v IUSA	CRC. Ft	Rucker. A	AL 36362
	D. Leader DIGITAL SIGNATURE 12	3456789 jc	04 Pmail on.lead@us.		7	DSN	558-34		AL 36362
b. Recor	D. Leader DIGITAL SIGNATURE 12 rder (Name and Signature)  H.I. WRITER DIGITAL SIGNATURE 1:	3456789 G	-mail	army.mil	Rating	DSN Addre V USA	558-34	I. No.	
b. Recor	rder (Name and Signature)	3456789 jc	mail on.lead@us. irade W5	army.mil	Rating	DSN Addre V USA DSN	ss and Tel	10 I. No. Rucker, A	
b. Recor	rder (Name and Signature)  H.I. WRITER DIGITAL SIGNATURE 1:	3456789 jc	mail on.lead@us. trade W5 -mail al.rite@us.ar	Branch AV	Rating MAARA	Addree HHC	ss and Tel CRC, Ft 558-24 ss and Tel	I. No. Rucker, A 10 I. No. SB, Hunte	AL 36362
b. Recor	rder (Name and Signature)  H.I. WRITER DIGITAL SIGNATURE 1:	3456789 G	mail on.lead@us. rrade W5 -mail al.rite@us.a	Branch AV army.mil	Rating MAARA	Addre USA DSN  Addre HHC Sava	ss and Tel CRC, Ft 558-24 ss and Tel C 603d A nnah, Gz	1. No. Rucker, A 10 1. No. SB, Hunte A 31499	AL 36362
RALP.	H.I. WRITER DIGITAL SIGNATURE 1: Surgeon (Name and Signature)	3456789 G E 23456789 G E b	mail on lead@us. rade W5 -mail al.rite@us.a	Branch AV army.mil	Rating MAARA	Addre USA DSN  Addre HHC Sava	ss and Tel CRC, Ft 558-24 ss and Tel	1. No. Rucker, A 10 1. No. SB, Hunte A 31499	AL 36362
RALP.	rder (Name and Signature)  H.I. WRITER DIGITAL SIGNATURE 1:	3456789 G E 23456789 G E b	mail on lead@us. rade W5 -mail al.rite@us.a. rade 04 -mail	Branch AV army.mil	Rating MAARA	Addre USA DSN  Addre HHC Sava	ss and Tel CRC, Ft 558-24 ss and Tel C 603d A nnah, Gz	1. No. Rucker, A 10 1. No. SB, Hunte A 31499	AL 36362
RALP c. Flight	H.I. WRITER DIGITAL SIGNATURE 1: Surgeon (Name and Signature)	3456789 G E 23456789 G E 123456789	mail on lead@us. rade W5 -mail al.rite@us.a. rade 04 -mail	Branch AV army.mil	Rating MAARA  Rating FS	Addre USA DSN  Addre HHC Sava DSN  Addre A	ss and Tel CRC, Ft 558-24 ss and Tel C 603d A nnah, GZ	1. No. Rucker, A 10  1. No. SB, Hunte A 31499 45  1. No.	AL 36362 or AAF
RALP c. Flight	rder (Name and Signature)  H.I. WRITER DIGITAL SIGNATURE 1: Surgeon (Name and Signature)  RT B. LIFESAVER DIGITAL SIGNATURE	3456789 G E 23456789 G E 123456789	mail on lead@us. rade W5 -mail al.rite@us.a. rade 04 -mail ob.lifer@us	army.mil Branch AV  rmy.mil Branch MC	Rating MAARA  Rating FS	Addree HHC Sava DSN  Addrev USA	ss and Tel CRC, Ft 558-24 ss and Tel C 603d A mnah, Gz G 333-34	1. No. Rucker, A 10  1. No. SB, Hunte A 31499 45  1. No. ker, AL 36	AL 36362 or AAF
RALP c. Flight	rder (Name and Signature)  H.I. WRITER DIGITAL SIGNATURE 1: Surgeon (Name and Signature)  RT B. LIFESAVER DIGITAL SIGNATURE	3456789 G E 23456789 G E 123456789 G E 6 D	mail on lead@us. rade W5 -mail al.rite@us.ar rade 04 -mail ob.lifer@us rade W4 -mail	army.mil Branch AV Branch MC army.mil Branch AV	Rating MAARA  Rating FS  II	Addree HHC Sava DSN  Addrev USA	ss and Tel CRC, Ft 558-24 ss and Tel C 603d A nnah, GZ	1. No. Rucker, A 10  1. No. SB, Hunte A 31499 45  1. No. ker, AL 36	AL 36362 or AAF
RALP c. Flight ROBE d. Instru	H.I. WRITER DIGITAL SIGNATURE I: Surgeon (Name and Signature)  RT B. LIFESAVER DIGITAL SIGNATURE CONTROL (Name and Signature)	3456789 G E 123456789 G E 123456789 G E g	mail on lead@us. rade W5 -mail al.rite@us.ar rade 04 -mail ob.lifer@us	army.mil Branch AV Branch MC army.mil Branch AV	Rating MAARA  Rating FS  II	Addree HHC Sava DSN  Addrev USA	ss and Tel CRC, Ft 558-24 ss and Tel C 603d A mnah, Gz G 333-34	1. No. Rucker, A 10  1. No. SB, Hunte A 31499 45  1. No. ker, AL 36	AL 36362 or AAF
RALP c. Flight ROBE d. Instru	rder (Name and Signature)  H.I. WRITER DIGITAL SIGNATURE 1: Surgeon (Name and Signature)  RT B. LIFESAVER DIGITAL SIGNATURE	3456789 G E 123456789 G E 123456789 G E g	mail on lead@us. rade W5 -mail al.rite@us.ar rade 04 -mail ob.lifer@us rade W4 -mail	army.mil Branch AV Branch MC army.mil Branch AV	Rating MAARA  Rating FS  II	Addree HHC Sava DSN  Addrev USA	ss and Tel CRC, Ft 558-24 ss and Tel C 603d A mnah, Gz G 333-34	1. No. Rucker, A 10  1. No. SB, Hunte A 31499 45  1. No. ker, AL 36	AL 36362 or AAF
RALP c. Flight ROBE d. Instru	H.I. WRITER DIGITAL SIGNATURE I: Surgeon (Name and Signature)  RT B. LIFESAVER DIGITAL SIGNATURE CONTROL (Name and Signature)	3456789 G E 123456789 G E 123456789 G E 123456789 G	mail on lead@us. rade W5 -mail al.rite@us.ar rade 04 -mail ob.lifer@us rade W4 -mail	army.mil Branch AV Branch MC army.mil Branch AV	Rating MAARA  Rating FS  II	Addree HHC Sava DSN  Addrev USA  Addrev HHC Sava DSN  Addrev DES  DSN  Addrev Addrev Addrev DES  ADDREV  ADDRE	ss and Tel CRC, Ft 558-24 ss and Tel 603d A mnah, Gz 333-34 ss and Tel 558-34	1. No. Rucker, A 10  I. No. SB, Hunte A 31499 45  I. No. ker, AL 36	AL 36362 er AAF
RALP c. Flight ROBE d. Instru	H.I. WRITER DIGITAL SIGNATURE I: Surgeon (Name and Signature)  RT B. LIFESAVER DIGITAL SIGNATURE (ctor Pilot (Name and Signature)	3456789 G E 123456789 G E 123456789 G E 123456789 G	mail on lead@us. rade W5 -mail al.rite@us.ar rade 04 -mail ob.lifer@us rade W4 -mail lo.train@us	army.mil Branch AV Branch MC Army.mil Branch AV  Branch AV	Rating MAARA  Rating FS  II  Rating MAARA	Addree HHC Sava DSN  Addres V DESN  Addres Addres A 600	ss and Tel CRC, Ft 558-24 ss and Tel 6603d A mnah, Gz 333-34 ss and Tel 558-34 ss and Tel 3d ASB,	1. No. Rucker, A 10  I. No. SB, Hunte A 31499 45  I. No. ker, AL 36	AL 36362 er AAF
RALP c. Flight ROBE d. Instru	H.I. WRITER DIGITAL SIGNATURE I: Surgeon (Name and Signature)  RT B. LIFESAVER DIGITAL SIGNATURE (ctor Pilot (Name and Signature)	3456789 G E 123456789 G E 123456789 G E 123456789 G	mail on lead@us. rade W5 -mail al.rite@us.ar rade 04 -mail ob.lifer@us rade W4 -mail lo.train@us	army.mil Branch AV  Branch MC  army.mil Branch AV  Branch AV	Rating MAARA  Rating FS  II  Rating MAARA	Addree HHC Sava DSN  Addree HHC Sava DSN  Addree Addree A 60 GA	ss and Tel CRC, Ft 558-24 ss and Tel 603d A mnah, Gz 333-34 ss and Tel 558-34 ss and Tel 558-34 ss and Tel 34 ASB, 31499	I. No. Rucker, A 10 I. No. SB, Hunte A 31499 45 I. No. ker, AL 36 I. No. Hunter AA	AL 36362 er AAF
RALP c. Flight  ROBE d. Instru  GLOR e. Maint	H.I. WRITER DIGITAL SIGNATURE I: Surgeon (Name and Signature)  RT B. LIFESAVER DIGITAL SIGNATURE (ctor Pilot (Name and Signature)	3456789 G E 23456789 G E 123456789 G E [ 123456789 G G [ E ] [ 123456789 G ] G	mail on lead@us. rade W5 -mail al.rite@us.ar rade 04 -mail ob.lifer@us rade W4 -mail lo.train@us rade	army.mil Branch AV  Branch MC  army.mil Branch AV  Branch AV	Rating MAARA  Rating FS  II  Rating MAARA  1	Addree HHC Sava DSN  Addree HHC Sava DSN  Addree Addree A 60 GA	ss and Tel CRC, Ft 558-24 ss and Tel 6603d A mnah, Gz 333-34 ss and Tel 558-34 ss and Tel 3d ASB,	I. No. Rucker, A 10 I. No. SB, Hunte A 31499 45 I. No. ker, AL 36 I. No. Hunter AA	AL 36362 er AAF
RALP c. Flight  ROBE d. Instru  GLOR e. Maint	HI. WRITER DIGITAL SIGNATURE I: Surgeon (Name and Signature)  RT B. LIFESAVER DIGITAL SIGNATURE ctor Pilot (Name and Signature)  LIA D. TRAINER DIGITAL SIGNATURE Officer/Tech/SME (Name and Signature)	3456789 G E 123456789 G E 123456789 G E 123456789 G E 123456789 G	mail on lead@us. rade W5 -mail al.rite@us.ar rade 04 -mail ob.lifer@us rade W4 -mail lo.train@us rade 03 -mail	army.mil Branch AV  Branch MC  army.mil Branch AV  Branch AV	Rating MAARA  Rating FS  II  Rating MAARA  1	Addree HHC Sava DSN  Addres V DESN  Addres Addres A 60 GA DSN	ss and Tel CRC, Ft 558-24 ss and Tel 603d A mnah, Gz 333-34 ss and Tel 558-34 ss and Tel 558-34 ss and Tel 34 ASB, 31499	1. No. Rucker, A 10 1. No. SB, Hunte A 31499 45 1. No. ker, AL 36 16 1. No. Hunter AA	AL 36362 er AAF
RALP: c. Flight  ROBE d. Instru  GLOR e. Maint  JAME f. Other	H.I. WRITER DIGITAL SIGNATURE I Surgeon (Name and Signature)  RT.B. LIFESAVER DIGITAL SIGNATURE CONTROL (Name and Signature)  LIA D. TRAINER DIGITAL SIGNATURE Officer/Tech/SME (Name and Signature)  S.M. FIXER DIGITAL SIGNATURE	3456789 G E 123456789 G E 123456789 G E 123456789 G E 123456789 G	mail m. lead@us. rade W5 -mail al.rite@us.a rade 04 -mail ob.lifer@us rade W4 -mail lo.train@us rade 03 -mail m. fixer@us	army.mil  Branch AV  Branch MC  army.mil  Branch AV  army.mi	Rating MAARA  Rating FS  II  Rating ARAV	Addre HHC Sava DSN  Addre V DES DSN  Addre A 60 GA DSN  Addre A Addre A MC	ss and Tel CRC, Ft 558-24 ss and Tel 603d A mah, GA 333-34 ss and Tel 558-34 ss and Tel 3d ASB, 31499 333-23 ss and Tel	I. No. Rucker, A 10 I. No. SB, Hunte A 31499 45 I. No. ker, AL 36 16 I. No. Hunter AA	AL 36362 or AAF
RALP: c. Flight  ROBE d. Instru  GLOR e. Maint  JAME f. Other	H.I. WRITER DIGITAL SIGNATURE I: Surgeon (Name and Signature)  RT B. LIFESAVER DIGITAL SIGNATURE I: CTOP PIlot (Name and Signature)  LIA D. TRAINER DIGITAL SIGNATURE Officer/Tech/SME (Name and Signature)  S. M. FIXER DIGITAL SIGNATURE III (Name and Signature)	3456789 G E 23456789 G E 123456789 G E 123456789 G E 123456789 G G E 23456789 G G G G G G G G G G G G G G G G G G G	mail m. lead@us. rade W5 -mail al.rite@us.a rade 04 -mail ob.lifer@us rade W4 -mail lo.train@us rade 03 -mail im.fixer@us	army.mil  Branch AV  Branch MC  army.mil  Branch AV  army.mi	Rating MAARA  Rating FS  II  Rating ARAV	Addre HHC Sava DSN  Addre V DES DSN  Addre A 60 GA DSN  Addre A Addre A MC	ss and Tel CRC, Ft 558-24 ss and Tel 6603d A mnah, Gz 1333-34 ss and Tel 558-34 ss and Tel 3d ASB, 31499 1333-23 ss and Tel	I. No. Rucker, A 10 I. No. SB, Hunte A 31499 45 I. No. ker, AL 36 16 I. No. Hunter AA	AL 36362 or AAF
RALP: c. Flight  ROBE d. Instru  GLOR e. Maint  JAME f. Other	H.I. WRITER DIGITAL SIGNATURE I: Surgeon (Name and Signature)  RT B. LIFESAVER DIGITAL SIGNATURE I: CTOP PIlot (Name and Signature)  LIA D. TRAINER DIGITAL SIGNATURE Officer/Tech/SME (Name and Signature)  S. M. FIXER DIGITAL SIGNATURE III (Name and Signature)	3456789 G E 23456789 G E 123456789 G E 123456789 G E [ ji]	mail m. lead@us. rade W5 -mail al.rite@us.a rade 04 -mail ob.lifer@us rade 03 -mail im.fixer@us	army.mil  Branch AV  Branch MC  army.mil  Branch AV  army.mii  Branch AV  army.mii	Rating MAARA  Rating FS  il  Rating AARA  Rating MAARA	Addre HHC Sava DSN  Addre V DES DSN  Addre A 60 GA DSN  Addre A Addre A MC	ss and Tel CRC, Ft 558-24 ss and Tel 603d A mah, GA 333-34 ss and Tel 558-34 ss and Tel 3d ASB, 31499 333-23 ss and Tel	I. No. Rucker, A 10 I. No. SB, Hunte A 31499 45 I. No. ker, AL 36 16 I. No. Hunter AA	AL 36362 or AAF

Figure 3-16. Example of a completed DA Form 2397-14, Index B

- a. Also see paragraph 3-16.
- b. Complete instructions as follows:
- (1) Block 1. DA Forms 2397-13 and 2397-14. Enter the MTDS of the accident aircraft.
- (2) Block 2. DA Forms 2397-13 and 2397-14. Enter the case number shown on DA form 2397-1, table 3-6.
- (3) *Block 3.* DA Forms 2397–13 and 2397–14. Place an "X" in the block opposite each item to indicate whether the information is "enclosed" or "Not Applicable." An "X" on the "See Remarks" block requires an explanation in block 4"Remarks" section of the form
- (4) Block 4. DA Form 2397–13 and 2397–14. The remarks are used to indicate that required information is being delayed or not available to the accident investigation board. Remarks pertaining to delayed information will contain an estimated forwarding date. Remarks pertaining to unavailable information will include reasons for non-availability. Also, when the accident board inserts multiple documents, or wants to clarify a document under a certain tab, it should be identified in this block.
- (5) *Block 5*. DA Form 2397–14. Type signature block of all voting board members to include grade, branch, unit address, e-mail address, and telephone number (SSN not required). Each voting board member will sign all copies of the DA Form 2397–14 unless a minority report is submitted in accordance with chapter 2 of this pamphlet. Use a continuation sheet (plain bond paper) if there are more than six voting board members.

3-36. Completion instructions for DA Form 2397-AB, Abbreviated Aviation Accident Report (AAAR)

	OR ALL CLAS	VIATED A\ SS C, D, E, F this form, see	, сомват	A AND B	, AND ALL	AIRC	RAFT GR	OUND		REQU.		ITS CC CSOCS	ONTROL SYMBOL S-309	***********
						UIRED				TS NOT			MAN ERROR/INJUR	Υ.
1. DATE/CASE OF ACCIDE	NO. a. (YY NT	YYMMDD) b.					2. a. Clas	sification	Name of the last o	В	la Trac		D E	F
		060522	915		0612345		b. Cate		✓ Fligh	nt F	light Rel	ated	Acft Ground	UAS
3. TYPE OF A		4. PERIOD OF DAY			NO. ACFT INVOLVED		6. NEARE	EST MIL ALLATION	ı					
UH-0		du de la companya de	Dusk	Night		i	d. State		Fort 1	rainer,		4.0-14.		
7. ACCIDENT LOCATION	a. On-Po	1 5	irfield C on Airfield		arest to acdt : vel Sands	site)	d. State		e. Country	(II HOL	USA)	i. Gila c	or Lat./Long. PU12345678	
8.	V OII-PO	ist V NOLE	JII All field	Le		74710	N INVOLVE						F012343078	
a. Name of U	nit			b. UIC	(6 Digit Unit Id								d. Army-HQ	
A	Company, 1-	234 Avn Reg	t		WABCA0				Fort Tra	iner			TRADOC	
9.			ORGANIZATI	ION DEEM	ED ACCOUN	TABL	E (If same	as block	8 leave b	blank)		all the state of t	<del>, K</del>	
a. Name of U	nit			b. UIC	(6 Digit Unit Id	Code)	c. Home S	Station	***************************************		***************************************	<	d. Army HQ	
												1	1	1
	D ACCIDENT C	1	ft Total Loss		Yes 🗸 I							1		No. of Street, or other Persons
b. Acft Damage	e (Exciman hr)	c. No. Man Hrs	s d. Man Hrs	e.	Other Damag	ge Mil	f. Civilian	Damage	g. Injury	Cost	h. Total	(This ac	i. Total (All acft	)
\$ 88,000		2	\$ 82	\$			\$		s <		\$ 88,082		\$	
11.GEN. a. N	Visn (1) Type		) /: Single-sh		ht Plan		oigital Sourd ✓ Yes		or Install				n Device/System in I	
	330043000	T Y	/ Single-ship Multi-ship	in the same of	IA <b>√</b> VF ≂R		VHMS	INO HARA	es opec	ну гуре	1 Ye	73 <b>V</b>	INO II TES Specify	type
e. Fire 🗸 No	est(soloses)	nflight f. Flan	nmable Fluid	Spillage	(If "Yes" for Ci			g. I	Field Trai	ining Ex	ercise	(FTX)		and the same
Y		Other and C	acdts, attach D	A Form 239	7-6)	Y	es 🗸 N	Activities of		A	If "Yes" I	7).	fFTX_/\\\	September 1
12. FLIGHT	Flight	Phase of Ope			Altitude	Ai	rspeed A	Aircraft					(Enter max 3 codes fro	
DATA	Duration	codes from Tab or specify phase			AGL			Weight	Condition Yes 1	No	which bes	t describ	385-40 or specify type es the acat/incdt, e.g.,	
a. At	Hours 1	Р	1-19-1		50	10	) 154	450		7	tree strike	, genera	tor fallure, eng overspe exhaustion, dropped	ed,
Emergency	Tenths 0	1			K V	1	1			/	cargo, oil	cooler be	earing failure, etc.)	
b. At	Hours 1	P			50	10	154	450		7				
Impact/Acdt or Termination	Tenths 0		11.5	and the same of th		1	V	1		<b>Z</b>   .	50			
14. ACCIDENT	CAUSE FACT		a. Huma		(If D or		Materiel Pai			T -	c. Envi	onmen	tal	T
Undetermined ca	ntify Definite, Sus uses)	spectea, or	S comple	ite biks 21,	23, & 24) D		:lûdes mfg/de ures)(If D or S	sign inauce S complete b	ea bik 16)	2	(If D or S	Complet	te bik 17)	
environment		ry of acdt sequer	nce from onset	of emergen	cy through tern	1 3	, A.	34	A STATE OF THE PARTY OF THE PAR	clude the	type of me	ateriel fai	lure and/or	
while conduction of the control of the control of the conduction of the control of the conduction of the conductio	al factors.) cting NOE AT e aircraft and l	ΓM training a landed in the vibrations so	t 50 feet AC nearest ope aircraft wa	GL and 10 en area. Ons landed	knots with E examined and shut do	the P d the I wn. I	of flight. For PI on the co main rotor	Class D, E, ontrols, th blades at	, and F, inc he UH-60 fter landi	0L crev	v heard did not	a loud see any	popping noise. PC y damage. PC broater blades. Both m	ight
while conduction control of the the aircraft to rotor blades v	et factors.) cting NOE AT e aircraft and o a hover, felt were sent to d	TM training a landed in the vibrations so lepot for repai	t 50 feet AC nearest ope aircraft wa	GL and 10 en area. On is landed (See con	knots with E examined and shut do tinuation sh	the Pd the rwn. I	of flight. For PI on the ec main rotor inspection	Class D, E, ontrols, th blades af revealed	, and F, inc he UH-60 fter landi damage	0L crev ing but to two	v heard did not of the u	a loud see any nain rot	popping noise. PC y damage. PC brot tor blades. Both m	aght aain
environment While conduct control of the the aircraft to rotor blades v	el fectors.) etting NOE AT e aircraft and o a hover, felt were sent to d	I'M training at landed in the vibrations so lepot for repair	t 50 feet AC nearest ope aircraft wa ir.	GL and 10 en area. On is landed (See con	knots with E examined and shut do tinuation sh	the Pd the rwn. I	of flight, For PI on the ec main rotor inspection	Class D, E, ontrols, th blades af revealed	, and F, inc he UH-66 fter landi damage	OL creving but to two	v heard did not of the n	a loud see any	popping noise. PC y damage. PC brot tor blades. Both m	aght ain
environment While conduct control of the the aircraft to rotor blades v  16. COMPONE	el fectors.) etting NOE AT e aircraft and o a hover, felt were sent to d	TM training a landed in the vibrations so lepot for repai	t 50 feet AC nearest ope aircraft wa ir.	GL and 10 en area. On is landed (See con	knots with E examined and shut do tinuation sh	the Pd the rwn. I	of flight. For PI on the ec main rotor inspection	Class D, E, ontrols, th blades af revealed	, and F, inc the UH-66 fter landi damage	0L creving but to two	w heard did not of the n	a loud see any nain rot  (Chk o	popping noise. PC y damage. PC broi tor blades. Both m	aght aain
environment While conduct control of the the aircraft to rotor blades v	el fectors.) etting NOE AT e aircraft and o a hover, felt were sent to d	I'M training at landed in the vibrations so lepot for repair	t 50 feet AC nearest ope aircraft wa ir.	GL and 10 en area. On is landed (See con	knots with E examined and shut do tinuation sh	the Pd the rwn. I	of flight, For PI on the ec main rotor inspection	Class D, E, ontrols, th blades af revealed	he UH-60 damage	0L creving but to two vironment (1)	w heard did not of the n	a loud see any nain rot (Chk c	popping noise. PC y damage. PC broi for blades. Both in conditions at time of acd	aght ain t.)
environment While conduct control of the the aircraft to rotor blades v  16. COMPONE	al factors.) cting NOE AT e aircraft and o a hover, felt were sent to d	I'M training at landed in the vibrations so lepot for repair	t 50 feet AC nearest ope aircraft wa ir.	GL and 10 en area. On is landed (See con	knots with E examined and shut do tinuation sh	the Pd the rwn. I	of flight, For PI on the ec main rotor inspection	Class D, E, ontrols, th blades af revealed	he UH-60 fter landi damage  17. EN a. Ger b. Env (1) We	OL creving but to two	w heard did not of the n	a loud see any nain rot (Chk c	popping noise. PC y damage. PC brot tor blades. Both in  conditions at time of acd  V VMC (3) U  (2) Other Condition	aght ain t.)
environment White conduct control of the the aircraft to rotor blades to  16, COMPONE Identificatio a. Nomenclat	at factors.) eting NOE AT e aircraft and o a hover, felt were sent to d int. AND PART	I'M training at landed in the vibrations so lepot for repair	t 50 feet AC nearest ope aircraft wa ir.	GL and 10 en area. On is landed (See con	knots with E examined and shut do tinuation sh	the Pd the rwn. I	of flight, For PI on the ec main rotor inspection	Class D, E, ontrols, th blades af revealed	and F, Inche UH-60 fter landi damage  17. EN a. Ger b. Env (1) We	OL creving but to two	w heard did not of the n	a loud see any nain rot (Chk c	popping noise. PC y damage. PC broi tor blades. Both in  conditions at time of acd  VMC (3) U  (2) Other Condition  (a) Animals	aght ain t.)
environment While conduc control of the the aircraft to rotor blades of  16,COMPONE Identificatio a. Nomenclat b. Type, Desig	au factora.) cating NOE AT e aircraft and o a hover, felt were sent to d  NT AND PART n ture	I'M training at landed in the vibrations so lepot for repair	t 50 feet AC nearest ope aircraft wa ir.	GL and 10 en area. On is landed (See con	knots with E examined and shut do tinuation sh	the Pd the rwn. I	of flight, For PI on the ec main rotor inspection	Class D, E, ontrols, th blades af revealed	and F, Inc. the UH-6t fter landi damage  17. EN a. Ger b. Env (1) We (a) (b)	OL crewing but to two	w heard did not of the n	a loud see any nain rot (Chk c	popping noise. PC y damage. PC broi tor blades. Both in  conditions at time of acd  VMC (3) U  (2) Other Condition  (a) Animals  (b) Fowl	aght ain t.)
environment While conduct control of the the aircraft to rotor blades v  16, COMPONE Identificatio a. Nomenclat b. Type, Desig and Series	au factora.) cating NOE AT e aircraft and o a hover, felt were sent to d  NT AND PART n ture	I'M training at landed in the vibrations so lepot for repair	t 50 feet AC nearest ope aircraft wa ir.	GL and 10 en area. On is landed (See con	knots with E examined and shut do tinuation sh	the Pd the rwn. I	of flight, For PI on the ec main rotor inspection	Class D, E, ontrols, th blades af revealed	and F, Inc. the UH-6t fter landi damage  17. EN a. Ger b. Env (1) We (a) (b)	OL creving but to two	w heard did not of the n	a loud see any nain rot (Chk c	popping noise. PC y damage. PC broi tor blades. Both in  conditions at time of acd  VMC (3) U  (2) Other Condition  (a) Animals	aght ain t.)
environment While conduct control of the the aircraft to rotor blades v  16, COMPONE Identificatio a. Nomenclat b. Type, Desig and Series	au factora.) cating NOE AT e aircraft and o a hover, felt were sent to d  NT AND PART n ture	I'M training at landed in the vibrations so lepot for repair	t 50 feet AC nearest ope aircraft wa ir.	GL and 10 en area. On is landed (See con	knots with E examined and shut do tinuation sh	the Pd the rwn. I	of flight, For PI on the ec main rotor inspection	Class D, E, ontrols, th blades af revealed	17. EN a. Ger b. Env (1) We (a) (b) (c) (d)	OL creving but to two  NVIRONI neral (1, vironment eather (2) Hail (3) Sleet (3) Prog	w heard did not of the n	a loud see any nain rot (Chk c	popping noise. PC y damage. PC brot tor blades. Both m  conditions at time of acd VMC (3) U  (2) Other Condition (a) Animals (b) Fowl (c) Surface (d) Noise	aght ain t.)
environment While conduc control of the the aircraft to rotor blades v  16, COMPONE identificatio a. Nomenclat b. Type, Desig and Series c. Part-Number	au factora.) cating NOE AT e aircraft and o a hover, felt were sent to d  NT AND PART n ture	I'M training at landed in the vibrations so lepot for repair	t 50 feet AC nearest ope aircraft wa ir.	GL and 10 en area. On is landed (See con	knots with E examined and shut do tinuation sh	the Pd the rwn. I	of flight, For PI on the ec main rotor inspection	Class D, E, ontrols, th blades af revealed	17. EN a. Ger b. Env (1) We (a) (b) (c) (d)	OL creving but to two NVIRONI neral (1) vironmeneather (2) Hail (3) Sleet (3) Fog	w heard did not of the n	a loud see any nain rot (Chk c	popping noise. PC y damage. PC brot tor blades. Both m  conditions at time of acd  VMC (3) U  (2) Other Condition (a) Animals (b) Fowl (c) Surface (d) Noise (e) Chemicals	aght ain t.)
environment While conduc control of the the aircraft to rotor blades v  16, COMPONE Identificatio a. Nomenclat b. Type, Desig and Series c. Part Numbe d. NSN e. Manufac	au factora.) cating NOE AT e aircraft and o a hover, felt were sent to d  NT AND PART n ture	I'M training at landed in the vibrations so lepot for repair	t 50 feet AC nearest ope aircraft wa ir.	GL and 10 en area. On is landed (See con	knots with E examined and shut do tinuation sh	the Pd the rwn. I	of flight, For PI on the ec main rotor inspection	Class D, E, ontrols, th blades af revealed	and F, Income UH-66 fter landidamage  17. EN a. Ger b. Env (1) We (a) (b) (c) (d) (e) (f)	OL creving but to two NVIRONI neral (1, vironmel eather (2) Hail (3) Sleet (3) Fog (3) Drizzle (3) Rain	w heard did not of the n  MENTAL )   IW  INITIAL CON- CONDITION	a loud see any nain rot (Chk c	popping noise. PC y damage. PC brot tor blades. Both m  conditions at time of acd VMC (3) U  (2) Other Condition (a) Animals (b) Fowl (c) Surface (d) Noise	aght ain t.)
environment While conduc control of the the aircraft to rotor blades v  16, COMPONE Identificatio a. Nomenclat b. Type, Desig and Series  c. Part Number	au factora.) cating NOE AT e aircraft and o a hover, felt were sent to d  NT AND PART n ture	I'M training at landed in the vibrations so lepot for repair	t 50 feet AC nearest ope aircraft wa ir.	GL and 10 en area. On is landed (See con	knots with E examined and shut do tinuation sh	the Pd the rwn. I	of flight, For PI on the ec main rotor inspection	Class D, E, ontrols, th blades af revealed	and F, Inche UH-66 fter landidamage  17. EN a. Ger b. Env (1) We (a) (b) (c) (d) (e) (f)	OL creving but to two NVIRONI neral (1, vironmeneather Ci) Hail (1) Sleet (2) Fog (3) Drizzle (3) Rain (3) Snow (4) Lightni	w heard did not of the n  MENTAL )   IW  INITIAL CON- CONDITION	a loud see any nain rot (Chk c	popping noise. PC y damage. PC brot tor blades. Both m  conditions at time of acd VMC (3) U  (2) Other Condition (a) Animals (b) Fowl (c) Surface (d) Noise (e) Chemicals (f) Radiation	aght ain t.)
environment While conduc control of the the aircraft to rotor blades v  16, COMPONE Identificatio a. Nomenclat b. Type, Desig and Series c. Part-Numbo d. NSN  e. Manufac- turer's Code f. Part Serial	au factora.) cating NOE AT e aircraft and o a hover, felt were sent to d  NT AND PART n ture	I'M training at landed in the vibrations so lepot for repair	t 50 feet AC nearest ope aircraft wa ir.	GL and 10 en area. On is landed (See con	knots with E examined and shut do tinuation sh	the Pd the rwn. I	of flight, For PI on the ec main rotor inspection	Class D, E, ontrols, th blades af revealed	17. EN a. Ger b. Env (1) We (a) (b) (c) (d) (e) (f) (g) (h)	OL creving but to two NVIRONI neral (1, vironmeneather Ci) Hail (1) Sleet (2) Fog (3) Drizzle (3) Rain (3) Snow (4) Lightni	w heard did not of the n  MENTAL )   IM Intal Con- Condition  ing lerstorm	a loud see any nain rot (Chk c	popping noise. PC y damage. PC brot tor blades. Both m  conditions at time of acd  VMC (3) U  (2) Other Condition  (a) Animals  (b) Fowl  (c) Surface  (d) Noise  (e) Chemicals  (f) Radiation  (g) Glare	aght ain  t.) nknown
environment While conduc control of the the aircraft to rotor blades v  16, COMPONE Identificatio a. Nomenclat b. Type, Desig and Series c. Part-Number d. NSN  e. Manufacturer's Code	au factora.) cating NOE AT e aircraft and o a hover, felt were sent to d  NT AND PART n ture	I'M training at landed in the vibrations so lepot for repair	t 50 feet AC nearest ope aircraft wa ir.	GL and 10 en area. On is landed (See con	knots with E examined and shut do tinuation sh	the Pd the rwn. I	of flight, For PI on the ec main rotor inspection	Class D, E, ontrols, th blades af revealed	17. EN a. Ger b. Env (1) We (a) (b) (c) (d) (g) (h) (i)	OL creving but to two NVIRONI neral (1, vironmeral (1) Hail (1) Sleet (1) Fog (1) Drizzle (1) Rain (1) Snow (1) Lightni (1) Thund	w heard did not of the n	a loud see any nain rot (Chk c	popping noise. PC y damage. PC brown or blades. Both in conditions at time of acd y VMC (3) U (2) Other Condition (a) Animals (b) Fowl (c) Surface (d) Noise (e) Chemicals (f) Radiation (g) Glare (h) FOD	aght ain  t.) nknown
environment While conduc control of the the aircraft to rotor blades v  16, COMPONE identificatio a. Nomenclat b. Type, Desig and Series c. Part-Numb d. NSN  e. Manufac turer's Code f. Part Serial No.  g. Cause	al factora.) eating NOE AT e aircraft and o a hover, felt were sent to d  NT AND PART n ture	TM training a landed in the vibrations so lepot for repair FAILURE/MAL Major Com	t 50 feet AC nearest ope aircraft wa ir.	GL and Months area. Constant area. C	knots with E examined and shut do tinuation sh	the P d the recovery the the P d the recovery the the recovery the	of flight, For PI on the equipment of the control o	Class D, E, ontrols, th blades af revealed	17. EN     17. EN     17. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18.	OL creving but to two wviRONimeral (1, vironmeral eather Con) Hail (1) Sleet (1) Program (2) Rain (2) Snow (3) Lightnin (4) Gusty (4) Gu	w heard did not of the n	a loud see any nain rot (Chk c	popping noise. PC y damage. PC brot or blades. Both in  conditions at time of acd  VMC (3) U  (2) Other Condition (a) Animals (b) Fowl (c) Surface (d) Noise (e) Chemicals (f) Radiation (g) Glare (h) FOD (i) Temperature	aght ain  t.) nknown
environment While conduc control of the the aircraft to rotor blades v  16, COMPONE Identificatio a. Nomenclat b. Type, Desig and Series c. Part Numbe d. NSN  e. Manufac- turer's Code f. Part Serial No.	al factors.) eating NOE AT eating NOE AT eating and to a hover, felt were sent to d  INT AND PART INT ILLURE  er  (1) Me	TM training at landed in the vibrations so epot for repair Major Comp	t 50 feet AC nearest ope aircraft we ir.  FUNCTION I	GL and Months area. Constant area. C	knots with E examined and shut do timuation sh	the P d the recovery the the P d the recovery the the recovery the	of flight, For PI on the equipment of the control o	Class D, E, outrols, the blades af revealed	17. EN     17. EN     17. EN     17. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN   18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN     18. EN	OL creving but to two NVIRONA (1) vironment (1) vironment (2) Hail (2) Fog (3) Drizzle (2) Rain (3) Snow (3) Lightni (4) Gusty (4) Freezin (4) Freezin (4) Freezin (4) Freezin (4) Processing (4) Process	w heard did not of the n  MENTAL  IN I	a loud see any (Chk c (2) dittions is	popping noise. PC y damage. PC brot tor blades. Both m  conditions at time of acd v VMC (3) U  (2) Other Condition (a) Animals (b) Fowl (c) Surface (d) Noise (e) Chemicals (f) Radiation (g) Glare (h) FOD (i) Temperature (j) Vibration	aght aain
environment While conduc control of the the aircraft to rotor blades v  16, COMPONE Identificatio a. Nomericlat b. Type, Desig and Series c. Part Numb d. NSN  e. Manufac turer's Code f. Part Serial No.  g. Cause Failure/ Malfunction 18, BOARD PF	al factors.) eather the property of the proper	TM training at landed in the vibrations so lepot for repair Major Compared to the vibrations of the vibrations of the vibrations of the vibration of the vibrat	t 50 feet AG nearest ope aircraft wa ir.  FUNCTION I pohent  Maintenance	GL and Mc marea. Cas landed (See con DATA (pa	knots with E examined and shut do timuation sh	the Pd the remaining the Pd the remaining the Pd the remaining the remai	of flight, For PI on the equipment of the control o	Class D, E, outrols, the blades af revealed	and F, Inch he UH-6f ter landi damage  17. EN a. Ger b. Env (1) Wo (a) (b) (c) (d) (e) (f) (g) (h) (i) (j) (k, c. Acft	OL creve ing but to two obvious plants of the two obvious plants of th	w heard did not of the n  MENTAL  IN I	a loud see any (Chk c (2) (Chk c) (2) (ditions is	popping noise. PC y damage. PC brot tor blades. Both m  conditions at time of acd  VMC (3) U  (2) Other Condition (a) Animals (b) Fowl (c) Surface (d) Noise (e) Chemicals (f) Radiation (g) Glare (h) FOD (j) Temperature (j) Vibration (k) Dust d. Turbulence VN	aght aain
environment While conduc control of the the aircraft to rotor blades v  16, COMPONE Identificatio a. Nomenclat b. Type, Desig and Series c. Part Numbo d. NSN e. Manufac turer's Code f. Part Serial No.  9. Cause Failure/ Malfunction R. BOARD PF Record, Robe	an factora.) eather than the control of the control	TM training at landed in the vibrations so lepot for repair Major Compared to the vibrations of the vibrations of the vibrations of the vibration of the vibrat	t 50 feet AG nearest ope aircraft wa ir.  FUNCTION I pohent  Maintenance	GL and Mc marea. Cas landed (See con DATA (pa	Renots with Experiment of the Control of the Contro	the Pd the remaining the Pd the remaining the Pd the remaining the remai	of flight, For If on the commain rotor inspection  //mailunction.j  Part  TYPEFL  Branch	Class D, E, outrols, the blades af revealed	and F, Inch he UH-6f fter landi damage  17. EN a. Ger b. Env (1) We (a) (b) (c) (d) (e) (f) (f) (h) (k) c. Acft Addre HHC.	OL creve ing but to two wire on the total to two wire on the total to two wire on the total tota	w heard did not of the n  MENTAL  ) IM  INITIAL Concondition  ing  lerstorm  Winds  ing Rain  V No  Tel No.	a loud see any contain rot (Chk c (2) ditions is	popping noise. PC y damage. PC brot tor blades. Both m  conditions at time of acd  VMC (3) U  (2) Other Condition (a) Animals (b) Fowl (c) Surface (d) Noise (e) Chemicals (f) Radiation (g) Glare (h) FOD (j) Temperature (j) Vibration (k) Dust d. Turbulence VN	aght aain
environment While conduc control of the the aircraft to rotor blades v  16, COMPONE Identificatio a. Nomericlat b. Type, Desig and Series c. Part Numb d. NSN  e. Manufac turer's Code f. Part Serial No.  g. Cause Failure/ Malfunction 18, BOARD PF	an factora.) eather than the control of the control	TM training at landed in the vibrations so lepot for repair Major Compared to the vibrations of the vibrations of the vibrations of the vibration of the vibrat	t 50 feet AG nearest ope aircraft wa ir.  FUNCTION I pohent  Maintenance	GL and Mc marea. Cas landed (See con DATA (pa FG) and DAT	Renots with Exexamined and shut do tinuation should be tinuation should be the should be the should be sho	the P in the	of flight, For PI on the commain rotor inspection of flight for the commain rotor inspection. The commain rotor inspection of the commain rotor inspection of the commain rotor inspection. The commain rotor inspection of the commain rotor inspection of the commain rotor inspection of the commain rotor inspection. The commain rotor inspection is a command to the command rotor inspection of the command rotor inspe	CAUFL	17. EN a. Ger b. Env (1) We (a) (b) (c) (d) (d) (e) (f) (f) (h) (i) (k) c. Acft HHC. DSN	OL creve ing but to two work of the total of the two works of two works of the two works of two works of the two works of the two works of the two works of two works of the two works of the two works of the two works of two works of the two works of the two works of two works of the two works of the two works of two works	w heard did not of the n  MENTAL    IN   IN    Interpretation   IN	a loud see any (Chk c (Chk C (2) (Chk C)) (Chk C (2) (Chk C)) (Chk C (2) (Chk C (2) (Chk C (2) (Chk C)) (Chk C (2) (Chk C (2) (Chk C)) (Chk C) (	popping noise. PC y damage. PC brot tor blades. Both m  conditions at time of acd  VMC (3) U  (2) Other Condition  (a) Animals (b) Fowl (c) Surface (d) Noise (e) Chemicals (f) Radiation (g) Glare (h) FOD (i) Temperature (j) Vibration (k) Dust d. Turbulence V N  g Com),	aght aain
environment While conduc control of the the aircraft to rotor blades v  16, COMPONE Identificatio a. Nomenclat b. Type, Desig and Series c. Part Numbo d. NSN e. Manufac turer's Code f. Part Serial No.  9. Cause Failure/ Malfunction R. BOARD PF Record, Robe	an factora.) eather than the control of the control	TM training at landed in the vibrations so lepot for repair Major Compared to the vibrations of the vibrations of the vibrations of the vibration of the vibrat	t 50 feet AG nearest ope aircraft wa ir.  FUNCTION I pohent  Maintenance	GL and Mc marea. Cas landed (See con DATA (pa FG) and DAT	Renots with Exexamined and shut do tinuation should be tinuation should be the should be the should be sho	the P in the	of flight, For If on the commain rotor inspection  //mailunction.j  Part  TYPEFL  Branch	CAUFL	17. EN a. Ger b. Env (1) We (a) (b) (c) (d) (d) (e) (f) (f) (h) (i) (k) c. Acft HHC. DSN	OL creve ing but to two work of the total of the two works of two works of the two works of two works of the two works of the two works of the two works of two works of the two works of the two works of the two works of two works of the two works of the two works of two works of the two works of the two works of two works	w heard did not of the n  MENTAL  ) IM  INITIAL Concondition  ing  lerstorm  Winds  ing Rain  V No  Tel No.	a loud see any (Chk c (Chk C (2) (Chk C)) (Chk C (2) (Chk C)) (Chk C (2) (Chk C (2) (Chk C (2) (Chk C)) (Chk C (2) (Chk C (2) (Chk C)) (Chk C) (	popping noise. PC y damage. PC brot tor blades. Both m  conditions at time of acd  VMC (3) U  (2) Other Condition  (a) Animals (b) Fowl (c) Surface (d) Noise (e) Chemicals (f) Radiation (g) Glare (h) FOD (i) Temperature (j) Vibration (k) Dust d. Turbulence V N  g Com),	aght aain

Figure 3-17. Example of a completed DA Form 2397-AB, Abbreviated Aviation Accident Report (AAAR)

19. MOON IL	LUMINATIO	N DATA	(For night Class	A, B, or C acdts	s. If blk a	is "no", no	other entry is r	equired.)						
a. Moon Abov Yes	e Horizon No	b. Moon Yes		c. Moon (D Above Hori			d.	Percent Illumina	of Moon tion	%		on (Clock Po ght Path/Nose o		
20. WIRE ST	RIKE DATA	(If "no" l	n bik a, no other	1 entry is required	1)									
a. Wire Strike	1		alled c. WSPS	Engaged Wire	1	SPS Cut V	Nire e.W			-	f. Wires			
Yes 🗸		Yes	No Yes	No.		Yes	No	Ye	s [	No	No.	D	ia (inches)	
21. PERSON a. Name (last		(Complete I	for each crew member	with access to flight						(6) UIC (Ass			ing Pole	
Teacher, Re				987-65-43		W3	M	PC	A	WABCA	- 1	✓ D	S N	υ
(8) On Fit	(9)(a) Lab	Test (	(9)(b) Results	(10) Activity	(a) Hrs	Slept	(c) Hrs	(11) (a)	RL 🏑 ´	1 2 3		ury (If "yes"	(13) Total	(14)Total
Controls				(Last 24 Hrs)		7	Flown	(b)	FAC 🗸		2397-9)	e DA Form	Flight Hours (acdt MTDS)	
Yes	✓ Y	es	Pos		(b) Hrs	Worked	1 1		DATE Red m Combat			Yes	1,492	1.855
✓ No	N	0	✓ Neg			5	1	110	20050		<b>√</b>	No	23,172	1,000
b. Name (last	, first, MI)	l-		(1) SSN	1	2) Grade	(3) Gender	(4) Duty	(5) SVC	(6) UIC (Ass	igned)	(7) Contribut	ing Role	
Learner, La				123-45-6		W2	F	PI	A	WABC		<b>√</b> ₽	S N	Ĵυ
(8) On Fit Controls	(9)(a) Lat	Test (	(9)(b) Results	(10) Activity (Last 24 Hrs)	1	Slept 9	(c) Hrs Flown		RL 🗸 ´		(12)Inj complet 2397-9)	ury (M."yes" e DA Form	(13) Total Flight Hours (acdt MTDS)	
√ Yes	✓ Y	es	Pos		(b) Hrs	Worked	1	(c)	DATE Red	deployed	t ď	Yes	512	789
No	[] N	0	✓ Neg		1, ,	3	1	tro	m Combat 20050		V	No	312	109
c. Name (last	, first, MI)			(1) SSN	4	2) Grade	(3) Gender	(4) Duty		(6) UIC (Ass	I igned)	(7) Contribut	ing Role	
Corner, Jan	nes J.			321-01-9	876	E5	M	CE	, and A	WABC		<b>√</b> D □	s N	U market U
(8) On Flt Controls	(9)(a) Lab	Test (	(9)(b) Results	(10) Activity (Last 24 Hrs)	(a) Hrs	Slept 8	(c) Hrs Flown		RL 🗸	1 2 3 1 2 3	(12)Inj complet 2397-9)	e DA Form	(13) Total Flight Hours (acdt MTDS)	
Yes	✓ Y	es	Pos		(b) Hrs	Worked	1. 1		DATE Red			Yes	all the same of th	
✓ No	N		✓ Neg		1	6	1	fro	m Combat 20050			No	100	200
22 IMPACTI	POTECTIVI	EIECAD	ES/SURVIVAL/	SECUE DAT	3	14	and C acdts)	1					İ	
a. Acft Occupia				b. Escape/Sur		4 4	7 7	Ye		rotective/Restra	int Faurin	Eupotioned as	docionad	✓ Yes
	Form 2397-6 i						he individual)	V No	A	f "no" DA Form				No
23. ACDT CA	USE FACTO	ORS (BI	k 24 must suppor	t all cause facto	ors check	ed; See DA	Pam 385-40 f		- 1	factors)				Same Transfer
	Failure (Std:		not b. Stan	dards Failure (S			Failure (Stds					rt Failure (Inac		p/
known or ways			DATIONS (See	tical, or do not exis instructions in	3 3					t followed) faci			rsonnei)	
			huting: Huma										at 50 feet .	AGL and
			d (PC) and I											
	-	9.	ne visually fi ed when they	N		70	J. 188						lt, the airc	raft's
		9	e a result of o	76	3,	16							ance. The	PC and
PI allowed	he aircraft		oo close to kno											
Recommend	460	~\	- 1 \\ \dagger_{	- 40 1 004	ATIME		1		-1 -645-	£				
h. Higher L			nder Compan	y A, 1-234	A V ₂ N, 1	miorm ai	i assigned	personn	ei oi the	racis and ci	cumsta	inces surrou	noing this	accident.
c. Army Le				Marie										
		and a second		(See continu	ation sl	neet)								
And the second second second	ning the particular and the second	and the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of th	1 2											
USACRC D	uty		Role			Failure	e/error Code			RM 1		RM 2	RM 3	
, P	hase of OP	1 1	Task/part					SI :	2	RM 1		RM 2	RM 3	
		A. C.	CAD, DA Forms											
	<u> </u>		nuation sheet,								<del></del>			
REVIEWER	T		d for Class A and				se separate sn Rai		nconcurren		nangs, ai	na recommena	Commen	to.
a.	A Compa	anization		Name (Ty William F.	ped/Pfili	ilea)	CP		GNATUF	Signature				
Unit	Avn Regt		Leader	william r.			Cr		OMMAN.			✓ Cor	ncur N	on-concur
Communation	USAATO	2	Reviev	er, Mike W			СО	L SI	GNATUF	RE OF REV	IEWEF	Cor	ncur [] N	on-concur
b. Reviewing	1	~	Approx	er, Glen D.			GE	N SI	GNATUF	RE OF APP	ROVE	R 🗸 Cor	our N	
b.	TRADO	~	Approv	v., 0.v. 2.								V Co	icus i,,,,, iv	on-concur

Figure 3-17. Example of a completed DA Form 2397-AB, Abbreviated Aviation Accident Report (AAAR)—continued

DA Form 2397-AB, block 15 (Cont'd), -- 2006052209150612345

After interviewing the accident aircraft crew members, the board determined that human error was the cause of this accident. The pilot in command (PC) who was on the controls and the pilot (PI), failed to properly scan while conducting TC 1-237. Task 1026, Perform Airspace Surveillance. The PC and PI simultaneously became visually fixated for several seconds on a deer approximately 50 feet off the nose of the aircraft. The PC's and PI's improper scan can be attributed to their overconfidence in each other's ability to clear the aircraft of obstacles when flying NOE. They had flown with each other several times in the past month and both stated they were very comfortable flying with each other. The PC did not conduct a crew mission briefing for this flight. This is in contravention of the unit safety and standardization SOP. Chapter 12-3 and TC 1-237. Task 1000, Participate in Crew Mission Briefing.

The crew did not properly employ all of the tenets of crew coordination with TC 1-237, Chapter 6, in that the crew did not announce actions, provide aircraft control and obstacle advisories, or communicate positively. The board determined that the lack of crew coordination was due to the crew's overconfidence in themselves and each other's ability to complete the mission without a crew mission briefing. The crew chief sitting in the left gunner's seat thought the aircraft was too close to the trees, but did not advise the PC because he thought the PC could see how close the blades were to the trees and would avoid hitting them.

Figure 3-17. Example of a completed DA Form 2397-AB, Abbreviated Aviation Accident Report (AAAR)—continued

a. Also see paragraph 3-20.

*Note.* Complete the entire form (both sides) for each Class C accident, all aircraft ground accidents and class A and B combat accidents in areas of combat or contingency operations when the submission of the DA Form 2397 series is deemed not practical by the senior tactical commandeer. For Class D and E accidents not involving human error, injury/occupational illness or wire strike and Class F incidents only blocks 1–18 are required. For Class D and E accidents involving human error or injury, complete blocks 1 through 18 21, 22, 23, 24 and any other pertinent blocks. Refer to paragraph 3–20.

- b. The DA Form 2397-AB will be completed as follows:
- (1) Block 1. The case number consists of the year, month, and day (YYYYMMDD) of the accident, the local time of the accident, and the seven-digit aircraft serial number. Aircraft serial number must contain seven digits. In those cases where the aircraft serial number is less than seven digits, insert zeros (0) after the model year (first two digits) until seven digits are reflected.
- (2) *Block* 2. Check the boxes corresponding to the appropriate classification per AR 385–10, paragraph 3–4, and category as defined in the DA Pam 385–40, paragraph 1–9.
- (3) Block 3. Enter the mission, type, design, and series of the aircraft involved in the accident. For example, UH-60L.
- (4) *Block 4*. Check the appropriate box. Dawn is that period of time between beginning of morning nautical twilight (BMNT) and official sunrise. Dusk is that period of time between official sunset and end of evening nautical twilight (EENT).
- (5) *Block 5*. Enter the number of aircraft involved in the accident and submit additional DA Forms 2397–AB for each additional aircraft. Do not include inoperative aircraft. When completing additional AAAR forms, do not duplicate data already provided on the case aircraft form.
  - (6) Block 6. Enter the name of the nearest military installation/facility from the accident site.
- (7) *Block 7*. Check the appropriate boxes to indicate whether or not the accident occurred on or off post, or on or off an airfield. Tactical landing zones under positive ATC. For example, Corps' instrumented airfield, Division's VFR helipad, stagefields, and support bases are considered "on post" and "on airfield" for reporting purposes. Also, aircraft

accidents occurring on joint-use civil airports and on civilian airports with USAR component facilities are considered "on post" and "on airfield" when there is intent to use the military facilities on that airport. For example, visit the unit, acquire fuel, and conduct training. Enter the name of the closest city, state, and country to the accident site and Military Grid Reference or latitude/longitude

(8) Block 8. For the organization involved, enter the six digit UIC and abbreviated title of the lowest level organization having operational control of the aircraft at the time of the accident.

*Note.* For Army Reserve or Army National Guard units on active duty status, if the unit of assignment is other than the Reserve or National Guard, enter the unit of assignment chain of command in block 8. Enter the Army Reserve or Army National Guard unit in block 21a(6).

- (9) *Block 9*. Enter the information pertaining to the organization most responsible/accountable for the accident. If the organization is the same as block 8, leave blank.
- (10) *Block 10*. Pertains to the estimated accident damage cost. Do not include those items excluded from accident cost by this DA Pamphlet, paragraph 1–10. Enter in blocks 10b through 10h, only the cost associated with the aircraft to which this form pertains. To complete this block:
- (a) Block 10a. If "Yes," enter the replacement cost per TB 43–0002–3 in block 10b and do not fill in blocks 10c and 10d (man-hours). If "No," enter AMDF cost of damaged components/parts in block 10b and fill in blocks 10c and 10d (man-hours).
  - (b) Block 10b. Enter the cost of replacement aircraft or component/part damage, excluding man-hour cost.
  - (c) Block 10c. Enter only the number of man-hours required to repair aircraft damage.
- (d) Block 10d. Man-hour cost pertains to aircraft damage only, based on current cost criteria specified in this DA pamphlet. Other man-hour cost will be included in block 10e (Other Damage Military).
  - (e) Block 10e. Enter all costs to other military property resulting from the accident (includes inoperative aircraft).
  - (f) Block 10f. Enter the damage cost to civilian property.
- (g) Block 10g. Enter the injury/occupational illness cost of all personnel. The cost can be obtained by adding the cost from block 19 of DA Form 2397–9 or injury/occupational illness criteria at table 1–1.
  - (h) Block 10h. Enter the total of blocks 10b through 10g.
- (i) Block 10i. Leave blank unless block 5 indicates multiple aircraft are involved. Enter the total of blocks 10h when multiple aircraft accidents are involved.
  - (11) Block 11. Complete the general data block as follows:
- (a) Block 11a. Enter the mission as shown on the DA Form 2408–12 or AR 95–1. For maintenance operations with or without intent for flight, enter "S" for service. If none enter "NA." Also, check the appropriate box to indicate if the mission was a single or multi-ship operation.
  - (b) Block 11b. Check the appropriate box which indicates the type flight plan on file at the time of the accident.
  - (c) Block 11c. Check the appropriate box to indicate whether or not a DSC was installed and type.
- (d) Block 11d. Check the appropriate box to indicate whether or not night vision device (NVDs)/system was in use at the time of the accident/incident. If "Yes," enter NVD used in the space provided.
- (e) Block 11e. Check the appropriate box to indicate the phase of operation when the fire started. Identify in the summary, the combustible material and the ignition source of the fire.
- (f) Block 11f. If "Yes," is checked for Class C and above accidents, complete a DA Form 2397–6 and attach it to the report. For Class D, E, and F, explain the type and source of spillage in block 15.
- (g) Block 11g. Check the appropriate box to indicate whether or not the subject aircraft was participating in a field training exercise (FTX). If "Yes," enter the FTX name in the space provided.
- (12) *Block 12*. Enter the flight parameters at the times indicated. Flight parameters pertains to both flight and ground operations of the aircraft.
- (a) Block 12a. Enter the listed flight parameters at the onset of the emergency. Enter a maximum of three phase of operation codes listed at table 3–4.

Note. The use of the term "emergency" in this pamphlet refers to "any occurrence/situation wherein the personnel involved sense a need to take appropriate measures to reduce the effects of the occurrence/situation or prevent injury/occupational illness, property damage, or further materiel failure."

- (b) Block 12b. Enter the flight parameters at the time of the first major impact/accident, except in those cases where an in-flight strike occurred, resulting in a second impact, in which case the second impact will be recorded here. This block may duplicate block 12a (emergency phase). Enter a maximum of three phase of operation codes listed at table
- (13) *Block 13*. Enter up to three event codes (see table 3–2 or app F) that best categorize the accident/incident. Enter the event code that best describes the accident/incident in the first space. Exception: Enter events 12, 40, and 45 in the first space if applicable.
- (14) *Block 14*. Enter "D," "S," or "U" in the appropriate block to indicate whether or not human, materiel, or environment factors played a definite, suspected, or undetermined role in the accident/incident. Each indicated contributing cause factor will be substantiated by the findings (block 24), and by the summary (block 15), for all accidents. In

addition, complete the appropriate block pertaining to the cause factor (block 16) for definite or suspected materiel factors.

(15) Block 15. Enter a concise summary of events from the initial onset of the emergency until the aircraft is at rest, to include injuries resulting from the accident. Specify the actual errors/failures/effects and the root causes. The specified errors/failures/effects and root causes should be supported in the narrative of the summary. The summary should substantiate the findings entered in block 24. For D, E, and F accidents/incidents not involving human error, describe all materiel and environmental contributing factors, fire ignition sources, and combustible materiel cases involving fire. Also, enter PQDR number, category, and status when materiel deficiencies are involved.

*Note.* Attach a completed DA Form 2397–3 if the board determines that more narrative information is required. See DA Form 2397–3 completion instructions for figure 3–4.

- (16) *Block 16.* This block must be completed if a material factor is indicated in block 14b. Enter the requested data for materiel failure/malfunction resulting from FWT, or for a maintenance or manufacture error and/or design deficiency over when the Army had no control (for maintenance error, over which the Army has control, block 21 must be completed with an accompanying human error, present and contributing finding). A PQDR is required for all materiel accidents in accordance with AR 385–10, chapter 3 and DA Pam 738–751, chapter 3. Component data is required only on those involving the power and drive trains. For example: engine, transmission, gearboxes, combining transmission.
- (17) *Block 17*. Check this block to reflect the environmental conditions present at the time and location of the accident/incident. This block must be completed for all reports. Environmental contributing factors will be checked and substantiated in the summary or findings, depending upon the classification and circumstances.
- (18) *Block 18*. For Class C and above accidents, enter the data for the investigation board president. For Class D and E accidents, and for Class E and F incidents, enter the safety officer/representative submitting the report. Include the email address of the board president/ASO/POC.
- Note. For Class D, E, and F reports not involving human error/injury or occupational illness, no further entries are required.
- (19) Block 19. Complete this block for night Class C and above accidents or night relevant dawn and dusk accidents involving human error, when NVD or environmental factors are present.
  - (20) Block 20. Complete this block for all wire strikes.
- (21) Block 21. Complete this block for all Class A, B, and C accidents for crew members with access to the controls regardless of the accident cause factor. Also, complete this block for all personnel who had a causative role or was injured as a result of the accident/incident (Class A–F). This block is not required for materiel failure Class D and E accidents, Class E and F incidents, where the only cause of the failure was FWT. If more than three personnel are involved, use additional forms as necessary. Use the instructions for block 21a for completing blocks 21b and 21c.
  - (a) Block 21a. (1). Enter the individual's last name, first name, and middle initial.
  - (b) Block 21a. (1). Enter the individual's social security number.
  - (c) Block 21a. (2). Enter the individual's pay grade. For example, O4, W3, GS-09, W-10. See table 3-8.
  - (d) Block 21a. (3). Enter the individual's gender.
- (e) Block 21a. (4). Enter the duty position code as shown on DA Form 2408–12 for the flight, or from the list at table 3–5.
  - (f) Block 21a. (5). Enter the personnel service code of the individual from the list at table 3-9.
  - (g) Block 21a. (6). Enter the UIC of the unit to which the individual is assigned at the time of the accident.
  - (h) Block 21a. (7). Check "D," "S," "N," or "U" to indicate the individual's casual role in the accident.
- (i) Block 21a. (8). Check the box to indicate if the individual was on the flight controls at the time of the accident or if his previous control input had any influence on the accident.
  - (j) Block 21a. (9)(a). Check if blood and urine samples were taken (required for Class C and above accidents).
- (k) Block 21a. (9)(b). If the results are positive, attach the AFMES results and address in findings at block 24 (authorized medication excluded).
- (1) Block 21a. (10)(a). Enter the total number of hours this individual slept during the 24-hour period preceding the accident.
- (m) Block 21a. (10)(b). Enter the total number of hours this individual worked in the 24 hours preceding the accident.
  - (n) Block 21a. (10)(c). Enter the total number of hours this individual flew in the 24 hours preceding the accident.
- (o) Block 21a. (11)(a)(b). If the individual is a rated aviator, check the appropriate box to indicate his/her RL and FAC level.
  - (p) Block 21a. (11)(c). Enter the date the individual redeployed from a combat zone.
- (q) Block 21a. (12). Check the appropriate box to indicate if the individual was injured. If "Yes" is checked, a DA Form 2397–9 is required to be submitted for each individual injured as a result of the accident. Accidents involving injury/occupational illness require a physician or flight surgeon (if a flight surgeon is not available, an Army medical

officer may be appointed) to be a member/advisor of the board. Instructions for completing the DA Form 2397–9 are contained in this pamphlet.

- (r) Block 21a. (13). Enter the total number of flight hours this individual has accrued in the accident aircraft mission, type, design, and series.
  - (s) Block 21a. (14). Enter the total number of flight hours in all aircraft.
  - (22) Block 22. Pertains to Class C and above accidents only.
- (a) Block 22a. Any deformation of occupiable space constitutes a compromise for the purpose of this report. If "Yes" is checked, a DA Form 2397–6 is required to be submitted with the DA Form 2397–AB. Instructions for completing the DA Form 2397–6 are contained in this pamphlet. Pertains to Class C and above accidents only.
- (b) Block 22b. Check the appropriate box to indicate if post-crash escape/rescue/survival difficulties were a factor for this individual. If "Yes," submit a DA Form 2397–10 for the individual(s). Instructions for completing the DA Form 2397–10 are contained in this pamphlet.
- (c) Block 22c. Check the appropriate box to indicate if protective/restraint equipment functioned as designed. If "No", submit a DA Form 2397–10 for the individual(s). Additionally, check "No" and submit DA Form 2397–10 on the individuals if protective/restraint equipment was needed but not available, or was a contributing factor in the accident. Instructions for completing the DA Form 2397–10 are contained in this pamphlet.
- (23) Block 23. Check the block(s) that best describe the cause(s) of the accident and substantiate each box checked in the findings.
- (24) *Block 24*. Instructions for writing findings and recommendations are contained in paragraph 3–23, block 1, of this pamphlet. Completion instructions for DA Form 2397–2 are contained in this pamphlet.
  - (25) Block 25. Enter the substantiating data submitted with the DA Form 2397-AB.
- (26) Block 26. For Class C and above accidents only. Class C and above accidents will be forwarded through the reviewing chain of command for signature and comment in accordance with higher headquarters directions. Block 26a will be signed by the unit commander. Block 26b may be signed by any higher level chain of command. Block 26c approving authority is either the ACOM, ASCC or DRU commander or that commander's designated representative.

Note. Supplemental DA Form 2397–AB. Follow-up data, (for example, CCAD, Deficiency Report (DR), PQDR) teardown results are to be submitted as required. Complete only block 1 (case number) and those blocks for which the supplemental data applies.

# 3-37. Completion instructions for DA Form 2397-U, Unmanned Aircraft System Accident Report (UASAR)

For	NED AIRC	Use for a	I UAS Avia	tion Acci	idents		<i>(UASAR)</i> Sa.		REQUIRE		CONTROL SYMBOL DCS-309
1. ACCIDENT CASE	1	(YYYYMMD	D)	b. Time (i				c. UAT	ail Number		
INFORMATION		0091014			15					200	
2. ACCIDENT CLAS CATEGORY	SS/ a. Class		RC [	D ME	:	b. Cate		aht Bolota	d Aircraft	Cround	3. UAS MTDS RQ-7B
4. PERIOD OF DAY			5. AIRCR		Number of A	,	b. In Fligh	-			EST MILITARY INSTALLATION
☐ Dawn 🕱 Da	y Dusk	☐ Night	INVOL		Involved	1	Yes		Unknown		Ft Where, TX
7. ACCIDENT a.	On-Post		irfield on Airfield	c. City	Whoville		d. State TX	e.	Country USA	f.	Grid and/or Lat/Long 16R12345678
					8. ORGANI						
a. Unit Designation	Co9BSTB		b. Unit lo	dentification 'W??	n Code (UIC	() c	. Home Stat		TV	d. Arm	y Headquarters FORSCOM
вс	098518							Where,		- Careton	FORSCOM
a. Unit Designation					n Code (UIC		f same as bl		e blank)	Id Arm	y Headquarters
a. Onn Designation			D. OHICK	acrameau0f	, code (OIC	"	. Home stat	ioti	The state of the	u. Aim	y neduqualities
10. ACCIDENT	a. UA Total I	oss b. U	A Damage o	r replacem	ent Cost	- c	. Number of		d. Man-Hou	rs Cost	e. Other UAS Sub-System
COST DATA	Yes	X No (Exc	uding Man-h		180,32	i_	Man-Hour	s	\$	<u> </u>	Cost \$
f. Other Damage C	ost-Military	g. Other Da \$			h. Injury/Oc \$	cupation	al Iliness		ost (This UAS 0,327	. 0	j. Total Cost (All Aircraft) \$
11. GENERAL	a. Mission	a(1). Type N	l	2). Aircraft			<u></u>	and the same	§ %		of Interoperability (LOI)
DATA a(4). Simultaneous	IIA Operation	T 7		Single-shi	ip ∐ Mu b. EligÎ		Manned/	Unmanne		. flight Ru	2 3 4 5 X N
a(4). Simultaneous (If Yes, specify num		· L	105	NO NO	.200	- N	Civil	X Opera	E .	. Flight Ru	13 ^{F2}
d. Mission/	d(1). At what	level was mi	ssion/training	g conducte			<u> </u>	· · · · · · · · · · · · · · · · · · ·	- P		on/training? Rank & Position:
Training	Bde	Bn	<b>X</b> Co	Plt	☐ Sqd	☐ Tea	m 🗌 Cre	w		CPT,	Co Cdr
d(3). Was a mission	brief complet	ed? d(4			during the n	nission?	1	d(5).			er present during the
X Yes	☐ No		Rank & F		W2, Plt L	dr	A Partie	1	mission/trainir		& Position: Plt Ldr
e. Risk	e(1). RM Per	formed? e0	). Who perf	1.5	RM? Rank	- 7	on: e(3)	RM Appro	ved? e(4). W		ed risks? Rank & Position:
Management (RM)	× Yes [	'	1	St. March	MC	1	- V	es 🗆 N			TC, Co Cdr
e(5). What was the			s applied?		1	e(6).			cess communic	***************************************	(Check all that apply.)
Low	▼ Modera	ite 🗀 I	ligh [	Extrem	ely High	ľ	Worksheet			Order	☐ Not Communicated
e(7). Accident even If yes, complet				ss? X Yes	□No	3/9/10	a. What was		of the identified loderate	isk?	Extremely High
	trol measure(s	) e(		s responsi Position:	ble for imple	menting	the controls?	,			otential for accident event as residual risk?
e(7)b. Was the con	,,, , , , , , , , , , , , , , , , , ,	W	natik &	r oauon.	SSG,	, MC			ì	X Yes	as residuai risk?
e(7)b. Was the con applied?    X   Yes	No 1	3.	yes, enter ty	pe of DSC			Data captur	ed and pre			fy storage location)
applied?	f(1). DSC ins	stalled? (If				1 ` "					777, Ft Where, TX
applied?  X Yes  f. Digital Source Collector (DSC)	f(1). DSC ins	stalled? (If	E II Box								
applied?  X Yes  f. Digital Source Collector (DSC)  g Fire	f(1). DSC ins	□ No AC	)	h. Hazaro	dous Materia & a Class A,	al Spillage	e i.		ent occur while	on an exe	rcise or at a training
applied?  X Yes  f. Digital Source Collector (DSC)	f(1). DSC ins	□ No AC	E II Box o	h. Hazaro If yes o		al Spillage B or C a 397-6)	e i.	Did accid	ent occur while		-
1377	À \			pe of DSC					served? (If	Yes Yes	No No No No No No No No No No No No No N

Figure 3–18. Example of a completed DA Form 2397–U, Unmanned Aircraft System Accident Report (UASAR)

13. FLIGHT DATA	Flight Duration	(Enter max of 3-4 of DA Pan	of Operation 3 codes from Table 1 385-40 or specify ere is no code for it	Altitude MSL	Altitude AGL	Airspeed KIAS	UA Weight	UA Ove Weig Cond Yes	ht for	F table F-3 of specify the ty	f 3 codes f DA Pam : pe event v	
a. At Emergency/ Onset	Hours 2 Tenths 7	G		5000	4850	70	338		×	if there is no	code for it	in the table.)
b. At Impact/Acdt or Termination	Hours 2 Tenths 8	6	R	150	0	0	338		×	U33	U05	U09
c Flight Ctrl Malfunction	Check all the		vironmental	Materiel	Hardy	ware [	Software		ompon	ent/Part 🔀	Not App	licable
15. ACCIDENT	CAUSE FACT	ORS (For block	s 15a-c, D=definite, S	S=Suspected	l, U=Undete	ermined and	N=No/None			n Factors (Che		
			codes in each block				des in table	- If	D or S,  □□□□	complete block		
a(1)a. Support			he table, write in that			ne тапиге) )c. Training	Failure			a(1)d. Leader	Failure	IN IN
a(//a. bappon	. unui o	-	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,		J ~ / .	,ou				4,1,4.,25440.		
a(1)e. Individu	al Failure	1 (0	Materiel Factors heck box D, S, U or I S, complete blocks 1	N. If D 15b(1)-(2))		xs 🗆	U 🔲 N.	200	i	Check all that a		Software
b(2). Compone	ent and Part	(Part that initiate	d failure/malfunction	)				1	N.		No. of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of Contract of	The second
			S Subsystem S, GDT, TALS, etc.)			Major Comp	onent		T	1	Part	
a. Nomenclatur	re e	(0/1, 00.	UA			Engin	e	1	A STATE OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PAR	Ma	igneto	Andrew Control
b. Type, Desig and Series	n,		RQ-7B	war.				and the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of t			and the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of t	š
c. Part Number			ID.		1	8629-410	005-30			38393-	-43307-	10
d. NSN/ Manufacture Number	er's			1				7				
e. Manufacture Code	er's						1	S. Carrier		9	7384	
f. Serial Numb	er		2001			263	photosis.				173	
g. Cause of Fa Malfunction	ilure/		The state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the s		➤ Mater  □ Desig		Maintena Manufact			the applicable Failu -2, DA Pam 738-75		
C Environment (Check box	D, S, U or N, a	×υ		). General		that apply.)	Turbu	ence	(Ente	Weather Condi r max of 3 code: 3-26 of DA Pam rer condition if the ble.)	s from App 385-40 o	r specify the
Uplink	Downlink		ence E 3 X	NA 🔲	Other (S)	pecify)						
c(4). Other En (Enter max of 3 specify the weat	codes from Ap	pendix F table 3	-27 of DA Pam 385-4 for it in the table.)	10 or	X5				_	W1		
16. LOSS OF	INK (Check t	ox D, S, U or N.	#5 6 T	Type of Link	Lost			ype of L				_
complete block	s 16 a-d)	U	X N	Uplink	Downlink	Unki	nown	LOS Other (S		-	:-Band	Ku-Band
c. UA distance	from the GCS	at time of LOL				all that apply.		Hardw	are [	Software	Comp	onent/Part
17. TAKE OFF	/LANDING DA	TA (Complete hi	ock 17a if accident o	ccured durin	a take-off n	hase and bic	ock 17h if du	ina land	ing nha	se)		
a. Take-Off	a(1). T/O N					(Check al			g pina	/		
(T/O) Phase		Launcher	1 '	•		ment [] N	.,,,	Hardw	are [	Software	Comp	onent/Part
b. Landing	b(1). Landi	ng Method				ctors (Chec						
Phase	ATLS [	TALS FT	S Manual	Human [	Environ	ment 🔲 N	Materiel	Hardw	are [	Software	Comp	onent/Part
	97-U, FEB 20											PAGE 2 OF

Figure 3-18. Example of a completed DA Form 2397-U, Unmanned Aircraft System Accident Report (UASAR)—continued

Wire	STRIKE  Bird Tree	:	oject  Lighting	Ante	anna 🔽	N/A [	T Other	(Specify)			
		land.	nch crew member with						al illness nersonne	l having a contr	ihutina
19. PERSON	role in		ent; use additional for	ms if neede	ed.)				·	_	-
a. Name (La Operator,			(1) SSN	(2) Grade E5	(3) Gender	(4) Duty AO	(5) SVC A	(6) UIC (Assigned)	(7) Contributing	(8) On Fit Ctrls	(9) Lab Test
			999-99-9999		Female			W?????			Not Required
(10) Activity	a) Hrs Slept	8.0	(11) Individual Statu		Mon Dror	) Msi	o Oual		Occupational Illnes	(13) MTDS Fit Hrs	(14) Total Fit Hrs
	(b) Hrs Worked	7.7	(a) RL X 1 (b) FAC X 1 (					DA Form 2	mplete and attach 397-9)	1 111113	i itilis
	(c) Hrs Flown	2.8	(c) Redeployed Da	te (YYYY/	MMDD)			☐ Yes	X No	350.1	425.5
b. Name (La Pavload, J			(1) SSN	(2) Grade E5		(4) Duty PO	(5) SVC A	(6) UIC (Assigned)	(7) Contributing	(8) On Fit	(9) Lab Test
rayioau, s	ane ivi.		888-88-8888	EJ	Male Female	1	А	W?????	Role D S		Pos X Neg
(10) Activity	a) Hrs Slept	7.5	(11) Individual Statu	us	[K] F CATIGATE	1		(12) Injury/C	Occupational Ilines		(14) Total
	(b) Hrs Worked	8.0	(a) RL X 1					(If "yes" co	mplete and attach	FITHIS	Fit Hrs
	(c) Hrs Flown	2.8	(b) FAC X 1 (c) Redeployed Da			15 Operation	ors)	T Yes	A .	225.3	321.7
c. Name (La	ist, First, MI)		(1) SSN	(2) Grade	(3) Gender	(4) Duty	(5) SVC		(7) Contributing	(8) On Fit	(9) Lab Test
					Male		Name of Street	(Assigned)	Role D D S		Pos Neg
(10) Activity	a) Urc Slant		(11) Individual Statu	ue.	Female		and the second	(12) Injubul	Ccupational Illnes		Not Required
(10) Activity			(a) RL 1 1	2   3	Msn Prep	) Msi	n Qual	(If "yes" co	mplete and attach	Fit Hrs	Flt.Hrs
	(b) Hrs Worked		(b) FAC 1 1			S Operato	ors)	DA Form 2	1 7	V.	
	(c) Hrs Flown		(c) Redeployed Da		They're	3.	A.	☐ Yes		and the second	
Finding 1 mission, the of the mag causing me connector	(Suspected Prese the ignition system that caused UA tajor fuselage and	ent and on m magno 's engino d system	(See instructions in D Contributing: M eto (P/N 38393-4 e to fail. The UA as damage. The tr. The magneto'	lateriel F 43307-10 A was de magneto	'ailure): V  (i) failed to  (cscended v  (failure w	Vhile the operate vith its pass due to	e RQ-7 e prope parachu o the ir	B was in our ly due to the deployer as	eruise flight or a suspected lo ed, impacting sembly/seating	a day time w coil short he ground n g of the mag	surveillance . The failure ose first neto
Finding 1 mission, th of the mag causing m connector resulting e	(Suspected Presone ignition system that ignition system that caused UA ajor fuselage and pins by the man agine failure.	ent and ( m magne d's engine d system ufacture	Contributing: Meto (P/N 38393-4e to fail. The UAs damage. The	Iateriel F 43307-10 A was de magneto 's (P/N 38	alure): V 0) failed to scended v failure w 8393-4336	While the operate with its pas due to 07-10) I	e RQ-7 e prope parachu o the ir ow coi	B was in our ly due to the deployer as	eruise flight or a suspected lo ed, impacting sembly/seating	a day time w coil short he ground n g of the mag	surveillance . The failure ose first neto
Finding 1 mission, the of the mag causing meconnector resulting e	(Suspected Preside ignition systemeto caused UA ajor fuselage and pins by the manngine failure.  Findings and R	ent and (m magnot's engined system aufacture	Contributing: M eto (P/N 38393-4 e to fail. The Uz as damage. The rr. The magneto' endations (see at	Iateriel F 43307-10 A was de magneto 's (P/N 38	aflure): V D) failed to escended v failure w 8393-4330 ontinuatio	While the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of	e RQ-7 e prope paracht o the ir ow coi	B was in or erly due to te deployen proper as I short cau	eruise flight of a suspected lo ed, impacting sembly/seatin sed a decline i	a day time w coil short he ground n g of the mag n bus voltag	surveillance . The failure ose first neto e and the
Finding 1 mission, the of the mag causing meconnector resulting e Additional	(Suspected Presset ignition systemeto caused UA ajor fuselage and pins by the manngine failure.  Findings and Research	ent and om magnets engined system sufacture	Contributing: Meto (P/N 38393-4e to fail. The U2 as damage. The r. The magneto' endations (see at	Iateriel F 43307-10 A was de magneto 's (P/N 38	alure): V 0) failed to scended v failure w 8393-4336	While the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of the compensation of	e RQ-7 e prope parachu o the ir	B was in or orly due to the deployed approper as I short can	eruise flight or a suspected lo ed, impacting t sembly/seatin sed a decline i	a day time w coil short he ground n g of the mag n bus voltag	surveillance . The failure ose first neto e and the
Finding 1 mission, the of the mag causing meconnector resulting e Additional USACRC USE ONLY F	(Suspected Present ignition system to caused UA ajor fuselage and pins by the manngine failure.  Findings and Ruthury	ent and om magnet's engined system unfacture	Contributing: Meto (P/N 38393-4 e to fail. The U2 is damage. The ir. The magneto' endations (see at e	Jateriel F. 43307-10 A was de magneto 's (P/N 38 tached co	aflure): V 0) failed to escended v failure w 8393-4336 ontinuatio	While the operate of operate vith its pas due to 07-10) if on sheet)	e RQ-7 e prope paracht o the ir ow coi	B was in or orly due to the deployed approper as I short can	eruise flight or a suspected lo ed, impacting t sembly/seatin sed a decline i	a day time w coil short he ground n g of the mag n bus voltag	surveillance . The failure ose first neto e and the
Finding 1 mission, the of the mag causing m connector resulting e Additional USACRC use only 21. LIST OF Block #20	(Suspected Preside ignition systemetic caused UA ajor fuselage and pins by the manngine failure.  Findings and Residual in the system is a system in the system in the system in the system is a system in the system in the system in the system is a system in the system in the system in the system is a system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in the system in	ent and om magnet's engined system unfacture Roll Tass	Contributing: Meto (P/N 38393-4e to fail. The Uz is damage. The irr. The magneto' endations (see at except and the irr. The magneto' poly. CCAD, PQDR, DA COD, PQDR, DA COD, PQDR, DA	Jateriel F. 43307-10 A was de magneto 's (P/N 38 tached co	adlure): V ) failed to seended v failure W 8393-4330 ontinuatio	While the operate of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the prope	e RQ-7 e proper parachu o the in ow coi	B was in our by due to the deployer as I short cau	eruise flight of a suspected leed, impacting sembly/seatin sed a decline i	a day time w coil short he ground n g of the mag n bus voltag	surveillance . The failure ose first neto e and the
Finding 1 mission, the of the mag causing m connector resulting e Additional USACRC USE ONLY FROM THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY	(Suspected Preside ignition systemeto caused UA ajor fuselage and pins by the manngine failure.  Findings and Resident of OP  ATTACHMENTS (E. Continuation SI Balance, RAW, PRESIDENT/ASO/PO	ent and om magnet's engined system ufacture  Roll Tas  ECOD/ACC heet, EC	Contributing: Meto (P/N 38393-4e to fail. The Uz is damage. The irr. The magneto' endations (see at except and the irr. The magneto' poly. CCAD, PQDR, DA COD, PQDR, DA COD, PQDR, DA	Jateriel F. 43307-10 A was de magneto. 's (P/N 38 tached co	adlure): V ) failed to seended v failure w, failure w, failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w f	While the operate of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the prope	e RQ-7 e proper parachu o the ir ow coi	B was in derly due to the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of the deployant of t	eruise flight of a suspected loed, impacting the sembly/seating sembly/seating and a decline in the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly s	a day time w coil short he ground n g of the mag n bus voltag  M 2  FN 05-14), I	RM 3 Photos,
Finding 1 mission, the of the mag causing m connector resulting e Additional USACRC USE only Fall LIST OF Block #20 Weight & 22. BÖARD Andrew T	(Suspected Preside ignition systemeto caused UA ajor fuselage and pins by the manngine failure.  Findings and Resident of OP  ATTACHMENTS (E. Continuation SI Balance, RAW, PRESIDENT/ASO/PO	ent and om magnet's engined system ufacture  Roll Tas  ECOD/ACC heet, EC	Contributing: Meto (P/N 38393-4e to fail. The Uzus damage. The cr. The magneto' endations (see at e. C.	A Forms 23 A Form 2:	adlure): V ) failed to seended v failure w 8393-4330  Failure/en 997-series, et 3397-4, Pro	While the operator of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of	e RQ-7 e proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper	B was in corly due to the deployant of the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the lea	eruise flight of a suspected loed, impacting sembly/seating sembly/seating and a decline in the sembly seating sed a decline in the sed and seating sed a decline in the seating sed and seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seating seati	a day time w coil short he ground n g of the mag n bus voltag  M 2  FN 05-14), I	RM 3 Photos,
Finding 1 mission, the of the mag causing m connector resulting e Additional USACRC USE ONLY FROM THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY OF THE PROPERTY	(Suspected Present ignition system to caused UA ajor fuselage and pins by the manngine failure.  Findings and Research ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the pins ignition of the	ent and om magnet's engined system ufacture  Roll Tas  ECOD/ACC heet, EC	Contributing: Meto (P/N 38393-4e to fail. The Uzus damage. The cr. The magneto' endations (see at e. C.	Jateriel F. 43307-10 A was de magneto. 's (P/N 38 tached co	adlure): V ) failed to seended v failure w, failure w, failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w f	Vhile the operate vith its pas due to 07-10) In sheet)  b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b	sf1 si2 y Engi	R was in corrly due to the deployer as a short cau	eruise flight of a suspected loed, impacting the sembly/seating sembly/seating and a decline in the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly seating the sembly s	a day time w coil short he ground n g of the mag n bus voltag  M 2  M 2  FN 05-14), I	RM 3 Photos,
Finding 1 mission, the of the mag causing m connector resulting e Additional USACRC use only process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the process of the pro	(Suspected Preside ignition systemeto caused UA ajor fuselage and pins by the manngine failure.  Findings and Routy  Thase of OP  ATTACHMENTS (E. Continuation SI Balance, RAW, PRESIDENT/ASO/PG. Byrd	ent and om magnet's engined system ufacture  Rob Tas  ECODIACC heet, EC Weathe	Contributing: Meto (P/N 38393-4e to fail. The Uzus damage. The cr. The magneto' endations (see at e. C.	A Forms 23 A Form 2:	adlure): V ) failed to seended v failure w, failure w, failure w say3-433i  Failurelen  Failurelen  W3	Vhile the operate vith its pas due to 07-10) In sheet)  b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b	sf1 si2 y Engi	R was in corrly due to the deployer as a short cau	eruise flight of a suspected loed, impacting the sembly/seating sembly/seating sed a decline in the sed a decline in the sed and the sed a decline in the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and	a day time w coil short he ground n g of the mag n bus voltag  M 2  M 2  FN 05-14), I	RM 3 Photos,
Finding 1 mission, the of the mag causing m connector resulting e Additional USACRC use only Fig. LIST OF Block #20 Weight & 22. BOARD Andrew T signature 28 Dec 09	(Suspected Preside ignition systemeto caused UA ajor fuselage and pins by the manngine failure.  Findings and Routy  Thase of OP  ATTACHMENTS (E. Continuation SI Balance, RAW, PRESIDENT/ASO/PG. Byrd	ent and om magnet's engined system ufacture  Rob Tas  ECODIACC heet, EC Weather  OC (Name	Contributing: Meto (P/N 38393-4e to fail. The Uz as damage. The carr. The magneto' endations (see at the carr. The magneto' pop. CCAD, PQDR, DA ar Brief	A Forms 23 A Form 2:	adlure): V ) failed to seended v failure w, failure w, failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w failure w fai	Vhile the operate vith its pas due to 07-10) In sheet)  b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b. Breed b	sf1 si2 y Engi	R was in corrly due to the deployer as a short cau	a suspected leed, impacting to sembly/seatin sed a decline in the sed a decline in the sed a decline in the sed a decline in the sed a decline in the sed a decline in the sed a decline in the sed a decline in the sed a decline in the sed a decline in the sed a decline in the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed an	a day time w coil short he ground n g of the mag n bus voltag  M 2  FN 05-14), I  (DSN and Com	RM 3 Photos,
Finding 1 mission, the of the mag causing m connector resulting e Additional USACRC use only F. 21. LIST OF Block #20 Weight & 22. BOARD Andrew T signature 28 Dec 09	(Suspected Preside ignition systemetic caused UA ajor fuselage and pins by the manngine failure.  Findings and R  ATTACHMENTS (E. Continuation SI Balance, RAW, PRESIDENT/ASO/PG. Byrd	ent and om magnet's engined system ufacture  Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert	Contributing: Meto (P/N 38393-4 e to fail. The U/s damage. The urr. The magneto' endations (see at e e contribution of the con	Idateriel F. 43307-10 A was de magneto. 's (P/N 38 A Forms 23 A Form 23 E-Mail	adlure): V  ) failed to seended v  failure w  8393-4331  ontinuatio  Failure/en  Failure/en  W3  email@	Vhile the operate vith its pas due to the operate vith its pas due to the operate vith its pas due to the operate vith its pas due to the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its passes of the operate vith its	e RQ-7 e prope pro	R was in corrly due to the deployary of the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the le	a suspected leed, impacting to sembly/seatin sed a decline in the sed a decline in the sed a decline in the sed a decline in the sed a decline in the sed a decline in the sed a decline in the sed a decline in the sed a decline in the sed a decline in the sed a decline in the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed and the sed an	a day time w coil short he ground n g of the mag n bus voltag  M 2  FN 05-14), I  (DSN and Com	RM 3 Photos,
Finding 1 mission, the of the mag causing m connector resulting e Additional USACRC USE ON Weight & 21. LIST OF Block #20 Weight & 22. BOARD Andrew T signature 28 Dec 09 23. COMMAI Reviewer a. Unit	(Suspected Present in the course of the ignition system neto caused UA ajor fusclage and pins by the manngine failure.  Findings and R  The course of OP  ATTACHMENTS (E CONTINUATION SI)  Balance, RAW,  PRESIDENT/ASO/PO.  Byrd  DREVIEW (Only representation of SI)  BYRD REVIEW (Only representation of SI)	ent and om magnet's engined system ufacture  Rol Tas  ECODIACC heet, EC Weather OC (Name on STB)	Contributing: Meto (P/N 38393-4 e to fail. The U/s damage. The urr. The magneto' endations (see at e e contribution of the con	Idateriel F. 43307-10 A was de magneto. 's (P/N 38 A Forms 23 A Form 2:  Bellia Gra  E-Mail	railure): V  allure): V  allure): V  failure to failure w  says-4331  continuation  Failure/en  Failure/en  w  and  email@  st. MI)  F.	Vhile the operator of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the property of the prop	e RQ-7 e prope pro	R was in derly due to the deployant of the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the lea	a suspected loed, impacting to sembly/seating sembly/seating sembly/seating and a decline in the sembly sembly seating sed a decline in the sembly seating sed a decline in the sembly seating sed a decline in the sembly seating sed a decline in the sembly seating sembly seating sembly seating sembly seating sembly seating sembly seating sembly seating sembly seating sembly seating sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly sembly semb	a day time w coil short he ground n g of the mag n bus voltag  M 2  FN 05-14), I  (DSN and Com	RM 3 Photos,
Finding 1 mission, the of the mag causing meconnector resulting e Additional USACRC use only F1. LIST OF Block #20 Weight & 22. BOARD Andrew T signature 28 Dec 09 23. COMMAI Reviewer a. Unit Commander	(Suspected Preside ignition systemetic caused UA ajor fuselage and pins by the manngine failure.  Findings and R  ATTACHMENTS (E. Continuation SI Balance, RAW, PRESIDENT/ASO/PG. Byrd  DREVIEW (Only in Draganization B Co 9 BS)  9 BCT	ent and om magnet's engined system ufacture  Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert Robert	Contributing: Meto (P/N 38393-4e to fail. The Uzas damage. The car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The magneto' endations (see attended to the car. The car. The magneto' endations (see attended to the car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The car. The ca	A Forms 23 A Form 2:  A Grae  Latertel F:  A Was de magneto  S (P/N 38 A Form 2:  A Form 2:  B Grae  E-Mail  (Last, Firs  William	adlure): V ) failed to seended v failure w. 8393-4330 ontinuatio  Failure/en  Failure/en  W3  email@  st. MI)  F.	While the operator of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of the control of	e RQ-7 e prope proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper proper p	R was in derly due to the deployant of the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the learning in the lea	eruise flight of a suspected loed, impacting the sembly/seating sembly/seating seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a decline in the seed a de	a day time w coil short he ground n g of the mag n bus voltag  M 2  FN 05-14), I  (DSN and Com	RM 3 Photos,

Figure 3–18. Example of a completed DA Form 2397–U, Unmanned Aircraft System Accident Report (UASAR)—continued

- a. Also see paragraph 3-21. Complete the entire form for all UAS accidents, regardless of accident class.
- b. Complete the UASAR, DA Form 2397-U, as follows:
- (1) Block 1, Accident Case Information. Complete this block as follows:
- (a) Block 1a, Date of accident. Enter the year, month, and day of the accident in YYYYMMDD format.
- (b) Block 1b, Time (Local). Enter the local time of the accident using the 24 hr clock.
- (c) Block 1c, UA Tail Number. Enter the Unmanned Aircraft's (UA) tail number Exception: some UAS (for example, the gMav SUAS) do not have a tail number. In that case enter the UAS serial number.
  - (2) Block 2, Accident Class/Category. Complete this block as follows:
- (a) Block 2a, Classification. Check the box corresponding to the appropriate accident classification per AR 385–10, paragraph 3–4.
- (b) Block 2b, Category. Check the box corresponding to the appropriate accident category as defined in the paragraph 1-9a(1)-(3) of this pamphlet.

Note. Block 2b does not apply to Class E FWT materiel failure incidents, leave blank.

- (3) *Block 3, UAS MTDS.* Enter the mission, type, design, and series (MTDS) of the UAS involved in the accident (examples: RQ-7B, MQ-1C).
  - (4) Block 4, Period of Day. Check the appropriate box.

*Note.* (Dawn is between the beginning of morning nautical twilight (BMNT) and official sunrise; Day is between official sunrise and official sunset; dusk is between official sunset and the end of evening nautical twilight (EENT); and night is between EENT and BMNT.)

- (5) Block 5, Aircraft Involved. Complete this block as follows:
- (a) Block 5a, Number of Aircraft Involved. Enter the number of aircraft involved in the accident.

Note. (If more than one aircraft is involved, submit additional DA Forms 2397–U for each UA and DA Form 2397–AB for each manned aircraft. Do NOT include damaged aircraft that were NOT being operated at the time of the accident. When completing additional forms, do not duplicate data already provided on the case aircraft form.)

- (b) Block 5b, In Flight/Mid-Air Collision. Check the appropriate box to indicate whether or not this accident involved an in flight/mid-air collision.
- (6) Block 6, Nearest Military Installation. Enter the name of the military installation/facility nearest to the accident site.
  - (7) Block 7, Accident Location. Complete this block as follows:
  - (a) Block 7a, On/Off Post. Check the appropriate box to indicate whether the accident occurred on or off post.
- (b) Block 7b, On/Off Airfield. Check the appropriate box to indicate whether the accident occurred on or off an airfield.

Note. (Tactical landing zones under positive ATC (for example: Corps' instrumented airfield, Division's VFR helipad, stagefields and support bases, UA Launch and Recovery Site) are considered "on post" and "on airfield" for reporting purposes. Also, UA accidents occurring on joint-use civil airports and on civilian airports with USAR component facilities are considered "on post" and "on airfield" when there is intent to use the military facilities on that airport.)

- (c) Block 7c, City. Enter the name of the city nearest to the accident site.
- (d) Block 7d, State. Enter the state in which the accident occurred.
- (e) Block 7e, Country. Enter the country in which the accident occurred.
- (f) Block 7f, Grid and/or Lat/Long. Enter the Military Grid Reference and/or latitude/longitude for the accident site.
- (8) Block 8, Organization Involved. Complete this block as follows:
- (a) Block 8a, Unit Designation. Enter the unit designation for the lowest level organization having operational control of the UAS at the time of the accident.
  - (b) Block 8b, Unit Identification Code. Enter the unit's six-digit Unit Identification Code (UIC).
  - (c) Block &c, Home Station. Enter the unit's home station.
  - (d) Block 8d, Army Headquarters. Enter the organization's Army Headquarters (the ACOM, ASCC, or DRU).

Note. (For Army Reserve or Army National Guard units on active duty status, if the unit of assignment is other than the Reserve or National Guard, enter the active duty unit information. Also, enter the UIC of the Army Reserve or Army National Guard unit in block 19a(6).)

- (9) Block 9, Accountable Organization. Complete this block as follows:
- Note. (If this organization is the same as block 8, leave blank).
- (a) Block 9a, Unit Designation. Enter the unit designation of the organization most responsible/accountable for the accident.
  - (b) Block 9b, Unit Identification Code. Enter the organization's 6-digit Unit Identification Code (UIC).

- (c) Block 9c, Home Station: Enter the organization's home station.
- (d) Block 9d, Army Headquarters. Enter the organization's Army Headquarters (the ACOM, ASCC, or DRU).
- (10) *Block 10, Accident Cost Data.* Do not include those items excluded from accident cost in DA Pam 385–40, paragraph 1–10. Enter in blocks 10b-i, only the cost associated with the UA/UAS to which this form pertains. Complete this block as follows:

Note. Fair Wear and Tear (FWT) materiel failure, where there is no corresponding damage to other components, is not considered damage, enter "0" or leave blank.

- (a) Block 10a, UA Total Loss. Check the appropriate box to indicate whether the UA is a total loss. If "Yes", enter the replacement cost in block 10b and leave blocks 10c & d (man-hours) blank.
- (b) Block 10b, UA Damage or Replacement Cost (excluding man-hours). If "Yes" is checked in block 10a, enter the current replacement cost (in whole dollars) for the UA. If "No" is checked in block 10a, enter the current cost (in whole dollars) to repair the UA to which this form pertains including component/part damage, but excluding man-hour cost. Cost to replace or repair the UA will be calculated at the current cost at the time of the accident.

Note. (Some UAS are contractually bound to receive ECOD/ACOD from the manufacturer who may not be required to break out man-hours cost. In that case, enter the cost to repair as provided by the manufacturer.)

(c) Block 10c, Number of Man-Hours. If block 10a is "No", enter the number of man-hours required to repair the damaged UA.

Note. (Some UAS are contractually bound to receive ECOD/ACOD from the manufacturer who may not be required to break out the number of man-hours or man-hours cost. In that case, leave blank.)

(d) Block 10d, Man-Hours Cost. If block 10a is "No", enter man-hour cost (in whole dollars) pertaining only to this aircraft's damage, based on current cost criteria specified in this DA pamphlet. Other man-hour costs will be included in block 10e (Other Damage Military).

Note. (Some UAS are contractually bound to receive ECOD/ACOD from the manufacturer who may not be required to break out the number of man-hours or man-hours cost. In that case, leave blank.)

(e) Block 10e, Other UAS Sub-Systems Cost. Enter the estimated/actual cost (in whole dollars) to repair or replace other UAS sub-systems (such as GCA, GDT, TALS, Arresting Gear, and so on) as a result of the accident. Cost to replace or repair the UAS sub-systems will be calculated at the current cost at the time of the accident.

Note. (Some UAS are contractually bound to receive ECOD/ACOD from the manufacturer who may not be required to break out man-hours cost. In that case, enter the cost to repair as provided by the manufacturer.)

- (f) Block 10f, Other Damage Cost-Military. Enter all costs (in whole dollars) to other military property resulting from the accident (including inoperative aircraft).
  - (g) Block 10g, Other Damage Cost-Civilian. Enter the damage costs (in whole dollars) to civilian property.
- (h) Block 10h, Injury/Occupational Illness Cost. Enter the injury/occupational illness cost (in whole dollars) for all personnel. The total cost can be computed by sum totaling the dollar amount found in block 19 of each DA Form 2397–9 completed or by using the cost standards table in DA Pam 385–40, table 1–1.

Note. A DA form 2397–9 is required to be submitted for each individual receiving an injury/occupational illness as a result of the accident. Instructions for completing DA Form 2397–9 are in DA Pam 385–40, paragraph 3–31.

- (i) Block 10i, Total cost (this UAS). Enter the total of the dollars in blocks 10b through 10h.
- (j) Block 10j, Total Cost (All Aircraft). Leave blank unless block 5 indicates multiple aircraft are involved. Enter the total cost (in whole dollars) for all aircraft (manned and unmanned) when multiple aircraft are involved.
  - (11) Block 11, General Data. Complete this block as follows:
  - (a) Block 11a, Mission. Complete this block as follows:
- 1. Block 11a(1), Type Mission. Enter the symbol for the mission as shown on the DA Form 2408–12 and/or from AR 95–23 (para 2–5b).
- 2. Block 11a(2), Aircraft Mode. Check the appropriate box to indicate if the mission was single-ship, multi-ship (more than one aircraft on same mission), or Manned/Unmanned Teaming (cooperative employment). If Manned/Unmanned Teaming is checked, complete block 11a(3).
- 3. Block 11a(3), Level of Interoperability (LOI). Check the appropriate box to indicate the LOI at the time of the accident. LOI refers to degree of manned aircraft control of the UAS during manned/unmanned teaming (cooperative employment). There are 5 levels: 1=Reception of the secondary product, 2=Direct data receipt, 3=Payload control, direct data receipt, 4=Flight control, payload control, direct data receipt, and weapons system operations, 5=Full function and control (only authorized when performing emergency procedures). Refer to AR 95–23, appendix C.
- 4. Block 11a(4), Simultaneous UA Operation. Check the appropriate box to indicate whether or not multiple unmanned aircraft were being operated simultaneously from the same ground control station (GCS). If "YES", specify the number, and MTDS, in the space provided.
  - (b) Block 11b, Flight Plan. Check the appropriate box to indicate the type flight plan (Military, Civil, or Operations

on file at the time of the accident.

Note. (Units may be using a locally developed form or DA Form 1594 as an Operations Log.)

- (c) Block 11c, Flight Rules. Check the appropriate box to indicate the flight rules the UA was flying under at the time of the accident.
  - (d) Block 11d, Mission/Training. Complete this block as follows: Complete this block as follows:
- 1. Block 11d(1), At what level was the mission/training conducted? Check the appropriate box to indicate the level at which the mission/training was conducted.
- 2. Block 11d(2), Who approved the mission/training? Enter the Rank and Position of the individual that approved the mission/training.
- 3. Block 11d(3), Was a mission brief completed? Check the appropriate box to indicate whether or not a mission brief was completed.
- 4. Block 11d(4), Who was in charge during the mission/training? Enter the Rank and Position of the individual that was in charge during the mission/training.
- 5. Block 11d(5), Who was the senior leader present during the mission/training? Enter the Rank and Position of the senior leader present during the mission/training.
  - (e) Block 11e, Risk Management (RM). Complete this block as follows:
- 1. Block 11e(1), RM Performed? Check the appropriate box to indicate whether or not a risk management was performed. If "YES", complete blocks 11e(2) 11e(7).
- 2. Block 11e(2), Who performed the RM? Enter the Rank and Position of the individual that performed the risk management.
- 3. Block 11e(3), RM Approved? Check the appropriate box to indicate whether or not the risk management was approved.
  - 4. Block 11e(4), Who accepted the risk(s)? Enter the Rank and Position of the individual that accepted the risk(s).
- 5. Block 11e(5), What was the level of risk after controls applied? Check the appropriate block to indicate the level of risk after the controls were applied.
- 6. Block 11e(6), How was the RM process communicated? Check the appropriate box (check all that apply) to indicate how the risk management process was communicated.
- 7. Block 11e(7), Accident event identified/considered during RM process? Check the appropriate box to indicate whether or not the accident event was identified/considered during the risk management process. If "YES", complete blocks 11e(7)(a)-11e(7)(d).
- a. Block 11e(7)(a), What was the level of the identified risk? Check the appropriate box to indicate the level of the identified risk.
- b. Block 11e(7)(b), Was the control measure(s) applied? Check the appropriate box to indicate whether or not the control measure(s) was applied.
- c. Block 11e(7)(c), Who was responsible for implementing the control(s)? Enter the Rank and Position of the individual responsible for implementing the control(s).
- d. Block 11e(7)(d), Was the potential for the accident event accepted as residual risk? Check the appropriate box to indicate whether or not the potential for the accident event was accepted as residual risk.
  - (f) Block 11f, Digital Source Collector (DSC). Complete this block as follows:
- 1. Block 11f(1), DSC installed? Check the appropriate box to indicate whether or not a Digital Source Collector was installed. If "YES," specify the type of DSC in the space provided.
- 2. Block 11f(2), Was the data captured and preserved? Check the appropriate box to indicate whether or not the DSC data was collected and preserved. If "YES," specify the storage location of the DSC data in the space provided.
- (g) Block 11g, Fire. heck the appropriate box to indicate if and when there was a fire during the accident sequence. If "Other," specify in the space provided.
- (h) Block 11h, Hazardous Material Spillage. Check the appropriate box to indicate whether or not a hazardous material spillage occurred. If "Yes" and this was a class A, B, or C accident, complete a DA Form 2397–6 (form completion instructions are in para 3–28 of this pamphlet) and attach it to the report (note the attachment in block 21); for Class D, E, and F accidents explain the type and source of spillage in block 12, Summary.
- (i) Block 11i, Did the accident occur while on an exercise? Check the appropriate box to indicate whether or not the subject UAS was participating in an exercise or while at a training facility (FTX, NTC, JRTC, named event such as Desert Eagle, and so on). If "Yes," enter the name of the exercise in the space provided.
- (12) *Block 12, Summary*. Enter a concise summary of events from the initial onset of the emergency until the aircraft came to rest, to include injuries/occupational illness resulting from the accident. Specify the actual errors/failures/effects and the root causes. The specified errors/failures/effects and root causes should be supported in the narrative of the summary. The summary should substantiate the findings entered in block 20. Refer to figure 3–5 of this pamphlet for narrative examples. Enter the SF 368 PQDR number, category, and status when materiel deficiencies are involved. Use a continuation sheet(s) on plain bond paper as necessary. Note: Attach a completed DA Form 2397–3

(form completion instructions are in para 3-25 of this pamphlet) if the board determines that more narrative information is required.

Note. Note the attachment in block 21.

- (13) Block 13, Flight Data Enter the flight parameters at the times indicated in the table. Flight parameters pertain to both flight and ground operations of the aircraft.
- (a) Block 13a, At Emergency/Onset. Enter the listed flight parameters at the onset of the emergency. Note: The use of the term "emergency" in this pamphlet refers to "any occurrence/situation wherein the personnel involved sense a need to take appropriate measures to reduce the effects of the occurrence/situation or prevent injury/occupational illness, property damage, or further materiel failure."
  - 1. Block 13a(1), Flight Duration. Enter the duration of the flight in hours and tenths of hours in the spaces provided.
- 2. Block 13a(2), Phase of Operation. Enter a maximum of 3 codes from table 3-4 of this pamphlet in the spaces provided or specify the phase of operation if there is no code for it in the table.
  - 3. Block 13a(3), Altitude MSL. Enter the aircraft's altitude (Mean Sea Level) in the space provided.
  - 4. Block 13a(4), Altitude AGL. Enter the aircraft's altitude (Above Ground Level) in the space provided.
  - 5. Block 13a(5), Airspeed KIAS. Enter the aircraft's speed (Knots Indicated Air Speed) in the space provided.
  - 6. Block 13a(6), UA Weight. Enter the aircraft's weight (pounds) in the space provided.
- 7. Block 13a(7), UA Overgross Weight for Conditions? Check the appropriate box to indicate whether or not the UA was over gross weight limitations. If "YES," explain in block 12 and/or block 20.
- (b) Block 13b, At Impact/Accident or Termination. Enter the listed flight parameters at the time of the first major impact/accident or termination. Exception: in those cases where an in-flight strike occurred, resulting in a second impact, record the second impact in this block. This block may duplicate block 13a (At Emergency).
  - 1. Block 13b(1), Flight Duration. Enter the duration of the flight in hours and tenths of hours in the spaces provided.
- 2. Block 13b(2), Phase of Operation. Enter a maximum of 3 codes from table 3-4 of this pamphlet in the spaces provided or specify the phase of operation if there is no code for it in the table.
  - 3. Block 13b(3), Altitude MSL. Enter the aircraft's altitude (Mean Sea Level) in the space provided.
  - 4. Block 13b(4), Altitude AGL. Enter the aircraft's altitude (Above Ground Level) in the space provided.
  - 5. Block 13b(5), Airspeed KIAS. Enter the aircraft's speed (Knots Indicated Air Speed) in the space provided.
  - 6. Block 13b(6), UA Weight. Enter the aircraft's weight (pounds) in the space provided.
- 7. Block 13b(7), UA Overgross for Conditions? Check the appropriate box to indicate whether or not the UA was over gross weight limitations. If "YES," explain in block 12 and/or block 20.
- (c) Block 13c, Flight Control Malfunction. Check all boxes that apply. Flight Control System related accidents could be the result of Human, Materiel, and/or Environmental factors. In addition to this block, complete blocks 15a-c as applicable.
- (14) *Block 14, Type Events.* Using appendix F, table F–3 of this pamphlet enter up to a maximum of three event codes that best categorize the accident/incident. The 3 codes should be listed in the sequence of occurrence. If there is no code for the event in the table, specify the Type of Event(s) in the space(s) provided.
- (15) Block 15, Accident Cause Factors. Indicate if Human, Materiel, or Environment cause factors (H/M/E) played a role in the accident/incident by selecting "D" if definite, "S" if suspected, "U" if undetermined, or "N" if None/No in the appropriate block. Accident Cause Factors contributing to the accident will be substantiated in block 12, Summary, and/or block 20, Findings and Recommendations.
- (a) Block 15a, Human Factors. Check the appropriate box (D, S, U, or N) to indicate if Human Factors played a role in the accident. If D or S is checked, complete blocks 15a(1)(a)-(e).
- 1. Block 15a(1), System Inadequacies (SI). Using figure 2–1 of this pamphlet, determine the System Inadequacy(s) responsible for the Human Factor(s). An accident may have multiple human factors and, therefore, multiple system inadequacies. Include all identified system inadequacies. The form allows for the entry of up to three codes for each system inadequacy.

Note. (If more than 3 are identified, use a continuation sheet.)

- 2. The primary table for System Inadequacy codes is table B–5, appendix B, of this pamphlet. Additional aviation specific codes can be found in table B–1. If there is no code(s) for the identified system inadequacy in either table, write in that which that best describes the failure.
  - a. Block 15a(1)(a), Support Failure. Enter up to 3 codes to identify the support failure.
  - b. Block 15a(1)(b), Standards Failure. Enter up to 3 codes to identify the standards failure.
  - c. Block 15a(1)(c), Training Failure. Enter up to 3 codes to identify the training failure.
  - d. Block 15a(1)(d), Leader Failure. Enter up to 3 codes to identify the leader failure.
  - e. Block 15a(1)(e), Individual Failure. Enter up to 3 codes to identify the individual failure.
- (b) Block 15b, Materiel Factors. Check the appropriate box (D, S, U, or N) to indicate if Materiel Factors played a role in the accident. If D or S is checked, complete blocks 15b(1) and 15b(2)(a)-(g).

- 1. Block 15b(1), Type. Check the appropriate box(s) to indicate the type of materiel failure and/or malfunction. Check all that apply.
- 2. Block 15b(2), Component and Part Data. Complete blocks 15b(2)(a)-(g) for the component and/or part that failed or malfunctioned. Enter the requested data for materiel failure and/or malfunction resulting from FWT, maintenance error, manufacturing defect or error, and/or design deficiency. Component column data is required "only" for those items involving power and drive trains; for example, engine, transmission, gearboxes, and so forth. For maintenance error, over which the Army has control, block 19 must also be completed. This is a three column chart. Column 1 is for the UAS sub-system (UA, GCS, GDT, TALS, FTS, ATLS, etc), column 2 is for the component, and column three is for the part. Note: If more than one UAS sub-system had a materiel causal factor, attach additional forms for each sub-system. An EIR/SF 368 (Product Quality Deficiency Report, PQDR) is required for all materiel accidents in accordance with paragraph 3–9b(1), AR 385–10 and paragraph 3–2, DA Pam 738–751. Attach a copy of the SF 368 to this report and note the attachment in block 21.
  - a. Block 15b(2)(a), Nomenclature. Enter the noun nomenclature in the space provided.
  - b. Block 15b(2)(b), Type, design, and series. Enter the Type, design, and series in the space provided.
  - c. Block 15b(2)(c), Part Number. Enter the part number in the space provided.
- d. Block 15b(2)(d), NSN/Manufacturer's Number. Enter the National Stock number (NSN) or Manufacturer's Number (if no NSN assigned) in the space provided.
  - e. Block 15b(2)(e), Manufacturer's Code. Enter the code to identify the manufacturer in the space provided.
  - f. Block 15b(2)(f), Serial Number. Enter the item's serial number in the space provided.
- g. Block 15b(2)(g), Cause of Failure/Malfunction. Column 1 intentionally left blank; in column 2 check the appropriate box; and in column 3 enter the applicable Failure Codes (maximum of 2) using DA Pam 738–751, table 1–2, (TAMMS–Aviation).
- (c) Block 15c, Environmental Factors. Check the appropriate box (D, S, U, or N) to indicate if Environmental Factors played a role in the accident.
- 1. Block 15c(1), General. This block identifies specific meteorological weather conditions at the time the accident occurred. Check all applicable boxes (more than one may apply).

Note. "VMC and IMC are NOT environmental "causal" factors if the conditions were forecast."

- 2. Block 15c(2), Weather Factors. Enter up to three codes from table 3–26 of this pamphlet in the spaces provided to indicate weather factors that played a role in the accident. If there is no code(s) for the weather condition in the table, specify the factor(s) in the space(s) provided.
- 3. Block 15c(3), Environmental Signal Factors. Check the appropriate box(s) to indicate the environmental signal factors/conditions at time of the accident. If "other" is checked, specify the signal factor(s) in the space provided.

Note. If the "signal" problem was not environmental related, but rather the result of human and/or materiel factors, DO NOT enter it in this block; enter it in block 15a and/or block 15b.

- 4. Block 15c(4), Other Environmental Factors. Enter a maximum of three codes from table 3–27 of this pamphlet in the spaces provided to indicate other environmental factors that played a role in the accident. If there is no code(s) for the other environmental factors in the table, specify the factor in the space(s) provided.
- (16) Block 16, Loss of Link (LOL). Enter D (definite), S (suspected), U (undetermined), or N (none/no) as appropriate to indicate if Loss of Link played a role in the accident. If D or S is checked, complete blocks 16a-d. LOL can be the result of Human, Materiel, and/or Environmental factors. In addition to blocks 16a-d, complete blocks 15a-15c as/if applicable.
- (a) Block 16a, Link Lost. Check the appropriate box to indicate whether it was a loss of uplink, downlink, or unknown.
- (b) Block 16b, Type of Link. Check the appropriate box to indicate the type of link lost. If "other" is checked, specify the type of link in the space provided.
- (c) Block 16c, UA distance from GCS at time of LOL. Enter the distance (nautical miles) the UA was from the GCS at the time that the link was lost.
  - (d) Block 16d, LOL Factors. Check the appropriate box(s) to indicate LOL Factors. Check all that apply.
- (17) Block 17, Take-Off/landing Data. Complete block 17a if the accident occurred during the take-off phase or block 17b if it occurred during the landing phase. Accidents occurring during T/O or Landing could be the result of human, materiel, and/or environmental factors. In addition to blocks 17a & 17b, complete blocks 15a-15c as/if applicable. If the accident did NOT occur during the takeoff or landing phase, leave blank.
- (a) Block 17a, Take-off (T/O) Phase. Complete this block, if the accident occurred during the take-off phase of flight, as follows:
- 1. Block 17a(1), T/O Method. Check the appropriate box to indicate the method of T/O. Examples of "manual" include joystick and hand launched.
- 2. Block 17a(2), T/O Accident Factors. Check the appropriate box(s) to indicate T/O accident factors. Check all that apply.

- (b) Block 17b, Landing Phase. Complete this block, if the accident occurred during the landing phase of flight, as follows:
- 1. Block 17b(1), Landing Method. Check the appropriate box to indicate the method of Landing. Example of "manual" is joystick flown.
- 2. Block 17b(2), Landing Accident Factors. Check the appropriate box(s) to indicate Landing accident factors. Check all that apply.
- (18) *Block 18, Type of Strike*. Check the appropriate box to indicate whether or not a "strike" occurred and the type. If "Other" is checked, specify the type of strike in the space provided.
- (19) Block 19, Personnel Data. Complete this block for class A, B and C accidents for all crewmembers occupying UAS flight crew station, regardless of the accident cause factor. Also, complete this block for all personnel who had a causative role or had injury/occupational illness as a result of the accident/incident (Class A–F). This block is not required to be completed for class C, D and F materiel failure accidents/incidents if the only cause of the failure was FWT. If more than three personnel are involved, use and attach additional forms as necessary. Use the instructions for block 19a to complete blocks 19b and 19c.
  - (a) Instructions.
  - (b) Block 19a, Name. Enter the individual's last name, first name, middle initial and complete (1)-(14).
  - 1. Block 19a(1) (SSN). Enter the individual's social security number.
- 2. Block 19a(2), Grade. Enter the individual's pay grade. For example, O4, W3, GS-11, WG10 (refer to table 3-8 of this pamphlet).
  - 3. Block 19a(3) (Gender). Check the appropriate box to indicate the individual's gender.
- 4. Block 19a(4), Duty Position. Enter the duty position/seat code as shown on the DA Form 2408–12 for the flight or in table 3–5 of this pamphlet.
  - 5. Block 19a(5), Service Code. Enter the personnel service code of the individual from table 3–9 of this pamphlet.
- 6. Block 19a(6), UIC Assigned. Enter the six position UIC of the unit to which the individual was assigned at the time of the accident.
- 7. Block 19a(7), Contributing Role. Check D (definite), S (suspected), U (undetermined), or N (none/no) to indicate the individual's contributing role in the accident.
- 8. Block 19a(8), On Flight Controls. Check the appropriate box to indicate if the individual was on the UAS flight controls at the time of the accident or if his/her previous control input had any influence on the accident.
- 9. Block 19a(9) (Lab Testing). Check the appropriate box to indicate the results of lab testing (testing required for class A, B and C accidents). If the test result was "positive", attach the Armed Forces Institute of Pathology (AFIP) results to this report and address it in block 20 (authorized medication excluded). Note the AFIP attachment in block 21
  - 10. Block 19a(10), Amount of Activity. Complete this block as follows:
- a. Block 19a(10)(a), Hours Slept: Enter the total number of hours this individual slept during the 24-hour period preceding the accident.
- b. Block 19a(10)(b), Hours Worked. Enter the total number of hours this individual worked during the 24-hour period preceding the accident.
- c.  $Block\ 19a(10)(c)$ ,  $Hours\ Flown$ . Enter the total number of flying hours for this individual during the 24-hour period preceding the accident.
  - 11. Block 19a(11), Individual Status. Complete this block as follows:
- a. Block 19a(11)(a), Readiness Level (RL). If the individual is a UAS operator, check the appropriate box to indicate his/her RL.

Note. Mission Preparation and Mission Qualification indicate SUAS operator status.

b. Block 19a(11)(b), Flight Activity Code (FAC). If the individual is a certified UAS operator, check the appropriate box to indicate his/her FAC.

Note. (FAC is not applicable to SUAS operators, check NA).

- c. Block 19a(11)(c), Redeployment Date. Enter the date (YYYYMMDD) of the individual's last redeployment from a combat zone.
- 12. Block 19a(12), Injury/Occupational Illness. Check the appropriate box to indicate if the individual was injured or had an occupational illness as a result of this accident. If "Yes" is checked, a DA Form 2397–9 (refer to para 3–30 of this pamphlet for form completion instructions) is required to be submitted for each individual injured or had an occupational illness as a result of this accident (note the attachment in block 21). Accidents involving injury/occupational illness require a physician or physician's assistant to be a member/advisor of the board.
- 13. Block 19a(13). MTDS Flight Hours. Enter the total number of flight hours the individual has accrued in the accident aircraft mission, type, design, and series (MTDS).
  - 14. Block 19a(14), Total Flight Hours. Enter the total number of flight hours the individual has accrued in all UAS.

- a. Block 19b(1)-(14). Complete as above for 19a(1)-(14).
- b. Block 19c(1)-(14). Complete as above for 19a(1)-(14).
- (20) *Block 20, Findings and Recommendations:* Instructions for writing findings and recommendations are contained in paragraph 3–5, table 3–1, and paragraph 3–24 of this pamphlet. Use additional/continuation sheets, as required. Accident causal/contributing factors identified in block 15 must be substantiated in this block.
- (21) Block 21, List of Attachments. List all substantiating data (examples include continuation sheets, ECOD/ACOD, C C A D , P Q D R , A F I P R e s u l t s , R A W , M s n B r i e f , p h o t o s , m a p s , w e i g h t & b a l a n c e , w e a t h e r b r i e f , D A f o r m s 2397-series, and so on) submitted with this DA Form 2397–U. Note that not all the above is required. The board always has the option of submitting any substantiating data it deems necessary to support the accident investigation and report.

Note. If this is a class A or B accident, refer to paragraph 3–17 of this pamphlet and submit those document and forms, pertinent to this accident investigation and report.

- (22) *Block 22, Board President/ASO/POC.* For class A, B and C accidents, enter the Name, Signature, and Date of the investigation board president. For class D, E, and F enter the information for the safety officer or POC representative submitting the report.
  - (a) Block 22a, Grade. Enter the individual's Grade (not rank).
  - (b) Block 22b, Branch. Enter the individual's Branch.
  - (c) Block 22c, E-mail. Enter the individual's e-mail address.
- (d) Block 22d, Address & Tel No. (DSN & Comm). Enter the individual's mailing address and telephone numbers (DSN & Commercial) in the space provided.
- (23) Block 23, Command Review: Required for class A, B, and C accidents only. The reference for determining the individuals responsible for performing the Command Review is AR 385–10, paragraph 3–17.
- (a) Unit Commander. Enter the individual's organization, name (last, first, MI), rank, and signature. Indicate comment by checking the applicable box.
- (b) Reviewing Official. Enter the individual's organization, name (last, first, MI), rank, and signature. Indicate comment by checking the applicable box.
- (c) Approving Authority. Enter the individual's organization, name (last, first, MI), rank, and signature. Indicate comment by checking the applicable box.
- (d) DA Review. Enter the individual's organization, name (last, first, MI), rank, and signature. In column 6, enter the date (YYYYMMDD) the report is approved for entry into the Army Safety Management Information System (ASMIS).

Note. Submission of Supplemental UAS Accident Report (DA Form 2397–U): Follow-up data (for example, CCAD, DR (PQDR), ECOD/ACOD, and teardown results) are to be submitted as required. Using DA Form 2397–U (UASAR) complete only Block 1a-c (Accident Case Information), Block 21 (List of Attachments), and those blocks to which the supplemental data applies.

Code	Type event	Code	Type event
01	Precautionary landing (PL)	53	Missing aircraft
02	Forced landing(FL)/UAS flight ter- mination system (FTS) deployed	54	FOD (other than event 45)
03	Aborted takeoff	55	Dynamic rollover
04	Human factor	56	Maintenance operational test
05	Cargo	57	Weapons related
06	Personnel handling	58	Lightning strike
07	External stores	59	Rescue operations
08	Multiple aircraft event	60	Object strike
09	Misappropriated aircraft	61	Air-to-ground collision
10	Unmanned aircraft/Drone aircraft	62	Stump strike
11	Contractor aircraft accident	63	Antenna strike

T-1.1- 0 0

Laad  133 Laser-induced/related 65 Whiteout  144 Fratricide 66 Tectown strike  15 Single-engine landing (multi-engine aircraft only)  16 Uncommanded control input  17 Cockpti airbags 69 Strutural 30 Engine failure, power loor infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord infernal of cord i	Code	Type event	Code	Type event
Fratricide	12	Aircraft ground accident	64	Engine overtorque/over-load
Single-engine landing (multi-engine aircraft on-ly)  16 Uncommanded control input  17 Cockpit airbags  18 Icing  19 (Reserved for future addition)  19 (Reserved for future addition)  20 Retueling  21 Vertical fin strike  21 Midair collision  22 Helocasting  23 Hard landing  24 Wheels up-landing  25 Landing gear collapse/retraction  26 Undershoot  27 Undershoot  28 Ditching  29 Ground loop/swerve  29 Ground loop/swerve  20 Ground loop/swerve  20 Oversteas  21 Aircraft collisions on the ground/water  22 Other collisions  23 Aircraft collisions  24 Wheels up-landing  25 Landing gear collapse/retraction  26 Undershoot  27 Overshoot or overrun  28 Ditching  29 Battery fire/overheat  29 Ground loop/swerve  30 Collision with ground/water  31 Aircraft collisions on the ground  32 Other collisions  33 Rotor overspeed  34 Fire and/or explosion in the direction of stall and stall and power than in the direction of stall and stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and power than in the direction of stall and po	13	Laser-induced/related	65	Whiteout
(multi-engine aircraft on-ly)  16 Uncommanded control input  17 Cockpit airbags  18 Icing  19 (Reserved for future addition)  19 (Reserved for future addition)  20 Refueling  21 Midair collision  22 Helocasting  23 Hard landing  24 Wheels up-landing  25 Landing gear collapse/retraction  26 Undershoot  27 Overshoot or overrun  28 Ditching  29 Ground loop/swerve  20 Collision with ground/water  29 Ground respeed  20 Collision so the ground  21 Airdraft collision  22 Airdrame  23 Airdrame  24 Wheels up-landing  25 Landing gear collapse/retraction  26 Undershoot  27 Fuel exhaustion  28 Airmal strike  29 Ground loop/swerve  29 Ground loop/swerve  30 Collision with ground/water  31 Aircraft collisions on the ground  32 Other collisions  33 Rotor overspeed  44 Fire and/or explosion on the ground  55 Fire and/or explosion in the interval in the air  29 Ground loop of swery  30 Rotor overspeed  40 Fire and/or explosion in the ground  41 Fire and/or explosion in the ground  42 Abandoned aircraft  43 Abandoned aircraft  44 Power train (except even dry) and propellers  45 Piles and/or explosion in the air  46 Fire and/or explosion in the ground  47 Abandoned aircraft  48 Power train (except even dry) and propellers  49 Landing system  40 Filight-related accident  40 Filight-related accident  41 Instruments  42 Rappelling  43 Fast rope  44 Utility/environmental cor	14	Fratricide	66	Tiedown strike
Input	15	(multi-engine aircraft on-	67	Parachute deployment
18	16		68	Mast bumping
	17	Cockpit airbags	69	Structural icing
dition	18	Icing	70	Engine failure, power loss or internal
Midair collision   73   Spike knock	19		71	Transmission failure
Helocasting 74 Seatbelt/restraint harnes strike  3 Hard landing 75 Blade flapping  4 Wheels up-landing 76 Fuel exhaustion  5 Landing gear collapse/retraction 76 Fuel starvation  5 Undershoot 77 Fuel starvation  6 Undershoot 77 Fuel starvation 78 Animal strike  8 Ditching 79 Battery fire/overheat  29 Ground loop/swerve 80 Excessive yaw/spin 30 Collision with ground/ water ground 41 Tail boom strike  31 Aircraft collisions on the ground 81 Tail boom strike 82 Airframe 83 Airdraft collisions 82 Airframe 83 Airdraft collisions 84 Airdraft collisions 85 Airdraft collisions 85 Airdraft collisions 85 Airdraft collisions 86 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdraft 60 Airdra	20	Refueling	72	Vertical fin strike
Hard landing 75 Blade flapping  24 Wheels up-landing 76 Fuel exhaustion  25 Landing gear collapse/retraction 76 Fuel starvation  26 Undershoot 77 Fuel starvation  27 Overshoot or overrun 78 Animal strike  28 Ditching 79 Battery fire/overheat  29 Ground loop/swerve 80 Excessive yaw/spin  30 Collision with ground/ 81 Tail boom strike  31 Aircraft collisions on the ground 81 Tail boom strike  32 Other collisions 82 Airframe  33 Rotor overspeed 83 Landing gear/arresting hook  34 Fire and/or explosion on the ground 84 Power train (except eve 47 and 70)  35 Fire and/or explosion in the air 85 Drive train (except eve 47 and 70)  36 Equipment loss or dropped object 86 Rotor/propellers  37 In-flight breakup 87 Hydraulics system  38 Spin or stall 88 Pneumatic system  40 Flight-related accident 90 Warning system  41 Instrument meteorological call condition (MC)  44 Overstress 94 Utility/environmental cont	21	Midair collision	73	Spike knock
24         Wheels up-landing         Fuel exhaustion           25         Landing gear collapse/retraction         76         Fuel exhaustion           26         Undershoot         77         Fuel starvation           27         Overshoot or overrun         78         Animal strike           28         Ditching         79         Battery fire/overheat           29         Ground loop/swerve         80         Excessive yaw/spin           30         Collision with ground/water         81         Tail boom strike           31         Aircraft collisions on the ground         Material Factor Event Codes           32         Other collisions         82         Airframe           33         Rotor overspeed         83         Landing gear/arresting hook           34         Fire and/or explosion on the ground         84         Power train (except even 47 and 70)           35         Fire and/or explosion in the air         85         Drive train (except even 71)           36         Equipment loss or dropped object         86         Rotor/propellers dropped object           37         In-flight breakup         87         Hydraulics system           38         Spin or stall         88         Pneumatic system           39	22	Helocasting	74	Seatbelt/restraint harness strike
Landing gear collapse/retraction  Landing gear collapse/retraction  Lundershoot  Covershoot or overrun  Covershoot or overrun  Covershoot or overrun  Covershoot or overrun  Randinal strike  Battery fire/overheat  Battery fire/overheat  Coullision with ground/  Water  Collision with ground/  Water  Collisions on the ground  Cother collisions  Rotor overspeed  Covershoed  Cover	23	Hard landing	75	Blade flapping
traction	24	Wheels up-landing		
27   Overshoot or overrun   78	25		76	Fuel exhaustion
Ditching 79 Battery fire/overheat 29 Ground loop/swerve 80 Excessive yaw/spin 30 Collision with ground/ water 31 Aircraft collisions on the ground 32 Other collisions 82 Airframe 33 Rotor overspeed 83 Landing gear/arresting hook 34 Fire and/or explosion on the ground 85 Power train (except every 47 and 70) 35 Fire and/or explosion in the air 86 Equipment loss or dropped object 87 In-flight breakup 87 Hydraulics system 88 Pneumatic system 40 Flight-related accident 90 Warning system 41 Instrument meteorological collision 92 Fuel system 43 Fast rope 93 Flight control 44 Overstress 94 Utility/environmental con	26	Undershoot	77	Fuel starvation
Ground loop/swerve  Ground loop/swerve  Collision with ground/ water  Aircraft collisions on the ground  Cother collisions  Rotor overspeed  Fire and/or explosion in the air  Equipment loss or dropped object  In-flight breakup  Spin or stall  Abandoned aircraft  Instrument meteorological condition (MC)  Excessive yaw/spin  Ratic paw/spin  Aircraft collisions on the ground  Aircraft collisions on the ground  Bat Airframe  Landing gear/arresting hook  Airframe  Bat Airframe  Bat Airframe  Bat Aning gear/arresting hook  Power train (except eve 47 and 70)  Bat Airframe  Bat Aning gear/arresting hook  Fire and/or explosion on and aning gear/arresting hook  Bat Airframe	27	Overshoot or overrun	78	Animal strike
Collision with ground/ water  Aircraft collisions on the ground  Aircraft collisions on the ground  Codes  Other collisions  Rotor overspeed  Airframe  Rotor explosion on the ground  Fire and/or explosion on the ground  Fire and/or explosion in the air  Airframe  Rotor overspeed  Airframe  Airframe  Rotor overspeed  Airframe  Airframe  Rotor overspeed  Airframe  Airfr	28	Ditching	79	Battery fire/overheat
Aircraft collisions on the ground  Aircraft collisions on the ground  Balance Airframe  Codes   29	Ground loop/swerve	80	Excessive yaw/spin	
ground  Codes  Airframe  Airframe  Rotor overspeed  Rotor over train (except eve 47 and 70)  Fire and/or explosion in the ground  Rotor/propellers	30		81	Tail boom strike
Rotor overspeed  83 Landing gear/arresting hook  34 Fire and/or explosion on the ground  85 Power train (except eve 47 and 70)  35 Fire and/or explosion in the air  36 Equipment loss or dropped object  37 In-flight breakup  38 Spin or stall  39 Abandoned aircraft  40 Flight-related accident  41 Instrument meteorological condition (MC)  42 Rappelling  43 Fast rope  94 Utility/environmental condition (MC)  84 Power train (except even 71)  85 Drive train (except even 71)  86 Rotor/propellers  87 Hydraulics system  88 Pneumatic system  89 Instruments  90 Warning system  Electrical system  Flight control  91 Fuel system	31			
hook  Fire and/or explosion on the ground  Fire and/or explosion on the ground  Fire and/or explosion in the air  Fire and/or explosion on the ground at an analysis and the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section of the ground at a section at a section of the ground at a section of the ground at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a section at a secti	32	Other collisions	82	Airframe
the ground 47 and 70)  Fire and/or explosion in the air  Equipment loss or dropped object  In-flight breakup  Spin or stall  Abandoned aircraft  Instrument meteorological condition (MC)  Rappelling  Fast rope  94  Drive train (except even 71)  B8  Rotor/propellers  Instrument system  Hydraulics system  Instruments  Pneumatic system  Instruments  Plight-related accident  90  Warning system  Electrical system  Fuel system  Utility/environmental con	33	Rotor overspeed	83	
the air  the air  T1)  Rotor/propellers  Rotor/propellers  Rotor/propellers  Rotor/propellers  Rotor/propellers  Rotor/propellers  Rotor/propellers  Rotor/propellers  Rotor/propellers  Hydraulics system  Rotor/propellers  Hydraulics system  Rotor/propellers  Rotor	34		84	Power train (except event 47 and 70)
dropped object  In-flight breakup  Spin or stall  Abandoned aircraft  Flight-related accident  Instrument meteorological condition (MC)  Rappelling  Fast rope  Overstress  B7  Hydraulics system  Hydraulics system  88  Pneumatic system  89  Instruments  Warning system  Electrical system  Fuel system  Flight control  Utility/environmental con	35		85	Drive train (except event 71)
Spin or stall  Spin or stall  Abandoned aircraft  By Instruments  Instruments  Instrument meteorological condition (MC)  Rappelling  Fast rope  Overstress  By Instrument  By Urility/environmental condition (MC)  By Warning system  Fast poe  Pneumatic system  Pneumatic system  Pneumatic system  Pneumatic system  Fast under the preumatic system  Pneumatic system  Pneumatic system  Preumatic system  Utility/environmental condition	36	Equipment loss or dropped object	86	Rotor/propellers
Abandoned aircraft 89 Instruments  40 Flight-related accident 90 Warning system  41 Instrument meteorological condition (MC)  42 Rappelling 92 Fuel system  43 Fast rope 93 Flight control  44 Overstress 94 Utility/environmental con	37	In-flight breakup	87	Hydraulics system
Flight-related accident  Instrument meteorological condition (MC)  Rappelling  Fast rope  Overstress  Flight-related accident  90  Warning system  Electrical system  Flectrical system  Fluel system  Flight control  Utility/environmental con	38	Spin or stall	88	Pneumatic system
Instrument meteorological condition (MC)  42 Rappelling  43 Fast rope  44 Overstress  45 Electrical system  46 Puel system  47 Flight control  48 Utility/environmental con	39	Abandoned aircraft	89	Instruments
cal condition (MC)  42 Rappelling  92 Fuel system  43 Fast rope  93 Flight control  44 Overstress  94 Utility/environmental con	40	Flight-related accident	90	Warning system
43 Fast rope 93 Flight control 44 Overstress 94 Utility/environmental con	41	Instrument meteorologi- cal condition (MC)	91	Electrical system
44 Overstress 94 Utility/environmental con	42	Rappelling	92	Fuel system
Overstress 94 Utility/environmental control system	43	Fast rope	93	Flight control
	44	Overstress	94	Utility/environmental control system

Code	Type event	Code	Type event
45	Turbine engine	95	Avionics
46	Rotor/prop wash	96	Cargo handling equipment
47	Engine overspeed/over-temp	97	Armament
48	Brownout	98	Night vision device
49	Bird strike	A1	Launcher malfunction
50	Tree strike	A2	Tactical Automated Landing System (TALS) Landing/recovery
51	Wire strike	A3	Arresting gear failure (drum, strap, pendant)
52	In-flight breakup	A4	Flight Termination System (FTS) failure/malfunction
		A5	Automatic Take Off and Landing System (ATLS) Failure/Malfunction Land- ing
		A6	Automatic Take Off and Landing System (ATLS) Failure/Malfunction Take- Off
		A7	Battery failure
		A8	Flight Termination System (FTS) Deployment
		A9	Test Flight
		B1	Ground Control System (GCS) Failure/Malfunction
		B2	Ground Data Terminal (GDT) Failure/Malfunction
		B3	Ground Power Generation Equipment Failure/Malfunction
		B4	Loss of Downlink
		B5	Loss of Link
		B6	Loss of Uplink
		В7	Other UAS Equipment Failure/Malfunction
		C1	Excessive High Winds during Aerostat Operation
		C2	Tether Strike
		C3	Aerostat Blown Down
		C4	Mooring Station Failure

Table 3–3	
Ownership of damaged pr	operty

Code	Owner	Code	Owner
A	Active Army	N	Army National Guard
В	Army contractor	R	Army Reserve
С	Non-appropriated fund	S	Commercial
F	Foreign Government	Т	Private/civilian
J	Air Force (includes Reserve/ARNG components)	X	Unknown
K	Navy (includes Reserve components)	Y	Ownership not elsewhere coded
L	Marine (includes Reserve components)	Z	Undetermined
M	Government, other (for example, FAA, FBI, Customs)		

Table 3-4	1
Phase of	operation

Phase of operation	
Code	Operations
A	Starting engine/run-up
В	Stationary (engines running)
С	Taxi
D	Takeoff/catapult/launch
E	Hover IGE
F	Climb (after takeoff phase is completed and climb to altitude is established)
G	Cruise
Н	Combat maneuver (masking, unmasking, gun run, evasive action)
I	Descent (does not include approach)
J	Approach (prior to landing/termination, including UAS ATLS and TALS)
К	Emergency autorotation
L	Go-around (the intended landing/termination is aborted, including UAS ATLS and TALS aborts)
М	Landing (aircraft touchdown until forward motion stops or aircraft clears surface)
N	Low level (constant airspeed and altitude below 500 feet AGL)
0	Contour (varying altitude and airspeed, while generally following the contours of the earth's surface/obstacles)
Р	NOE (varying airspeed and altitude, generally following the earth's surface/foliage for concealment)
Q	Hover OGE
R	Crash (crew has no control over the aircraft attitude)
S	Aerobatics
Т	Termination w/power (planned/attempted termination of an autorotation is to hover)
U	Undetermined/unknown

Table 3-4 Phase of operation—Continued	
Code	Operations
V	Power recovery (the process of returning the aircraft to power; flight from an engine-out configuration)
W	Training autorotation
X	Formation
Υ	Preflight activity (any activity prior to the flight that caused or contributed to the accident), for example: mission planning, crew assignment, training, loading UA on launcher, preflight.
Z	Refueling (to identify the type refueling being conducted, use an additional code preceding the Z code) For example, code in-flight refueling as "GZ", G=Cruise & Z=Refueling
2	Turning
3	Deceleration
4	Level off
5	Shut down
6	Flight Termination System (FTS) deployed (UAS)
7	Automatic Return Home Mode (UAS)
8	Holding pattern (includes UAS loitering on station to perform designated mission)
9	UAS crew hand-off (UA in-flight)
10	UAS crew hand-off (UA on ground, prior to take-off)
11	UA hand-off (manned/unmanned teaming, cooperative employment)
12	Aerostat Moored
13	Aerostat Flight
14	Aerostat Recovery
15	Aerostat Launch
16	Altitude Adjustment (raising or lowering the Aerostats elevation)

Table 3–5 Duty position codes	
Code	Duty description
ABC	Aviation battalion commander
AC	Aircraft commander
ADC	Approach-departure controller
AMC	Air mission commander
AO	Unmanned Aircraft Operator
AOP	Assistant Operations Officer
AOS	Assistant Operations SGT
ART	Armament/Arms Technician
AS	AFTP Supervisor
ASO	Aviation Safety Officer
AUC	Aviation unit commander
AVT	Avionics technician
СС	Company Commander
CE	Crew chief or flight engineer

Table 3–5 Duty position codes—Continued	
Code	Duty description
CET	Combat-equipped troops or jumpers
CP	Copilot
DC	Deputy commander
DCO	DA/DOD-level commander
DEP	Design & engineer personnel
DS	Direct supervisor
E	Electrician
EO	External operator
FAC	FWD Air Controller
FC	Flight commander
FCO	Flight leader
FCT	Weather personnel
FFT	Crash rescue/firefighters
FI	Flight Engineer Instructor
FSP	Flight service personnel
FTM	Fuel team member
FTS	Fuel team supervisor
G-3	G-3
GC	Ground unit commander
GCA	Final controller
GG	Ground guide or "Follow me" service
GM	General mechanic
GO	Ground Observer
GSY	Other ground support personnel
IE	Instrument flight examiner
IP	Instructor pilot
10	Instructor Operator
JPM	PARA Jump Master
LCO	Supervisor or unit commander
LO	Liaison Officer
MC	Mission coordinator
MCO	Major commander/Supervisor
ME	Maintenance test flight evaluator
MFP	Manufacturing or rework personnel
MO	Flight surgeon/medical officer/attendant
MP	Maintenance test pilot
MPO	Mission Payload Officer
MS	Maintenance supervisor
OAY	Others Aboard Aircraft
OGY	Others not aboard aircraft
OP	Operations Officer
OPN	Operations Dispatcher, etc.

Table 3–5 Duty position codes—Continued	
Code	Duty description
OR	Gunner, Technical Observer, Aircraft Maintenance Personnel, Photographer
PAX	Passenger
PC	Pilot in command
PF	Pathfinder
PI	Pilot
PL	Platoon Leader
PO	Mission Payload Operator
PPM	Power plant mechanic
PT	Pilot trainee
PTM	Power train mechanic
РТО	Pilot trainee, observer
PTR	Pilot trainee, rated
RAP	Rappeller
RM	Rappeller Master
RS	Rappeller Safety
SI	Standardization flight engineer instructor
SM	Structure/airframe mechanic
SO	Standardization instructor operator
SP	Standardization instructor pilot
S3	S3
TI	Technical Inspector
TWC	Tower personnel
UNK	Unknown
UT	Unit trainer
UAG	Unmanned Aircraft System Ground Crewmember
NR	Not reported
UAO	Unmanned Aircraft Observer
XO	Executive Officer
XP	Experimental test pilot
ZR	Rated passenger

Table 3–6 Accident case number	
Digits	Information
1 & 4	4 Digits of the year in which the accident occurred. For example, 2008, 2009.
5 & 6	A 2-digit designator for the month in which the accident occurred. For example, 01=Jan, 09=Sep, 11=Nov.
7 & 8	A 2-digit designator for the day of the month in which the accident occurred. For example, 01, 02, 03.
9 - 12	A 4-digit designator for local time of day accident occurred. For example, 0930, 2200.
13 - 19	The serial number of the "case aircraft" involved.

Table	Table 3–7				
Accident errors/failures/effects/system inadequacy(ies)/recommendations					
Code	Description				
	Errors				
P01	Scan				
P02	Maintain/recover orientation				
P03	In-flight planning				
P04	Preflight planning				
P05	Estimate distance/closure/control input				
P06	Detect hazards/obstacles				
P07	Diagnose or respond to an emergency				
P08	Coordination				
P09	Failed to use or follow checklist				
P10	Failed to follow maintenance manual (TM, SOP, TB), instructions while servicing acft/equip				
P11	Failed to follow instructions (TM, TB, MWO) while repairing, installing, or adjusting equipment				
P12	Inadequate/improper inspection				
P13	Failed to read/follow available SOPs, notices, ARs, general rules/principles				
P14	Inadequate tool/equip accountability				
P15	Failed to secure materiel/equip/cargo				
P16	Inadequate/improper LZ/termination point selection				
P17	Improperly prepared LZ				
	Supervisor–Specific Mistakes/Errors				
P18	Improper mix/match/number of personnel				
P19	Inadequate time allowed for pre-mission preparation				
P20	Set/permitted inappropriate launch time for environmental conditions				
P21	Permitted selection of inappropriate LZ for intended training or crew experience				
P22	Failed to ensure repairs/services/inspections/MWO are in accordance with appropriate TMs, TB, MWOs				
P23	Failed to take appropriate/timely action to prevent or stop violation of procedures/unsafe acts acts.				
P24	Inadequate mission planning for risk-management, operational, and logistic decisions				
P25	Failed to brief/provide information				
P97	Insufficient information to determine mistake/error				
	Materiel Failure/Malfunction				
M01	Overheated/burned/melted				
M02	Froze (temperature)				
M03	Obstructed/pinched/clogged				
M04	Vibrated				
M05	Rubbed/worn/frayed				
M06	Corroded/rusted/pitted				
M07	Overpressured/burst				
M08	Pulled/stretched				
M09	Twisted/torqued				
M10	Compressed/hit/punctured				
M11	Bent/warped				
M12	Sheared/cut				

	Table 3–7 Accident errors/failures/effects/system inadequacy(ies)/recommendations—Continued			
Code	Description			
M13	Decayed/decomposed			
M14	Electric current action (short, arc, surge)			
M97	Insufficient information reported to identify type of failure/malfunction			
	Environmental Effects/Condition			
E01	Illumination (dark,glare)			
E02	Precipitation (rain, fog, ice, snow)			
E03	Contaminants (fumes, dust, chemicals, FOD)			
E04	Noise			
E05	Temperature/humidity			
E06	Wind turbulence			
E07	Vibration			
E08	Acceleration/deceleration			
E09	Radiation (sunlight, X-ray, LASER)			
E10	Work surface/space (slippery floor, cluttered walkway, steep rough road)			
E11	Air pressure (explosion, decompression, altitude effects)			
E12	Electricity (lightning, arc, surge, short, shock)			
E13	Animals (deer, birds, rodents, insects)			
E97	Insufficient information reported to identify environmental conditions			
	System inadequacy(ies)/Root cause(s)/Readiness shortcomings			
01	Inadequate/improper supervision by "Higher command"			
02	Inadequate/improper supervision by "Staff officer," (or example, operations, safety, supply)			
03	Inadequate/improper supervision by "Unit command"			
04	Inadequate/improper supervision by "Direct supervisor," (for example, instructor, squad leader, aircraft commander)			
05	Inadequate school training			
06	Inadequate unit training			
07	Inadequate experience			
08	Habit interference			
09	Inadequate written procedures for operation under normal, abnormal, or emergency conditions			
10	Inadequate facilities or services			
11	Inadequate/improper equip/materiel design or equipment not provided			
12	Insufficient type/number of personnel			
13	Inadequate manufacture, assembly, packaging, or quality control			
14	Inadequate maintenance (inspection, installation, troubleshooting, record keeping, and so forth)			
15	Fear/excitement (inadequate composure)			
16	Overconfidence (in self, others, equipment)			
17	Lack of confidence (in self, others, equipment)			
18	Haste/Attitude (motivation)			
19	Fatigue (self induced)			
20	Effects of alcohol, drugs, or illness			
21	Poor attitude/indiscipline			
22	Environmental conditions			
97	Insufficient information reported to identify inadequacy/shortcoming/cause			

	Table 3–7 Accident errors/failures/effects/system inadequacy(ies)/recommendations—Continued			
Code	Description			
	Recommendations/Remedial Measures			
01	Improve school training			
02	Improve unit training			
03	Revise procedures for operation under normal, abnormal, or emergency conditions			
04	Ensure personnel are ready to perform (training, experience, psycho physiological state)			
05	Inform personnel of problems and remedies (meetings, publications, EIRs)			
06	Positive command action (to encourage proper performance and discourage improper performance)			
07	Provide personnel resources (number or qualifications) required for job			
08	Redesign (or provide) equipment or material			
09	Improve (or provide) facilities or services			
10	Improve quality control			
11	Perform studies to get solutions to system inadequacy(ies)			

Table 3–8 Pay grade codes	
Grade/Code	Description
01–010	Commissioned officer
WO1-CW5	Warrant officer
E1-E9	Enlisted service member
GS1-GS 15 & SES 1-5	DOD civilian employee
WG1–WG 15 & WS 16–WS 19	Wage board employee
XN	Foreign National
X–1	Foreign officer, all grades
X-2	Foreign enlisted, all grades
CAC	Civilian Army contractor employee
CIV	Non-DOD civilian
DAC	Department of Army Civilian
KAD	USMA
ROTC	ROTC student
NRPT	Not reported
ос	WOC/OC
UNK	Unknown
UNKE	Unknown Enlisted
UNKO	Unknown Officer
ОТН	Personnel other than above

Table 3–9 Personnel service codes	
Code	Service
A	Active Army
В	Army civilian
С	Army contractor
C1	Army direct contractor
D	Non-appropriated fund employee
E0	Other U.S. military personnel
E1	Navy
E2	Air Force
E3	Marine Corps
F0	Foreign
F1	Foreign National Direct Hire
F2	Foreign National Indirect Hire
F3	Foreign National KATUSA
F4	Foreign Military Attached
G	Dependent
M	Government, Other
N0	National Guard
N1	NG Tech
N2	NG IDT
N3	NG AT
N4	NG ADSW
N5	NG AGR
N6	NG ADT
N7	NG Activated
0	Other
P	Public
R0	Reserve
R1	Reserve IDT
R2	Reserve AT
R3	Reserve ADT
R4	Reserve FTM
R5	Reserve Tech
R6	Reserve Activated
R7	Reserve AGR
Т	ROTC
U	Unknown
Z	Not reported

Table 3–10 Injury/illness terms and code	ne.			
NFS-Not Further Specified				
Body Region				
A		00 Body in General		
В	00 Head, General	16 Mouth	30 Nasal	
	01 Head Less	17 Nose	31 Lacrimal	
	02 Brain	18 Teeth	32 Palatine	
	03 Ears	19 Tongue	33 Zygoma/Malar	
	04 Hair	20 Gums	34 Temporal	
	05 Scalp	21 Chin	35 Parietal Area	
	06 Skull	23 Frontal	36 Multiple Bonds (Face)	
	07 Temple	24 Ethmoid	37 Multiple Bones (Calvarium)	
	10 Face, General	25 Spheroid		
	11 Cheeks	26 Vomer	38 Multiple Bones (Basilar)	
	12 Eyes	27 Occipital Area	39 Multiple Bones (Other)	
	13 Forehead	28 Mandible	40 Orbit	
	15 Lips	29 Maxilla Face		
;		00 Neck, General		
	01 Espophagus	08 Vertebra C3	14 Odontoid (Atlanta Multiple Axial)	
	02 Larynx	09 Vertebra C4	15 Atlanto-occipital	
	03 Trachea	10 Vertebra C5	16 Jugular Vein	
	04 Vertebra, General	11 Vertebra C6	17 Carotid Artery	
	06 Vertebra C1	12 Vertebra C7		
	07 Vertebra C2	13 Intervertebral Disk		
)	00 Trunk, General			
	10 Abdomen, General	43 Heart	64 Vertebra T5	
	11 Colon	44 Lungs	65 Vertebra T6	
	12 Gall Bladder	45 Mammary	66 Vertebra T7	
	13 Intestines, General	46 Ribs/Sides	67 Vertebra T8	
	14 Kidney	47 Sternum	68 Vertebra T9	
	15 Liver	49 Aorta	69 Vertebra T10	
	16 Pancreas	50 Pelvis, General	70 Vertebra T11	
	17 Spleen	51 Bladder	71 Vertebra T12	
	18 Stomach	52 Buttocks	72 Vertebras, Multi-lumber	
	20 Intestines (large)	53 Genitalia	73 Vertebra L1	
	21 Intestines (small)	54 Hip	74 Vertebra L2	
	30 Back, General	55 Rectum/Anus	75 Vertebra L3	
	31 Scapula	56 Pelvises, NFS	76 Vertebra L4	
	32 Spinal Cord, General	59 Vertebras, Multi-thoracic	77 Vertebra L5	
	33 Vertebra, Multiple	60 Vertebra T1	78 Sacryn	
	40 Chest, General	61 Vertebra T2	79 Coccyx	
	41 Clavicle	62 Vertebra T3	80 Intervertebral Disc	

	42 Diaphragm	63 Vertebra T4	81 Vena Cava	
 E		00 Upper Extremities, General		
	10 Upper Arm, General	20 Lower Arm, General	31 Finger(s), Genera	
	11 Shoulder	21 Wrist	32 Knuckles	
	12 Elbow	22 Arm Lower, NFS	33 Thumb	
	13 Arm Upper, NFS		34 Hand, NFS	
F		00 Lower Extremities, General		
	10 Leg Upper, General	21 Ankle	32 Ball	
	11 Knee	22 Leg Lower, NFS	33 Heel, NFS	
	12 Leg Upper, NFS	30 Foot, General	34 Toes	
	20 Leg Lower, General	31 Arch	35 Foot, NFS	
X		97 Not reported		
Υ		99 Other		
 Z		98 Unknown		
	Body Asp	ect, Primary		
01 Right	97 Not Reported			
02 Left	98 Unknown			
03 Bilateral/Both	99 Other (Specify)			
09 Medial/Mesial/Midline	(1 7/			
	Body Aspe	ct, Secondary		
	04 Central (incl. internal organs)			
	05 Anterior/Ventral/Front	11 Whole Body Regions, General		
	06 Posterior/Dorsal/Back	12 Whole Body Part		
	07 Superior/Cranial/Upper	98 Unknown		
	08 Inferior/Caudal/Lower	99 Other (Specify)		
Injury/Illness Types or Resu	lts			
., .,		Chemical)		
Α				
	00 Burns, General	03 Third Degree		
	01 First Degree	04 Fourth Degree		
	02 Second Degree	05 Burns, Chemical, NFS		
		(Thermal)		
В		(,		
	00 Burns, General	05 Burns, Thermal, NFS		
	01 1st Degree	06 1st & 2d Degree		
	02 2d Degree	07 1st & 3d Degree		
	03 3d Degree	08 2d & 3d Degree		
	04 4th Degree	09 3d & 4th Degree		
	-	nberments		
	Distilicii			
<del>-</del>	00 Dismemberments, General	03 Decapitation		
	01 Amputation	04 Dismemberment, NFS		
	02 Avulsion (Evisceration)	J. D.S. S.		
	32 / (Calouration)	1		

Table 3–10 Injury/illness terms and codes—Continued					
Environmental Exposure					
D					
	01 Decompression/Bends	06 Immersion Foot			
	02 Frostbite	07 Noise Injury			
	03 Heat Exhaustion	08 Radiation (Other than Burns)			
	04 Heatstroke	09 Exposure, NFS			
	05 Hypothermia				
	Environme	ntal: Intake			
E					
	01 Asphyxiation	04 Aspiration (Suffocation)			
	02 Нурохіа	05 Inhalation			
	03 Ingestion				
	Frac	tures			
F					
	00 Fractures, General	08 Transverse			
	01 Chip/Wedge	09 Oblique			
	02 Compound (open)	10 Linear			
	03 Compression	11 Stellate			
	04 Crushed/Depressed	12 Comminuted			
	05 Incomplete (Greenstick)	13 Fracture/Dislocation			
	06 Simple (closed)	14 Blowout			
	07 Fracture, NFS				
	Stress	Injuries			
G					
	01 Dislocation				
	02 Sprain (wrenching of joint with stretching or tearing of ligaments)				
	03 Strain (stretched ligaments or muscles)				
	04 Stress Injury, NFS				
	Wou	unds			
H					
	01 Abrasions (Scraping)	06 Laceration/Cut			
	02 Bites	07 Puncture, Perforation, or Pene- tration			
	03 Blister	08 Transection (Cut Across)			
	04 Contusion (Bruise, Hematoma)	09 Wounds, NFS			
	05 Crushed				
	Miscell	aneous			
I					
	01 Collapsed Lung	08 Multiple Fatal Injuries			
	02 Concussion	09 Internal Injury, NFS			
	03 Dermatitis	10 Multiple Injuries, NFS			

Injury/filness terms and codes—Continued	Table 3–10	Continued		
(Not Related to Heat or Cold)  05 Foreign Object Retained 98 Injury, NFS  06 Hemiation/Rupture 97 Not Reported  07 Inflammation (Irritation) 98 Injury Unknown  Results  Z  00 Results, NFS 52 Paralyzed  04 Amnesia 55 Pneumconicese  08 Cardiac Arrest 60 Pneumchorax  10 Drowned 64 Poisoning  12 Edema 68 Trauma Shock (Emotional)  16 Embolism 69 Trauma Shock (Emotional)  20 Emphysema 69 Shock Due to Trauma (Physic cal)  24 Exanguination 72 Syncope (Finiting)  28 Hearing Loss (Acute) 75 Unconsciousness/Coma  32 Hemorrhage 90 Vision Loss  36 Heno-pneumothorax NFS  40 Hemothorax 96 Occupational Disorders, NFS  41 Infection 97 Not Reported  48 Occlusion 98 Unknown  19 Other (Specify)  Injury Mechanism (How Injury Occurred)  Action  01 Caught in/under/between 08 Thrown from 03 Exposed to 99 Other (Specify)  Qualifier  01 Aircraft 17 Irritating Fluids/Fumes 02 Aircraft frie 18 Litter/Litter support 03 Amor 19 Main rotor 04 Ceiling mechanism (MiPA)  04 Ceiling 20 Multiple injury producing mechanism (MiPA)  05 Collective 21 Pedals 06 Occupational pisorders (MiPA)  06 Console 22 Restraint system 07 Cyclic 23 Seat 08 Door 24 Structure forces 09 Excessive deceleration 2 Cal Windshield/Window 10 External object 27 Night vision device(s)	injury/iliness terms and codes		44 Flatt Ob and	
06 Herniation/Rupture			11 Fiail Chest	
		05 Foreign Object Retained	96 Injury, NFS	
Results		06 Herniation/Rupture	97 Not Reported	
2		07 Inflammation (Irritation)	98 Injury Unknown	
00 Results, NFS   52 Paralyzed   04 Amnesia   56 Pneumoconioses   06 Cardiac Arrest   60 Pneumothorax   10 Drowned   64 Poisoning   12 Edema   68 Trauma Shock (Emotional)   16 Embolism   69 Trauma Shock (Physical)   20 Emphysema   69 Shock Due to Trauma (Physical)   24 Exsanguination   72 Syncope (Fainting)   28 Headring Loss (Acute)   76 Unconsciousness/Coma   32 Hemorrhage   90 Vision Loss   36 Hemo-pneumothorax   34 Repeated Trauma Disorders, NFS   44 Infection   97 Not Reported   48 Occlusion   99 Other (Specify)   10 Jury Mechanism (How Injury Occurred)   Action   97 Not Reported   01 Caught in/under/between   05 Struck by   02 Experienced   04 Struck against   98 Unknown   99 Other (Specify)   10 Jury Mechanism (How Injury Occurred)   99 Other (Specify)   10 Jury Mechanism (How Injury Occurred)   99 Other (Specify)   10 Jury Mechanism (How Injury Occurred)   99 Other (Specify)   10 Jury Mechanism (How Injury Occurred)   99 Other (Specify)   10 Jury Mechanism (How Injury Occurred)   99 Other (Specify)   10 Jury Mechanism (How Injury Occurred)   99 Other (Specify)   10 Jury Mechanism (How Injury Occurred)   99 Other (Specify)   10 Jury Mechanism (How Injury Occurred)   99 Other (Specify)   10 Jury Mechanism (How Injury Occurred)   99 Other (Specify)   10 Jury Mechanism (How Injury Occurred)   99 Other (Specify)   10 Jury Mechanism (How Injury Occurred)   99 Other (Specify)   10 Jury Mechanism (MiPM)   10 Jury Mechanism (Mi		Res	sults	
04 Amnesia   56 Pneumoconioses   08 Cardiac Arrest   60 Pneumothorax   10 Drowned   64 Poisoning   12 Edema   68 Trauma Shock (Emotional)   16 Embolism   69 Trauma Shock (Physical)   20 Emphysema   69 Shock Due to Trauma (Physical)   24 Exsanguination   72 Syncope (Fainting)   28 Hearing Loss (Acute)   76 Unconsciousness/Coma   32 Hemorrhage   90 Vision Loss   36 Hemorrhage   39 Vision Loss   36 Hemorrhage   39 Vision Loss   36 Hemorrhage   39 Vision Loss   36 Hemorrhage   39 Vision Loss   36 Hemorrhage   39 Vision Loss   36 Hemorrhage   39 Vision Loss   36 Hemorrhage   39 Vision Loss   36 Hemorrhage   39 Vision Loss   36 Hemorrhage   39 Vision Loss   36 Hemorrhage   39 Usion Loss   38 Hepeated Trauma Disorders, NFS   44 Infection   97 Not Reported   48 Occlusion   39 Unknown   39 Other (Specify)   39 Unknown   39 Other (Specify)   39 Unknown   39 Other (Specify)   39 Unknown   30 Exposed to   97 Not reported   30 Exposed to   97 Not reported   30 Exposed to   37 Not reported   30 Exposed to   39 Unknown   30 Exposed to   37 Not reported   30 Exposed to   30 Exp	Z			
08 Cardiac Arrest		00 Results, NFS	52 Paralyzed	
10 Drowned		04 Amnesia	56 Pneumoconioses	
12 Edema		08 Cardiac Arrest	60 Pneumothorax	
16 Embolism		10 Drowned	64 Poisoning	
20 Emphysema (69 Shock Due to Trauma (Physi- cal) 24 Exsanguination 72 Syncope (Fainting) 28 Hearing Loss (Acute) 76 Unconsciousness/Coma 32 Hemorrhage 90 Vision Loss 36 Hemo-pneumothorax 84 Repeated Trauma Disorders, NFS 44 Infection 97 Not Reported 48 Occlusion 98 Unknown 99 Other (Specify) Injury Mechanism (How Injury Occurred)  Action  O1 Caught in/under/between 05 Struck by 02 Experienced 06 Thrown from 03 Exposed to 97 Not reported 04 Struck against 99 Unknown 99 Other (Specify)  Cualifier  O1 Aircraft 17 Irritating Fluids/Fumes 02 Aircraft fire 18 Litter/Litter support 03 Armor 19 Main rotor 04 Ceiling 20 Multiple injury producing mechanism (MIPM) 05 Collective 21 Pedals 06 Console 22 Restraint system 07 Cyclic 23 Seat 08 Door 24 Structure forces 09 Excessive deceleration 26 Windshield/window 10 External object 27 Night vision device(s)		12 Edema	68 Trauma Shock (Emotional)	
(Physi- cal)		16 Embolism	69 Trauma Shock (Physical)	
28   Hearing Loss (Acute)   76   Unconsciousness/Coma   32   Hemorrhage   90   Vision Loss   36   Hemo-pneumothorax   84   Repeated Trauma Disorders, NFS   40   Hemothorax   96   Occupational Disorders, NFS   44   Infection   97   Not Reported   48   Occlusion   98   Unknown   99   Other (Specify)   Injury Mechanism (How Injury Occurred)   Action   01   Caught in/under/between   05   Struck by   02   Experienced   06   Thrown from   03   Experienced   04   Struck against   99   Other (Specify)   Other (Specif		20 Emphysema		
32 Hemorrhage		24 Exsanguination	72 Syncope (Fainting)	
36 Hemo-pneumothorax		28 Hearing Loss (Acute)	76 Unconsciousness/Coma	
NFS		32 Hemorrhage	90 Vision Loss	
44 Infection   97 Not Reported   48 Occlusion   98 Unknown   99 Other (Specify)		36 Hemo-pneumothorax		
A8 Occlusion   98 Unknown   99 Other (Specify)		40 Hemothorax	96 Occupational Disorders, NFS	
99 Other (Specify)		44 Infection	97 Not Reported	
Nation		48 Occlusion	98 Unknown	
Action  01 Caught in/under/between			99 Other (Specify)	
01 Caught in/under/between 05 Struck by 02 Experienced 06 Thrown from 03 Exposed to 97 Not reported 04 Struck against 98 Unknown 99 Other (Specify) Qualifier 01 Aircraft 17 Irritating Fluids/Fumes 02 Aircraft fire 18 Litter/Litter support 03 Armor 19 Main rotor 04 Ceiling 20 Multiple injury producing mechanism (MIPM) 05 Collective 21 Pedals 06 Console 22 Restraint system 07 Cyclic 23 Seat 08 Door 24 Structure forces 09 Excessive deceleration 26 Windshield/window 10 External object 27 Night vision device(s)	Injury Mechanism (How Injury	Occurred)		
02 Experienced   06 Thrown from   03 Exposed to   97 Not reported   98 Unknown   99 Unknown   99 Other (Specify)		Act	tion	
03 Exposed to   97 Not reported   98 Unknown   99 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90 Other (Specify)   90		01 Caught in/under/between	05 Struck by	
04 Struck against 98 Unknown 99 Other (Specify)  Cualifier  01 Aircraft 17 Irritating Fluids/Fumes 02 Aircraft fire 18 Litter/Litter support 03 Armor 19 Main rotor 04 Ceiling 20 Multiple injury producing mechanism (MIPM) 05 Collective 21 Pedals 06 Console 22 Restraint system 07 Cyclic 23 Seat 08 Door 24 Structure forces 09 Excessive deceleration 26 Windshield/window 10 External object 27 Night vision device(s)		02 Experienced	06 Thrown from	
99 Other (Specify)  Qualifier  01 Aircraft 17 Irritating Fluids/Fumes 02 Aircraft fire 18 Litter/Litter support 03 Armor 19 Main rotor 04 Ceiling 20 Multiple injury producing mechanism (MIPM)  05 Collective 21 Pedals 06 Console 22 Restraint system 07 Cyclic 23 Seat 08 Door 24 Structure forces 09 Excessive deceleration 26 Windshield/window 10 External object 27 Night vision device(s)		03 Exposed to	97 Not reported	
Qualifier           01 Aircraft         17 Irritating Fluids/Fumes           02 Aircraft fire         18 Litter/Litter support           03 Armor         19 Main rotor           04 Ceiling         20 Multiple injury producing mechanism (MIPM)           05 Collective         21 Pedals           06 Console         22 Restraint system           07 Cyclic         23 Seat           08 Door         24 Structure forces           09 Excessive deceleration         26 Windshield/window           10 External object         27 Night vision device(s)		04 Struck against	98 Unknown	
01 Aircraft 17 Irritating Fluids/Fumes  02 Aircraft fire 18 Litter/Litter support  03 Armor 19 Main rotor  04 Ceiling 20 Multiple injury producing mechanism (MIPM)  05 Collective 21 Pedals  06 Console 22 Restraint system  07 Cyclic 23 Seat  08 Door 24 Structure forces  09 Excessive deceleration 26 Windshield/window  10 External object 27 Night vision device(s)			99 Other (Specify)	
02 Aircraft fire 18 Litter/Litter support 03 Armor 19 Main rotor 04 Ceiling 20 Multiple injury producing mechanism (MIPM) 05 Collective 21 Pedals 06 Console 22 Restraint system 07 Cyclic 23 Seat 08 Door 24 Structure forces 09 Excessive deceleration 26 Windshield/window 10 External object 27 Night vision device(s)		Qua	lifier	
03 Armor 19 Main rotor  04 Ceiling 20 Multiple injury producing mechanism (MIPM)  05 Collective 21 Pedals  06 Console 22 Restraint system  07 Cyclic 23 Seat  08 Door 24 Structure forces  09 Excessive deceleration 26 Windshield/window  10 External object 27 Night vision device(s)		01 Aircraft	17 Irritating Fluids/Fumes	
04 Ceiling  20 Multiple injury producing mechanism (MIPM)  05 Collective  21 Pedals  06 Console  22 Restraint system  07 Cyclic  23 Seat  08 Door  24 Structure forces  09 Excessive deceleration  26 Windshield/window  10 External object  27 Night vision device(s)		02 Aircraft fire	18 Litter/Litter support	
mechanism (MIPM)  05 Collective 21 Pedals  06 Console 22 Restraint system  07 Cyclic 23 Seat  08 Door 24 Structure forces  09 Excessive deceleration 26 Windshield/window  10 External object 27 Night vision device(s)		03 Armor	19 Main rotor	
06 Console 22 Restraint system 07 Cyclic 23 Seat 08 Door 24 Structure forces 09 Excessive deceleration 26 Windshield/window 10 External object 27 Night vision device(s)		04 Ceiling	mechanism	
07 Cyclic 23 Seat  08 Door 24 Structure forces  09 Excessive deceleration 26 Windshield/window  10 External object 27 Night vision device(s)		05 Collective	21 Pedals	
08 Door 24 Structure forces 09 Excessive deceleration 26 Windshield/window 10 External object 27 Night vision device(s)		06 Console	22 Restraint system	
09 Excessive deceleration 26 Windshield/window 10 External object 27 Night vision device(s)		07 Cyclic	23 Seat	
10 External object 27 Night vision device(s)		08 Door	24 Structure forces	
		09 Excessive deceleration	26 Windshield/window	
11 Floor 28 Tail rotor		10 External object	27 Night vision device(s)	
		11 Floor	28 Tail rotor	

Table 3–10 njury/illness terms and code	es—Continued		
	12 Gun sight	29 Transmission	
	13 Helmet	97 Not reported	
	14 Instrument panel	98 Unknown	
	15 Internal Object	99 Other (Specify)	
	16 Intruding Object		
	Injury/Illness Cause Factors	(Why Injury/Illness Occurred)	
	Sul	oject	
	01 Aircraft	20 Monkey Harness	
	02 Armor	21 Qualifier	
	03 Body/Body Part	22 Restraint System	
	04 Canopy Removal System	23 Roof/Ceiling	
	05 Cargo	24 Seat	
	06 Design	25 Structure	
	07 Door	26 Transmission	
	08 Engine	27 Unauthorized Equipment	
	09 External Objects	28 Upper torso restraint system	
	10 Fuel Lines	29 Window	
	11 Fuel tanks/Cell	30 Windshield	
	12 Fuel vent line	31 Night Vision Device(s)	
	13 Helmet	32 Occupiable Space	
	14 Impact	33 Refueling Equipment	
	15 Instrument Panel	34 Lap Belt	
	16 Landing Gear	35 Inertial Reel	
	17 Litter	97 Not Reported	
	18 Internal Objects	98 Unknown/Unclassified	
	19 Main Rotor	99 Other (Specify)	
	Ac	tion	
	01 Absorbed	19 Separated/Dislodged	
	02 Allowed	20 Spilled	
	03 Broke	21 Stretched	
	04 Buckled	22 Trapped/Pinned	
	05 Caused	23 Used Improperly	
	06 Collapsed	24 Not Restrained/Secured	
	07 Crushed	25 Allowed Excessive Motion	
	08 Displaced	26 Injured outside aircraft	
	09 Exceeded	27 Bottomed out	
	10 Flailed	28 Disintegrated	
	11 Ignited	29 Penetrated Occupied Space	
	12 Injured	30 Injured During Exit	
	13 Located	31 Failed to Fully Stroke	
	14 Not provided	32 Failed to Attenuate For	
	15 Not used	97 Not Reported	
	16 Penetrated	98 Unknown	

Table 3-10 Injury/illness terms and codes	s—Continued		
	17 Provided	99 Other (Specify)	
	18 Ruptured		
	Qua	lifier	
	01 During Exit	12 Longitudinal	
	02 Excessive Loading	13 Occupiable Space	
	03 Excessive Motion	14 Outside Aircraft	
	04 Excessively	15 Properly	
	05 Fuel	16 Vertical	
	06 Human and Design Limits	17 6–12 Inches	
	07 Improperly	18 Greater than 12 Inches	
	08 Inadequate Clearance	19 Less than 6 Inches	
	09 Insufficient Loads	97 Not Reported	
	10 Jagged Edges	98 Unknown	
	11 Lateral	99 Other (Specify)	

Table 3–11 Equipment Information Codes		
ltem	Component	Condition
Helmet		
10 Retained	0 All	0 No damage
11 Dislodged from acceleration (no blow to helmet)	1 Chin Strap	1 Missing
12 Dislodged from blow	2 Nape Strap	2 Loose
	3 Snap Fastener	3 Torn
	4 Attachments	4 Burned
	5 Shell	5 Slipped/Stretched
	6 Strap Slide Fastener	6 Worn improperly/ Improperly fitted
	7 Pads	7 Fractured or Punctured
	8 Suspension Scratched	8 Scraped/System
	9 Crushable Liner	9 Compressed to half original thickness
Note: Helmet, retained, shell fractured. Enter	er code "1057." If LASER visor used	, so indicate and include date of issue in block 7.
Visor		
Retention	Component	Condition
20 Datained	1 Face piece	0 No Damage
zu Retained		
	2 Housing (cover)	1 Shattered
	2 Housing (cover) 3 Track	1 Shattered 2 Cracked
	- ' '	
	3 Track	2 Cracked
	3 Track 4 Screws	2 Cracked 3 Punctured
	3 Track 4 Screws 5 Adjusting knob	2 Cracked 3 Punctured 4 Separated
	3 Track 4 Screws 5 Adjusting knob 6 All	2 Cracked 3 Punctured 4 Separated 5 Stripped
20 Retained 21 Dislodged	3 Track 4 Screws 5 Adjusting knob 6 All	2 Cracked 3 Punctured 4 Separated 5 Stripped 6 Burned

# Table 3-11 Equipment Information Codes—Continued

Item	Component	Condition
------	-----------	-----------

Note: Visor, retained, face piece cracked. Enter code "2012."

Glasses			
Item	Component	Condition	
30 Retained, Prescription, Clear	1 Lens(es)	0 No Damage	
31 Retained, Prescription, Tinted	2 Frame(s)	1 Shattered	
32 Retained, Nonprescription	3 Earpiece	2 Broken	
33 Dislodged, Prescription, Clear	4 All	3 Bent	
34 Dislodged, Prescription, Tinted	9 Other	4 Separated	
35 Dislodged, Nonprescription, Tinted		5 Missing	
36 Contact, Clear		6 Burned	
37 Contact, Tinted		7 Scratched	
		9 Other	

Note: Glasses, retained, lenses shattered, Enter code "3011."

### Flight Suit/Flight Gloves/Flight Jacket/Boots/Other Clothing

Туре	Configuration	Condition
40 Cotton, fire retarded, treated	0 All	0 No Damage
41 Cotton, non-fire retardant or open	1 Sleeves up	1 Torn
42 Wool	2 Sleeves down	2 Burned
43 Leather	3 Shirt out of pants or open	3 Melted
44 Synthetics, non-fire retardant, (for exam- ple, Nylon)	4 Pants out of or bloused over boots	4 Damaged, NFS
45 Fire retardant synthetics, (for example, ACU)	5 Short sleeves	5 Missing
46 Other	6 Worn properly	9 Other

Note: Flight suit (cotton), non-fire retardant; sleeves rolled up, burned. Enter code "4112." In the event crewmembers are wearing other than ACU, (for example, Army green shirt/pants/blouse/shirt) which causes a problem/condition, enter the item(s) of clothing in the blank space (line h, "other clothing.") Specify type. Check the appropriate columns and enter the four-digit information codes in the "Information Code" column.

### Restraint Equipment Codes (Items I through M)

Lap Belt/Shoulder Harness/Gunner Harness/Inertial Reel

Component	Condition	Location
50 Webbing (Strap/belt)	1 Broke	1 At end fitting
51 Hardware fittings	2 Slipped	2 At anchor fitting
52 Lock	3 Stretched	3 At buckle
53 Cable	4 Torn/cut	4 At slide adjustment
54 Mount	5 Failed to properly lock	5 At guide
55 Lap Belt, general	6 Worn loosely	6 In automatic lock
56 Shoulder harness	7 Bent	7 In manual lock
57 Inertial reel	8 Torn Free	8 Between attaching points
	9 Burned/melted	9 Other, general
	0 Missing	0 All locations

Note: Shoulder harness broke at guide. Enter code "5256." Inertial reel lock failed to lock in automatic lock. Enter code "5256."

#### Seat/Litter

A	0	1 11	
Component	Condition	Location	

Table 3–11 Equipment Information Codes—Continued

Item	Component	Condition
60 Back Rest	1 Bent/Distorted	1 Front
61 Seat Pan	2 Broken	2 Rear
62 Support/Legs	3 Bottomed out	3 Right
63 Anchor fittings	4 Displaced	4 Left
64 Track	5 Torn/Ripped	5 Center
65 Brace	6 Torn free	6 Longitudinal
66 Pole or Frame	7 Stroked	7 Vertical
67 Canvas/Netting	8 Did not stroke	8 Lateral/Diagonal
68 Energy attenuator	9 Missing	9 All
69 Litter support	0 No Damage	0 Removed/not installed
70 Armor, Sliding	10 Burned/melted	
71 Armor, Hinged		
72 Armor, Fixed		
73 Seat, General		
74 Litter Carousel		

Note: The front leg(s) of a pilot's seat was/were torn free. Enter code "6261." A longitudinal energy attenuator stroked on impact. Enter code "6876." The litter carousel had been removed, by direction of the unit commander, to facilitate rapid loading of patients during combat conditions. Enter code "7490."

Table 3–12		
<b>Equipment</b>	information	codes

Equipment information codes	
Survival equipment/components	Survival Equipment Problem/Condition
79	Cockpit airbags
80	Survival vest
81	Survival radio
82	Pen flare
83	Signal flare
84	Strobe light
85	Mirror
86	Flashlight
87	Compass
88	Panel marker
89	Reflective tape
90	Night vision goggles/devices
91	Helmet sighting system
92	Night vision imaging system
93	NBC protective clothing
94	NBC protective mask
95	Life preserver
96	Life raft
97	Survival kit (see Note 1)
98	First aid kit (see Note 2)
	<del></del>

Table 3–12 Equipment information codes—Continued	
99	Other (specify), (for example, Parachute, Oxygen, Mask, Body Armor).
01	Not available-supply problem
02	Not available-left behind
03	Damaged, unable
04	Damaged, unusable
05	Failed to operate
06	Operated partially
07	Difficulty locating
08	Beyond reach
09	Connection/closure problems
10	Release/disconnect problems
11	Inadvertent released/disconnect
12	Inadvertent actuation
13	Actuation problems
14	Actuated by other person
15	Improper use
16	Unfamiliar with use
17	Cold hampered use
18	Injury hampered use
19	Water hampered use
20	Other equipment interfered
21	Donning/removal problem
22	Poor fit
23	Leaked
24	Materiel deficiency
25	Design deficiency
26	Hang-up/entanglement
27	Dragging (parachute only)
28	Nonstandard configuration
29	Aided in location/rescue
30	Not effective in location/rescue
31	Equipment produced injury
32	Failure/relay in using; compromised survival use
33	Maintenance/installation error
34	Problem experienced by others in actuation/release of equipment
35	Discarded
36	Lost
37	Deteriorated, not usable
38	Failed during use
39	Broken
40	Battery inoperative
41	Burned
42	Locally procured item
	, F

## Table 3–12 Equipment information codes—Continued

-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1-1	
98	Other

#### Notes:

## Table 3-13 Method of evacuation/escape

Method of evacuation/escape		
Method of escape	Information codes	
Did not egress, (for example, fatally injured)	1	
Exit unassisted	2	
Assistance required	3	
Blown/thrown out/fell out	4	
Jumped prior to impact	5	
Unknown if attempt was made	7	
Other (specify in Remarks)	8	
Egress method undetermined	9	

Table 3–	14		
Location	in	aircraft	

Location in aircraft		
Aircraft station	Information codes	
Cockpit	1	
Engineer	2	
Passenger	3	
Gunner	4	
Crew Chief	5	
Other (specify in Remarks)	8	
Undetermined	9	
Longitudinal Location		
Forward section	1	
Center section	2	
Aft section	3	
Undetermined	9	
Lateral Location		
Center	1	
Left side	2	
Right side	3	
Undetermined	9	
Direction Facing		
Forward	1	
Aft	2	

¹ Survival Kit. Specify type, then match the component with the problem/condition with the appropriate code from the problem/condition code list. Example, the food packet in the cold climate survival kit had deteriorated and was usable. Enter SURVIVAL KIT in an available open space (o or p), "type" would be cold climate, and the code 9737 should be entered in the "information code" column.

² First aid kit. Specify type, then match the component with the problem/condition with the appropriate code from the problem/condition code list. Example, the provodine leaked inside the tropical first aid kit. Enter FIRST–AID KIT in an available open space, "type" would be entered as "tropical," and the four-digit code "9823" would be entered in the "Information Codes" column.

Table 3–14 Location in aircraft—Continued	
Sidefacing	3
Undetermined	9
Use of Seat	
Not in seat	1
In seat	2
Litter	3
Undetermined	9

Table 3–15 Exit attempted		
Exit attempted	Information codes	
Normal exit	1	
Emergency exit	2	
Opening in aircraft wreckage	3	
Cut through canopy	4	
Canopy removal system	5	
Cargo hatch	6	
Other (specify in Remarks)	8	
Undetermined	9	
Fatal-None attempted	0	

Table 3–16 Exit used		
Exit used	Information codes	
Normal exit	1	
Emergency exit	2	
Opening in aircraft wreckage	3	
Cut through canopy	4	
Canopy removal system	5	
Cargo hatch	6	
Other (specify in Remarks)	8	
Undetermined	9	·
Fatal-None used	0	

Table 3–17 Aircraft attitude at time of Escape		
Aircraft at rest	Information codes	
Upright	A1	
Inverted	A2	
Nosed Over	A3	
Lying on left side (More than 45 degrees from upright)	A4	
Lying on right side (More than 45 degrees from upright)	A5	
Tail low	A6	
Other (specify in Remarks)	A8	
Undetermined	A9	
Fatal-Did not escape	A0	
Aircraft in Motion	Codes	
Level	B1	
Inverted	B2	
Nose low	B3	
Left bank	B4	
Right bank	B5	
Nose high	B6	
Other (specify in Remarks)	B8	
Undetermined	B9	

Table 3–18 Cockpit/Cabin Condition		
Condition	Information codes	
No damage	01	
Survivable	02	
Partially survivable	03	
Nonsurvivable	04	
Undetermined	09	

Table 3–19 Escape difficulties		
Difficulties	Information codes	
Difficulty locating canopy jettison mechanism	01	
Difficulty releasing canopy/door	02	
Difficulty releasing restraints	03	
Difficulty reaching exit due to obstructions	04	
Difficulty reaching exit due to injuries	05	
Difficulty reaching exit due to aircraft attitude	06	
Difficulty reaching exit due to personal equipment hang-up	07	
Canopy/door jettison problem	08	
Canopy/door jettison failure (automatic)	09	
Could not open canopy/door (mechanical failure)	10	

Table 3–19 Escape difficulties—Continued	
Could not open canopy/door (jammed due to structural deforma-	11
Could not onen consolv/door (Other consists in Demorks)	42
Could not open canopy/door (Other, specify in Remarks)	12
Could have but did not open canopy/door	13
Exit inaccessible (out of reach)	14
Hampered by controls	15
Hampered by body armor	16
Hampered by seat armor	17
Hampered by seat	18
Hampered by airframe structure	19
Hampered by components of power train	20
Hampered by cargo or loose equipment	21
Hampered by armament system components	22
Hampered by clothing	23
Hampered by injuries	24
Personal equipment factor (Other than hang-up) (specify in Remarks)	25
Hampered by others aboard	26
Hampered by high temperature of exit surfaces	27
Parachute entanglement	28
Failure of lap belt to open	29
Smoke, fumes	30
Fire	31
Spilled fluids	32
Confusion	33
Anthropometric problem	34
Unconscious	35
Darkness-no visual reference	36
Cold	37
In rushing water	38
Intruding object (tree, rock, aircraft structure) (specify in Remarks)	39
Lack of emergency evacuation during preflight briefing	40
Lack of in-flight warning	41
Briefing not followed	42
Panic	43
Disorientation	44
Dazed	45
Other (specify in Remarks)	98
Undetermined	99
None	00

Table 3–20 Survival problems		
Problems	Information codes	
Inadequate flotation gear	01	
Inadequate cold weather gear	02	
Lack of signaling equipment	03	
Lack of other equipment (specify in Remarks)	04	
Entanglement (parachute)	05	
Dragging (parachute)	06	
Parachute hardware problems	07	
Entrapment in aircraft	08	
Pulled down by sinking chute	09	
Pulled down by body armor	10	
Unfamiliar with procedure	11	
Confused	12	
Incapacitated by injury/occupational ill- ness	13	
Poor physical condition	14	
Exposure (heat, cold, sunburn)	15	
Fatigue	16	
Weather	17	
Topography	18	
Darkness	19	
Thrown from raft	20	
Hampered by rotor downwash	21	
Problem boarding rescue vehicle	22	
Thirst	23	
Hunger	24	
Insects	25	
Sharks	26	
Unfamiliar with equipment	27	
Dazed	28	
Animals	29	
No problems encountered	30	
Other (specify in Remarks)	98	

Table 3–21 Means used to locate individual	
Means	Information codes
Survivor located rescuers	01
Accident observed	02
Accident site located w/o aid of signals or equipment	03
Individual located w/o aid of signals or equipment	04
Other aircraft orbiting scene to direct rescue personnel	05
Radio or radar vector or DF steer	06
Aircraft radio after mishap	07
Radar chaff	08
Sonar buoy	09
Walkie-talkie	10
Fire	11
Beacon (emergency locator transmitter)	12
Aircraft radio prior to mishap	13
Radio (survival type)	14
Telephone	15
Corner reflection	16
Reflective tapes	17
Mirror	18
Reflective surface other than code, 16, 17, or 18 (specify in remarks)	19
Raft	20
Flight clothing	21
Parachute	22
Signal flare	23
Smoke flare	24
Aircraft lights	25
Pen gun flare	26
Tracers	27
Strobe light	28
Flashlight	29
Signal wand	30
Smoke	31
Dye marker	32
Whistle	33
Voice	34
Gunfire	35
Signals on surface	36
Not applicable	37
Other (specify in Remarks)	98

Table 3–22		
Rescue equipment used		
Item	Information codes	
Sling	01	
Seat	02	
Cargo net	03	
Rope	04	
Life ring	05	
Basket	06	
Axe	07	
Saw	08	
Raft	09	
Webbing cutters	10	
Cable	11	
Grapnel	12	
Boarding ladder	13	
Knife	14	
Makeshift carrier/support	15	
First-aid equipment	16	
Forest penetrator seat	17	
Helicopter platforms	18	
Stretcher/litter	19	
Cable cutters	20	
Helicopter rescue boom	21	
Not applicable	22	
Other (specify in Remarks)	98	

Table 3–23 Factors that helped rescue		
Item	Information codes	
Rescue personnel training	01	
Training of person to be rescued	02	
Aircraft emergency escape means	03	
Personal equipment	04	
Accident plans	05	
Availability of rescue equipment	06	
Survivor's techniques	07	
Suitability of rescue equipment	08	
Coordination of rescue effectors	09	
Survival training (specify in Remarks)	10	
Emergency locator transmitter	11	
Electronic tracking equipment	12	
Not applicable	13	
Other (specify in Remarks)	98	

Table 3–24 Factors that complicated rescue	
Factors	Information codes
Failure of rescue vehicle (mechanical problems)	01
Inadequacy of rescue vehicle	02
Failure of rescue equipment	03
Inadequacy of rescue equipment	04
Inadequacy of rescue personnel	05
Inadequate medical equipment	06
Inadequate medical facilities	07
Vehicle operator factor (poor procedure)	08
Rescue crewman assist hesitancy	09
Fire	10
Entrapment in aircraft	11
Physical limitations of rescue personnel	12
Physical limitations of person rescued	13
Carelessness by rescue personnel	14
Inappropriate actions of person rescued	15
Rescue vehicle accident	16
Communication problems	17
Entanglement by deployed parachute	18
Topography	19
Interference from other vehicles	20
Victim pulled away by extreme forces	21
Weather	22
Darkness	23
Weight/drag problems due to parachute	24
Hampered by equipment of person rescued	25
Floating debris	26
Primary rescuer delayed by other rescuers	27
Hampered by helicopter downwash	28
Head wind	29
Poor visibility	30
High sea state	31
Mechanical problems	32
Other obstructions (specify in Remarks)	33
Rescuers lost	34
No problems	35
Vehicle operator not available	36
Vehicle not ready	37
Vehicle crew not available	38
Communication breakdown	39
Completing previously assigned duties	40
Lack of information about crash site	41

Table 3–24 Factors that complicated rescue—Continued							
Poor radio reception/transmission	42						
Telephone line busy	43						
Poor radio discipline	44						
Aircraft radio equipment inoperative	45						
Poor radio procedures	46						
Lack of emergency locator transmitter	47						
Lack of electronic tracking equipment	48						
Other (specify in Remarks)	98						

Table 3–25 Inidividual's physical condition	
Condition	Information codes
Fully able to assist	01
Partially able to assist	02
Immobile or unconscious	03
Fatal	04

# Chapter 4 Ground Accident Reporting

#### 4-1. Introduction

- a. In accordance with AR 385–10, chapter 3, ground accidents will be reported on the DA Form 285 series forms. This chapter provides instruction for completing a full report of investigation and an abbreviated report of investigation.
- b. All on-duty Class A and B accidents and other classes of accidents investigated by a formal board (on or off-duty) require a full report of investigation. For exceptions, refer to AR 385–10. The full report of investigation includes the following:
  - (1) DA Form 285-A, Index A.
  - (2) Substantiating data.
  - (3) DA Form 285-B, Index B.
  - (4) DA Form 285-O, Statement of Reviewing Officials.
- (5) DA Form 285, Technical Report of U.S. Army Ground Accident Form. One completed form is required, unless more than one individual is involved (injured or had a causal or contributing role in the accident). An additional form with sections A (blocks 1–5) and B completed is required for each additional individual involved.
  - (6) Findings and Recommendations. (Typed on plain bond paper).
  - (7) Narrative of the investigation. (Typed on plain bond paper).
  - (8) DA Form 285-W, Summary of Witness Interview.
- c. All other classes of accidents can be reported on a DA Form 285–AB, Abbreviated Ground Accident Report (AGAR). Abbreviated reports can be submitted using the on-line reporting system, or on an AGAR in legible hand-printed or typed copy by electronic mail, standard mail, FAX, courier, or message format. Work copies on plain paper will be acceptable, but each data element must reference the respective block of the DA Form 285–AB.
  - (1) The message address is as follows: CDR USACRC FT RUCKER AL //CSSC-CG//.
- (2) The mailing address is as follows: Administrative QC, U.S. Army Combat Readiness Center (CSSC-OR), Bldg 4905, 5th Ave, Fort Rucker, AL 36362-5363. Email: usarmy.rucker.hqda-secarmy.mbx.safe-accident-info@mail.mil.
- d. The automated reporting system allows for quick and easy reporting at the USACRC Web site: https://safety.army.mil.
  - e. Table 4-1 summarizes the reporting requirements.

Table 4–1
Ground accident notification, reporting requirements, and suspenses

	PEACETIME		COMBAT ²							
Accident Class	Telephonic Notification Worksheet	Abbreviated Report AGAR	Full Report DA Form 285	Telephonic Notification Worksheet	AGAR ONLY by any means possible (auto- mated, e-mail, fax, hand carry, mail)					
ON-DUTY A & B	Immediately ¹	Not required	IAI/CAI-90 days	Immediately ¹	As time Permits (Not to Exceed 60 days)					
С	Not required	Within 90 days	Not required	Not required	As time Permits (Not to Exceed 60 days)					
D & E	Not required	Within 30 days	Not required	Not required	As time Permits (Not to Exceed 30 days)					
OFF-DUTY A & B	Immediately ¹	Within 30 days	Not required	Immediately ¹	As time Permits (Not to Exceed 30 days)					
C, D, & E	Not required	Within 30 days	Not required	Not required	As time Permits (Not to Exceed 30 days)					

#### Notes:

## 4-2. DA Form 285, Technical Report of U.S. Army Ground Accident

- a. The DA Form 285 is a five page form and is available at the USACRC Web site: https://safety.army.mil under the Accident Reporting and Investigation Tab.
  - (1) The entire report is required for on-duty Class A and B accidents according to AR 385-10.
  - (2) Instructions are organized by sections and keyed to the block numbers of the form.
- (3) The form may be completed by typing or legibly printing the data in the appropriate blocks. Items may be continued on a blank sheet of paper and attached to the report.
- (4) When more than one person is involved (caused/contributed and/or injured), complete an additional DA Form 285 (sections A and B) for each person.
- b. For supplemental reports, sections A (blocks 3a, 4, and 5), B, and pertinent blocks to be changed/added will be completed and forwarded through the appropriate chain of command to USACRC.

#### 4-3. Findings and recommendations

- a. Findings and recommendations will be completed for all Class A and B on duty accidents requiring a report according to AR 385–10 (see table 4–2). Findings fall into one of five categories:
  - (1) Present and contributing.
  - (2) Suspected present and contributing.
  - (3) Present and contributing to the severity of the injury/occupational illness or extent of property damage.
  - (4) Present but not contributing.
  - (5) Special observations.
  - b. Each finding must be fully substantiated in the analysis portion of the narrative of the investigation.
- c. As a minimum, the following elements of information will be addressed for each present contributing, suspected present contributing, and present contributing to the severity of injury/occupational illness or extent of damage finding in the order stated (see table 4–2).
- (1) An explanation of when and where the error, materiel failure, or environmental factor occurred in the context of the accident sequence of events, (for example, "walking," "lifting," "while driving an M1114 on a dirt road," "while employing an M16A2 on a range.")
- (2) Identification of the individual involved by duty position (do not use individual's name), or the name, and PN or NSN of the part, component, or system that failed or a description of the environmental factor, as appropriate.
- (3) Identification of the mistake/error and an explanation of the how the task was performed improperly. Refer to appendix B for mistake/error categories. The error could be one of commission or one of omission, (for example, an individual performed the wrong task, incorrectly performed the correct task, or failed to perform a required task or function). In the case of a materiel failure, identify the mode of failure, (for example, corroded, burst, twisted, decayed). See appendix B for definitions and examples.
  - (4) Identification of the directive (for example, SOP, FM, TM) or common practice governing the performance of

¹ USACRC must be notified IMMEDIATELY by phone at DSN 558–2660/2539/3410 or COM (334) 255–2660/2539/3410 or notify safety rep forward (during combat).

² When the senior tactical commander determined that the situation, conditions or time does not permit normal peacetime investigation and reporting.

the activity/task or function. In lieu of a written directive, the error may represent performance that is contrary to common practice.

- (5) An explanation of the consequences of the mistake/error, materiel failure, or environmental condition. An error may directly result in property damage or injury/occupational illness. A materiel failure may have an immediate effect on equipment or its performance, or it may create circumstances that results in error, injury/occupational illness or make further damage inevitable. (For example, as a result, the vehicle rolled, the passenger was fatally injured, and the vehicle was damaged.)
- (6) Identification of the reasons (root cause(s)) the human, materiel, environmental conditions caused or contributed to the accident (why it happened). Refer to the list and examples of root cause(s)/system inadequacy(ies) at appendix B.
- (7) A brief explanation of how each reason (root cause/system inadequacy) influenced the error, materiel failure, or environmental factor.
- d. In addition, for Present and Contributing to the Severity of Injury/occupational illness or Extent of Damage findings, the board should also:
- (1) Summarize personnel injuries attributable to defects in LSE, PPE, or crashworthiness design as findings in this category.
  - (2) Address injuries sustained from failure to use provided equipment (for example, seatbelts).
- (3) Separate the findings and recommendations in this category from those that caused the accident and preceding them with the following statement: "THE FINDINGS(S) LISTED BELOW DID NOT DIRECTLY CONTRIBUTE TO THE CAUSE FACTORS INVOLVED IN THIS ACCIDENT; HOWEVER, IT/THEY DID CONTRIBUTE TO THE SEVERITY OF INJURY(IES) AND/OR EXTENT OF DAMAGES(S)."
- e. "Present but Not Contributing" findings are those that did not cause or contribute to the accident or to the severity of injuries.
- (1) The board should report errors, materiel failures, or other hazards that did not contribute to the accident but have a high potential for causing other accidents or adversely affecting the safety of personnel and equipment if not corrected. Reporting these deficiencies will ensure they receive command attention throughout the chain of command to include DA-level action.
- (2) The findings and recommendations in this category will be separated from those that caused the accident or those that did not cause the accident but contributed to the severity of injuries, and will be preceded by the following statement: "THE FINDING(S) LISTED BELOW DID NOT CONTRIBUTE TO THIS ACCIDENT; HOWEVER, IF LEFT UNCORRECTED, IT/THEY COULD ADVERSELY AFFECT THE SAFETY OF PERSONNEL AND EQUIPMENT."

Table 4–2 Ground Finding Examples (Human, Materiel, Environmental)									
Human Cause Factor—Ground Example  FINDING 1 (Present and Contributing: Human Error—Training, Leader)									
Explanation of when and where the error occurred in context of the accident sequence of events.	While receiving driver's training on an unimproved road during New Equipment Training (NET) at the Yankee Training Center,								
2. Identification of individual involved by duty position and equipment involved (if applicable).	the student driver of an M1117 Armored Security Vehicle (ASV)								
3. Identification of mistake/error made (ref ground-specific mistakes/errors in DA Pam 385–40, table B-2) and an explanation of how task/activity was performed improperly.	oversteered the vehicle. That is, while descending a hill on a dirt/ gravel road, he made abrupt and excessive steering inputs causing the vehicle to swerve uncontrollably from one side of the road to the other								
4. Directive (SOP, FM, TM, etc.) or common practice governing performance of task/activity or function.	in contravention of AR 385-10, AR 600-55, and TC 21-305.								
5. Consequences of mistake/error.	Consequently, the vehicle departed the roadway, slid into a ditch, pivoted and rolled four times, coming to rest in an upright position. The vehicle sustained substantial damage. The gunner and passenger were critically injured when they were ejected from the vehicle during the rollover sequence. The driver and senior occupant received minor injuries.								
6. Reason(s) {root cause(s)/system inadequacy(s)} for the mistake/error {ref System Inadequacies in Table B-5 of DA Pam 385–40}.	The student driver's actions were the result of inadequate unit training and inexperience.								

## Table 4–2 Ground Finding Examples (Human, Materiel, Environmental)—Continued

7. Brief explanation of how each reason (root cause/system inadequacy) contributed to the error.

The unit failed to ensure the student driver received the required prerequisite training, testing and a learner's permit for the ASV before allowing him to attend NET and operate the vehicle on an unimproved road. Due to the student driver's lack of experience, he was unfamiliar with the handling characteristics of the ASV and over-steered the vehicle causing loss of control.*

*NOTE: When 'Leader' is identified as a system inadequacy/root cause, this will probably lead to a second finding, in which case a mistake/error will be assigned to the leader/command and the root cause(s)/system inadequacy(s) for that mistake will be identified. When a finding is written on a leader/command, it is important to determine why that mistake/error was made so that, if necessary, the problem can be brought to the attention of senior Army leadership. For example, if inadequate risk management is identified, was it due to a support problem (lack of sufficient resources), a standards problem, and so forth.

#### NARRATIVE EXAMPLE FOR HUMAN ERROR

FINDING 1 (Present and Contributing: Human Error—Training, Leader)

While receiving driver's training on an unimproved road during New Equipment Training (NET) at the Yankee Training Center, the student driver of an M1117 Armored Security Vehicle (ASV) over-steered the vehicle. That is, while descending a hill on a dirt/gravel road, he made abrupt and excessive steering inputs causing the vehicle to swerve uncontrollably from one side of the road to the other in contravention of AR 385–10, AR 600–55, and TC 21–305. Consequently, the vehicle departed the roadway, slid into a ditch, pivoted and rolled four times, coming to rest in an upright position. The vehicle sustained substantial damage. The gunner and passenger were critically injured when they were ejected from the vehicle during the rollover sequence. The driver and senior occupant received minor injuries.

The student driver's actions were the result of inadequate unit training and inexperience. The unit failed to ensure the student driver received the required prerequisite training, testing and a learner's permit for the ASV before allowing him to attend the NET and operate the vehicle on an unimproved road. Due to the driver's lack of experience, he was unfamiliar with the handling characteristics of the ASV and over-steered the vehicle causing loss of control. The Board concluded the senior occupant did not properly supervise the student driver.

#### Materiel Cause Factor—Ground Example

FINDING 1 (Present and Contributing: Materiel Failure)

Required Information	Example
1. Explanation of when and where the materiel failure/malfunction occurred in context of the accident sequence of events.	While traveling on an interstate highway at approximately 55 mph,
2. Name and part number (PN) or national stock number (NSN) of the part, component, or system that failed.	the left front tire (NSN 2610-01-214-1344) of a M925A2
3. Mode of failure (see DA Pam 385–40, appendix B for definitions and examples).	failed (burst).
4. Consequences of materiel failure.	As a result, the vehicle veered sharply to the left, striking a guard-rail.
5. Identification of reasons (root causes/system inadequacies) materiel failure/malfunction caused or contributed to accident.	The cause of the tire failure was inadequate quality control by the manufacturer. That is, a defect (weak spot) in the tire wall was not detected during the manufacturer's inspection process.
6. Brief explanation of how each reason (root cause/system inadequacy) contributed to the materiel failure/malfunction.	The inadequate quality control allowed a defective tire to be distributed and placed in service. During normal operation, the tire failed causing personal injuries and equipment damage.

#### NARRATIVE EXAMPLE FOR ENVIRONMENT

FINDING 1 (Present and Contributing: Materiel Failure)

While traveling on an interstate highway at approximately 55 mph, the left front tire (NSN 2610-01-214-1344) of a M925A2 failed (burst). As a result, the vehicle veered sharply to the left, striking a guardrail. The impact caused the driver to strike his head on the steering wheel, and he received minor injuries. The left front and side of the vehicle received substantial damage.

The cause of the tire failure was inadequate quality control by the manufacturer. That is, a defect (weak spot) in the tire wall was not detected during the manufacturer's inspection process. The inadequate quality control allowed a defective tire to be distributed and placed in service. During normal operation, the tire failed causing personal injuries and equipment damage.

Environmental Cause Factor—Ground Example								
FINDING 1 (Present and Contributing: Environment)								
Required Information	Example							
Explanation of when and where the environmental factor occurred in context of accident sequence of events.	At approximately 1915 hours, a severe thunderstorm passed through							

Table 4–2 Ground Finding Examples (Human, Materiel, Environmental)—Continued						
2. Identification of individual involved by duty position and/or equipment involved.	the heliport in Camp Doha, Kuwait					
3. Description of environment involved.	with estimated sustained winds of 40 mph and gusts to 60 mph.					
4. Consequences of environmental effect.	As a result, two temporary sunscreen shelters were destroyed and four helicopters that were secured on the ramp were damaged. One UH-60A was damaged as the temporary shelter under which it was parked was destroyed.					
5. Explanation of reason(s) environmental conditions caused/contributed to accident.	The property damage was caused by an abrupt, rapidly developing thunderstorm that was neither forecasted nor expected. The exposed aircraft were secured on the ramp in accordance with established policy.					
NARRATIVE EXAMPL	E FOR ENVIRONMENT					
FINDING 1 (Present and Contributing: Environment)						

At approximately 1915 hours, a severe thunderstorm passed through the heliport in Camp Doha, Kuwait, with estimated sustained winds of 40 mph and gusts to 60 mph. As a result, two temporary sunscreen shelters were destroyed, and four helicopters that were secured on the ramp were damaged. One UH-60A was damaged as the temporary shelter under which it was parked was destroyed. One destroyed shelter was blown into and damaged another UH-60A secured on the ramp. The high winds also overcame the main rotor blade tie downs for two AH-64 aircraft, causing extensive damage due to excessive blade flapping. The property damage was caused by an abrupt, rapidly developing thunderstorm that was neither forecasted nor expected. The exposed aircraft were secured on the ramp in accordance with established policy.

- f. Each finding will be followed by recommendations having the best potential for correcting or eliminating the reasons for (root cause(s)/readiness shortcoming(s)/system inadequacy(ies)) the error, material failure, or environmental factor that caused or contributed to the cause of the accident (see app B–6 for definitions and examples).
  - (1) Recommendations should not focus on punitive steps addressing an individual's failure in a particular case.
- (2) To be effective at preventing accidents in the future, recommendations must be stated in broader terms. The board should not allow the recommendation to be overly influenced by existing budgetary, material, or personnel restrictions.
- (3) In developing the recommendations, the board should view each recommendation in terms of its potential effectiveness; for example, design improvement of a part that has a history of recurring failure is a better solution than recommending procedures to accommodate the deficiency.
- (4) Each recommendation will be directed at the unit, command, or activity which is best capable of implementing the actions contained in the recommendation. The actions required at unit level (company, troop, battalion), higher level (brigade, division, corps, Army Headquarters), and DA (to include Army Headquarters with Army-level ACOM, ASCC, DRU proponency) levels of command will be addressed in each recommendation.
- (5) If there is no recommendation at a particular command level, state "None," (for example, "DA-level Action: None").
- (6) In cases where an Army Headquarters is the highest level proponent for a recommended action having Armywide application, the Army Headquarters will be listed in the "DA-level" category.

## 4-4. Narrative of investigation

- a. Narrative. A narrative of the investigation will be completed for all on-duty Class A and B accident reports required by DA Pam 385–40 (see fig 4–2).
- (1) The investigation board will report, in narrative form, the facts, conditions, and circumstances as established during the investigation and present this information in four sections (history of events, human factors, materiel factors, and analysis). The first three sections will contain only factual data.
- (2) The analysis section is reserved for the board's documentation of its conclusions/opinions concerning the accident cause relationships. Chapter 2, paragraph 2–8, explains procedures for development of formal written analysis. Additional subheadings may be added as deemed necessary.
- (3) It is important that the narrative address all of the chronological events and evidence that had a bearing on the cause of the accident and/or have the potential for adversely affecting the safety of future operations.
- (4) For accidents in which the investigation board determines human error, materiel failure/malfunction, or environmental conditions were a factor, that portion of the narrative will be completed in its entirety, as specified in the instructions below. The history of events, personnel background/management, meteorological, and analysis portions will be completed. For the remaining subheadings which the investigation board determines were not a factor, enter after the subheading "Investigation revealed not a factor" and proceed to the next subheading.
  - (5) Opinions concerning the accident cause will be discussed only in the analysis section.

- (6) Individual names will not be included in the analysis portion of the narrative. Personnel will be referred to by duty position, (for example, the driver, civilian passenger, the gunner).
  - b. History of events.
- (1) *Pre-accident phase*. Report type of mission, activity or event, its purpose, how the organization became tasked with it, and who authorized it. Identify the individual(s) involved in the accident/injury or occupational illness, to include duty, unit/organization assigned, and how they were selected for and informed of the mission, activity or event. Describe the actions of the personnel involved in preparing for the mission, activity or event to include planning, application of risk management orders, and/or briefings. Describe vehicle/equipment/vessel/structure involved, to include type, serial/lot numbers, inspections conducted and the dispatching process. Describe facts which may indicate whether or not an undue sense of urgency was associated with the mission, activity, or event and if there were any delays prior to the onset of the operation.
- (2) Accident phase. Indicate when the vehicle/personnel departed on the mission, activity or event and continue until the accident occurred. If the mission, activity or event involved more than one routine segment, requiring multiple activities, functions or stops before the accident occurred, concisely summarize these events until addressing the segment involving the accident. If the segment involving the accident contained an emergency, give a detailed description of the onset of the emergency to include where and when it occurred, symptoms, warnings, indications, and instrument readings. Also, describe actions/reactions of the personnel between the time of the emergency and the conclusion of accident.
- (3) *Post-accident phase*. Briefly describe the condition of the equipment/vehicle/structure/vessel, to include whether or not the equipment was still operating and the condition of personnel immediately after the accident. Reserve details of damage to various equipment/vehicle/structure components for the materiel factors portion of the narrative.
  - (a) If a post-accident fire occurred, so indicate and explain how and when it was extinguished, if applicable.
  - (b) Describe how the accident site was located.
- (c) Summarize rescue and first-aid efforts, to include who notified rescue/medical/police of accident, response time, type of equipment used in the evacuation, who administered first aid/cardiopulmonary resuscitation and their medical qualifications.
- (d) Briefly summarize egress of occupants from vehicle/equipment, time of arrival at the medical facility, medical facility providing treatment, and time of death, if applicable. Reserve details of the egress, rescue, and evacuation for rescue operations portion of the narrative.
- c. Human factors investigation. For accidents resulting from causes other than human factors, the human factors portion of the narrative may be sharply reduced by making a statement like "none" for the subheadings except for subheadings addressing personnel background/management.
- (1) Personnel Background/Management Information. Personnel background is extremely important in terms of providing a complete and informative profile of the principal persons involved. The sources of information will include, but are not limited to, personnel, training records, friends, peers, subordinates, superiors, and the persons themselves. Background information should primarily address:
- (a) Briefly summarize service background, to include date of service entry (or the civilian equivalent), training, experience, type of assignments, and qualifications acquired prior to joining current unit.
- (b) Report evidence of safety/traffic violations and prior accident experience on the primary personnel involved. If involved in a prior accident, explain their role.
- (c) Describe experience in mission/duty/activity relative to the accident mission/duty/activity, also describe if the individual received his/her qualifications by on-the-job training (OJT) or attending a school. Discuss only those preservice activities/experiences which are accident related.
- (2) Personnel management. Personnel management should primarily address how the individual was managed by the unit/organization to which assigned at the time of the accident.
- (a) Review how the unit/organization has managed each individual involved. Begin with date of assignment to current unit/organization.
- (b) Review experience, training and qualifications upon assignment and report how individual was tasked, trained, and otherwise managed up to the date of the accident.
- (c) Describe how the unit/organization prepared the individual with qualifications and readiness to perform the mission/activity/event. Indicate whether or not the individual was qualified to perform the mission/activity/event involved in the accident.
  - (d) Explain irregularities in the individual's training folder.
- (e) Also discuss whether the individual was medically qualified to perform the mission/activity/event involved in the accident.
  - (f) Discuss additional duties and the percentage of time given them versus their primary duty.
  - (g) Report qualifications acquired since assignment to unit such as OJT and schooling.
  - (h) Review the procedures involved in selecting the personnel involved for the mission/activity/event.

- (i) Describe timelines of notification, compatibility of personnel for the mission/activity/event, and their relative experience for the mission/activity/event.
- (j) Describe involved personnel in terms of their professional reputations in unit, opinions of peers, subordinates, and others who have worked with/for them.
- (k) Describe the individuals' sleep, work, and dietary habits and use of alcohol and nicotine. Review unit sleep/rest policy. Report whether or not a sleep/rest policy was in effect, being monitored, and complied with.
- (1) Highlight weaknesses in proficiency, if appropriate, especially the performance of tasks duplicating those involved in the accident.
- (m) Discuss if the individual was receiving medication before the accident. Report the name of the medication, type, source, dosage, potential side effects, and possible effect on performance. Summarize the findings of the post-accident medical examination, including the results of appropriate toxicological analyses. If the individual sustained fatal injuries, briefly summarize autopsy report (if available), to include cause of death.
- (n) The same scope of information is usually not necessary for personnel not directly involved, but if it is suspected or known that other personnel played a role in the accident, summarize their background, experience and qualifications. This part of the narrative can involve commanders/supervisors, operations personnel, supply and weather personnel, maintenance personnel, and others, if applicable.
- (3) Vehicle/equipment/suitability. Describe suitability of the vehicle/equipment/structure/vessel involved to perform the mission/activity/event. Consider primary purpose versus use at the time of the accident, equipment design limitation as found in applicable operator's manual, configurations.
- (4) Communications. Describe evidence relating to communications equipment (adequacy of visual and electronic signals) and the communication that occurred or failed to occur among and between personnel, (for example, base station, operations, command and control, agency to agency, service to service). Consider language difficulties, clarity of spoken words, static, interference, adequacy and precision of instruction, and so forth. Summarize tape recordings of communications between crew and other stations, if applicable.
- (5) Meteorological information. Describe weather conditions that prevailed throughout the mission/activity/event and conditions that existed at the accident site at the time of the accident. Include sky condition, visibility, winds, temperature, and any significant weather conditions. Consider weather observations made by trained weather observers and/or witnesses in the area. If weather was considered a contributory factor to the accident, describe the accuracy of the weather forecast. If the actual weather differed significantly from the forecast, include a discussion of the information that was available to the forecaster. For parachute accidents evaluate the winds aloft (at drop altitude) and surface winds. If the accident occurred at night, include details of moon illumination if it applied to the accident.
- (6) Support services. Describe evidence that relates to the role of support services in the accident. Consider ground guides, road guards, traffic signs, fire stations, POL and dispatch procedures.
  - (7) Accident survivability.
- (a) Discuss crashworthiness/construction of the vehicle/equipment/structure in terms of crash/collapse sequence, impact conditions, kinematics, and crash impact forces.
- (b) Indicate whether the restraint systems failed or malfunctioned and the adequacy of the vehicle/equipment structure to maintain occupiable space and attenuate crash forces.
  - (c) Explain occupant injury/occupational illness relationship to crashworthiness.
  - (d) Explain if injuries occurred during or after the crash/accident sequence.
- (e) Include the performance of PPE. For example, seatbelt, visor, helmet, roll bar, and clothing. Discuss in terms of usage and nonusage.
- (8) Rescue operations. Discuss details of egress, survival, and rescue investigations. Describe where individuals were located in vehicle/structure/equipment, how and where they exited, difficulties encountered, and position of vehicle/equipment at time of egress. Describe factors that may have enhanced or inhibited the success of the survival/rescue situation. Report when and how rescue personnel were notified and how long it took rescue personnel to respond to the initial notification, arrive at accident site, and evacuate the survivors. Explain problems associated with delays in rescue.
- (9) Special investigation. Report results of any special investigations that were conducted because of the accident. If, for example, during the investigation, it is found that night vision devices played a role in the accident, the applicable agency/program manager should be notified and a determination made as to their involvement.
- (10) Witness interview. Briefly indicate number of witnesses interviewed and identify duty position and experience. Summarize pertinent witness observations and indicate whether or not witnesses generally agreed concerning accident events. In the analysis, describe major conflicts in the provided information and resolution of inconsistencies in the information. Opinions regarding witness credibility should also be reserved for the analysis section.
- d. Materiel factors investigation. This report provides results of any special investigation in the appropriate sub-paragraphs. Those accidents that do not involve materiel failure/malfunctions may be abbreviated, to include negative reports. Identify and discuss damage resulting from pre-accident materiel failure/malfunctions and omit damage that resulted from crash/impact forces exceeding design limits. References can be made to the wreckage distribution diagram, photographs, reports, and records. Include the following:

- (1) Vehicle/equipment/structure/vessel worthiness. Describe the worthiness of the vehicle/equipment/structure.
- (a) Investigation should include, but not be limited to, maintenance records, historical records, interviews with maintenance personnel, operator preventive maintenance records, and dispatch records.
- (b) Identify all deficiencies, or discrepancies found during the investigation that had a role in the accident, or may not have had a role but, if not corrected could impair safe operations; however, reserve discussion of the results of discrepancies/deficiencies for the analysis portion of the narrative.
- (2) *Systems*. Use subparagraphs to report evidence obtained in the examination of fuel, steering/control, hydraulic, electrical, frame, tire, weapon, suspension, and brake systems. Note all discrepancies.
- (3) Engine. Report the evidence obtained during examination of the engine(s). Include indications of power at impact, if available.
  - (4) Transmission. Report condition and describe any faults noted.
- (5) Laboratory Analysis. Describe any laboratory analysis done on materiel to include: Where it was done, why it was done, when it was done and exactly what was done to what.
- (6) Accident site information. Describe the accident site, to include grid location, dimensions, lighting and marking, obstructions, type and condition of surface, or any other peculiarities found.
- (7) Fire. Discuss the role of fire, to include when it occurred, manner in which the fire was detected, ignition source, combustible material, location, propagation, method, and degree of success in extinguishing.
  - e. Analysis.
- (1) The analysis paragraph summarizes the narrative and discusses the opinions and conclusions of the board and must conclusively show the cause and effect relationship of the evidence gathered during the accident investigation. The analysis will discuss the influence of command activity, or lack thereof, in the context of its role in the accident or the prevention of accidents. An example of an analysis organizational structure may be found in the USACRC Army Accident Investigator's Handbook, which can be found at https://safety.army.mil. As a minimum, the analysis part of the narrative will provide the following information:
- (a) Identify the errors, materiel failures, or environmental factors involved in the accident in the context of the accident sequence of events. To accomplish this task, the board will use the listings of mistake/errors, materiel failures/malfunctions, and environmental factors and the explanations, examples, and key words contained in appendix B.
  - (b) Discuss the results/effects of the errors/materiel failures/environmental factors.
- (c) Identify the system inadequacy(ies)/root cause(s) that caused or permitted the errors/materiel failures/environmental factors to occur. To fulfill this task, the board will use the explanations, examples, and key words contained in appendix B.
  - (d) Report preventable injuries in the context of the accident sequence of events and explain how they occurred.
  - (e) Identify the root cause(s)/readiness shortcoming(s) that caused or permitted injuries to occur.
  - (f) Discuss the command/management influence relative to cause factors and accident prevention.
- (g) Indicate whether risk management was performed, who accepted the risk, what the residual risk was, and include whether the accident event was considered during the risk management process.
- (2) To fulfill these information requirements, the board should review all the evidence relating to the accident disclosed during the human, environment and materiel factors investigations. This may require readdressing specific paragraphs contained in the narrative and indicating the relationships between the facts disclosed and the errors/materiel failures/environmental factors that occurred. From this review, the board should consider:
- (a) A logical development of the various circumstances and events that may have existed. This process of deductive reasoning should lead to the formulation of an explanation(s) concerning the accident cause and preventable injuries (if and why they occurred).
  - (b) The explanation(s) should be discussed and tested against the evidence gathered during the investigation.
- (c) If it is necessary to develop hypotheses, it is important for the board to state why a particular hypothesis was or was not supported by the evidence.
- (3) The investigation board should initially outline and structure the correlation of cause-related errors/materiel failures/environmental factors and associated root cause(s)/readiness shortcoming(s). When the outline has been completed, the narrative rationale and conclusions should be composed using the following examples as a guide:
- (a) Begin the paragraph by specifying the scope and conclusions of the investigation. In all cases, begin the paragraph with these words: "After analyzing the human, materiel, and environmental data collected during the investigation, the board concluded the accident was caused by..." Complete the sentence by specifying the factor(s) (human, materiel, or environment) which caused the accident, (for example, "... human error-leader failure.")
- (b) Describe when or where the error/failure/injury or occupational illness/environmental factor occurred in the context of the accident chronology of events, (for example, "Before the mission/activity/event ...", "While installing a hydraulic line ...", "During steering ...", "During the crash sequence...")
- (c) Identify the duty position of the person who erred, became injured, or the name and PN and NSN of the part, component or system that failed, (for example, "the mechanic"; "the brake line, PN 1-234-5678-9"; "the driver.")

- (d) Identify the error in the context of a listed mistake/error category, (for example, "inadequate planning," "excessive speed," "improper passing.") See table B-2.
- 1. If a materiel failure is being reported, explain the type of failure; for example, "overheated," "vibrated," "frayed," "decayed," and so forth. See table B-3.
- 2. If an injury is being reported, explain if the individual "struck" or "was struck by" the injury-causing agent. Refer to DA Form 285, block 28.
- (e) Cite the directive or standard the mistake/error category failed to comply with, (for example, "contrary to standard and description for task 5007, TC 1–135").
- 1. In the absence of written guidance/standards for a mistake/error, evaluate the task in terms of how other equally qualified and prudent personnel would perform the same task under similar circumstances.
  - 2. If the error represents performance that is unacceptable, it is contrary to common practice.
  - (f) Describe the specifics of the error, (for example, "he excessively torqued the nut, PN 12345").
- (g) Describe the consequences of the error, materiel failure, environmental factor, or the resulting injury/occupational illness.
- (h) A complete failure statement could read as follows: "While driving an M1114, Up-Armored HMMWV, a section of the right front brake line, PN 1–234–5678–9, eroded through. As a result, all brake fluid was lost and subsequent loss of effective braking."
- (4) Each statement of error/materiel failure, environmental factor, or injury/occupational illness will be followed by statements identifying the system inadequacy(ies)/root cause(s) that caused or permitted the error//materiel failure/injury or occupational illness to occur or an environmental factor to become a cause. The system inadequacy(ies)/root cause(s) statements are the most important part of the analysis. This information is more important from a corrective action standpoint than the error/materiel failure, injury/occupational illness, or environmental factor itself. Each system inadequacy(ies)/root cause(s) statement will contain the following information:
- (a) A transition phrase to tie the system inadequacy(ies)/root cause(s) to the error/materiel failure, or injury/occupational illness, (for example, "The driver exceeded the posted speed limit because ...", "The brake line eroded to a point of failure because ..."; "The driver sustained the back injury because ...")
- (b) Identification of the specific system inadequacy(ies)/root cause(s); for example, "because of inadequate motivation/mood (attitude)," "inadequate supervision by the unit operations officer," "because of inadequate quality control on the part of the manufacturer," "because of inadequate seat design".
- (c) An explanation of how or why each system inadequacy(ies)/root cause(s) permitted or caused the injury/occupational illness or error/materiel failure/environmental factor.
- (5) Once the preceding elements of information are reported for each error/materiel failure, injury/occupational illness, or environmental factor in the manner stated, the resulting conclusions (findings) can stand on their own. There could be more than one system inadequacy(ies)/root cause(s), depending upon the circumstances. The point to be made is that system inadequacy(ies)/root cause(s), which caused or permitted an error/materiel failure, or environmental cause must be made visible before effective corrective actions can be recommended.
- (6) The analysis paragraph of the narrative does not have to be limited to explaining and concluding what caused or contributed to the accident, injuries or damage. It should also address present but not contributing hazards if they could adversely affect the safety of operations. There are provisions for reporting non-cause-related hazards. They are contained in the instructions for completing the findings and recommendations.

## 4-5. DA Form 285-W, Technical Report of U.S. Army Ground Accident, Summary of Witness Interview

- a. Instruction. DA Form 285–W, Summary of Witness Interview (see fig 4–3) will be completed for all on duty Class A and B accidents. As a minimum, summaries of the interviews with the primary personnel involved/injured will be included. Any individual identified in a finding having a causal or contributing role must be interviewed, if available. The form will also be used to summarize interviews and statements of commanders, supervisors, maintenance personnel, and others who are able to contribute pertinent information concerning the accident. If additional space is required, use letter-size paper for continuation sheets. Form is available at USACRC Web site: https://safety.army.mil at Accident Reporting & Investigation–Forms.
  - b. Procedural guidelines. The procedural guidelines instructions are as follows:
- (1) All witnesses will be interviewed according to chapter 2, paragraph 2–3. The investigator will emphasize to the witness that the sole purpose of the accident investigation is for accident prevention. The witness should be further informed that the U.S. Army seeks to isolate the cause(s) of the accident so it may take appropriate action to avoid similar accidents. If the witness is a civilian, the investigator will avoid using Army terms and acronyms.
- (2) The board president or recorder will brief all witnesses concerning the interview. This will be done by reading to the witness the information on page 2 of the DA Form 285–W, contained in block 15, "General Witness Information Briefing." (See fig 4–3).
- (a) The purpose is to ensure that the witness understands the intent of the interview, who will or can have access to the information, DOD restrictions on the use of the interview, and its public releasability.
  - (b) If a promise of confidentiality is not offered to the witness, the interviewer will read the section, "No promise of

confidentiality offered." As a general rule, ground accidents are "General Use" investigations and the promise of confidentiality cannot be offered unless they meet the criteria outlined in AR 385-10.

- (c) If a promise of confidentiality is to be offered—
- 1. The interviewer will read the section, "Promise of confidentiality offered."
- 2. The witness will complete block 16, "Availability of Promise of Confidentiality for Limited Use Report of Investigation."
- 3. The witness will initial the appropriate paragraph indicating his/her choice, requesting or declining confidentiality. *Note.* (The exception for interviews under enhanced recall/hypnosis, which will automatically be deemed confidential and treated as such.)

Summaries of witness interviews will not be signed by the witness.

- 4. The interviewer will complete block 12 of the DA Form 285-W and only sign and date the form if "Yes" is checked.
- (d) If the witness is willing to be interviewed or make a statement, it will be summarized in "third person" in block 13 of the DA Form 285–W. The complete verbatim account of all that was stated should not be included. A summarization is to be used, but it should not exclude any information that assists in explaining the circumstances of the accident.

## 4-6. Assembly of the accident folder

An accident folder (see fig 4-8) is required for all Class A and B on duty accidents. The recorder will assemble the information as follows:

- a. Use folders to enclose the forms and substantiating data for each copy of each report.
- b. Post substantiating data to the left side of the accident folder under the completed DA Form 285–A, Index A. Items such as the DA Form(s) 285, Findings and Recommendations, Narrative and Summary of Witness Interview 285–W, are posted on the right side under the completed DA Form 285–B, Index B.
  - c. Tab and index each item on the left and right sides of the folder as shown in Figure 4-9.
- (1) DA Form 285–A. Place a number for all tabs and provide a brief descriptive title of what the tab contains. As a minimum, TABs 1 through 4 will always be used, TAB 5 is required when there is vehicle, system, and equipment damage or failure.
- (2) DA Form 285–B. Place a number for all tabs and provide a brief descriptive title of what the tab contains. As a minimum, TABs A through E will always be used. Type the signature block of all board members, to include, grade, branch, unit address, telephone number, and e-mail address (SSN not required). Use a continuation sheet if there are more than six board members.
  - d. The front of the folder will be marked with the following information:
  - (1) Limited or General Use.
  - (2) Safety Accident Investigation Report of U.S. Army Class (A-B) Accident.
  - (3) Type Equipment and Serial No.: (M109A2XXXXX).
  - (4) Date of accident: (ddmmyyyy).
  - (5) Location of accident: (DA Form 285, block 11).
  - (6) Unit: (DA Form 285, block 3).

## 4-7. DA Form 285-A, Index A and DA Form 285-B, Index B

DA Form 285-A (see fig 4-4), and DA Form 285-B (see fig 4-5) will be completed for all on-duty Class A and B accidents requiring a report.

## 4-8. Substantiating data

- a. Instructions. DA Form 285-A, Index A, lists the information that will be appended to the technical report as substantiating data.
- b. Requirements. TAB items 1 through 4 of DA Form 285–A and TAB items A through E of DA Form 285–B are required for all Class A and B on duty accidents. All other items which are necessary to explain or substantiate other parts of the report should be submitted, if appropriate. Additional instructions pertaining to applicability are contained in the paragraphs below.
  - c. Special considerations.
- (1) Social Security Numbers. None of the substantiating documents require an SSN. If any of the documents on the left side of the report have an SSN listed, black out the number with a black felt tip marker.
- (2) Legibility. Original copies of substantiating data should not be appended to the report. (Leave originals with the unit for legal/legal accident investigations.) The copies provided, however, will be legible and suitable for additional reproduction.
  - (3) Extracts. Extracts or concise quotes of regulations, tasks, performance standards, specifications, and other

directives are preferred in lieu of whole source documents to minimize bulk. When used, extracts will be annotated to include information which identified the source documents with date and latest change or update information.

- (4) *Highlighting key words and phrases*. Substantiating data referred to by other parts of the report will have key words, phrases, or passages made prominent to complement the review of the accident report. This should be done by underlining or annotating margins, which is preferred in lieu of felt-tipped markers in that the fluid dispensed devices may obliterate the legibility of subsequent copies if and when reproduced.
  - d. Information items at each TAB on the DA Form 285-A.
- (1) TAB 1-Serious incident report/casualty report. A copy of the appropriate document should be included in the report.
- (2) TAB 2-Investigation board orders. A copy of the original signed orders appointing the board and any amendments will also be appended.
- (3) TAB 3-Map of the accident site. Always include a map of the site annotated to show where the accident occurred. A copy of the map sheet portion that includes the accident site annotated with an appropriate scale, distance, and map sheet name is acceptable.
- (4) TAB 4-Diagrams and photographs. A diagram of the accident site should be appended to the report if it will assist in clarifying the accident sequence of events. The number and types of photographs, with captions, to be appended to the accident report will be determined by the accident circumstances. Additional guidance concerning photographic coverage of an accident is contained in chapter 2, paragraph 2-5e of this pamphlet.
- (5) TAB 5-Certificate of damage/ECOD. Completed ECOD(s) or ACOD(s) are required for vehicle/system/equipment damage. The ECOD(s) will include an itemized list of damaged components, number and cost of man-hours, and the total cost of repair. If the vehicle/system/equipment is damaged to the extent that the items are classified as a total loss, a statement to that effect, signed by the maintenance officer assigned to the accident investigation board, will suffice in lieu of an ECOD. The statement will reflect the AMDF cost or applicable parts manual costs.
- (6) TAB 6-Copy of deficiency reports/PQDR. Include a copy of each deficiency report submitted as a result of the accident. All failed or suspected failed parts/systems must be reported on a PQDR. When a material failure is the sole cause of the accident and a PQDR is not submitted, the accident will be charged to the accident unit in accordance with AR 385-10. Coordinate with unit maintenance personnel for completion of PQDRs.
- (7) TAB 7-Copy of directives and regulations. Extracts of directives or manuals that establish the standards for either human or material issues will be included in the report. The extracts will be annotated to reflect the source document, usually with the document cover.
- (8) TAB 8-Special technical reports and laboratory analysis reports. Append a copy of the results of all fluid (fuel, oil, hydraulic) sample analyses, TDA, or other material-related analyses conducted as a result of the accident.
- (9) TAB 9-Copy of uncorrected fault record. Append copies of the appropriate forms, if applicable to the accident vehicle/system/equipment, if a materiel problem related to an uncorrected fault is involved.
- (10) TAB 10-Copy of equipment modification record (DA Form 2408-5). Append copies of DA Form 2408-5, if applicable to accident vehicle/system/equipment, when necessary to substantiate maintenance errors, and omissions that had a bearing on the accident.
- (11) TAB 11-Weather reports. If weather had no bearing on the outcome of the accident, a brief synopsis by the nearest weather service activity of the weather that existed during the accident will suffice in most cases. If weather contributed or is suspected to have contributed to the accident, the information to be provided will include, but not limited to, the following:
- (a) A signed narrative of the weather conditions prior to and during the accident provided by a weather forecaster, briefer, or observer.
  - (b) A copy of the weather forecast or observation from official files.
- (12) *TAB 12–Medical data*. Copy of toxicology, AFMES autopsy reports, and so forth. Autopsy protocol and pictures of deceased personnel will not accompany the report through channels. This information will be forwarded separately to USACRC (CSSC–O), for inclusion in the file copy of the report. For further discussion on autopsies see chapter 2, paragraph 2–4.
- (13) TAB 13 through 18-Other. Include copies of other substantiating data deemed appropriate by the investigation board or information that is critical to the report and is not available from other sources.
- e. DA Form 285-B, Index B. Indexes by Tab the enclosed information required for the accident report. This form also reflects the Board Members information and signatures. Refer to Paragraph 4-14 and Figure 4-5 for entry instructions.
  - (1) Tab A Statement of Reviewing Officials (DA Form 285-O).
  - (2) Tab B U.S. Army Accident Report (DA Form 285).
  - (3) Tab C Findings and Recommendations.
  - (4) Tab D Narrative of Accident.
  - (5) Tab E Summary of Witness Interviews (DA Form 285–W).

## 4-9. DA Form 285-O, Technical Report of U.S. Army Ground Accident, Statement of Reviewing

Officials DA Form 285–O (see fig 4–7) will be submitted with the copy of the technical report forwarded through channels to the USACRC. If additional space is required, use letter-size paper for continuation sheets.

#### 4-10. Miscellaneous

A list may be beneficial to the local safety POC for actions required prior to the arrival/appointment of the accident investigation board. The guidelines in appendix G can be used to prepare this list.

## 4-11. DA Form 285-AB, Abbreviated Ground Accident Report (AGAR)

DA Form 285–AB is required for all Class C through E on-duty and all off-duty accidents. (See fig 4–7 for an example and table 4–1 for accident notification.) The AGAR only reduces the reporting requirements and should not affect the quality or extent of the accident investigation.

- a. Investigation and submission of the DA Form 285-AB will be according to AR 385-10.
- b. One complete form is required. If more than one individual is involved, submit an additional form, completing only blocks 1 thru 5, and 9 thru 37 (38, if applicable) for each person. Involved means any person who was injured or who took actions or made decisions that caused or contributed to the accident.
- c. Submit AGARs in legible hand-printed or typed copy via mail, fax, courier, e-mail, or through the on-line reporting system. Work copies on plain paper will be acceptable, but each data element must reference the respective block of the DA Form 285–AB.
  - (1) The message address is as follows: CDR USACRC FORT RUCKER AL //CSSC-O//.
- (2) The mailing address is as follows: Commander, U.S. Army Combat Readiness Center (CSSC-O), Bldg 4905, 5th Ave, Fort Rucker, AL 36362-5363.
  - (3) The e-mail address is: usarmy.rucker.hqda-secarmy.mbx.safe-accident-info@mail.mil
- (4) The automating reporting system allows for quick and easy reporting through the USACRC Web site: https://safety.army.mil.

TECHNICAL REPORT OF U.S. A For use of this form, see DA Pamphlet 385-				FOR USACRC USE	CSOCS-308						
	SEC			ENT INFORMATION							
1. CHECK ONE  ✓ a. ORIGINAL  b. CHANGE  2. UIC ((6-Diginal Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accide Accid	B Company, 2/28th			ING	, 5th BDE, 2	nd INF	3b. BRANCH (Armor, Infantry, e Infantry				
4. DATE OF ACCIDENT 5. TIME (	WAAWAA  DF   6. PEF	RIOD OF	· 17	. ACCIDENT OCCURRED	8.	IF ON POST, NAI	ME OF	9. AC	CIDEN	T OCCURRED	
a. YEAR b. MONTH c. DAY	ACCIDENT (Local DA Military Time)					FOB Smedla		9. ACCIDENT OCCURRED DURING (Check one)  a. Combat  b. Non-Combat			
INDICAL VED. (Conservation Constitution Della)	ia. EXACT LOCATION Liver Creek and			-	e site)				and profession of	1	
100	1b. TYPE OF LOCATION	ON			11c.	GRID COORDINA	ATES OR LAT	LONG	and the second	<del>_</del>	
F	Liver Creek emb					4.567.910	- All	September .	and the second		
12. NAME (Last, First, MI)	SEC	T		NEL INFORMAT	ION	00 041105		0011047			
Hard, Charging J		21.	ACCIDENT	TION AT TIME OF T (Check)			OF INJURY/O				
13. SOCIAL SECURITY NUMBER (SSN) 14.	DOB (YYYYMMDD)	<b>V</b>	a. Active A	ırmy		a. Struck Ag	ainst	1	g. E	Bodily Reaction	
123-45-6789	19880202		b. Army Ci	ivilian		b. Struck By		1	h. C	Overexertion	
15. GENDER (Check) 16. RANK OR GRADE 17.	MOS OR JOB SERIES		c. Army Co	ontractor	ecoeso.	c. Fell from	Elevation	1	i.\{E	Exposure	
✓ a. Male b. Female PVT	19KIO		d. Army Di	irect Contractor	<u> </u>	d. Fell from	Same Level	1	j. È	xternal Contact	
18a. ADDRESS (Use Official Address for All Military Personnel) (If different than Block 3, add UIC.)				propriated Fund	1	e. Caught In	/ Under/	2	<del> </del>	ngested /	
B Company, 2/28th ING, 5th BDE, 2:			(NAF)	.S. Military	$\vdash$	f. Rubbed/A	braded	1	er i	nhaled	
FOB Ramadi, Baghdad, Iraq 00000			g. KOTC	1, 1	H	29	. BODY PART		ECTED	<i>3</i>	
18b. For injured Army Civilians or Contractors, enter h	ome address	3/	h. Depend	lant	2		in order of se		o more		
		1	- #	1 1	1		Jinciai)	4	├		
19a. DUTY STATUS AT TIME 19b. IF OFF DUTY OF ACCIDENT (Check one)	(if on leave/pass)	H	i. NGB Te	1 1	H	b. Head		-	-	Vrist	
✓ On Duty Leave Date Fr	om:	H	i NGB ID		$\vdash$	c. Forehead				land	
Off Duty Pass Date To			k. NGB AT		1	d. Eyes		$\bot$	p. F	ingers	
20. FLIGHT STATUS (Check one) a. Yes	V b. No		I. NGB AD	wac	_ \	e: Nose			q. L	.eg	
21a. TIME BEGAN WORK:	0645L	M.	m. NGB AC	GR )		f. Jaw			r. K	(nee	
21b. CONTINUOUS WORK W/o SLEEP:	10.5	M	n, NGB AE	от \ 📉		g. Neck			s. A	Ankle	
22. HRS. SLEEP IN LAST 24.	6		o. NG Acti	vated		h. Trunk			t. F	oot	
23. DAYS LOST/RESTRICTED (not counting day of injur	EMERGENCY		p. USAR II	ĐΤ̈́		i. Chest			u. T	oes	
a. Hospitalized: Days b. Not Hospitalized: Days	ROOM	1	q. USAR A	AT		j. Heart		1	v. C	Other (Specify)	
c. Restricted Days	✓ a. Yes b. No		r. USAR A	ADT		k. Back		1			
25a. OSHA 300 Log Case Number:			s. USAR F	-TM	<b>†</b>	I. Shoulder					
25b. Name of Physician/Health Care Provider:			t. USAR A		T		. TYPE OF IN				
25c. If treatment was given away from worksite, where	was it given?	1	u. USAR A		╁	a. Burns (C	er to Correspo hemical)	ond with	T	ouncture Wound	
Facility:	3			Nat. Direct Hire	<del> </del>	-		-	<del> </del>		
Street:	1-1				<del> </del>			+		lernia, Rupture	
<del></del>	late:	120000		Nat. Indirect Hire	<del> </del>	c. Amputation				Frostbite	
26 SEVERITY OF ILLNESS/INJURY (Chec			Eoreign	Nat. KATUSA Mil. Attached to	<del>  .</del>	G. Sickness		-	ļ	leat Stroke	
b. Permanent Total Disability. Persor		-	the U.S.	. Army	1	Suffocati	on)	-	N	leat Exhaustion	
do gainful work.			z. Public		<u> </u>	f. Fractures			r. 1	njury/Illness	
c. Permanent Partial Disability. Pers never again use a body part			aa. Not rep	orted		g. Dislocation	on		s. o	leedle Stick or Sharp	
d. Days Away from Work. Person mis workdays; bed rest/on quarters.						h. Abrasion:	5			oss of Consciousness	
e. Restricted Work Activity. Person is unable to perform regular duties; job tran	sfer/light duty/profile.					i. Concussi	on	_	u. C	Other (Specify)	
f. Medical Treatment Beyond First Ai consciousness, needle stick, etc.	d. Loss of					j. Sprain/Sti	rain				
g. First Aid Only. Person has one-time minor injury. (No lost work days.)	treatment of				2	k. Cuts/Lace	erations				
h. No Injury.						I. Contusion	n		1		

Figure 4–1. Example of completed DA Form 285, Technical Report of U.S. Army Ground Accident

SECTION B - PERSO	NNEL	INFOR	MATION (Continued)				I	Hard,	, Chargir	ıg J			
31. Person's action(s) at time of accide	ent (C	heck on	e and explain in Block 32.)										
a. Soldiering		i. Patie	ent Care (People/Animals)		q.	Handling Animal			y. Coun	seling/A	Advisor	у	
b. Combat Soldiering		j. Test/Study/Experiments			r. 1	Maintenance/Repa	ir/Servicing	Ù	z. Sport	s			
c. Physical Training		k. Edu	k. Educational			Fabricating			aa. Hob	bies	,		
d. Weapons Firing/Handling		I. Infor	mation and Arts		t. I	Handling Material	Passengers		bb. Pass	senger			
e. Engineering or Construction		m. Foo	od and Drug Inspection	Li	u.	Janitorial/Housek Grounds Keeping	eeping/		cc. Hum	an mov	ement	ı	
f. Communications		n. Lau	indry/Dry Cleaning Services		٧.	Food/Drink Prepa	rations	Ш	dd. Hors	eplay	***		
g. Security/Law Enforcement		o. Pes	st/Plant Control		w.	Supervisory		Ш	ee. Byst		Sec. 17.		
h. Fire Fighting	✓	р. Оре	erating Vehicle or Vessel		х.	Office			ff. Perso	onal Hy umptio			∤rink 
gg. Parachuting (See Instructions	DA Pa	mphlet :	385-40)						and the second second	and the same of the			
(1) Jumper Height			(7) Wind Direction/Speed	At			(15) Date (			airborr	ne trair	ning	à
(2) Jumper Weight			Jump Height	E	Orop	Zone	,,,,,,		1	1	ng property and the second	-warden's	)
(3) Type of Jump			(8) Jump Altitude			***************************************	(16) Type o	f Airci	raft	À.	N. Carlot	option of the same	
(4) Parachute Type/Model			(9) Position in Stick							1	A	1	A STATE OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PARTY OF THE PAR
(5) Equipment			(10) Door Exited			and the second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second s	(17) Accide	ent fac	tors (para	chute):	\	7	Agriculture of the second
			(11) Time pre-jump condu	ucted	, pt	and the second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second s	Explain	as ne	cessary)		No.		STATE OF PARTY AND ADDRESS OF
			(12) Date of Last Jump	-					1	and the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of t	1	The Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Park of the Pa	ta.
			(13) Type of Last Jump	- 1	١,	$\rightarrow$	- Comment	P. Committee	1		and the same		
(A) IAU (5				2/	1	_/_		1		AND STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, STREET, ST			
) Wt. of Equipment (14) Number of previous ju						\	e ^r		The state	Fe.			
control of the vehicle and slid do	icle (l wn e	mbank	ment of river creek an	d rol	led	over into the 8	1/2 ft. dee	p riv	er bed. 7	he ve	hicle		
SM was driving the accident vehicle and slid do	icle (l wn e	mbank	ment of river creek an	d rol	led	over into the 8	1/2 ft. dee	p riv	er bed. 7	he ve	hicle		
SM was driving the accident vehi control of the vehicle and slid do rest on the roof and the driver wa	icle (lown eas una	mbank able to	ment of river creek an egress safely. The pas	d rol	led ger	over into the 8 was able to eg	1/2 ft. dee ress with m	p riv	er bed. T	The ve I bruis	hicle ses.	came	
SM was driving the accident vehicentrol of the vehicle and slid do rest on the roof and the driver was 33. ON FIELD EXERCISE/NAMED OPER	icle (lown eas una	mbank able to	egress safely. The pase	d rol	led ger	over into the 8 was able to eg	1/2 ft. deeress with m	p riv	er bed. T	The veil bruis	us	ED?	
SM was driving the accident vehice control of the vehicle and slid do rest on the roof and the driver was 33. ON FIELD EXERCISE/NAMED OPER A Yes (If YES, specify name of exercise/operation.)	icle (lown eas una	mbank able to	a Yes	d rol	ger 38. F	over into the 8 was able to eg  REQUIRED PROT	1/2 ft. deeress with m	p riv	er bed. To cuts and	The ve I bruis	hicle ses.	ED?	e to
SM was driving the accident vehice and slid do rest on the roof and the driver was as a control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicl	extion	mbank able to	egress safely. The pase	d rol	38. F	over into the 8 was able to eg  REQUIRED PROT  CK APPROPRIAT  a. Seat belt	1/2 ff. dee ress with m	p riv	er bed. T	The veil bruis	us	ED?	e to
SM was driving the accident vehice control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the	ATION	mbank able to	ACTIVITY PART OF TACTIC TRAINING?  a. Yès	d rol	38. F	over into the 8 was able to eg  REQUIRED PROT  CK APPROPRIAT  a. Seat belt  b. Restraint Sys	1/2 ft. dee ress with m	p riv	er bed. To cuts and	The veil bruis	us	ED?	e to
SM was driving the accident vehice control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and slid do rest on the roof and the driver was as a control of the rest on the roof and the driver was as a control of the roof and the driver was as a control of the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the driver was as a control of the roof and the driver was as a control of the roof and the driver was as a control of the roof and the driver was as a control of the roof and the driver was as a control of the roof and the driver was as a control of the roof and the driver was as a control of the roof and the driver was as a control of the roof and the driver was as a control of the roof and the driver was a control of the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof an	check	mbank able to	ACTIVITY PART OF TACTIC TRAINING?  a. Yès  b. No  g. Std. range facility/live fir	d rol	38. F	over into the 8 was able to eg  REQUIRED PROT  CK APPROPRIAT  a. Seat belt  b. Restraint Sys  c. Goggles/Gla	1/2 ft. dee ress with m	p riv	er bed. To cuts and	The veil bruis	us	ED?	e to
SM was driving the accident vehice control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and slid do rest on the vehicle and the driver was as a control of the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and the vehicle and the vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and v	check	mbarik able to	ACTIVITY PART OF TACTIC TRAINING?  a. Yès	d rol	38. F	over into the 8 was able to eg  REQUIRED PROT  CK APPROPRIAT  a. Seat belt  b. Restraint Sys  c. Goggles/Gla  d. Gloves	1/2 ft. dee ress with m	p riv	er bed. To cuts and	The veil bruis	us	ED?	e to
SM was driving the accident vehice control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and the driver was as a control of the vehicle and the driver was as a control of the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and slid do rest on the vehicle and the driver was as a vehicle and the vehicle and the vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle an	icle () www e e e e e e e e e e e e e e e e e e	mbarik able to	ACTIVITY PART OF TACTIC TRAINING?  a. Yes  J. b. No  g. Std. range facility/live fir.  h. Other (Specify):	d rol	38. F	over into the 8 was able to eg  REQUIRED PROT  CK APPROPRIAT  a. Seat belt  b. Restraint Sys  c. Goggles/Gla  d. Gloves  e. Ear plugs	1/2 ft. dee ress with m	p riv	T AVAIL YES	The veil bruis	us	ED?	e to
SM was driving the accident vehice control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and the driver was as a control of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of t	icle () www e e e e e e e e e e e e e e e e e e	mbarik able to	ACTIVITY PART OF TACTIC TRAINING?  a. Yes  J. b. No  g. Std. range facility/live fir.  h. Other (Specify):	d rol	38. FCHE	over into the 8 was able to eg  REQUIRED PROT  CK APPROPRIAT  a. Seat belt  b. Restraint Sys  c. Goggles/Gla  d. Gloves  e. Ear plugs  f. IBA	1/2 ft. dee ress with m	p riv	er bed. To cuts and	The veil bruis	us	ED?	e to
SM was driving the accident vehice control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and slid do rest on the roof and the driver was as a control of the roof and the driver was as a control of the roof and the driver was as a control of the roof and the driver was as a control of the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the driver was as a control of the roof and the driver was as a control of the roof and the driver was as a control of the roof and the driver was as a control of the roof and the driver was as a control of the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and t	icle () www e e e e e e e e e e e e e e e e e e	able to	ACTIVITY PART OF TACTIC TRAINING? a. Yès b. No  g. Std. range facility/live fir h. Other (Specify):	d rol	38. FCHE	REQUIRED PROT CK APPROPRIAT a. Seat belt b. Restraint Sys c. Goggles/Gla d. Gloves e. Ear plugs f. IBA g. Other (Specific	1/2 ft. dee ress with m	p riv	T AVAIL YES	The veil bruis	us	ED?	e to
SM was driving the accident vehice control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and the driver was as a control of the vehicle and the driver was as a control of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of	icle () www e e e e e e e e e e e e e e e e e e	able to	ACTIVITY PART OF TACTIC TRAINING?  a. Yes  J. b. No  g. Std. range facility/live fir.  h. Other (Specify):	d rol	38. FCHE	REQUIRED PROT CK APPROPRIAT a. Seat belt b. Restraint Sys c. Goggles/Gla d. Gloves e. Ear plugs f. IBA g. Other (Specifi	1/2 ft. dee ress with m	p riv	T AVAIL YES	ABLE?	Usi YES	ED?	e to
SM was driving the accident vehice control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and the driver was as a control of the vehicle and the driver was as a control of the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle an	icle () www e e e e e e e e e e e e e e e e e e	able to	ACTIVITY PART OF TACTIC TRAINING? a. Yès b. No  g. Std. range facility/live fir h. Other (Specify):	d roll ssenn	38. FCHE	over into the 8 was able to eg  REQUIRED PROT  CK APPROPRIAT  a. Seat belt  b. Restraint Sys  c. Goggles/Gla  d. Gloves  e. Ear plugs  f. IBA  g. Other (Specify  h. Helmet  DOT Approved (Iff	1/2 ft. dee ress with m	p rivinor	T AVAIL YES V V Yes	ABLE? NO	USS YES USS VES US VES US VES USS VES USS VES USS VES US VES	ED?	N/A
SM was driving the accident vehice control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of th	Check NTC JRTC CMFC	mbank able to a same and a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a same a sam	ACTIVITY PART OF TACTIC TRAINING?  a. Yès  y. b. No  g. Std. range facility/live fir  h. Other (Specify):  Crew (3) Individ	d roll ssen EAL	38. FCHE	REQUIRED PROT CK APPROPRIAT a. Seat belt b. Restraint Sys c. Goggles/Gla d. Gloves e. Ear plugs f. IBA g. Other (Specifi	1/2 ft. dee ress with m	p rivinor  PMEN	T AVAIL YES V V Yes	ABLE? NO	USS YES USS VES US VES US VES USS VES USS VES USS VES US VES	ED? NO	N/A
SM was driving the accident vehice control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and slid do rest on the roof and the driver was as a control of the roof and the driver was as a control of the roof and the driver was as a control of the roof and the driver was as a control of the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and the roof and	Check NTC JRTC CMFC	mbank able to 34.	ACTIVITY PART OF TACTIC TRAINING? a. Yes  J. No  g. Std. range facility/live fir h. Other (Specify):  The passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passion of the passi	d roll ssen EAL	388. FCHE	over into the 8 was able to eg  REQUIRED PROT  CK APPROPRIAT  a. Seat belt  b. Restraint Sys  c. Goggles/Gla  d. Gloves  e. Ear plugs  f. IBA  g. Other (Specify)  h. Helmet  DOT Approved (If  NDIVIDUAL LICENSIT  VEHICLE/EQUIPMEN  vehicle/Equipmen	1/2 ft. dee ress with m	p rivinor  PMEN  PATORA	T AVAIL YES  V  Yes Y4 hr FETY	ABLE? NO	USI YES  V  V  A  A  A  A  A  A  A  A  A  A  A	ED? NO V	N/A
SM was driving the accident vehice control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and the driver was as a control of the vehicle and the driver was as a control of the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle an	Check NTC JRTC CMFC	mbank able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said	ACTIVITY PART OF TACTIC TRAINING?  a. Yes  b. No  g. Std. range facility/live fir  h. Other (Specify):  Crew  (3) Individ	d roll ssen EAL	388. FCHE	over into the 8 was able to eg  REQUIRED PROT  CK APPROPRIAT  a. Seat belt  b. Restraint Sys  c. Goggles/Gla  d. Gloves  e. Ear plugs  f. IBA  g. Other (Specify  h. Helmet  DOT Approved (Iff  INDIVIDUAL LICENSITO OPERATE  VEHICLE/FACTOUPMET  Va. Yes  b. No	1/2 ft. dee ress with m	p rivinor  PPMEN  DATORA	T AVAIL YES  V  Yes Y4 hr FETY	ABLE? NO	USS YES V	ED? NO V	N/A
SM was driving the accident vehice control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and slid do rest on the roof and the driver was as a control of the driver was as a control of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of the vehicle of t	Check NTC JRTC CMFC	mbank able to o accide (2) o accide e. 1 f. Mc	ACTIVITY PART OF TACTIC TRAINING? a. Yes b. No  g. Std. range facility/live fir h. Other (Specify):  Crew (3) Individ  ent on activity specified in Blo	d roll ssen and roll ssen and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and	38. FCHE	over into the 8 was able to eg  REQUIRED PROT  CK APPROPRIAT  a. Seat belt  b. Restraint Sys  c. Goggles/Gla  d. Gloves  e. Ear plugs  f. IBA  g. Other (Specify)  h. Helmet  DOT Approved (If  INDIVIDUAL LICENSI VEHICLE/EQUIPMEN  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen  vehicle/Equipmen	1/2 ft. dee ress with m	p rivinor  PMEN  PATOR	T AVAIL YES  V  V  Yes  Y4 hr FETY	ABLE? NO No No Specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the specific to the	USS YES V V V V V V V V V V V V V V V V V V V	ED? NO V V RTIFIED RYES NO	N/A
SM was driving the accident vehice control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and slid do rest on the roof and the driver was as a control of the vehicle and the driver was as a control of the vehicle and the driver was as a control of the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and the vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle and vehicle an	Check NTC JRTC CMFC	mbank able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said able to a said	ACTIVITY PART OF TACTIC TRAINING? a. Yes b. No  g. Std. range facility/live fir h. Other (Specify):  Crew (3) Individ  ent on activity specified in Blo	d roll ssen and roll ssen and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and roll and	38. FCHE	over into the 8 was able to eg  REQUIRED PROT  CK APPROPRIAT  a. Seat belt  b. Restraint Sys  c. Goggles/Gla  d. Gloves  e. Ear plugs  f. IBA  g. Other (Specify)  h. Helmet  DOT Approved (Iff  INDIVIDUAL LICENSITO OPERATE  VEHICLE/FACTOUPMET  Va. Yes  b. No	1/2 ft. dee ress with m  ECTIVE EQUII E BLOCK(S)  Stem Sses/Visor  Motorcycle)?  ED 39b. MAND: TRAF TRAIN TRAIN TRAIN TRAIN TRAIN TRAIN TRAIN TRAIN TRAIN TRAIN TRAIN TRAIN TRAIN TRAIN TRAIN THE STAIN TRAIN THE STAIN	PMEN  PATOR  PAT	T AVAIL YES  V  V  Yes  Y4 hr FETY	ABLE? NO  No  39c. W	USI YES  V  V  T  T  T  T  T  T  T  T  T  T  T	ED? NO V V RTIFIED RYES NO	N/A N/A

Figure 4–1. Example of completed DA Form 285, Technical Report of U.S. Army Ground Accident—continued

SECTION B - PERSONNEL INFOR	MATIO	N (Continue	d)				Hare	d, Charg	ing J		
41. If drug use by this individual caused/contributed to the	nis accid	lent, check appr	opriate t	olock.							
a. Prescription b. Illegal		c. Ove	er-the-co	unter	d.	Suppl	ements	✓	e. No	ne	
42. Were vision enhancement devices being used? (Ch	eck app	ropriate block.)									
a. Yes (Specify type/model in c and d.)		✓ b. No			c. TYPE:			d. N	ODEL:		
43. Standard/Reference covering activity/task											
a. Soldier's Manual (Task No.)			1	e.	Federal/State Lav	W					
b. CTT (Task No.)				f.	Other (Specify):						
✓ c. AR/TM/FM (Specify) AR 385-10				g.	None (Go to Bloo	ck 45.)				art.	
✓ d. SOP											
44. WAS ACTIVITY/TASK PERFORMED IAW STANDARD/REFEI			45.		NDIVIDUAL MAKE A a. Yes (If YES, o			September 1	ď	b. No	
46. What was the mistake? How was the activity/task pr	-			<del></del>				_	2/2	, gr ^{egor}	$\Delta$
swerved off road and rolled over into river or passenger egressed safely, but the driver was Finding 2 - Soldier failed to wear seatbelt what 47. Why was mistake made/activity performed incorrective	unable	to egress an	d drow	vned	Ī.	. Jan	1		J.	J.	of, the
a. Inadequate school training (content/amount)		Poor/bad attitu		einlin	e desa	17	m. Inadeq	uata writte	n nroce	duree	R TH SOL
b. Inadequate unit training (content/amount)	1 1 1 1 1	Lack of rest/sl		CIPIIII	$\leftarrow$	L.A	n. Imprope	<del></del>	<del></del>	uuies K	111, 410, 301
10000		Effects of alcoh	<del>~</del>	<u> </u>			o. Other			<u> </u>	
c. Inadequate on-the-job training			<del></del>	viiine	55		,	, , , , , , , , , , , , , , , , , , ,	North Total Confession of		
d. Fear/excitement/anger		Inadequate fac		·	$+-\leftarrow$	-		1			
abilities/complacent	all tax	Inadequate se	<del>\</del>	+	<del></del>	$\frac{1}{2}$					
f. In a hurry	17	Improper equip	<del></del>		<del>\</del> \	1	<u> </u>				
	72	al AMV driving n		<del>\</del>	k one)	50a. Total time in unit (Check one)					
a. Less than one year		Less than 1,00	_	1	-	months					
b. One to two years		1,000 - 5,000	$-\mu$	V.	<del>\</del>	$\vdash$					
c. Over two years		5,000 - 10,000		1	. A.	Enh	Over one ye		E0- D		
51. WHICH ITEM FROM SECTION C APPLIES TO THE I (This is needed in order to relate the person in Block	NDIVID 12 to ti	he equipment/ve	BLOCK	12? low.)		1300.	Date Assigi (YYYYMMDD)		fr if	om com applica YYYYMMI	bat zone, ble
	Other (S		INVOL	VED	(Whether Dam	aged	or Not)				
	V	ITEM A			···	M B			IT	EM C	
52. Type of item	75	Truck, Util	ity								
53a. Model number	I	IMMWV M	1114								
b. Serial number		MQ234789	D	-		*************					
54. Ownership (DoD, DA, POV Unit Person)		DA								***************************************	
55. Dollar cost of damage.		\$27,500.0	0								
56. Rollover protection system installed?	<b>√</b> Y	es No	N/	١	Yes	No	NA	Y	es	No	NA
57. Was this item being towed?	Y	es ✓ No	N/	4	Yes	No	NA	Y	es	No	NA
58. If towed, enter letter for item doing towing.											
59. Types of collision codes (Pick up to three from list below and enter in blocks.) (In sequence)	7	6									
Types of Collisions  1- Going forward and collided with moving v 2- Going forward and collided with parked v 3- Collision while backing 4- Collision with pedestrian 5- Collision with object (other than vehicle/t	ehicle	an)		7- 8- 9- 10- 11-	Ran off the roa Jackknifed Going forward Going forward Collision while	and re	ar-ended pa	oving vehi Irked vehi	cle cle		

Figure 4–1. Example of completed DA Form 285, Technical Report of U.S. Army Ground Accident—continued

SECTION C - PROPERTY/MATERIEL INVOLVED (WI	hether Damaged	or Not) (Contin	ued)		Hard	l, Charging J	
60. Component/Part that Failed/Malfunctioned (Complete th	his section if a mate	riel failure/malfun	ction cause	d/contribute	d to the ac	cident.)	
	ITEM A			ITEM B		ITI	EM C
a. National Stock Number							
6. Dad Marshar			***************************************		***************************************		
b. Part Number							
			***************************************				
c. Describe Part							A
d Manufacturada Idantification Code						and the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of t	<u> </u>
d. Manufacturer's Identification Code						at a second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second seco	and the second second
- FIRIORD Number							
e. EIR/QDR Number						1	
61. How/Why Part Malfunctioned (Select code from	HOW	WHY	HOW	V	VHY	HOW	WHY
"How" list below and enter in first block; select code from "Why" list and enter in second block.)				K	1		
How Part Failed/Malfunctioned Codes:			Why.l	Part Failed	/Malfunct	ioned Codes:	1
	wisted/torqued			proper equi			\
	ompressed/hit/pur ent/warped	ctured		adequate m		e of equipment //	n \ seed
4 - Vibrated 12 - S	heared/cut	No.	4 - In	adequate w	ritten proc	edures (AR, TM,	SOP)
	ecayed/decompos lectric current acti			proper supe aknown	ervision	1	ale and the second
	nknown/Other	OIL		ther (Specif	y in narrat	ive)	r
8 - Pulled/stretched Blank - N	ot Reported	1		- Miletan Berkelin		A supplied	
SECTIO	N D - ENVIRONM	ENTAL CONDIT	TIONS INV	OLVED		1,00	
62. Environmental Conditions. (Check environmental condi	itions present and in	dicate if condition	ns caused/o	contributed to	the accid	ent.)	
PRESENT CAUSED/ CONTRIBUTED COND	<del></del>	PRESEN	9.	AUSED/ TRIBUTED		CONDITIC	DN
✓ CONTRIBUTED a. Clear/dry; visibility ur		1	CON	TRIBUTED	k Wind o	just/turbulence	
b. Bright, glare	milinos 1	<del>-                                      </del>	-	101		, shimmy, sway, s	haka
c. Dark, dim			4			tion, laser, sunligh	
d. Fog, condensation, f	too!		Ac.			rocky, rough, rutte	
e. Mist, rain, sleet, hall	1051	Samuel			o. Incline		eu, uneven
f. Snow, ice	<del>\</del>			<u> </u>			tation)
				1 1	a. Air pre	ry (not due to precipi ssure	
g. Dust fumes, gasses	s, smoke, vapors			<u>L.J.</u>	(bends,	decompression, altitu	
h. Noise, bang, static	<del></del>					ng, static electricity	y, grouna
i. Temperature/humidity					s. Other	(Specify)	
j. Storm, hurricane, torn	ado						
SECTION E - ACCIDEN	T DESCRIPTION/	NARRATIVE (F	rom Block	s 10, 46, 47	, 61 and 6	52)	
63. The investigation board will report, in narrative form on		e facts, condition	s, and circu	mstances as	establishe	ed during the inves	stigation and
present this information in accordance with DA PAM 385-40	0, paragraph 4-4.						
See Tab D, Narrative							
The state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the s							
64a. PRINTED/TYPED NAME OF PERSON COMPLETING	THIS REPORT	64b. RANK	1	34c. TITLE			
Writer, Ralph A.	1	CW			Вс	ard Recorder	
64d. SIGNATURE	64e. DATE OF SIGNATUR	64f. TELEP	HONE NO.				
DICHELL CLONIATINE 442455	SIGNATUR (YYYYMMD	1		DSN	239-123	3-4321	
DIGITAL SIGNATURE 123456789	1		ADDRESS				
DIGITAL SIGNAL CRE 125430707	1	1-13					

Figure 4–1. Example of completed DA Form 285, Technical Report of U.S. Army Ground Accident—continued

SECTION F - CORRE	·						Hard, Ch		
65. The investigation board will form paragraph 4-3. See Tab C, Findings and Reco		recomme	ndations or	n letter sized paper in	n accordan	ce wit	th the examples co	ontained in DA PAM 385-40,	
66a. PRINTED/TYPED NAME OF CO	MMANDER				66b. RAI	٧K			
Majo, Jon A.							M	AJ	
66c. SIGNATURE				66d. DATE OF SIGNATURE	66e. TEL	.EPHC			
DIGITAL SIGN	ATURE 12345	6789		(YYYYMMDD)	200 511		DSN 236-	345-6789	
DIGITIE STOTE	110102 12010	0702			66f. EMA	AIL AD	jon.a.major2@	Due army mil	
a. TYPED NAP	ME/EMAIL ADDRESS		b.	SIGNATURE			c. TITLE	d. RANK/DATE	
67. Fill out completely, or in TAB A, type "See DA				- HL ALL					
68. Fill out completely, or in TAB A, type "See DA						Name of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last o	and the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of th		
69. Fill out completely, or in TAB A, type "See DA				and the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of t					
		SECTIO	N G - SAF	ETY OFFICE USE	ONLY	Ź	1 1		
70. LOCAL REPORT NO.	1115-001		apt.	71. ARMY HEA	DQUARTE	RS	USARCENT		
72. ACCIDENT TYPE (Check choice			al profession and the second	7	Jane Jane	althor and a	OSARCENT	and the second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second second s	
✓ a. Army Motor Vehicle	<u></u>	h. Othe	r Army Vel	nicle		<u> </u>	o. Personal Injur	v - Other	
b. Army Combat Vehicle		i. Fire	1 1		1	p. Property Damage - Other			
c. Army Operated Vehicle		i. Cher	nical Agent		1	g. POV - On Official Business			
d. POV - Not on Official Busine	ss S	k. Expl	osive	1///	1		r. Space		
e. Marine Diving	N. I.	I. Miss	ile		/ <del></del>		s. Commercial 0	Carrier/Transportation	
f. Marine Underway		m. Rad	diation		7				
g. Marine Not Underway		n. Nuc	lear 🔪	, l					
73. NAME OF SAFETY POINT OF CO Safeman, Roger, D.	DNTACT(POG)			74b. EMAIL ADD	DSN 22 DRESS	(c.) (2-34	156	75. DATE REPORT COMPLETED BY SAFETY OFFICER (YYYYMMDD)	
· Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual Annual	- British Company	00000				ı@us	s.army.mil	20141111	
76. EXPLOSIVE/AMMUNITION INFO		SECTIO		LOSIVES/AMMUN		1	ITEM 3	ITEM 4	
a. LOT#	Lamentan de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya del companya del companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya de la companya d			( ) ( )			7721110	(12m)	
b. QUANTITY									
c. NET EXPLOSIVE WEIGHT (NEW									
d. DoDIC/DoDAC									
77. SPECIAL INTEREST								L	
78. SUPPLEMENTAL INFORMATION									

Figure 4–1. Example of completed DA Form 285, Technical Report of U.S. Army Ground Accident—continued

FINDING 1 (Present and Contributing- Materiel Failure):

While traveling on an interstate highway at approximately 70 mph, the M1083, Family of Medium Tactical Vehicles (FMTV) experienced a left front tire (NSN 2610-01-214-1344) failure. That is, the tire burst due to a defect in the sidewall. As a result, the driver lost control of the vehicle and it veered sharply to the left, striking a guardrail, flipping rearend over front into the opposing lane of traffic. It then collided with a Ford pickup truck traveling in the opposite direction. During the accident sequence, the driver of the FMTV was fatally injured and the operator of the Ford pickup truck experienced minor injuries. Both vehicles incurred extensive damage.

Laboratory testing determined the tire wall had a manufacturing defect (weak spot), which was not detected by the manufacturer's quality-control procedures.

#### **RECOMMENDATION 1:**

- a. Unit Level Action: None.
- b. Higher Level Action: Commander, 6th Armor, require subordinate units to conduct an inspection of tires to ensure none have similar defects.
- c. Army Level Action: Program Executive Office, Combat Support & Combat Service Support,
  - (1) Review historical information to determine if this failure was an anomaly or indicates a trend.
  - (2) Provide product deficiency information to the manufacturer so they can evaluate the adequacy of their quality-control procedures.

FINDING 2 (Present and Contributing: Human Error- Individual Failure):

While operating an M1083, 5-ton **FMTV**, west on an interstate highway, the driver operated the vehicle at excessive speeds. That is, the driver operated the vehicle at approximately 70 mph in contravention of the battalion SOP (55 mph). Consequently, when the tire burst, the driver could not maintain control of the vehicle. The vehicle ran into a guardrail, flipped rear-end over front and then collided with a Ford pickup truck in the opposing lane of traffic. The driver of the FMTV received fatal injuries. The passenger of the FMTV and driver of the pickup truck received minor injuries. Both vehicles were extensively damaged.

The driver willfully exceeded the battalion specified speed limit because he was overconfident in his ability to control the vehicle at any speed. The speed limit was stenciled on the dash. The driver was also in a hurry to complete the mission so he could meet a friend.

## RECOMMENDATION 2:

- a. Unit Level Action: Commander, C Co, 3d Bn. 6th Armor:
- (1) Inform all personnel of the circumstances and consequences of this accident, reminding them of the battalion standards.
- (2) Ensure first-line leaders enforce the standards and take corrective action before Soldiers get into an accident.
- b. Higher Level Action: Commander, 6th Armor, inform all personnel of the circumstances and consequences of this accident.
- c. Army Level Action: Commander, U.S. Army Combat Readiness Center, publish the facts and circumstances surrounding this accident in KNOWLEDGE Magazine with special emphasis on lessons learned, as appropriate.

Figure 4–2. Sample of a narrative investigation and findings and recommendations

FINDINGS AND RECOMMENDATIONS (Cont'd)-20040115

THE FINDING LISTED BELOW DID NOT DIRECTLY CONTRIBUTE TO THE CAUSE FACTORS INVOLVED IN THIS ACCIDENT; HOWEVER, IT DID CONTRIBUTE TO THE SEVERITY OF THE INJURY.

FINDING 3 (Present and Contributing to the Severity of Injuries: Human Error -Individual Failure):

While traveling on an interstate highway at approximately 70 mph, the driver failed to use his seatbelt in accordance with AR 385-10 and local policy. Consequently, after losing control of the vehicle, the driver was violently thrown around in the cab of vehicle and then ejected during the accident sequence. He received fatal injuries while the other occupant of the vehicle, who was wearing a seatbelt, received minor injuries.

The driver's actions were a result of indiscipline. The driver knew he was required to use seatbelts and was routinely corrected by leaders.

#### **RECOMMENDATION 3:**

- a. Unit Level Action: Commander, C Co, 3d Bn, 6th Armor, take positive action to enforce policy to seatbelt use.
- b. Higher Level Action: Provost Marshall, Fort Water, consider conducting no-notice seatbelt checks of Army vehicles with off-post dispatches.
- c. Army Level Action: None.

THE FINDING LISTED BELOW DID NOT CONTRIBUTE TO THIS ACCIDENT. HOWEVER, IF LEFT UNCORRECTED, IT COULD HAVE AN ADVERSE EFFECT ON THE SAFETY OF FUTURE OPERATIONS.

FINDING 4 (Present but Not Contributing):

During a review of the unit's maintenance records, the Board noted a few of the assigned vehicles were overdue for services.

### **RECOMMENDATION 4:**

- a. Unit Level Action: Commander, C Co, 3d Bn, 6th Armor, conduct a review of the service schedule biweekly to ensure services on the training schedule have been completed.
- b. Higher Level Action: None.
- c. Army Level Action: None.

Figure 4-2. Sample of a narrative investigation and findings and recommendations—continued

#### NARRATIVE OF INVESTIGATION

#### 1. History of Events.

a. Pre-accident Phase. The mission was a day time service mission in support of the 1Bth AD training exercise, Eagle Spear. C Co, 3d En, 6th AR, Fort Water, WA, was tasked by the battalion S-3 in OPORD 04-1 to provide an M1083 cargo truck and a driver for a daily logistics run between the training area and Fort Water. The mission was a recurring event scheduled approximately one week prior and was posted on the battalion mission schedule. SPC Charlie A Driver, C Co, 3d En, 6th AR, was designated as the driver and SGT Just A Passenger, who was newly assigned to the unit, was designated as the senior occupant. The driver was notified three days prior to execution. This time was used to prepare his vehicle and attend the required mission and safety briefings. All inspections, loading, and dispatching procedures of the vehicle were conducted in accordance with the battalion SOP. This provided sufficient time to plan and prepare for the mission. There was no undue sense of urgency or any delays in the mission's departure time.

On 15 January 2004 at 0600, SPC Driver and SGT Passenger conducted PMCS on the vehicle, to include checking the tires, air pressure, and lug nuts on the vehicle, and there were no deficiencies noted. At approximately 0800, all drivers were briefed on the operation order by the platoon leader, which included the platoon's mission, risk assessment worksheets, enemy situation, rules of engagement, route selection, and platoon brief back procedures. This was considered a low-risk mission. The briefed speed was 55 mph on hard-surface roads and 30 mph on all other roads. The road conditions and enemy situation would dictate speed. SPC Driver repositioned his vehicle for departure at 1015.

b. Accident Phase. SPC Driver and SGT Passenger departed the motor pool at 1100 on 15 January 2004 en route on a paved road to their designated training area. The M1083 arrived at 1140 and delivered cargo to requesting unit. While the vehicle was being unloaded, the driver and the passenger performed their during operations checks, noting no deficiencies. At 1315, the M1083 departed on the return trip to Fort Water and was empty except for 12 rounds of 105 mm ammunition and scrap containers.

At 1400, while traveling west on 1-10 at approximately 70 mph, near the Tepeetown exit SPC Driver and SGT Passenger heard a loud noise as their vehicle veered sharply to the left. Immediately SPC Driver felt the vehicle begin to slide to the left. He applied right steering, but the vehicle continued to slide to the left toward the edge of the road. As the vehicle was leaving the roadway, it struck the median guardrail and flipped rear-end over front into the opposing traffic lane. During the accident sequence, SPC Driver was ejected as the vehicle collided with a 2002 Ford Ranger pickup truck. The M1083 came to rest in the opposing traffic lane on its left side.

c. Post-accident Phase. The state troopers, military police, and rescue personnel were alerted by witnesses via cellular phone at 1402. SGT Passenger had to remove his individual ballistic armor (IBA) before exiting through the passenger window with minor scrapes and bruises. As the vehicle flipped during the accident sequence, SPC Driver's body came to rest 6 feet in front of the vehicle's bumper. Emergency vehicles arrived at 1408. The driver of the M1083 was pronounced dead at the scene and transported to Winston Hospital. The driver of the civilian vehicle received minor injuries and was transported to Jackson Hospital. At approximately 1430, a recovery vehicle arrived at the accident site and began recovery operation. The vehicle was righted and transported to C Co, 3d En, 6th AR motor pool.

Figure 4-2. Sample of a narrative investigation and findings and recommendations—continued

- 2. Human Factors Investigation.
  - a. Personnel Background/Management.
    - (1) SPC Driver enlisted into the U.S. Army National Guard in June 2000. He completed basic training in August 2000. He was awarded Military Occupational Specialty (MOS) 88M10 in November 2000. He enlisted into the U.S. Army (active duty) in June 2001. He was assigned to C Co, 3d Bn, 6th AR on 12 November 2002. He was current and qualified on the M915 series truck with over three years of driving experience. After assignment to C Co, he was trained on the M1083 5-ton cargo truck in accordance with AR 600-55, TC 21-305, and TM 9-2320-366-10-1 and was licensed on 26 May 2003. He was then assigned as the primary driver of the M1083. He was physically qualified to operate the M1083. He operated the M1083 from the time he was licensed to the date of the accident without any incidents/violations. He had driven the same route to the training area and back numerous times. He was respected and well liked by this peers. His chain of command considered him a dedicated Soldier and hard worker. He had no known social or financial problems. His sleep and dietary habits were normal. He had eight hours of sleep the night before the accident and had been on-duty for eight hours. At the time of the accident, he was not under the influence of drugs or alcohol.
    - (2) SGT Passenger. (Similar type of information as above)
  - b. Vehicle Suitability. The M1083 was suitable to perform the supply mission. It is a cargo vehicle by design.
  - c. Communications. Communications between the accident vehicle and the command was via FBCB2. Communication checks were made prior to vehicle departure and no difficulties were noted. The driver checked in with his command upon arrival at the training area, reporting no difficulties or delays had been encountered. He checked in again just prior to departure on the return trip to Fort Water.
  - d. Meteorological Information. The weather was clear and dry with a temperature of 47°F upon departure for the training area. Conditions remained the same throughout the mission. There were no weather watches, advisories, or warnings in effect or issued during the mission. e. Support Services. The vehicle was dispatched in accordance with the unit SOP to the driver. The route consisted of mainly interstate highway, which was well marked and maintained.
  - f. Accident Survivability. The accident was survivable even though the truck flipped over, collided with a civilian vehicle, and landed on its left side. The roof of the cab was depressed, but there was sufficient occupiable space on the driver's side of the cab for him to have survived. Seatbelts were present and serviceable. The driver was not wearing his seatbelt. The passenger was wearing his seatbelt.
  - g. Rescue Operations. State troopers, military police, and rescue personnel responded to the accident six minutes after being notified by witnesses via cellular phone. The driver was ejected from the truck during the accident sequence and landed in the median, 6 feet from where the truck came to rest in the opposing traffic lane. He was treated immediately upon arrival of emergency personnel, but was pronounced dead at the scene and transported to a local hospital. The driver of the civilian vehicle sustained only minor injuries and was transported to the hospital.
  - h. Witness Interview. The accident investigation board interviewed five personnel. Summaries of the interviews are included at Tab E.

Figure 4-2. Sample of a narrative investigation and findings and recommendations—continued

- 3. Materiel Factors Investigation.
  - a. Vehicle Worthiness. A review of the vehicle records revealed no major equipment or systems discrepancies. The driver recorded no deficiencies as a result of the preventive maintenance checks and services conducted prior to the mission and considered the vehicle to be roadworthy.
  - b. Systems. Post-accident investigation revealed a possible defective spot in the tire wall of one of the M1083 tires. The vehicle was equipped with seven Michelin 395/85 R20 Xml tires. All rims were mounted properly. The fuel, steering, hydraulic, electrical, suspension, and breaking systems were examined and no equipment/system deficiencies were noted.
  - c. Engine. Examination of the engine revealed it was operating normally prior to the accident with no deficiencies.
  - d. Transmission. Examination of the transmission revealed it was operating normally prior to the accident with no deficiencies.
  - e. Laboratory Analysis. The tire with the possible defective spot in the tire wall was submitted to the U.S. Army tank-Automotive and Armament Command for laboratory testing. Tests revealed the tire wall had a manufacturing defect.
  - f. Accident Site Information. The accident occurred on 1-10, a straight stretch of improved divided interstate without potholes, runs, and so forth. Visibility was unobstructed and the road surface was dry. Speed limits and exit ramps are well marked.
  - g. Fire. There was no pre- or post-crash fire.
- 4. Analysis. After analyzing command, human, materiel, and environmental data collected during the investigation, the board concluded that the accident was caused by human error and materiel failures. Rationale for this conclusion is as follows:
  - a. Command Data. The board evaluated the accident unit command policies and procedures and determined that command influence did not contribute to this accident. The board assessed unit status reports, quarterly training briefings, and unit policy and procedures for Composite Risk Management (CRM), mission planning, and briefings and determined all were appropriate for the level of command. Communications up and down the chain of command appeared to be effective and routine.
  - b. Environmental Factors. Environmental factors were evaluated and determined not to be causal in this accident.
  - (1) Meteorological Conditions. The weather was clear and dry.
  - (2) Non-meteorological Conditions. The roadway was typical four-lane interstate highway with guard rails and dividers. There were no unusual characteristics in the roadway.
  - c. Materiel Factors. The board evaluated materiel issues and determined a materiel failure caused this accident.
    - (1) Examination of the vehicle and systems revealed that all were functioning as designed except for a materiel defect in the left front tire wall. Laboratory testing revealed that a manufacturing defect consisting of a significant thinning of the tire wall which caused the tire to fail.

Figure 4-2. Sample of a narrative investigation and findings and recommendations—continued

- (2) The board determined that the driver's and the passenger's seatbelts were serviceable. The board determined that had the driver used his seatbelt, it is likely that he would have survived this accident. There was sufficient occupiable space in the driver's compartment, and there was no other apparent damage or objects in the cab that would have caused a fatal injury (if belted in).
- (3) Explosive Ordnance Disposal personnel arrived at the accident scene, secured the explosives, and transported them back to the Fort Walter Ammunition Supply Point. The ammunition was later disposed of.
- d. Human Factors. After evaluating witness interviews, vehicle damage, skid and impact marks, the board concluded that the M1083 was traveling at approximately 70 mph, in violation of the 65 mph posted speed limit and the 55 mph speed limit imposed by the unit SOP. As a result, the driver was unable to maintain control of the vehicle when the left front tire failed.
  - (1) Support. The board evaluated support issues and determined that support issues did not contribute to this accident. The accident unit is properly resourced to accomplish their mission. The accident vehicle was properly maintained. The unit dispatch procedures were conducted in accordance with local and Army level requirements. The board did note that several of the assigned vehicles were overdue some services. The unit was quick to schedule the services when pointed out by the board.
  - (2) Standards. The board evaluated standards issues and determined that they were not contributory to the
  - accident. The unit SOP addressed all areas associated with the accident mission. Installation and Army level
  - guidance and operators manual were considered adequate. The board noted that the maximum speed limit of 55 mph is stenciled on the front dash of the accident vehicle.
  - (3) Training. The board evaluated training issues and determined that they were not causal to this accident. The driver had received all appropriate battalion level training when he was qualified in the accident vehicle. While the board did not consider him a highly experienced driver, he had been driving Army vehicles for over three years and the M1083 5-ton for eight months.
  - (4) Leader/Command. The board evaluated leader issues and determined that they were not contributory to his accident. The passenger was the senior occupant in the vehicle and, as such, was responsible for the senior occupant requirements contained in AR 600-55. Based on witness interviews, the board determined that the driver's immediate supervisor briefed the driver and the passenger (senior occupant) on the mission in accordance with the unit SOP and gave very specific instructions as to the route, use of seatbelts, and speed limits. Upon notification of the accident, the unit leadership immediately activated the unit pre-accident plan and took all the appropriate notification steps. The leadership in the unit appears to be well versed in CRM and in its application to everyday missions. Although it had no bearing on this accident, the board noted unit leaders had overlooked some required services on a few of the unit's assigned vehicles. Most of these vehicles had not been used for some time so the missed services were not noticed during dispatch.

Figure 4-2. Sample of a narrative investigation and findings and recommendations—continued

(5) Individual. The board evaluated individual failure issues and determined that the driver was overconfident in his abilities as a driver. Based on witness interviews with the surviving senior occupant of the accident vehicle, unit leaders, and peers, the board determined that the driver often spoke of himself as a good driver. The board concluded that part of this attitude was because of his sincere desire to do well as a Soldier, but that he often drove too fast for conditions in Army vehicles and in his privately owned vehicle (POV). Interviews with fellow Soldiers indicate that he tried to "show off" in his POV a couple of times by driving aggressively away from stop signs. Through witness interviews, the board determined that the driver was in a hurry to get back to the unit area in order to not be late for an appointment with a friend later that day. The board also noted a degree of indiscipline on the part of the driver in that he was not wearing his seatbelt at the time of the accident and his leaders had routinely correctly him. The driver had been briefed on seatbelt use prior to the mission. Based on the fact that the senior occupant suffered only minor injuries and was wearing a seatbelt, the board concluded that had the driver been wearing his seatbelt as required by Army regulation and Washington State Jaw, it is likely that he would have survived the accident.

Figure 4-2. Sample of a narrative investigation and findings and recommendations—continued

## 4-12. Completion instructions for DA Form 285, Technical Report of U.S. Army Ground Accident

- a. Also see paragraph 4-2.
- b. Section A-Accident Information. This section should be completed for the report and for any changes to a previously submitted report.
- (1) *Block 1*. Check "original" if this is the first report submitted on the accident. Check "change" if this report is a change or provides supplemental data for a previously submitted report of accident.
- (2) *Block 2*. Enter the six-digit UIC for the specific organizational unit or activity responsible for the accident, (for example, WXXXXX). Guidance on determining accountability for Army accidents is provided in AR 385–10, chapter
  - (3) Block 3. For the unit/organization listed in block 2 provide the following data:
- (a) Block 3a. Name and full military address of unit/organization, (for example, B Company, 2/18th Cavalry, Fort Bragg, NC XXXXX–XXXX).
- (b) Block 3b. The branch of the Army with which the unit/organization is affiliated, (for example, Armor, Infantry, Engineer). Army branches are listed in table 4–3.
- (4) *Block 4*. Enter the year, month, and day of the accident in the appropriate blocks, (for example, 25 September 2007 would be shown as 20070925).
  - (5) Block 5. In local military time (24-hour clock), report the time the accident occurred, (for example, 1845).
- (6) *Block* 6. Check the block that best describes when the accident occurred (day or night). Day is from first light to full night (dark). Night is from full night (dark) to first light. Dawn is the period of time between BMNT and official sunrise. Dusk is the period of time between official sunset and EENT.
- (7) Block 7. Check either on post or off post, depending on where the accident happened. Note. On post includes all land under DOD control.
- (8) *Block* 8. If the accident occurred on post, state the name of the post, government facility, or installation where it occurred, (for example, Fort Bragg, NC; Federal Center, Atlanta, GA).
- (9) *Block 9.* Check whether or not the accident occurred in a combat theater. "Combat" should be checked if the accident occurred in a theater of hostile fire or enemy action, but not as a result of such fire/action. This includes direct preparation for combat, actual combat, or redeployment from a combat theater immediately following combat.
- (10) *Block 10*. Check if explosives were involved and explain in the narrative. Involved means damage or injury occurred as a result of the functioning, detonation, ignition or release of an explosive or explosive device, or an explosive device was damaged. If "Yes" is checked, provide the information specified in DA Pam 385–40, chapter 5, paragraph 5–3*d*, in blocks 52 and 76 and in the narrative, as appropriate. Check the appropriate fields in block 62 if the explosive was exposed to significant environmental conditions and describe in the narrative.

- (11) Block 11. Enter accident location information.
- (a) Describe the exact location of the accident. Provide the building number or direction and distance from closest landmark, street or highway name/number, city or military installation, state and/or country.
- (b) Using the type location information in table 4–4, choose the type that best describes the location's primary function. For example, a person injured in the kitchen of a private resident would be in "family housing," not in a "dining facility."
  - (c) Enter the grid coordinate or the latitude/longitude of the accident location.
- c. Section B-Personnel Information. Complete this section for each individual involved (caused/contributed and/or injured) in the accident.
  - (1) Block 12. Enter last name, first name, and middle initial of involved person.
  - (2) Block 13. Enter the SSN for the individual listed in block 12.
  - (3) Block 14. Enter the date of birth for the person listed in block 12.
  - (4) Block 15. Check the appropriate block which reflects the gender of the individual listed in block 12.
- (5) *Block 16*. Enter the rank/pay grade of the individual listed in block 12 (for example, SGT/E5, CPT/O3, GS-11, WG-08). Complete for all government personnel.
- (6) *Block 17*. Enter the full MOS/job series for the individual listed in block 12. For military MOS, give the full series number including the alphabetic character, (for example, 54E20, 11B40). For civilians, give the full job series number or occupational code and include the pay plan and grade or ban (for example, GS-0018-13, WG-07, YA-0018-2). Do not give the job title.
  - (7) Block 18. Address information for the individual listed in block 12.
- (a) Provide individual's full official military address of assignment for all government personnel if it is different than the address listed in block 3a. If different than block 3a, provide the UIC as well.
  - (b) For injured Army civilians or contractors, and members of the visiting public, enter their home address.
  - (8) Block 19.
- (a) Check the correct block to indicate the duty status of the person listed in block 12 (See glossary for definition of duty status). (This determination applies for safety accident reporting purposes only, and has no relation to compensability or line-of-duty decisions.)
- (b) If the Soldier was on leave or pass at the time of the accident, check the box and enter the inclusive leave/pass dates, (for example, 10 Jun 5 Jul '06).
- (9) Block 20. Check the appropriate block (for government personnel only) to indicate the current military flight status of the individual listed in block 12.
  - (10) Block 21.
  - (a) Enter the local military time the Soldier or employee began work.
  - (b) State how many continuous hours this individual was on duty without sleep before the accident.
- (11) Block 22. Indicate how many hours of sleep (cumulative) this individual had in the last 24 hours before the accident.
  - (12) Block 23. Days lost or restricted.
- (a) Days hospitalized. Enter the actual or estimated number of days the individual in block 12 was hospitalized as an inpatient/admitted receiving treatment. This also includes days hospitalized for observation only.
- (b) Days away from work not hospitalized. Enter the actual or estimated number of days lost that the individual could not work excluding the day of the injury/occupational illness. Include quarters, bed rest, convalescence leave, or time that a physician indicated the individual could not work regardless of whether the individual was scheduled to work. Count all calendar days including weekends and holidays. For example, if the individual was injured on Friday and the individual could work on Monday, if the physician or licensed health care professional indicated they should not work over the weekend, enter 2 days. If there is no information from the physician, enter 0 days. You may stop counting days away from work or days of restricted work once the total of either or the combination of both reaches 180 days.
- (c) Days restricted. Enter the actual or estimated number of days the individual was unable to perform one or more routine job functions (regularly performed by the individual at least once per week), or could not work a full work day they would otherwise have been scheduled to work; or a physician or licensed health care professional recommends that the employee not perform one or more routine functions of his/her job. Restricted work activities include light duty, profiles, and job transfers.
  - (13) Block 24. Check "Yes" if this individual was treated in an emergency room, otherwise check "No."
  - (14) Block 25.
- (a) OSHA log 300 case number. Enter the OSHA log 300 case number for the individual listed in block 12. OSHA log 300 case number is not required for Soldiers or off-duty civilians.
  - (b) Enter the name of the physician or other health care professional.
  - (c) If treatment was given away from the worksite, enter the name and address of the facility.
  - (15) Block 26. Check the block that indicates the severity of the injury/occupational illness to the person listed in

- block 12. If more than one applies, check the most severe. If fatal is checked, enter the date of death in the space provided.
- (16) Block 27. Select the classification of the person listed in block 12 at the time of the accident. For complete definitions, consult the glossary in sections II and III of this pamphlet. Check only one block.
- (17) Block 28. Number in order of the most severe (no more than three with one being the most severe), the cause of the injury/illness. These numbers should correlate with the information in blocks 29 and 30. For example, an individual's hand was caught between some machinery resulting in fractures. The number "1" would be assigned to "caught in/under/between."
- (18) *Block* 29. Select the body part(s) most seriously injured (no more than three) and number them in order of the most serious first. Enter the number(s) in the appropriate blocks next to the body part(s) affected. Be as specific as possible.
- (19) *Block 30.* For each body part numbered in block 29, place a corresponding number in the block that indicates the type of injury/illness incurred by that body part (no more than three). Be as specific as possible. For example, the number "1" used to indicate item o, Hand, in block 29 is also used to indicate item f, Fractures, in block 30, showing that the most serious injury/occupational illness was to the hand, which was fractured. (If necessary, more than one number can be put into a block).
- (20) *Block 31*. Check the block that best describes the individual's activity/task at the time of the accident (For example, physical training). Check only one block. If the person was engaged in more than one activity at the time of the accident, check the one most relevant to the cause of the accident. For example, a PVT in the back seat was navigating while a passenger in a HMMWV. The HMMWV ran off the road and turned over. The PVT was injured. The most relevant activity for the PVT would be "Passenger." If block 31gg, Parachuting, is checked, complete 31gg (1)–(17) below.
  - (a) (1) Jumper height In inches, (for example, 5'8" would be 68").
  - (b) (2) Jumper weight In pounds (round up at 1/2 lb or 8 ozs, that is, 168 1/2 lbs would be rounded up to 169 lbs).
- (c) (3) Type of Jump Static line, non-tactical; static line, mass tactical (night or day); freefall, non-tactical; freefall, tactical (night or day), and so forth.
  - (d) (4) Parachute type/model Self explanatory.
- (e) (5) Equipment List type of equipment, (for example, rucksack (ALICE), weapon, Modular Lightweight Load-Carrying Equipment.
  - (f) (6) Weight of equipment Give approximate weight of jumper's equipment, in pounds.
- (g) (7) Wind direction/speed at jump height, drop zone What was the wind direction (in degrees) and speed (in knots) at jump altitude and on ground when jumper exited aircraft.
  - (h) (8) Jump altitude Altitude jumpers exited aircraft (in feet).
  - (i) (9) Position in the stick What number in stick was jumper to exit the door.
  - (j) (10) Door exited Self explanatory.
  - (k) (11) Time pre-jump conducted date and time (time in zulu).
  - (l) (12) Date of last jump Self explanatory.
  - (m) (13) Type of last jump See number 3 above.
  - (n) (14) Number of previous jumps Self explanatory.
  - (o) (15) Date graduated basic airborne training (YYYY/MM/DD).
  - (p) (16) Type aircraft Self explanatory.
- (q) (17) Accident factors (parachute) Improper exit, static line injury, broken static line, parachute malfunction, entanglement, lost/stolen air, oscillation, unstable position, dragged on drop zone, tree landing, drop zone hazard (specify), or other. Explain as necessary.

Note. See the glossary, sections II and III for explanation of activities.

- (21) Block 32. Provide a short but descriptive explanation of the item checked in block 31.
- (22) Block 33. Check "Yes" if activity listed in blocks 31 and 32 was part of a field exercise or a named operation. Indicate the name of the exercise or operation (major and local field training exercise) if it has a name, (for example, Team Spirit, Operation Enduring Freedom/Operation Iraqi Freedom (OEF/OIF). Check "No" if the activity was not part of a field exercise or named operation. Note. Field exercise and tactical training begin when the individual reports to their primary duty location for movement to the field site and ends when they arrive back at the primary duty location from the field.
- (23) *Block 34*. Check "Yes" or "No" to indicate whether the activity listed in blocks 31 and 32 was part of tactical training.
- (24) Block 35. If the individual was participating in any type of training, check the type of training facility being used at the time of the accident. Leave blank, if not applicable.
  - (25) Block 36. If the individual was participating in any type of training, check the type of training in which he/she

was participating. If unit training is selected, also indicate the type of unit training (platoon, crew, or individual). (Leave blank if not applicable.)

- (26) Block 37. Indicate how long it had been since the individual received training, before the accident, on the activity listed in blocks 31 and 32.
- (27) *Block 38.* Determine what PPE was required for the activity/task being performed. If PPE was required, determine if it was available and used, available but not used, or not available. Check the appropriate blocks for each item of PPE to indicate availability and use/non-use. If no PPE was required, check the NA (not applicable) column for each type of protective clothing and equipment. For privately owned motorcycle accidents, indicate whether the helmet was Department of Transportation approved.

Note. Restraint systems are those systems such as the Gunners Restraint System in military vehicles.

- (28) Block 39.
- (a) Indicate whether the individual listed in block 12 was properly licensed to operate the vehicle or equipment that was being operated at the time of the accident. Complete this block whenever operation of a vehicle or piece of equipment requiring a licensed operator is involved.
- (b) Check "Yes" if the individual has attended the mandatory 4 hours of classroom instruction in traffic safety and indicate the date of the training, otherwise, check "No." Leave blank if not applicable.
- (c) If the individual was operating a motorcycle in this accident, check "Yes," if the individual is motorcycle safety foundation certified enter the date, otherwise, check "No."
- (29) Block 40. Indicate whether any alcohol use by the individual in block 12 caused/contributed to this accident. If "Yes," indicate test results, in space provided, (for example, percent blood alcohol content (BAC), percent BAC).
- (30) Block 41. Indicate whether drug use by the individual in block 12 caused/contributed to this accident. Check "None" or indicate the type of drug suspected of being involved.
- (31) *Block 42*. Indicate if the person listed in block 12 was using a vision-enhancement device (NVG, AN/PVS-5A, NVD, thermal imagery, Forward Looking InfraRed at the time of the accident. If a vision-enhancement device was being used, specify the type in block 42c and the model number in block 42d, even if it did not contribute to the accident. (If caused/contributed, explain in block 63.)
- (32) Block 43. Check the type of guidance (standard/reference), if it exists, that covers correct performance of the activity/task identified in blocks 31 and 32. In the space provided following the selected type of guidance, specify by name/number (for example, FM 21–305, para 3c). Guidance may be written in state/local laws, ARs, TMs, FMs, Soldier's manuals, SOPs, directives.
- (33) *Block 44*. Indicate if the activity/task was being performed in accordance with the guidance (standard/reference) specified in block 43. If "No," complete blocks 45 through 47.
- (34) Block 45. Indicate whether the individual listed in block 12 made a mistake that caused or contributed to the accident. If "Yes," enter the mistake number from Appendix B and complete blocks 46 and 47. If "No," skip to block 48.
- (35) Block 46. Provide a simple explanation of the mistake(s) made by the person listed in block 12 or explain how the activity/task was performed incorrectly. When describing mistakes, be sure to use one or more of the mistakes/errors listed at Appendix B to identify the specific mistake(s) made by the individual. Include the results or outcome of the mistake(s). For example, "The driver failed to use a ground guide to back the M915 truck, although one was required. As a result, the vehicle collided with a legally parked sedan." For on-duty Class A and B accidents requiring separate findings and recommendations, reference the finding number in this block (see fig 4–1).
- (36) Block 47. Identify why the mistake was made or the activity was performed incorrectly. What was the root cause of the mistake? Carefully consider deficiencies in system design, training, procedures, and command climate as well as individual factors such as attitude, haste, and overconfidence. Appendix B contains explanations and examples of root causes. Check the most important root causes (reasons) and explain in block 63. For on-duty Class A and B accidents requiring separate findings and recommendations and narrative of investigation, the root causes should be fully explained in the findings and supported in the analysis portion of the narrative, and referenced in block 63.
- (37) Block 48. If the individual listed in block 12 was operating a vehicle, indicate how long they had been licensed to operate this type of vehicle before the accident.
- (38) Block 49. If the individual listed in block 12 was operating a vehicle, indicate total miles they had driven Army motor vehicles (include all Army motor vehicles) before the accident.
  - (39) Block 50.
- (a) Indicate the length of time the individual listed in block 12 had been in the unit shown in block 18 before the accident.
  - (b) Enter the date the Soldier was assigned or Army civilian/contractor was hired.
  - (c) Indicate the date of redeployment, if applicable.
- (40) Block 51. Check the appropriate block to indicate which item from section C "Property/Materiel Involved" was associated with the individual listed in block 12. This information is required to ensure that it can be determined who was operating or using, each item of property/materiel involved in the accident. For example, PFC Jones was driving a

tank. His name will be in block 12 and his vehicle will be item A in section C. Therefore, the correct entry for block 51 would be "Item A." If the property/materiel associated with the individual will not be items A, B, or C, determine which letter will represent that item (see instructions for section C). Check "Other" and specify the appropriate letter in the space provided.

- d. Section C-Property/Materiel Involved. Complete an entire column (For example, column titled Item A) filling in blocks 52 through 59 on each piece of property or item of equipment involved in the accident (whether damaged or not). If the property/materiel experienced a materiel failure/malfunction, also complete blocks 60 and 61. Be sure the same column is used for all blocks. Include Army and non-Army equipment/materiel as well as equipment/materiel whose use or misuse contributed to the accident. Include up to three items of equipment on the initial form. Use additional sheets of bond paper for other equipment, if necessary, continuing letter sequence, (for example, D, E, F, and G). Each column will be used to provide information for one piece of equipment/materiel.
- (1) *Block 52*. Enter the type of property/materiel (for example, sedan, truck, generator) involved in the accident. If explosives were involved, enter the type of explosive and the NSN.
  - (2) Block 53
- (a) Enter the full military equipment model number and/or civilian make and serial number, (for example, M109A2, M60A2, 2006 Ford Taurus, M16A2 rifle, M4 rifle). If explosives were involved, enter the model number and DODAC or DOD Identification Code (DODIC).
  - (b) Enter the serial number for Army equipment/materiel, as applicable.
  - (3) Block 54. Indicate who owns the equipment/materiel.
  - (4) Block 55. Enter the ECOD or ACOD for each piece of property.
- (5) Block 56. Indicate whether a rollover protection system was installed. If rollover protection systems do not apply to the piece of equipment, check NA (not applicable).
- (6) *Block 57*. Indicate if this specific piece of equipment was being towed at the time of the accident. (Does not refer to post-accident towing of vehicles/equipment.)
- (7) Block 58. If the answer in block 57 is "Yes," indicate in which column (item A, B, C, and so forth), the equipment doing the towing is listed.
- (8) Block 59. From the list provided on the form, select the type(s) that best describe the collision in which this property/materiel was involved. More than one collision type might be appropriate for the property/materiel. If so, enter up to three, in sequence, in the blocks provided. If "Other" is selected, specify what type of collision in the space provided. If no collision was involved, leave blank.

Note. If the property listed in blocks 52 and 53 experienced a materiel failure/ malfunction that caused or contributed to the accident, complete blocks 60 and 61. Ensure the information is entered in the same column as the involved property. For example, if item A (blocks 52 and 53) experienced a materiel failure/malfunction, the information about that failure/malfunction should be entered in blocks 60 and 61 in the column entitled "Item A."

- (9) *Block 60.* Complete items "a" through "d" for each component/part whose failure or malfunction contributed to the accident. Enter name/nomenclature of component/part in block 60c. Ensure an EIR/PQDR (SF 368) is prepared and submitted through appropriate channels for each component/part. Include EIR/PQDR number in block 60e (See DA Pam 750–8).
- (10) Block 61. Indicate how and why each component/part failed/malfunctioned by selecting from the lists provided on the form and entering the appropriate number in the blocks provided. Appendix B contains explanations and examples. In block 63, include an explanation of how the materiel failed/malfunctioned and the reason (root cause) for the failure/malfunction. For on-duty Class A and B accidents requiring separate findings and recommendations, the findings should fully explain the failure and cause.
  - e. Section D-Environmental Conditions Involved.
- (1) *Block* 62. Check the appropriate blocks (no more than three) to indicate the environmental conditions present at the time of the accident. Also check the cause/contributed block if the environmental condition caused or contributed to the accident and explain in block 63 how the environmental condition caused/contributed to the accident.
- (2) On-duty Class A and B accidents. For on-duty Class A and B accidents, contributing environmental factors will be fully explained in the findings and analysis portion of the narrative.
  - f. Section E-Accident Description/Narrative.
- (1) *Block 63*. The investigation board will report, in narrative form on letter-size paper, the facts, conditions, and circumstances as established during the investigation and present this information in accordance with DA Pam 385–40, paragraph 4–4.
- (2) Block 64. Provide the following information for the individual that completed the report. Ensure the information is legible.
  - (a) Print the name. (First, MI, Last)
  - (b) Enter the rank.
  - (c) Enter the title.
  - (d) Signature of this individual.

- (e) Enter the date of the signature.
- (f) Enter the telephone number and specify whether it is DSN or commercial.
- (g) Enter this individual's e-mail address.
- g. Section F-Corrective Action and Command Review.
- (1) *Block 65*. The investigation board will formulate the findings and recommendations on letter sized paper in accordance with paragraph 4–3 and the examples contained in DA Pam 385–40.

Note. The level of command review (company, battalion, division, and so forth) is determined by either the Army Headquarters or installation policy.

- (2) *Block* 66. Provide the name (block 66a), rank (block 66b), and telephone number (block 66e) of the unit commander. Ensure the information is typed or printed legibly, and specify whether the telephone number is DSN or commercial. Also ensure the commander signs and dates the report in blocks 66c and 66d as part of the review process. Enter this individual's e-mail address in block 66f.
- (3) Blocks 67 through 69. Provide the names and e-mail address (blocks 67a, 68a, and 69a), titles (blocks 67c, 68c, and 69c), and ranks (blocks 67d, 68d, and 69d) of the individuals in the chain of command who have reviewed this report. Ensure the information is typed or printed legibly. Ensure each individual in the chain of command signs and dates the report in blocks 67b and d, 68b and d, or 69b and d. For on-duty Class A and B accidents, use blocks 1 and 2, DA Form 285–O (Statement of Reviewing Officials), for reviewing official and approving authority comments, included at Tab A of the report, and reference that form in this block. (See para 4–9.)
- h. Section G-Safety Office Use Only. This section is for local safety office use only and should be left blank by all other personnel. The safety office will complete this section on all accidents.
  - (1) Block 70. Enter the local report number for this accident report.
  - (2) Block 71. Enter the Army Headquarters of the unit shown in block 2 (the unit responsible for the accident).
- (3) *Block* 72. Check the accident type(s) that best describe this accident. Check all that apply. Consult DA Pam 385–40, chapter 1, paragraph 1–9, for definitions. If fratricide is the type of accident, declare it in the narrative, block 63.
- (4) *Blocks 73 and 74*. Provide the name (block 73) and signature, telephone number (block 74a), and the e-mail address (block 74b) of the local safety office POC for information about this report. Ensure the information is typed or printed legibly, and specify whether the telephone number is DSN or commercial.
  - (5) Block 75. Enter the date the report was completed by the safety office (yyyymmdd).
  - i. Section H–Explosives/Ammunition Information.
  - (1) Blocks 76, Explosives/Ammunition Information. If block 10 was checked "Yes," enter the following:
  - (a) Enter the lot numbers.
  - (b) Enter the quantity.
  - (c) Enter the net explosive weight (NEW) of all ammunition and explosives involved.
  - (d) If explosives or ammunition were involved, enter the model number and DODAC or DODIC.
  - (2) Blocks 77 and 78. Fill in the required information.

*Note.* If the explosive/ammunition was exposed to significant environmental conditions, the environmental conditions should be checked in block 62, and an explanation of the conditions and their effect on the explosive/ammunition should be provided in the narrative. Significant E³. For example, radiated energy (such as being in close proximity to a radar site), electromagnetic energy, electrostatic energy or high voltage; water or high humidity; or prolonged exposure to direct sunlight.

	U.S. ARMY GROUND ACCIDENT WITNESS INTERVIEW		ITS CONTROL SYMBOL
For use of this form, see DA Pamph	nlet 385-40; the proponent agency is OCSA.		CSOCS-308
1. NAME OF WITNESS (LAST, FIRST, MI)	2. OCCUPATION/TITLE	3. GRADE	4. DATE OF BIRTH
Boyd, Don, D  5. ADDRESS (Include ZIP Code) (If military, include	Driver	E-8	19780101 MBER (Duty/Work)
C Co, 2-215th Aviation	o organizativity		SN 55 8/1236
Fort Rucker, AL 36330		7. DATE OF INTERVIEW (YYYYMMDD) 20090101 10. INTERVIEWER (Name and Grade)	
8. EXPERIENCE AND BACKGROUND TIS 5 yrs	9. LOCATION AT TIME OF ACCIDENT Behind accident vehicle	DAC Darlington	i 🔥
<b>11. Promise of confidentiality.</b> A promise not ground accidents. For exception, see A	se of confidentiality can only be offered in Limite AR 385-10, paragraph 3-10.	ed Use Investigations	s, which normally are
a. Was a promise of confidentiality off blk 15. If no, read blk 14b to the witness.	fered to the witness? Ves No (If yes, i	read blk 14a to the v	vitness and complete
b. Confidentiality was requested by th	e witness.	er sign and date sta	tement below.)
THE WITNESS	S MADE THIS STATEMENT UNDER A PROMISE OF	CONFIDENTIALITY.	Marine f f
<u>DI</u>	GITAL SIGNATURE 123456789 SIGNATURE OF INTERVIEWER	DAT	20090101 TE (YYYYMMDD)
12. SUMMARY OF INTERVIEW		1 1 1	,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,
Market Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contract of the Contrac			
13. DATE OF ACCIDENT (YYYYMMDD)	20090101		

Figure 4–3. Example of completed DA Form 285–W, Summary of Witness Interview

14. GENERAL WITNESS INFORMATION BRIEFING (Interviewer must read appropriate instructions to the witness)

#### a. Promise of confidentiality offered.

- (1) This accident investigation board has been convened under the provisions of Army Regulation 385-10 for the purpose of conducting a safety investigation.
- (2) This may be just one of a number of investigations being conducted regarding this accident; collateral or legal investigations may be ongoing as well. Those investigations are entirely separate from a safety investigation and are also required to inform you of their purpose and of your legal rights.
- (3) This safety investigation is being conducted for accident prevention purposes only. Within the military, pursuant to AR 385-10, it cannot be used for any other purpose, to include any future disciplinary actions against any individuals. Therefore, the interview you are being asked to provide will be used by the Army in the interest of safety and accident prevention only.
- (4) Nonconfidential witness interviews may be released to the public pursuant to a Freedom of Information Act request. If you wish to protect your interview from public release outside the military, then your interview must be pursuant to a promise of confidentiality. Confidentiality means that your interview will not be released to the public or outside DoD safety channels.
- (5) Whether your interview is confidential or not, the chain of command will review the final accident report, which may include a summary of your interview, but the chain of command may only use the investigation report and the interviews for safety and accident prevention purposes.
- (6) If you ever have knowledge that your witness interview was used by the Army for anything other than accident prevention purposes (for example, disciplinary, action against an individual), you should consult with your local Judge Advocate Defense Counsel Office and request that the Command Judge Advocate, U.S. Army Combat Readiness Center, be notified at DSN 558-2924 or commercial (334) 255-2924.
- (7) The promise of confidentiality is available to you if you desire it. Do you desire

#### b. No promise of confidentiality offered.

- (1) This accident investigation board has been convened under the provisions of AR 385-10 for the purpose of conducting a safety investigation.
- (2) This may be just one of a number of investigations being conducted regarding this accident; collateral or legal investigations may be ongoing as well. Those investigations are entirely separate from a safety investigation and are also required to inform you of their purpose and of your legal rights.
- (3) This safety investigation is being conducted for accident prevention purposes only. Within the military, pursuant to AR 385-10, it cannot be used for any other purpose, to include any future disciplinary actions against any individuals. Therefore, the interview you are being asked to provide will be used by the Army in the interest of, safety and accident prevention only.
- (4) The chain of command will review the final accident report, which may include a summary of your interview, but the chain of command may only use the investigation report and the interviews for safety and accident prevention purposes. The interview summary may be released to the public pursuant to a Freedom of information Act request.
- (5) If you ever have knowledge that your witness interview was used by the Army for anything other than accident prevention purposes (for example, disciplinary action against an individual), you should consult with your local Judge Advocate Defense Counsel Office and request that the Command Judge Advocate, U.S. Army Combat Readiness Center, be notified at DSN 558 -2924 or commercial (334) 255-2924.

#### 15. AVAILABILITY OF PROMISE OF CONFIDENTIALITY FOR "LIMITED USE" REPORT OF INVESTIGATION

- a. Pursuant to AR 385-10, witness interviews may only be used within the military for purposes of accident prevention, and may not be used as evidence in connection with any administrative or disciplinary proceeding. This protection alone does not prevent release of the interview outside of the military (to the public, newspapers, attorneys, etc.) under the Freedom of Information Act. If you wish to protect your interview from release outside of the military, then your interview must be pursuant to a promise of confidentiality.
- b. If you do not wish a promise of confidentiality, you may decline such below. In that case, your interview will still be used in the military only for purposes of accident prevention, but it may be released outside of the military in response to a Freedom of Information Act request. Please indicate which option you desire by initialing one of the choices below:

_____I request a promise of confidentiality. I understand that the results of my interview will be used within the military only for the purposes of accident prevention, and will also be protected from public release outside of the military under the Freedom of Information Act.

I decline a promise of confidentiality. I understand that the results of my interview will be used within the military only for purposes of accident prevention. I also understand that the results may be publicly released outside of the military under the Freedom of Information Act.

Воу	rd, Don, D	
Name of witness	(Print Name - do not sign)	

DA FORM 285-W, FEB 2009

PAGE 2 OF 2

Figure 4-3. Example of completed DA Form 285-W, Summary of Witness Interview—continued

## 4-13. Completion instructions for DA Form 285-W, Summary of Witness Interview

- a. Also see paragraph 4-5.
- b. Block 15. See example of completed DA Form 285-W (see fig 4-3).
- (1) Block 1. Self- explanatory.
- (2) Block 2. Enter general occupation of the witness and duty being performed at time of the accident.
- (3) Block 3. Enter the grade of witness. Use codes from table 4-5.
- (4) Blocks 4–5. Self-explanatory. (SSN is not required.)
- (5) Block 6. List DSN number if applicable.
- (6) Block 7. Enter date(s) of interview(s) was/were made.
- (7) Block 8. Enter a summary of experience, expertise, and background in duty/MOS involved in the accident
- (8) Block 9. Enter location of witness at the time of the accident relative to the accident.
- (9) Block 10. Enter grade and last name of person in charge of interview. If witness is interviewed by different persons in charge on separate occasions, list the lead interviewer.
  - (10) Block 11. Promise of confidentiality.
- (a) Check the appropriate box to indicate if the witness was/was not offered a promise of confidentiality. This can only be offered for limited use investigations. See AR 385–10.
  - (b) Also, check the appropriate box to indicate whether or not the witness requested a promise of confidentiality.
- (c) If promise of confidentiality was offered and requested/accepted, the interviewer must sign and date the confidentiality statement.
  - (11) Block 12. Summary of interview, will be completed as follows:
- (a) Multiple interviews, same witness. Preface the summary of each interview with the date and indicate if it is the first, second, third, and so forth, interview.
- (b) Comprehensiveness. As a general rule, the interview summaries of persons involved/injured in the accident should be summarized in greater detail than the statements of others. This is because the personnel involved are the best source of information pertaining to the accident chronology of events. The chronology for the "history of events," Narrative of Investigation (see para 4–4) will most often be obtained from the personnel involved and should be used as a guide in determining what elements of information to include in the interview summaries. If human error appears to be involved in the accident, the mistakes/errors and system inadequacy(ies) listed in the instructions for completing the findings and recommendations (see para 4–3) are useful for determining what should be addressed in the witness summaries.
- (c) Consolidating. When several witnesses, other than person(s) involved, provide essentially the same observations, it is not necessary to prepare a separate DA Form 285–W for each witness except for statements made with a promise of confidentiality. In cases where the summarized statements of several witnesses can be consolidated, it is appropriate to leave blocks 1 through 9 blank. In block 13, list the names of the witnesses and then summarize their collective observations.
- (d) Format. The proper format is a concise summary of information elements. An example is as follows: "This witness was a passenger (identify location of passenger) in the vehicle at the time of the accident. Additionally, he heard a grinding noise in the area of the right rear wheel, prior to the brake failure." In cases where it is essential, limited direct quotes of a witness (together with the specific questions they are in response to) may be used. Again, this should be done sparingly and only when necessary. It is important that the statement be the investigator's summarization and not an exact verbatim transcript of what the witness said. The summary should be written in the third person ("The witness said ...," "He said ...,") and not the first person ("I saw ...," "I heard ...").
  - (12) Block 13. Enter the date of the accident.
- (13) Block 14. Interviewer will read block 15a or 15b to each witness, depending upon the category and/or circumstances of the witness.
- (14) *Block 15*. Those witnesses offered a promise of confidentiality, must indicate acceptance or refusal by initialing the appropriate statement (see fig 4–3).

TECHNICAL REPORT OF U.S. ARMY GROUND ACCIDENT INDEX A For use of this form, see DA Pamphlet 385-40; the proponent agency is OCSA.				REMENTS CONTROL SYMBOL CSOCS-308				
. DA	ATE OF ACCIDENT (YYYYMMDD) 20071115							
AB	Information		Encl	Not Applic	See Remarks			
1	Serious Incident/Casualty Report							
2	Copy of Orders Appointing Investigating Board							
3	Map of Accident Site							
4	Diagrams and/or Photographs							
5	Certificate of Damage/ECOD		✓_					
6	Copy of Deficiency Reports							
7	Copy of Directives, Regulations, Etc.		_<_	ļ <u>,</u>				
8	Special Technical Reports and Laboratory Analysis			<b>V</b>				
9	Copy of Uncorrected Fault Record							
10	Copy of Equipment Modification Record (DA Form 2408-5)							
11	Weather Data  Medical Data (Autonom Toxicology AFIR etc.) (In USACRC conv. anti-)			1	+			
13	Medical Data (Autopsy, Toxicology, AFIP, etc.) (In USACRC copy only)  Other (Specify) DA Form 7306 - Telephone Notification of Ground Accident			<del> </del>	<b></b>			
14	Other (Specify) Composite Risk Management Worksheet		<u> </u>		+			
15	Other (Specify)  Other (Specify)							
16	Other (Specify)							
17	Other (Specify)							
18	Other (Specify)							
	e- TM 9-2320-387-10  1- Ft. Anywhere Directive #01-003  2- Autopsy report included in the USACRC Channel Copy							
	1- Ft. Anywhere Directive #01-003							
	1- Ft. Anywhere Directive #01-003							
	1- Ft. Anywhere Directive #01-003							
	1- Ft. Anywhere Directive #01-003							
	1- Ft. Anywhere Directive #01-003							
	1- Ft. Anywhere Directive #01-003							
	1- Ft. Anywhere Directive #01-003							
	1- Ft. Anywhere Directive #01-003							
	1- Ft. Anywhere Directive #01-003							
	1- Ft. Anywhere Directive #01-003							
	1- Ft. Anywhere Directive #01-003							

Figure 4-4. Example of completed DA Form 285-A, Index A

	TECHNICAL REPORT OF U.S. ARMY O INDEX B For use of this form, see DA Pamphlet 385-40; the p			REQ		S CONTROL OCS-308	SYMBOL	
1. DATE	OF ACCIDENT (YYYYMMDD)							
		20071115				T	1	
2. TAB	Title Statement of Reveiwing Officials (DA Form 285-O)				Encl	Not Appl	See Remarks	
B	U.S. Army Accident Report (DA Form 285)		***************************************					
					<b>- ' - ' - - - - - - - - - -</b>	<del>                                     </del>	<del> </del>	
С	Findings and Recommendations							
D	Narrative of Accident					1		
E 3. REM	Summary of Witness Interviews (DA Form 285-W)							
4. a. Presid	dent (Name and Signature)	BOARD MEMI Grade 04 E-mail phacolapoch.p@	Branch	USA Et. R	ss and Tel. N CRC .ucker, AL	36362-536	53	
Phil Pl	hacolapoch DIGITAL SIGNATURE 123456789	Lange Lange	/					
	der (Name and Signature)  D. Writer DIGITAL SIGNATURE 123456789	Grade SW4 E-mail ralph.wroter1@	Brench AV us.army.mil	USA Ft. R	ss and Tel. N CRC .ucker, AL 228-3262	36362-530	53	
	al Officer (Name and Signature)	Grade	Branch	Addre	ss and Tel. N	lo.		
Robert	E. Lifesaver DIGITAL SIGNATURE 123456789	04 E-mail bob.e.lifesaver@	MC @us.army.mil	1		3 94118-28 )	09	
d. Maint	Officer/Tech/SME (Name and Signature)	Grade	Branch	Addre	ss and Tel. N	lo.		
	The state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the s	CW4	AV			5 BDE. 2 I	NFDIV	
<	and the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second of the second o	E-mail james.w.fixer@	us army mil		Ramadi Idad, Iraq (	00000		
Jamws	W. Fixer DIGITAL SIGNATURE 123456789	,						
	(Name and Signature)	Grade	Branch	Addre	ss and Tel. N	lo	~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~~	
	m A. Advisor - Technical Advisor	GS-13	DAC	TAC				
		E-mail	1 5710	ł	ren, MI 48	397-5000		
		1	r@us army mil		872-9988			
			william.a.advisor@us.army.mil DS		201. 012 2700			
	DIGITAL SIGNATURE 123456789							
Willian	DIGITAL SIGNATURE 123456789 (Name and Signature)	Grade	Branch	Addre	ss and Tel N	lo.	**************************************	
Willian	DIGITAL SIGNATURE 123456789 (Name and Signature)	Grade E-mail	Branch	Addre	ss and Tel. N	lo.	Manufacture and American	

Figure 4-5. Example of completed DA Form 285-B, Index B

## 4-14. Completion instructions for DA Form 285-A, Index A and 285-B, Index B

- a. Also see paragraph 4–7.
- b. See figures 4-4 and 4-5.
- (1) Block 1,. DA Forms 285-A and 285-B. Enter the date of the accident (YYYYMMDD).
- (2) *Block 2, DA Forms 285–A and 285–B.* Place an "X" in the block opposite each item to indicate whether the information is "Enclosed" or "Not Applicable." An "X" in the "See remarks" block requires an explanation in block 3 "Remarks" section of the form.
- (3) *Block 3,. DA Forms 285–A and 285–B.* The remarks block is used to indicate that required information is being delayed or not available to the accident investigation board. Remarks pertaining to delayed information will contain an estimated forwarding date. Remarks pertaining to unavailable information will include reasons for non-availability. Also, when the accident board inserts multiple documents or wants to clarify a document under a certain tab, it should be identified in this block.
- (4) *Block 4,. DA Form 285–B.* Type signature block of all voting board members to include grade, branch, unit address, e-mail address, and telephone number (SSN not required). Each voting board member will sign all copies of the accident report unless a minority report is submitted in accordance with chapter 2 of this pamphlet. Use a continuation sheet (plain bond paper) if there are more than six voting board members.

# TECHNICAL REPORT OF U.S. ARMY GROUND ACCIDENT STATEMENT OF REVIEWING OFFICIALS REQUIREMENTS CONTROL SYMBOL CSOCS-308 For use of this form, see DA Pamphlet 385-40; the proponent agency is OCSA. 1. INITIAL REVIEW (Include Name, Rank, Title and Organization. Use additional sheet if required.) 1. Concur with the findings and the recommendations of the accident investigation board. 2. Actions specified in recommendation 2a, 3a, and 4a were implemented. RICHARD F. FOREMAN, MAJ. AR Commanding. B Co. 2d BN, 28th INF Comment 2: 1. Concur with the findings and recommendations of the accident investigation board. (see continuation sheet) 2. ARMY HEADQUARTERS REVIEWING AUTHORITY COMMENTS 1. Concur with findings and recommendations fo the accident investigation board and comments of the reviewing official(s). 2. Actions recommended by the board pertaining to higher headquarters are consedered adequate. This command has no furger recommendations. BRIAN A. DIRECTOR, GENERAL, COMMANDING, (HQ element as appropriate) Signature **DIGITAL SIGNATURE 123456789** 3. DEPARTMENT OF ARMY REVIEW (USACRC) Findings and recommendations of the accident investigation board are considered correct and appropriate. DA level recommendations ahave been ofrwarded to the appropriate agency for aciton. Facts ans circumstances pertaining to this accident will be published in the Jun 08 Knowledge Magazine. The report data is approved for inclusion into the USACRC WILLIAM R. PRESERVER, GS-14, DIRECTOR, G-3, USACRC **DIGITAL SIGNATURE 123456789** 4. DATE OF ACCIDENT (YYYYMMDD) 20071115 DA FORM 285-O, FEB 2009 PREVIOUS EDITION IS OBSOLETE. APD PE v1.00

Figure 4-6. Example of completed DA Form 285-O, Statement of Reviewing Officials

# 4-15. Completion instructions for DA Form 285-O, Statement of Reviewing Officials

- a. Also see paragraph 4-9.
- b. See figure 4–6.
- (1) Block 1. The initial reviewing official(s) will indicate the official's organization as follows:
- (a) State concurrence or nonconcurrence with the findings and recommendations. Any nonconcurrence will be fully explained.
- (b) Report actions taken as well as recommendations for additional action by higher headquarters or other Army commands. Attach, as enclosures to this form, copies of correspondence, forms, and other data requiring additional action.
- (c) Identify those area(s) recommended for improvement by the investigating board that are beyond the resources available to the command.
- (d) Authenticate comments with signature, appropriate signature block, organization, and date at the close of each reviewing official's remarks.
- (e) Higher command reviewing official(s) will indicate the official's organization and enter the same information as (a) through (d) (above), as comment number 2, 3, and so forth.
- (2) *Block 2*. Army Headquarters reviewing authority. Army Headquarters commanders or their designated representatives will provide written concurrence or nonconcurrence for each finding and recommendation made by the accident investigation board.
  - (a) Indicate reasons for nonconcurrence. Also include any additional recommended actions.
- (b) The reviewing authority will make note of those areas recommended for improvement by the accident investigation board or subordinate reviewing officials on which action can or will be completed. If corrective action is beyond the purview or capability of the Army Headquarters reviewing authority, this will be stated.
  - (c) Authenticate comments with signature, appropriate signature block, and organization at the close of remarks.
- (3) *Block 3.* Reserved for USACRC and will be completed by the USACRC to show coordination/follow-up taken in response to recommendations requiring DA-level action.
  - (4) Block 4. Enter the date of the accident.

			BREVIATED GROUND ACC		ı	REQUIF	REMENTS CONTROL SYMBOL CSOCS-308
1. TI	IME & DATE OF ACCIDENT	. Yr 2008 b. Mth	05 c. Day 10 d. Time 0015	2. PERIOD OF DAY  Day ✓ Night Dusk E	3. ACDT CLASS I	4. COMBAT STATU	S Combat V Non-Combat
5. U	NIT IDENTIFICATION a. UIC (	6-digit Code) WBA	WB0 b.Unit Address B Co	o, A-111 BN, Fort Fun, CA		nch TC	5d. Army HQ's FORSCOM
6. L0		Exact Location orner of A and B s	street, Ft Fun, CA		b. Type Loca	code from DA Pam 385	6c. Grid Coordinates/Lat-Long MJ123456
d. S	itate/Country California, USA	Α Θ.	Off Post V On Post Name: Fo	ort Fun, CA	1	7. EXPLOSIVES/AM	IMO INVOLVED? ∠ Yes ✓ No
8. M	IISSION a. Briefly describe	the mission. Off-di	uty	/			b. METL Task? Yes V No
9. V	/EHICLE/EQUIPMENT/MATERI	EL INVOLVED		- Andrew Control			
	a. Type of Item (Nomenclature	)	b. Make/Model #	c. Serial#	d. Ownership	e. Estimated Cost of Da	amage f. Véhicle Collision
	POV		Honda/Accord/ 4dr.	VIN#	SGT Smith (POV)	\$0.00	7 & 6
#1	Materiel Failure/Malfunction In		<u> </u>			<del></del>	A
	g. Failure Mode	h. Part Nomenclatur	re i. Part#	j. Part N	SN	k. Part Manufacturer Code	I. EIR/QDR Submitted
					1 1	*	Yes No
	a. Type of item (Nomenciature	)	b. Make/Model #	c. Serial #	d. Ownership	e. Estimated Cost of Da	amage f. Vehicle Collision
#2	Materiel Failure/Malfunction In		1 12	<del>\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ </del>	<del>\ \ \ \</del>		
	g. Failure Mode	h. Part Nomenclatur	re i\Part#	j. Part N	SN \	k. Part Manufacturer Code	I. EIR/QDR Submitted Yes No
40	IMAN DID THE MATERIES FAI	AM EUROTIONS	(Check the root causes(s) in BIR 10	22 1- P/6 103	<del></del>	b. Describe how the materie	
10.	causes(s) led to the materiel f		Check the foot causes(s) in bik to	oa. yn Bik 100, explain flow the t	500	explain why (root cause).	er raned/manufictioned and
a.	LEADER (Not ready, willing, or able to enforce standards)		OCEDURES Not practical) (Short comings	SUPPORT in type, capability, amount or cor services/facilities)	dition of equip/supplies/		
	Direct Supervision	AR	SQP Equip/Materi	iel Improperty Designed	adequate Manufacture		
	Unit Command Supervision	TM	Other Equip/Materi	iel Not Provided l	nadequate Maintenance		
13	Higher Command Supervision	FM)	None Exists Inadequate I	Facilities/Services C	ther		
diffe	NAME (Last, First, MI) (includerent than Blks 5a and 5b.)	le Address and UIC	if 12,85N 111=22-233	1	L CLASSIFICATION	13b. DATE ASSIGNED/HIF	RED (YYYYMMDD)
		1	13c. DATE OF REDEPT		RIES 15a. DUTY		UTY (if on leave/pass)
11b	. HOME ADDRESS	1	FROM COMBAT ZONE, APPLICABLE (YYYYMM		On-dut ✓ Off-dut	y Leave	Date from (YYYYMMDD) 20080509 Date to (YYYYMMDD)
	00 K Street	] ]	20070922			, , , , , , ,	20080512
Av	onville, CA 31111	and the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of the same of th	16. DOB (YYYYMMDD) 198301	M	18. PA E-5		9. FLIGHT STATUS Yes ✓ No

Figure 4–7. Example of a U.S. Army Abbreviated Ground Accident Report (AGAR)

20. MOST SEVERE INJURY (See Instructions)	a. Degre	e C	Đ	ate of Death ()	YYYMM	(DD) b. Ty	pe	F c.	Body F	ert B	d. C	ause A
21. LOST TIME	ACTIVIT	Y OF INC	DIVIDUA	L Provide code	(from lis	t in instructions) and descr	ibe in sį	pace below.		and the second second	zt	
a. Days Hospitalized 90	23. ACT	IVITY CO	DDE (If	24. SP	ECIFIC E	ESCRIPTION OF ACTIVIT	Y/TASK			$\leftarrow$		<u></u>
b. Days lost not Hospitalized 30	activity is complete			Servic	e memb	er was operating his Po	OV at 1	he time of the acc	cident.	1	AND REAL PROPERTY.	
- D B4	P	DIK 30)								1 1		No. of Street, Street, Street, Street, Street, Street, Street, Street, Street, Street, Street, Street, Street,
180										1	Secretary of the second	
d. Treated in ER ✓ Yes No	_							1		1	Sel.	American Comments
22a. OSHA Log 300 Case No.									<b>b</b>	N. A.	d	
b. Name of Physician						and the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of the state of t	doc	All Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Marie Ma	W.	1/4		September 1
c. Name and Address of Treatment Facility						and the second		A ST	A. Salah	i,	1	September 100
						and the second	and the same	J. J.		\ _^	" North	and the second
		NO.	DO 1		001101	RUGS CAUSE/CONT			<u> </u>	N WAS ASSOCIATED	<u> </u>	
	VAILABLE?	Yes		N/A	to the same of the same of	1 1	N. Strandi	(Enter Item N			) WHI H	
	7		1	Yes	BAC 9	0.09 No U	nknown	#1	ď	A STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STATE OF THE STA		
b. Restraint System				28a. L	CENSE	TO OPERATE EQUIPME	NT g	28b. MANDATOR	Y 4hr T	RAFFIC SAFETY TR		
c. Goggles/glasses/visor		-198		✓ Yes	N	N/A		✓ Yes	No	If Yes, Date: 2	008012	22
d. Gloves				28c. M	SF CER	TFIED		29. DUTY HOURS	S work b	egan (e.g., 0645): 0	COF	
e. Ear Plugs			100	Yes	, No	If Yes, Date:	No.	1 %			505	
f. IBA		100	N			11 1	1	1 - 1		hours: 12		
g. Other (Specify)		-1	111	30. HF LAST 2	S SLEE	31 TACTICAL TRAINI	1G	32. TYPE TRAINI	NG FAC	ILITY 33. LAST	TRAIN	NG
h. Helmet  DOT Approved (if Motorcycle) ? Yes	. No		لللب		Section 1	Yes V	ю					
34. FIELD EXERCISE/NAMED OPERATION	NO		7	11.0		35. NIGHT VISION SY	STEMI	ISED				
Yes ✓ No If Yes, provide name:	The Parket		J. J.	1	And the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of the last of th	Yes V		Yes, provide type:				
		-		<del>\ \</del>	-/	, A 1401						
36. DID INDIVIDUAL MAKE A MISTAKE THAT O (from instructions) in Blk b and describe in Blk c	AUSED/CON	TRIBUTE	ED TO A	CCIDENT OR	SEVERI	FY OF INJURY/DAMAGE?	in Blk a	, indicate if individua	il made	a mistake. If yes, pr	ovide th	e code
a. Mistake c. Tell what the mistake w	as and how it	caused/e	contribut	ted to the accid	lent or se	rverity of injury/damage.						
✓ Yes No Service member travel	\$ N	>.	200	- 2			- Soldi	er was travelino s	nnrox	imately 60-70 MP	H in a	30 MPH zone
Driver was unable to co					all die p	ooted speed mint. 11	o sora	or mas auremag c	ppron			o mi ii zone.
b. Code	January.		or the land									
40	1	and the second	100	N. Standardson								
37. WHY WAS THE MISTAKE MADE? (ROOT	CAUSE) (Che				n Blk b, t			mistake.)				
a. LEADER TRAINING (Not ready, willing, or (Insufficient	. 1		PROCE	DURES ractical)	(04-	SUPPOI rtcomings in type, capabilit				INDIV (Mistake due to o	/IDUAL	
able to enforce standards) Content/Amo		(IVOLCIE	аглиот р	racucar)	(SHC	ncomings in type, capabili equip/supplies/serv				(мізіаке але ю о	wn perso	mai ractors)
✓ Direct Supervision School		AR		SOP		Equip/Materiel Improperly Designed		Inadequate Manufacture		Poor/Bad Attitude	<b>V</b>	Fatigue
Unit Command Unit Supervision	U	TM	Ш	Other	L	Equip/Materiel Not Provided		Inadequate Maintenance	✓	Overconfident	L	Alcohol, Drugs
Higher Command Experien Supervision Off	ce,	FM		None exists		Inadequate Facilities/Services		Other	<b>V</b>	In a Hurry		Fear/Excitement

Figure 4-7. Example of a U.S. Army Abbreviated Ground Accident Report (AGAR)—continued

The Soldier's decision making	and tell how it/they caused the mistake. process was hindered by fatigue and the driving habits while operating military ve				
38. PARACHUTE INFORMATION F	OR PERSON LISTED IN BIK 11.				
a. Jumper Height	g. Wind Direction/Speed at	m. Type of Last Jump		39. ENVIRONMENTAL CONI	DITIONS
b. Jumper Weight	Jump Height Drop Zone	n. Number of Previous Jump	os	#1 C Yes	No Unk
c. Type of Jump	h. Jump Altitude	o. Date Graduated Basic Airb	borne Training	#2 Yes	No Unk
d. Parachute Type/Model	i. Position in Stick	(YYYYMMDD)		#3 Yes	No Unik
e. Equpiment	j. Door Exited	p. Type Aircraft	march from	b. Caused/Contributed: #1 Yes	No Unk
	k. Time Pre-jump Conducted	q. Accident Factors (parach	ute):(Explain as necessary)	#1 Yes	No Unk
f. Wt. of Equipment	Date of Last Jump		m / /	#3 Yes	No Unk
40 000 405 0015 004 000 0	F ACDT (Use additional sheets if required)(Expla		<u> </u>		
shopette back to the barracks or road. The driver lost control or rolled down the 15' embankmed 41. CORRECTIVE ACTION(S) TAKE a. Unit level: 1) Commander,	with SGT Smith driving. He accelerated to f the vehicle wile negotiating the curves are net lading upright. The passdenger egress EN OR PLANNEO B Co, A-111 BN; a) Ensure all personnel	nd slid off the roadway into a gravel sed with minor cuts and bruises, the I returning from deployments report	hin 1/3 of a mile prior to l area on the right side u driver sustained a seven to their supervisor for i	o entering into a series of intil reaching an embankure head injury (See cont sinstructions and appropri	S-curves in the nent then barrel heet).
shopette back to the barracks in road. The driver lost control o rolled down the 15' embankme 41. CORRECTIVE ACTION(S) TAKE a. Unit level: 1) Commander, to releasing them from duty, b personnel back into the unit af b. Higher Level: None; c. At	with SGT Smith driving. He accelerated to the vehicle wile negotiating the curves and tading upright. The passdenger egressen OR PLANNED B Co. A-111 BN; a) Ensure all personnel D Breif all unit personnel on the facts and ter deployments.  Truy Level: None (Use continuation sheet)	to a speed between 60-70 MPH with and slid off the roadway into a gravel sed with minor cuts and bruises, the l returning from deployments report circumstances surrounding the acci- ots as needed)	hin 1/3 of a mile prior to l area on the right side u driver sustained a seven to their supervisor for i dent. 2) Commander, A	o entering into a series of intil reaching an embanking re head injury (See cont s' instructions and appropri -111 BN, establish a poli	S-curves in the lent then barrel heet).  ate briefings prior cy for integrating
shopette back to the barracks or road. The driver lost control o rolled down the 15' embankme 41. CORRECTIVE ACTION(S) TAKE a. Unit level: 1) Commander, to releasing them from duty, b personnel back into the unit af b. Higher Level: None; c. AI 42. EXPLOSIVE/AMMUNITION I	with SGT Smith driving. He accelerated to the vehicle wile negotiating the curves and tading upright. The passdenger egressen OR PLANNED B Co. A-111 BN; a) Ensure all personnel D Breif all unit personnel on the facts and ter deployments.  Truy Level: None (Use continuation sheet)	to a speed between 60-70 MPH with and slid off the roadway into a gravel sed with minor cuts and bruises, the l returning from deployments report errounstances surrounding the acci-	hin 1/3 of a mile prior to l area on the right side u driver sustained a seven to their supervisor for i	o entering into a series of intil reaching an embanking re head injury (See cont s' instructions and appropri -111 BN, establish a poli	S-curves in the nent then barrel heet).
shopette back to the barracks road. The driver lost control o rolled down the 15' embankme 41. CORRECTIVE ACTION(S) TAKE a. Unit level: 1) Commander, to releasing them from duty, b personnel back into the unit af b. Higher Level: None; c. AI 42. EXPLOSIVE/AMMUNITION I a. Lot#	with SGT Smith driving. He accelerated to the vehicle wile negotiating the curves and tading upright. The passdenger egressen OR PLANNED B Co. A-111 BN; a) Ensure all personnel D Breif all unit personnel on the facts and ter deployments.  Truy Level: None (Use continuation sheet)	to a speed between 60-70 MPH with and slid off the roadway into a gravel sed with minor cuts and bruises, the l returning from deployments report circumstances surrounding the acci- ots as needed)	hin 1/3 of a mile prior to l area on the right side u driver sustained a seven to their supervisor for i dent. 2) Commander, A	o entering into a series of intil reaching an embanking re head injury (See cont s' instructions and appropri -111 BN, establish a poli	S-curves in the lent then barrel heet).  ate briefings prior cy for integrating
shopette back to the barracks or road. The driver lost control to rolled down the 15' embankme 41. CORRECTIVE ACTION(S) TAKE a. Unit level: 1) Commander, to releasing them from duty, b personnel back into the unit af b. Higher Level: None; c. AI 42. EXPLOSIVE/AMMUNITION I a. Lot#	with SGT Smith driving. He accelerated to the vehicle wile negotiating the curves and tading upright. The passdenger egressen OR PLANNED B Co. A-111 BN; a) Ensure all personnel D Breif all unit personnel on the facts and ter deployments.  Truy Level: None (Use continuation sheet)	to a speed between 60-70 MPH with and slid off the roadway into a gravel sed with minor cuts and bruises, the l returning from deployments report circumstances surrounding the acci- ots as needed)	hin 1/3 of a mile prior to l area on the right side u driver sustained a seven to their supervisor for i dent. 2) Commander, A	o entering into a series of intil reaching an embanking re head injury (See cont s' instructions and appropri -111 BN, establish a poli	S-curves in the lent then barrel heet).  ate briefings prior cy for integrating
shopette back to the barracks or road. The driver lost control to rolled down the 15' embankme 41. CORRECTIVE ACTION(S) TAKE a. Unit level: 1) Commander, to releasing them from duty, b personnel back into the unit af b. Higher Level: None; c. AI 42. EXPLOSIVE/AMMUNITION I a. Lot# b. Quantity c. Net Explosive Weight (NEW)	with SGT Smith driving. He accelerated to the vehicle wile negotiating the curves and tading upright. The passdenger egressen OR PLANNED B Co. A-111 BN; a) Ensure all personnel D Breif all unit personnel on the facts and ter deployments.  Truy Level: None (Use continuation sheet)	to a speed between 60-70 MPH with and slid off the roadway into a gravel sed with minor cuts and bruises, the l returning from deployments report circumstances surrounding the acci- ots as needed)	hin 1/3 of a mile prior to l area on the right side u driver sustained a seven to their supervisor for i dent. 2) Commander, A	o entering into a series of intil reaching an embanking re head injury (See cont s' instructions and appropri -111 BN, establish a poli	S-curves in the lent then barrel heet).  ate briefings prior cy for integrating
shopette back to the barracks or road. The driver lost control to rolled down the 15' embankme 41. CORRECTIVE ACTION(S) TAKE a. Unit level: 1) Commander, to releasing them from duty, b personnel back into the unit af b. Higher Level: None; c. AI 42. EXPLOSIVE/AMMUNITION I a. Lots b. Quantity c. Net Explosive Weight (NEW) d. DODIC/DoDAC	with SGT Smith driving. He accelerated to five vehicle wile negotiating the curves are trading upright. The passdenger egressen OR PLANNED B Co, A-111 BN; a) Ensure all personnel bereit personnel on the facts and ter deployments.  Timy Level: None (Use continuation shee NFORMATION ITEM 1	to a speed between 60-70 MPH with and slid off the roadway into a gravel sed with minor cuts and bruises, the l returning from deployments report circumstances surrounding the acci- ots as needed)	hin 1/3 of a mile prior to l area on the right side u driver sustained a seven to their supervisor for i dent. 2) Commander, A	o entering into a series of intil reaching an embanking re head injury (See cont s' instructions and appropri -111 BN, establish a poli	S-curves in the lent then barrel heet).  ate briefings prior cy for integrating
shopette back to the barracks or road. The driver lost control to rolled down the 15' embankme 41. CORRECTIVE ACTION(S) TAKE a. Unit level: 1) Commander, to releasing them from duty, be personnel back into the unit at b. Higher Level: None; c. At 42. EXPLOSIVE/AMMUNITION I a. Lot# b. Quantity c. Net Explosive Weight (NEW) d. DODIC/DODAC 43. POINT OF CONTACT INFORM	with SGT Smith driving. He accelerated to f the vehicle wile negotiating the curves an ent lading upright. The passdenger egress EN OR PLANNED  B Co. A-111 BN; a) Ensure all personnel by Breif all unit personnel on the facts and ter deployments.  TIMP LEVEL: None (Use continuation shee NFORMATION ITEM 1	to a speed between 60-70 MPH with and slid off the roadway into a gravel sed with minor cuts and bruises, the l returning from deployments report circumstances surrounding the acci- ots as needed)	hin 1/3 of a mile prior to l area on the right side u driver sustained a seven to their supervisor for i ident. 2) Commander, A	o entering into a series of until reaching an embankur re head injury (See cont s instructiions and appropri-111 BN, establish a poli	S-curves in the lent then barrel heet).  ate briefings prior cy for integrating
shopette back to the barracks or road. The driver lost control to rolled down the 15' embankme 41. CORRECTIVE ACTION(S) TAKE a. Unit level: 1) Commander, to releasing them from duty, be personnel back into the unit at b. Higher Level: None; c. At 42. EXPLOSIVE/AMMUNITION 1 a. Lot# b. Quantity c. Net Explosive Weight (NEW) d. DoDIC/DoDAC 43. PÓINT OF CONTACT INFORM a. Namie (Last, First, MI), Rank P	with SGT Smith driving. He accelerated to the vehicle wile negotiating the curves and taking upright. The passdenger egress EN OR PLANNED  B Co, A-111 BN; a) Ensure all personnel b) Breit all unit personnel on the facts and the deployments.  The continuation of the facts and the components of the facts and the components.  THEM 1  ATTION ON THE ACCIDENT  OSITION (THE	to a speed between 60-70 MPH with and slid off the roadway into a gravel sed with minor cuts and bruises, the l returning from deployments report circumstances surrounding the acci- ots as needed)	hin 1/3 of a mile prior to l area on the right side u driver sustained a seven to their supervisor for i dent. 2) Commander, A	pentering into a series of until reaching an embankur re head injury (See cont s instructions and appropri-111 BN, establish a poli	S-curves in the lent then barrel heet).  ate briefings prior cy for integrating
shopette back to the barracks or road. The driver lost control to rolled down the 15' embankme 41. CORRECTIVE ACTION(S) TAKE a. Unit level: 1) Commander, to releasing them from duty, be personnel back into the unit at b. Higher Level: None; c. At 42. EXPLOSIVE/AMMUNITION I a. Lot# b. Quantity c. Net Explosive Weight (NEW) d. DODIC/DODAC 43. POINT OF CONTACT INFORM	with SGT Smith driving. He accelerated to the vehicle wile negotiating the curves and taking upright. The passdenger egress EN OR PLANNED  B Co, A-111 BN; a) Ensure all personnel b) Breit all unit personnel on the facts and the deployments.  The continuation of the facts and the components of the facts and the components.  THEM 1  ATTION ON THE ACCIDENT  OSITION (THE	to a speed between 60-70 MPH with and slid off the roadway into a gravel sed with minor cuts and bruises, the l returning from deployments report circumstances surrounding the acci- ots as needed)	hin 1/3 of a mile prior to l area on the right side u driver sustained a seven to their supervisor for i ident. 2) Commander, A	Dentering into a series of until reaching an embanking the head injury (See cont series of instructions and appropriate of the propriate of th	S-curves in the lent then barrel heet).  ate briefings prior cy for integrating
shopette back to the barracks or road. The driver lost control to rolled down the 15' embankme 41. CORRECTIVE ACTION(S) TAKE a. Unit level: 1) Commander, to releasing them from duty, be personnel back into the unit at b. Higher Level: None; c. At 42. EXPLOSIVE/AMMUNITION I a. Lot# b. Quantity c. Net Explosive Weight (NEW) d. DeDIC/DoDAC 43. POINT OF CONTACT INFORM a. Name (Last, First, MI), Rank P Johnson, Mary, A. MAJ, BN S	with SGT Smith driving. He accelerated to the vehicle wile negotiating the curves and taking upright. The passdenger egress EN OR PLANNED  B Co, A-111 BN; a) Ensure all personnel by Breif all unit personnel on the facts and the deployments.  THY LEVEL: None (Use continuation shee NFORMATION)  ITEM 1  INTIMITEM 1  INTIMITEM 1	to a speed between 60-70 MPH with and shid off the roadway into a gravel sed with minor cuts and bruises, the I returning from deployments report circumstances surrounding the acci- sts as needed)  ITEM 2	hin 1/3 of a mile prior to a rea on the right side us driver sustained a sever to their supervisor for ident. 2) Commander, A  ITEM 3  D. Telephone No.  c. Email Address:	Dentering into a series of until reaching an embankur re head injury (See cont s instructions and appropri-111 BN, establish a poli and appropriation of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the	S-curves in the lent then barrel heet).  ate briefings prior cy for integrating  ITEM 4
shopette back to the barracks or road. The driver lost control to rolled down the 15' embankme 41. CORRECTIVE ACTION(S) TAKE a. Unit level: 1) Commander, to releasing them from duty, be personnel back into the unit af b. Higher Level: None; c. At 42. EXPLOSIVE/AMMUNITION I a. Lot# b. Quantity c. Net Explosive Weight (NEW) d. DODIC/DoDAC 43. PÓINT OF CONTACT INFORM a. Name (Last, First, MI), Rank P Johnson, Mary, A. MAJ, BN S	with SGT Smith driving. He accelerated to the vehicle wile negotiating the curves and taking upright. The passdenger egress EN OR PLANNED  B Co, A-111 BN; a) Ensure all personnel of the facts and the deployments.  The passdenger of the facts and the deployments.  THE ATTION ON THE ACCIDENT  OSITION ON THE ACCIDENT	to a speed between 60-70 MPH with and shid off the roadway into a gravel sed with minor cuts and bruises, the I returning from deployments report circumstances surrounding the accidence of the same	hin 1/3 of a mile prior to l area on the right side u driver sustained a seven to their supervisor for i ident. 2) Commander, A	Dentering into a series of until reaching an embanking the head injury (See cont series of instructions and appropriate of the propriate of th	S-curves in the lent then barrel heet).  ate briefings prior cy for integrating  ITEM 4
shopette back to the barracks or road. The driver lost control to rolled down the 15' embankme 41. CORRECTIVE ACTION(S) TAKE a. Unit level: 1) Commander, to releasing them from duty, be personnel back into the unit af b. Higher Level: None; c. At 42. EXPLOSIVE/AMMUNITION I a. Lot# b. Quantity c. Net Explosive Weight (NEW) d. DODIC/DoDAC 43. PÓINT OF CONTACT INFORM a. Name (Last, First, MI), Rank P Johnson, Mary, A. MAJ, BN S	with SGT Smith driving. He accelerated to the vehicle wile negotiating the curves and taking upright. The passdenger egress EN OR PLANNED  B Co, A-111 BN; a) Ensure all personnel by Breif all unit personnel on the facts and the deployments.  THY LEVEL: None (Use continuation shee NFORMATION)  ITEM 1  INTIMITEM 1  INTIMITEM 1	to a speed between 60-70 MPH with and shid off the roadway into a gravel sed with minor cuts and bruises, the I returning from deployments report circumstances surrounding the accidence of the same	hin 1/3 of a mile prior to a rea on the right side us driver sustained a sever to their supervisor for ident. 2) Commander, A  ITEM 3  D. Telephone No.  c. Email Address:	Dentering into a series of until reaching an embankur re head injury (See cont s instructions and appropri-111 BN, establish a poli and appropriation of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the policy of the	S-curves in the lent then barrel heet).  ate briefings prior cy for integrating  ITEM 4  June 1  June 1  June 1  June 1  June 2  June

Figure 4-7. Example of a U.S. Army Abbreviated Ground Accident Report (AGAR)—continued

# 4-16. Completion instructions for DA Form 285-AB, Abbreviated Ground Accident Report (AGAR)

- a. Also see paragraph 4–11.
- b. See legend for figure 4-7.
- (1) Block 1. Date and time of accident.
- (a) Block 1a. Enter the year (for example, 2006).
- (b) Block 1b. Enter the month (for example, 06).
- (c) Block 1c. Enter the month (for example, 06).
- (d) Block 1d. Military time. Enter the local military time (for example, 2315).
- (2) Block 2, Period of day. Check the block that best describes when the accident occurred (day or night). Day is from first light to full night (dark). Night is from full dark (full night) to first light. Dawn is the period between BMNT and official sunrise. Dusk is the period of time between official sunset and EENT.
- (3) Block 3, Accident class. Enter the accident's classification: A, B, C, D, or E. (See definitions in AR 385-10, chapter 3).
- (4) Block 4, Combat status. Check whether or not the accident occurred in a combat theater. Combat should be checked if the accident occurred in a theater of hostile fire or enemy action, but not as a result of such fire/action. This includes direct preparation for combat, actual combat, or redeployment from a combat theater immediately following combat.
- (5) *Block 5, Unit Identification*. Enter information for the unit or organization responsible for the accident. Guidance for determining accident accountability can be found in AR 385–10.
- (a) Block 5a. Enter the six-digit UIC for the specific organizational unit or activity responsible for the accident (for example, WXXXXX).

- (b) Block 5b. Unit address. Enter the full military address of unit/organization (for example, B Company, 2/18th Cavalry, Fort Bragg, NC XXXXX–XXXX).
- (c) Block 5c. Unit's Branch. Enter the abbreviation of Army branch the unit is affiliated with (for example, Armor, Infantry, Engineer, and so forth) Army branches are listed in table 4–3.
- (d) Block 5d. Army Headquarters. Enter the abbreviation for the Army commands, Army Service Component Commands, or Direct Reporting Units that the unit/activity belongs to (for example, Army Materiel Command [AMC], U.S. Army Europe and 7th Army, Forces Command, and so forth.)
  - (6) Block 6, Location of the accident.
- (a) Block 6a. Enter the exact location of the accident (for example, building number, street name and address, distance from nearest landmark, and so forth).
  - (b) Block 6b. Enter one code for primary function of the accident location, see table 4-4.
  - (c) Block 6c. Enter the grid coordinate or latitude/longitude for the accident location.
  - (d) Block 6d. Enter the state or country if outside the United States.
- (e) Block 6e. Indicate whether the accident occurred on or off post, and if on post, enter the name of the installation/activity.
- (7) Block 7. Explosives/Ammunition. Check if explosives, ammunition, or pyrotechnics were involved. Involved meaning damage or injury occurred as a result of the functioning, detonation, ignition or release of an explosive or explosive device, or an explosive device was damaged. If "Yes" is checked, provide the information specified in DA Pam 385–40, chapter 5, paragraph 5–3, in blocks 9, 39, 42, and the synopsis. Check the appropriate fields in block 39 if the explosive/ ammunition was exposed to significant environmental conditions and describe in block 40.
  - (8) Block 8.
- (a) Block 8a. Briefly describe the mission the individual or unit was conducting at the time of the accident. If off duty, state so.
  - (b) Block 8b. Was the task a Mission Essential Task List task? Check the appropriate box.
- (9) Block 9, Vehicle/Equipment/Materiel Involved. "Involved" means vehicle/equipment/materiel/property that is damaged, whose use or misuse contributed to the accident or whose materiel failure/malfunction caused and/or contributed to the accident. Include Army and non-Army equipment/materiel. Use one line for each piece of equipment or item and enter the requested information. Continue on blank paper if necessary (be sure to annotate the block number).
  - (a) Block 9a. Enter the name of the equipment/materiel involved.
  - (b) Block 9b. Enter the equipment model.
  - (c) Block 9c. Enter the equipment serial number (if applicable).
  - (d) Block 9d. Indicate who owns the vehicle/equipment/materiel (for example, DOD, DA, unit, person).
  - (e) Block 9e. Enter an estimate of the damage cost for the piece of equipment listed in Block 9a.
- (f) Block 9f. From the list below select the type(s) of collision in which this property/materiel was involved. More than one collision type might be appropriate for the property/materiel. If so, enter up to three, in sequence, in the space provided. If "Other" is selected, specify what type of collision in the space provided. If no collision was involved, leave blank.
  - 1. 1=Going forward and collided with moving vehicle
  - 2. 2=Going forward and collided with parked vehicle
  - 3. 3=Collision while backing
  - 4. 4=Collision with pedestrian
  - 5. 5=Collision with object (other than vehicle/pedestrian)
  - 6. 6=Overturned
  - 7. 7=Ran off road
  - 8. 8=Jackknifed
  - 9. 9=Going forward and rear-ended with moving vehicle
  - 10. 10=Going forward and rear-ended stopped vehicle
  - 11. 11=Collision while turning
  - 12. 12=Other (specify)

*Note.* If the item in block 9a experienced a materiel failure/malfunction that caused or contributed to the accident, complete blocks 9g-91 and block 10. If not, skip to block 11.

- (g) Block 9g 9l, Materiel malfunction/failure information. Enter the code that indicates how the component/part failed/malfunctioned (mode of failure). See appendix B for list and examples of failure codes. Complete items h through 1 for each component/part whose failure or malfunction contributed to the accident. Annotate whether an EIR/PQDR (SF 368) was prepared and submitted through appropriate channels for each component/part.
- (10) *Block 10.* Why Did the Materiel Fail/Malfunction (Root Cause)? Materiel failures/malfunctions can be caused by shortcomings of support. Specific causes may include:

- (a) Block 10a. Support shortcomings in type, capability, amount, or condition of equipment, supplies, services, or facilities (equipment/material not provided or improperly designed, inadequate or maintenance, or inadequate facilities/services). Determine the underlying reason (root cause (s) the material failed/malfunctioned and check accordingly (see app B).
- (b) Block 10b. Describe how the materiel failed/malfunctioned and explain why (for example, explain mode of failure from block 9f and root cause. Example: Block 9f=M05, and block 10a="Support equip/materiel improperly designed," enter why the improper design caused the materiel to fail or malfunction or malfunction by friction producing movement.
  - (11) Block 11.
- (a) Block 11a. Enter last name, first name, and middle initial of involved person. Include unit name, address, and UIC if it is different from block 5a.
- (b) Block 11b. For Army civilians, Army contractors, or members of the visiting public that are injured, enter their home address.
  - (12) Block 12. Enter the SSN of the individual listed in block 11.
  - (13) Personnel Classification.
- (a) Block 13a. Enter the code for the classification (at the time of the accident) of the person listed in block 11. See table 4–6.
- (b) Block 13b. Date assigned/hired. Enter the date the soldier was assigned or the Army civilian/contractor was hired.
  - (c) Block 13c. Indicate the date of redeployment, if applicable.
- (14) *Block 14, MOS/job series*. For Army personnel, enter the full MOS or job series of the individual, (for example, 63B10, GS-0018-14).
  - (15) Block 15. Duty status.
- (a) Block 15a. For DOD personnel, check the appropriate box to reflect the duty status at the time of the accident of the individual listed in block 11. (See glossary for definitions of on- and off-duty status). (This determination applies for safety accident reporting purposes only, and has no relation to compensability or line-of-duty decisions.)
- (b) Block 15b. If the Soldier was on leave or pass at the time of the accident, check the box and enter the inclusive leave/pass dates (for example, 20060705).
  - (16) Block 16. Enter the date of birth for the individual listed in block 11.
  - (17) Block 17. Enter the gender for the individual listed in block 11 ("M" for male or "F" for female).
- (18) *Block 18*. For DOD personnel, enter the rank/pay grade for the individual listed in block 11 (for example, E5, 03, GS-11, WG-08).
- (19) *Block 19*. Check the appropriate box (for government personnel only) to indicate the military flight status of the individual listed in block 11.
- (20) Block 20, Most Severe Injury/Occupational Illness. For the individual listed in block 11, complete blocks "a" through "d" for the most severe injury/occupational illness.
- (a) Block 20a, Degree. Enter the code that indicates the severity of the injury/occupational illness to the individual list in block 11 from the table below. If more than one applies, enter the most severe. Enter the date of death as indicated on the form. See glossary for definitions.
  - 1. a=Fatal.
  - 2. b=Permanent Total Disability.
  - 3. c=Permanent Partial Disability.
  - 4. d=Days Away From Work.
  - 5. e=Restricted Work Activity (Light duty, profile).
  - 6. f=Medical Treatment Beyond First Aid (Includes cases of loss of consciousness, needle stick/cuts from sharps).
  - 7. g=First Aid Only.
  - 8. h=No Injury/Occupational Illness.
- (b) Block 20b, Injury/illness type. Enter the one code below that best describes this person's most serious injury/occupational illness type.
  - 1. A Burns (chemical)
  - 2. B Burns (thermal)
  - 3. C Amputation
  - 4. D Decompression sickness
  - 5. E Asphyxiation (suffocation)
  - 6. F Fractures
  - 7. G Dislocation
  - 8. H Abrasions
  - 9. I Concussion

- 10. J Sprains/strain
- 11. K Cuts/lacerations
- 12. L Contusion
- 13. M Puncture wound
- 14. N Hernia, rupture
- 15. O Frostbite
- 16. P Heatstroke
- 17. Q Heat exhaustion
- 18. R Noise injury
- 19. S Needle stick or cuts from sharps
- 20. T Loss of consciousness
- 21. U Other (specify)
- (c) Block 20c, Body part. Enter the one code below that best describes the most seriously injured part of this person's body. Body part entered here should be the one with the injury indicated in previous block.
  - 1. A Body (General, cannot specify)
  - 2. B Head
  - 3. C Forehead
  - 4. D Eyes
  - 5. E Nose
  - 6. F Jaw
  - 7. G Neck
  - 8. H Trunk
  - 9. I Chest
  - 10. J Heart
  - 11. K Back
  - 12. L Shoulder
  - 13. M Arms
  - 14. N Wrist
  - 15. O Hand
  - 16. P Fingers
  - 17. Q Leg
  - 18. R Knee
  - 19. S Ankle
  - 20. T Foot
  - 21. U -Toes
  - 22. V Other
- (d) Block 20d, Cause. Enter the one code below that best describes the cause of the most serious injury/occupational illness to this individual.
  - 1. A Struck against
  - 2. B Struck by
  - 3. C Fell from elevation
  - 4. D Fell from same level
  - 5. E Caught in/under/between
  - 6. F Rubbed/abraded
  - 7. G Bodily reaction
  - 8. H Overexertion
  - 9. I Exposure
  - 10. J External contact
  - 11. K Ingested
  - 12. L Inhaled
  - 13. M Thrown from
  - (21) Block 21, Lost time.
- (a) Block 21a, Days hospitalized. Enter the actual or estimated total number of days this individual will be hospitalized (inpatient/admitted) receiving treatment. Days hospitalized for "observation only" are only included if they miss a day of work.
- (b) Block 21b, Day lost not hospitalized. Enter the estimated or actual number of days this individual will be away from work (totally unable to perform any work, on bed rest/quarters, convalescence leave, or time a physician indicated

that the individual could not work regardless of whether the individual was scheduled to work. Count all calendar days including weekends and holidays. For example, if the individual was injured on Friday and the individual could work on Monday, if the physician or licensed health care professional indicated they should not work over the weekend, enter 2 days. If there is no information from the physician, enter 0 days.

- (c) Block 21c, Days restricted. Enter the actual or estimated number of days the individual was unable to perform one or more routine job functions (regularly performed by the individual at least once per week), or could not work a full work day they would otherwise have been scheduled to work; or a physician or licensed health care professional recommends that the employee not perform one or more routine function of his/her job. Restricted work activities include light duty, profiles and job transfers.
  - (d) Block 21d, Treated in Emergency Room. Check if this individual was treated in an emergency room.
  - (22) Block 22.
- (a) Block 22a, OSHA log 300 case number. For injured personnel, enter the OSHA log 300 case number for the individual listed in block 12. OSHA log 300 case number is not required for Soldiers or off-duty civilians.
- (b) Block 22b,. Enter the name of the physician or other health care professional who treated the individual. Optional for military personnel.
  - (c) Block 22c,. If treatment was given away from the worksite, enter the name and address of the facility.
- (23) *Block 23, Activity.* Enter the individual's activity at the time of the accident from the list below. Enter the code that best describes this individual's activity at the time of the accident. Complete block 38 if the activity is parachuting (see DA Pam 385–40, Section II Terms and Section III Special Abbreviations and Terms and glossary for explanation of activities.)
  - (a) A Soldiering
  - (b) B Combat soldiering
  - (c) C Physical training
  - (d) D Weapons firing/handling
  - (e) E Engineering or construction
  - (f) F Communication
  - (g) G Security/law enforcement
  - (h) H Firefighting
  - (i) I Patient care (people/animals)
  - (j) J Test/study/experiments
  - (k) K Educational
  - (1) L Information and art
  - (m) M Food and drug inspection
  - (n) N Laundry/dry cleaning services
  - (o) O Pest/plant control
  - (p) P Operating vehicle/vessel
  - (q) Q Handling animal
  - (r) R Maintenance/repair/servicing
  - (s) S Fabricating
  - (t) T Handling material/passengers
  - (u) U Janitorial/housekeeping/grounds keeping
  - (v) V Food/drink preparations
  - (w) W Supervisory
  - (x) X Office
  - (y) Y Counseling/advisory
  - (z) Z Sports
  - (aa) AA Hobbies
  - (ab) BB Passenger
  - (ac) CC Human movement
  - (ad) DD Horseplay
  - (ae) EE Bystanding/spectating
  - (af) FF Personal hygiene/eating/sleeping
  - (ag) GG Parachuting
- (24) *Block 24*. Briefly describe this individual's activity at the time of the accident. For example, the Soldier was a right rear passenger in the vehicle at the time of the accident; the individual was performing maintenance on a split rim tire in the maintenance shop.
- (25) Block 25, Personal Protective Equipment. Determine what PPE was required for the activity/task being performed. If PPE was required, determine if it was available and used, available but not used, or not available. Check

the appropriate blocks for each item of PPE to indicate availability and use/non-use. If no PPE was required, check the NA (not applicable) column for each type of PPE. For privately owned motorcycle accidents, indicate whether the helmet was Department of Transportation approved.

Note. Restraint systems are those systems such as the Gunner's Restraint System in military vehicles.

- (26) *Block* 26. Check the appropriate box to indicate whether or not this individual's use of alcohol or drugs (include prescription, over the counter, supplements or illegal drugs) caused or contributed to the accident. If "Yes" is checked, explain in block 40.
- (27) Block 27. Equipment this Person was Associated With. Enter the item number (for example, #1, #2) from block 9 that indicates which piece of equipment this individual was associated with.
  - (28) Block 28. Licensed to Operate Equipment.
- (a) Block 28a. If this individual was operating a vehicle or equipment (at the time of the accident) that required a license, complete the following information. Check the appropriate block. If no, skip to block 29.
- (b) Block 28b. Check "Yes" if the individual has attended the mandatory 4 hours of classroom instruction in traffic safety and indicate the date of the training. Otherwise, check "No."
- (c) Block 28c. If the individual was operating a motorcycle in this accident, check yes if the individual is motorcycle safety foundation certified and enter the date. Otherwise, check "No."
  - (29) Block 29, Duty Hours.
  - (a) Block 29a. Enter the time the Soldier or employee began work.
  - (b) Block 29b. State how many continuous hours this individual was on duty without sleep before the accident.
- (30) Block 30, Hours Sleep. Enter the number of hours of sleep (cumulative) this individual had in the past 24 hours.
- (31) Block 31, Tactical Training. Indicate whether the activity listed in blocks 23 and 24 was part of tactical training. Field exercise and tactical training begin when the individual reports to his or her primary duty location for movement to the field site and ends when he or she arrives back at the primary duty location from the field.
- (32) *Block 32, Type Training Facility.* If the individual was participating in any type of training, enter the code for the type of training facility being used (see FM 7–1 for definitions). Code/Facility is listed as follows:
  - (a) A=Garrison
  - (b) B=Local training area
  - (c) C=Major training area
  - (d) D=NTC
  - (e) E=JRTC
  - (f) F=CMTC
  - (g) G=Standard range facility/live fire
  - (h) H=Other (specify)
- (33) *Block 33, Last Training*. For the activity specified in blocks 23 and 24, enter the number of months since the last time the individual received training prior to the accident.
- (34) *Block 34, Named exercise.* Check "Yes" if activity listed in blocks 23 and 24 was part of a field exercise or a named operation. Indicate the name of the exercise or operation (major and local field training exercise) if it has a name (for example, Team Spirit, Gallant Eagle). Check "No" if activity was not part of a field exercise or named operation.
- (35) *Block 35, Night Vision System.* Indicate if night vision devices were being used by this individual at the time of the accident, (for example, NVG, AN/PVS-14). If used, specify the type. If they caused or contributed to the accident, explain in Block 40.
- (36) *Block 36.* Individual Mistake(s) that Caused/Contributed to the Accident or Severity of Injury or Occupational Illness/Damage.
- (a) Block 36a. In your opinion, did this individual make a mistake(s) that caused and/or contributed to the accident? If the answer is "YES", complete Blocks 36b and 36c, and Block 37. If "NO", skip to Block 39.
- (b) Block 36b. Enter the code from appendix B, table B-2, which best indicates the type of mistake made by this individual.
- (c) Block 36c. Describe the mistake and how it caused/contributed to the accident. Be specific, (for example, block 36a="Yes"; block 36b="47" (failed to use a ground guide when required); block 36c="The Mine-Resistant Ambush Protected (MRAP) driver failed to use a ground guide when required. That is, the driver attempted to drive through an Entry Control Point (ECP) which required ground guides. Consequently, he struck a barrier causing extensive damage to the right side of the vehicle."
- (37) Block 37. Why the mistake(s) was made (system inadequacies/root causes). Mistakes can be caused by shortcomings of support, standards/procedures, training, leaders, or the individual. There can be more than one root cause selected. Specific causes include-Support-Shortcomings in type, capability, amount, or condition of equipment, supplies, services, facilities, and number and type personnel. Standards/procedures not clear or not practical or do not

exist. Training-School training, Unit training, or Experienced/OJT insufficient in content/amount. Leader-Direct, Unit Command, or Higher Command Supervision not ready, willing, or able to enforce known standards. Individual-Soldier knows and is trained to standard but elects not to follow standard (self-discipline-mistake due to own personal factors).

- (a) Block 37a. Identify why the mistake was made (specific root cause(s)). See appendix B, Table B-5 for definitions. Enter the mistake number in the box next to the associated root cause. Multiple boxes can be checked.
- (b) Block 37b. Describe the root cause(s) and tell how it/they caused the mistake. See appendix B for explanations. For example, if block 37a "Individual-Overconfident, Leader-Direct Supervision" then block 37b might say something like, "The driver was overconfident in his ability to operate the MRAP without a ground guide and the Vehicle Commander (VC) did not properly supervise the driver by allowing him to enter an entry control point (ECP) without a ground guide. This was in contravention of the BN SOP."
- (38) *Block 38, Parachuting information.* If the activity for the individual listed in block 11 is parachuting, complete blocks 38a thru 38q.
- (39) Block 39, Environmental conditions. Enter the code(s) (no more than three from the list below) to indicate the conditions present at the time of the accident. Also indicate if the condition caused or contributed to the accident by checking the Caused/Contributed block and, if "YES", explain in Block 40 (see app B). Code/Condition is listed follows:
  - (a) A=Clear/dry
  - (b) B=Bright/glare
  - (c) C=Dark/dim
  - (d) D=Fog/condensation/frost
  - (e) E=Mist/rain/sleet/hail
  - (f) F=Snow/ice
  - (g) G=Dust/fumes/gasses/smoke/vapors
  - (h) H=Noise/bang/static
  - (i) I=Temperature/humidity (cold/heat)
  - (j) J=Storm/hurricane/tornado
  - (k) K=Wind/gust/turbulence
  - (1) L=Vibrate/shimmy/sway/shake
  - (m) M=Radiation/laser/sunlight
  - (n) N=Holes/rocky/rough/rutted/uneven
  - (o) O=Inclined/steep
  - (p) P=Slippery (not due to precipitation)
  - (q) Q=Air pressure (bends, decompression, altitude, hypoxia)
  - (r) R=Lightning/static electricity/grounding
  - (s) S=Electromagnetic radiation (EMR)
  - (t) T=OTHER (specify)
- (40) *Block 40, Synopsis*. Provide a brief synopsis of the accident explaining what and how the accident happened. If need be, continue on a separate sheet of paper annotating the block number and attach it to the report. The synopsis should include the events leading up to the accident, the actual accident sequence, and the post-accident scene and actions. For example, if a Soldier was involved in an off-duty POV accident, be sure to indicate where the Soldier was going, where he/she was coming from, and so forth. Also include the following information for off-duty accidents:
  - (a) Indicate whether the Soldier was on leave, pass, permanent change of station, or temporary duty (TDY)?
  - 1. How long was the Soldier on leave/pass when the accident occurred?
  - 2. Did the accident occur while the Soldier was en route to/from his/her destination?
  - (b) Was the Soldier deployed within the 365 days prior to the accident (yes/no)? If yes:
  - 1. When did the Soldier return from the deployment?
  - 2. Where was the deployment?
  - 3. How long was the deployment?
  - (c) Was the Soldier recently notified that he/she would deploy soon?
  - (d) Was there leader contact prior to the accident (yes/no)? If yes,
  - 1. What level of leadership?
  - 2. What type of contact (brief, TRiPS, trip planning, counseling, vehicle inspection, other)?
- (41) *Block 41, Corrective action(s) taken or planned.* Briefly describe all actions taken, planned, or recommended to eliminate, or at least reduce, the root cause(s) of this accident and prevent similar accidents from happening (see app B)
- (42) Block 42, Explosive/Ammunition. If block 7 was checked "Yes," enter the lot numbers, quantity, and the NEW of all ammunition and explosives involved. Also, include the model number and DODAC or DODIC.

Note. If the explosive/ammunition was exposed to significant environmental conditions, the environmental conditions should be

checked in block 39, and an explanation of the conditions and their effect on the explosive/ammunition should be provided in the synopsis. Significant environmental conditions include the following: extremely high/low temperatures; electromagnetic environmental effects; for example, radiated energy (such as being in close proximity to a radar site), electromagnetic energy, electrostatic energy or high voltage; water or high humidity; or prolonged exposure to direct sunlight.

- (43) Block 43, Point of Contact.
- (a) Block 43a. Enter the name, rank, and position of the individual from the unit/organization who can answer questions about this accident report.
  - (b) Block 43b. Enter the phone number for the individual listed in 43a.
  - (c) Block 43c. Enter the e-mail address for the individual listed in block 43a.
  - (44) Block 44, Command Review. As locally required.
  - (45) Block 45, Safety office review.
  - (a) Enter the name, rank and title of the safety office reviewing official.
  - (b) Enter the DSN and commercial phone number of the safety office reviewing official
  - (c) Enter the e-mail address of the individual listed in 45a.
  - (d) Enter the date the report was reviewed.
  - (e) Enter the local report number (safety office use only).

Army branches	
Army branch	Abbreviation
Adjutant General	AG
Air Defense Artillery	AD
Armor	AR
Army Medical Specialist Corps	SP
Army Nurse Corps	AN
Aviation	AV
Chaplain	СН
Chemical	СМ
Dental Corps	DC
Engineers	EN
Field Artillery	FA
Finance Corps	FC
Infantry	IN
Judge Advocate General's Corps	JA
Medical Corps	MC
Medical Service Corps	MS
Military Intelligence	MI
Military Police	MP
Ordnance	OD
Public Affairs	PA
Quartermaster Corps	QM
Signal Corps	sc
Space Command	SP
Special Forces	SF
Transportation Corps	тс
Veterinary Corps VC	VC

Table 4–4 Types of accident locations	
Code	Type Location
	Maintenance/Fabrication Facility
A1	Vehicle facility (motor pool, maintenance shop)
A2	Aircraft facility (hangar)
A3	Vessel facility (boat overhaul/rebuild facility)
A4	Engineer facility (carpentry/electrical/plumbing shop)
A5	Other maintenance facility
	Travel Ways
B1	Pedestrian way (sidewalk)
B2	Vehicle trail (tank trail)
B3	Roadway (street, curb, shoulder, driveway)
B4	Parking lot
B5	Aircraft way (flight line, runway)
B6	Railroad
	Other operational facilities/areas
C1	Office building
C2	Communications facility
C3	Construction site
C4	Security/law-enforcement facility
C5	Bridge
C6	Dam
C7	Navigation locks
C8	Barge
C9	Dredge
C10	Floating plant
C11	Vessel (not elsewhere coded)
C12	ARNG/Reserve armory)
	Training areas
D1	Range—small arms/individual weapons
D2	Range—crew-served weapons
D3	Range-aerial firing/bombing
D4	Range-infiltration course
D5	Designated nonfiring training area (obstacle/confidence course, parachute drop zone, landing zone, stagefield)
D6	Temporary training area (unit assembly area, bivouac area)
D7	Range-EOD
D8	Range tirehouse
D9	Urban training
	Services facilities
E1	Library
E2	Chapel/church
E3	Child-care center
E4	Post office
	•

Table 4–4 Types of accident locations—Continued	
E5	Laboratory
E6	Medical care facility
E7	Fire station
E8	Commissary
E9	Post exchange
E10	Dining facilities
E11	Service station, gas station, and shopette
E12	Museum
E13	Animal-care facility
E14	Refuse disposal area
E15	Laundry/cleaning facility
Terrain and w	vater locations
F1	Sloped terrain (ditch, mountain)
F2	Wooded terrain (forest, swamp, marsh)
F3	Open terrain (field, desert)
F4	Moving bodies of water (creek, stream, river)
F5	Standing bodies of water (pond, lake, ocean)
F6	Lake shore/beach
Storage	facilities
G1	Storage buildings (ammunition bunker, warehouse, barn, storage shed)
G2	Outside storage area (POL dump, property disposal area)
Plants and	d factories
H1	Heating plant
H2	Printing plant
H3	Electric generating plant (includes power substations)
H4	Ammunition/weapons manufacturing plant
H5	Other industrial plants and factories
Recreation/enter	tainment facilities
<u>I1</u>	Indoor facilities (bowling alley, gym, movie theater, swimming pool)
12	Outdoor facilities (playing fields, golf course, swimming pool)
Housing	facilities
<u>J1</u>	Family housing
J2	Individual housing (BOQ, barracks, rooms)
Freight and pass	senger terminals
<u>K1</u>	Airport/airfield (includes control tower)
K2	Rail station/yard
К3	Port/dock/wharf
K4	Vehicle terminal (bus station, truck terminal)
School	facilities
L1	Kindergarten through grade 12
L2	Army-operated technical/occupational training facilities/classrooms (university/college classes)

Table 4–4 Types of accident locations—Continued				
L3	Non-Army-operated technical/occupational training facilities/orooms (university/college classes)	class-		
	Hobby shop			
M1	Auto hobby shop			
M2	Woodworking hobby shop			
M3	Other hobby shop			

Table 4–5 Pay Grade/Rank codes	
Grade/code	Description
01–010	Commissioned officer
W1-W5	Warrant officer
E1-E9	Enlisted service member
GS1-GS18 & GM13-GM18	DOD civilian employee
WG1-WG18 & WS13-WS18	Wage board employee
NSPS	National Security Personnel System
XN	Foreign National
X-1	Foreign officer
X-2	Foreign enlisted
CAC	Civilian Army contractor
CIV	Non-DOD civilian
DAC	Department Army civilian
KAD	USMA
ROTC	ROTC students
NRPT	Not Reported
ос	WOC/OC
UNK	Unknown
UNKE	Unknown enlisted
UNKO	Unknown officer
ОТН	Personnel other than above

Table 4–6 Personnel classification codes				
Code	Description			
A	Active Army			
В	Army civilian			
С	Army contractor			
C1	Army direct contractor			
D	Non-appropriated Fund employee			
E0	Other U.S. military personnel			
E1	Navy			
E2	Air Force			
E3	Marine Corps			

Table 4–6 Personnel classification codes—Cor	ntinued
Code	Description
F0	Foreign Military
F1	Foreign National Direct Hire
F2	Foreign National Indirect Hire
F3	Foreign National KATUSA
F4	Foreign Military Attached
G	Dependent
M	Government, Other
NO	National Guard
N1	NG Tech
N2	NG IDT
N3	NG AT
N4	NG ADSW
N5	NG AGR
N6	NG ADT
N7	NG Activated
0	Other
P	Public
RO	Reserve
R1	Reserve IDT
R2	Reserve AT
R3	Reserve ADT
R4	Reserve FTM
R5	Reserve Tech
R6	Reserve Activated
R7	Reserve AGR
Т	ROTC
U	Unknown
Z	Not reported

# **Chapter 5 Special Notification and Reporting Requirements**

# 5-1. Marine accidents

a. Overview. Marine accidents (may also be known as watercraft accidents) involve a collision, grounding, sinking, fire, or explosion as a result of the operation of any Army watercraft. They also involve military diving (which does not include recreational diving) and hyperbaric exposure accidents, or swimming operations resulting in injury or illness to persons or damage to watercraft, cargo, or other property. Marine accidents will be reported as Class A through Class D accidents and shown as marine underway, marine not underway or marine diving, as appropriate, on DA Form 285 (block 72).

- (1) Marine accidents include—
- (a) Accidents occurring while loading, off-loading, or receiving services at dockside.
- (b) Damage to Army property handled as an on-board commodity.
- (c) Accidents occurring during amphibious or on-shore warfare training operation.
- (d) Damage and all injuries to Army personnel occurring onboard.
- (2) Marine accidents do not include accidents that are reportable under other major categories prescribed in this pamphlet. For example, aircraft, missile, or chemical agent accidents.

- (3) This chapter covers watercraft under the jurisdiction of DA that is—
- (a) Used in logistics-over-the-shore operations; coastal, harbor, and inland waterways; and ocean operations.
- (b) Identified in AR 56-9, table 1-1.
- (c) Operated and exclusively controlled or directed by the Army. This includes watercraft furnished by a contractor or another government agency when operated by Army watercraft personnel.
- (d) Lent or leased to non-Army organizations for modification, maintenance, repair, test, contractor training, research, or development projects for the Army.
  - (e) Under test by Army agencies responsible for research, development, and test of equipment.
- (f) Under operational control of an Army contractor. Accidents involving Army equipment lent or leased by the Army to a non-Army organization for maintenance, repair, test, contract training, or experimental projects will not be charged to the Army if the non-Army organization that has operational control of the equipment has assumed the risk of loss.
- (g) Contractor-owned and operated watercraft where contractor accident reporting to the Army is contractually required.
- (4) This chapter does not negate the Master's responsibility to report any applicable marine accident, injury, or death involving commercial or government-owned watercraft or property to the U.S. Coast Guard.
- b. Notification requirements. In addition to the notification required by AR 385-10, marine accidents will be reported as follows:
- (1) Marine underway/Marine not underway. Any grounding that creates a hazard to navigation, the environment, or watercraft safety, or any occurrence affecting the watercraft's seaworthiness or fitness for service, including but not limited to, fire, flooding, or damage to fixed fire extinguisher systems, life saving equipment, or bilge pumping systems will be telephonically reported to the U.S. Army Combat Readiness Center (CSSC–O), Fort Rucker, AL 36362–5363, DSN 558–2660, COM (334) 255–2660, within 24 hours.
- (2) Marine diving. Marine diving accidents classified as Type II Decompression Sickness or Pulmonary Over inflation Syndromes will be telephonically reported to the U.S. Army Combat Readiness Center (CSSC-O), Fort Rucker, AL 36362–5363, DSN 558–2660, COM (334) 255–2660, within 24 hours. All other marine accidents will be reported to the Marine Safety/Diving Safety Office as soon as possible.
- (3) Army Special Operations Forces diving. Army Special Operations Forces (ARSOF) diving accidents classified as Type II Decompression Sickness or Pulmonary Over inflation Syndromes (as defined in U.S. Navy Dive Manual, Volume I) will be telephonically reported to the Commander, U.S. Naval Safety Center, Norfolk, VA, DSN 564–3520, ext. 7837/7086, COM (757) 444–3520, ext. 7837/7086 within 24 hours of the occurrence.
  - (a) All other diving accidents will be reported to the Naval Safety Center and the USACRC, as soon as possible.
- (b) Dives resulting in a mishap requiring recompression treatment or resulting in the diver being away from work for 24 hours or longer will be reported by message, per OPNAVINST, 5102–1D, to Commander, U.S. Naval Safety Center, Norfolk, VA. The Commander, USASOC//AOOS// will be an info addressee on the message. This message is required in addition to telephonic notification.
- (c) A DA Form 285 will be completed for the incident and forwarded through appropriate command channels to USACRC. The following additional information is required:
  - 1. Operation at time of accident (brief scenario).
  - 2. Environmental/meteorological conditions at time of accident to include—
  - a. Water temperature at surface.
  - b. Water temperature at depth.
  - c. Sea state.
  - d. Visibility at depth.
  - e. Visibility at surface.
  - f. Outside air temperature.
  - g. Wind speed and direction.
  - h. Tide, wave, and current data.
  - i. Type of dive platform.
  - 3. Diving system utilized (surface supplied, open circuit, closed circuit scuba, or hyperbaric facility).
  - 4. Maximum depth of dive in feet of sea water (FSW).
  - 5. Total bottom time.
  - 6. Total time of dive.
  - 7. Onset of symptoms (month/day/hour/minute, depth).
  - 8. Whether the accident victim is a current and qualified diver per AR 611-75.
  - 9. Type of symptoms (neurological, serious symptoms, pain only, and/or mechanical).
  - 10. Recompression started (month/day/hour/minute).
  - 11. Treatment table used.

- 12. Treatment outcome (complete relief, partial relief, no relief, fatal).
- 13. Prognosis and diagnosis.
- (4) Marine diving accidents. In addition to the information required by the DA Forms 285/285–AB, the following will be included on the DA Forms 285/285–AB when reporting marine diving accidents to the Diving Safety Office:
  - (a) Operation at time of accident (brief scenario of diving operation).
  - (b) Diving system utilized (surface supplied, open circuit scuba, closed circuit scuba, or hyperbaric facility).
  - (c) Maximum depth of dive in FSW.
  - (d) Total bottom time of exposure.
  - (e) Onset of symptoms (month/day/hour/minute, depth).
  - (f) Type of symptoms (embolism, serious symptom, pain only, and/or mechanical).
  - (g) Recompression started (month/day/hour/minute, depth).
  - (h) Treatment table used.
  - (i) Diagnosis or treatment outcome (complete relief, partial relief, no relief, fatal).
  - c. Recordkeeping.
- (1) The Master/Coxswain, or person in charge of any watercraft involved in an accident, shall retain voyage records which are normally maintained by the watercraft.
  - (2) Voyage records include, but are not limited to-
  - (a) Logs.
  - (b) Bell books.
  - (c) Navigation charts and workbooks.
  - (d) Compass deviation cards.
  - (e) Gyro records.
  - (f) Stowage plans.
  - (g) Records of draft.
  - (h) Aids to mariners.
  - (i) Night order books.
  - (j) Radiograms sent and received.
  - (k) Radio logs.
  - (1) Crew and passenger lists.
  - (m) Articles of shipment.
  - (n) Other material which might be of assistance in investigating and determining the cause of the accident.
- (o) The Master/Coxswain or person responsible for the records' custody shall make these records available upon request to the authorized safety investigator(s).
- (3) The following records pertinent to the dive or hyperbaric exposure will be retained for possible use during the investigation:
- (a) Completed operation and emergency procedures which document the status of all equipment and systems relevant to the dive and/or hyperbaric exposure.
  - (b) Diving log worksheet.
  - (c) Recompression chamber treatment log.
  - (d) Diver's Medical Records for the past 5 years (if available).
- (e) DD Form 314, Preventive Maintenance Schedule and Record, (or the ULLs-generated equivalent) for the equipment being used.
- d. Marine accident report. For watercraft accidents, the following additional information will be included on the DA Form 285/285-AB, or as an enclosure to those forms:
  - (1) Description of the circumstances, including the following when applicable:
  - (a) Time and place of commencement of voyage and destination.
  - (b) Current (direction and force).
  - (c) Wind (direction and force).
  - (d) Visibility in yards at time of accident.
  - (e) Tide and sea conditions.
  - (f) Name of person in charge of navigation and persons on the bridge at time of accident.
  - (g) Name and rank of lookout and where stationed on Army watercraft.
  - (h) Time when bridge personnel and lookouts were posted for duty.
  - (i) Course and speed of watercraft at time of accident.
  - (j) Number of passengers, troops, and crew on board Army watercraft.
  - (k) Copies of all pertinent log entries.
  - (1) List of the names and addresses of the witnesses who saw the accident.

- (m) When steering gear and controls of Army watercraft were last tested.
- (n) When and where compasses of Army watercraft were last adjusted and deviation, if any, at time of accident.
- (o) Statement of any outside assistance received.
- (p) Any further details not covered above.
- (2) Diagrams, log extracts, and any pertinent documents or exhibits will be submitted with the accident report.
- (3) If a pier, wharf, bridge, or other stationary structure is involved, submit a diagram showing the watercraft's heading, the direction of tidal current and wind, longitudinal axis of the structure, and the berthing location if the watercraft is docking, undocking, or is coming alongside a vessel at anchor.
- e. Marine accident investigation. In addition to the normal procedures required for investigating Army accidents, diving accidents require the following:
  - (1) All diving or hyperbaric exposure accidents classified as Type II and Gas Embolism will be investigated.
  - (2) All other marine diving accidents may be investigated upon determination of possible safety violations.

# 5-2. Chemical agent mishaps

- a. Chemical agent mishaps will be investigated and reported per DA Pam 385-61.
- b. Chemical agent mishaps that also meet the definition of Chemical Events will be reported per AR 50–6. A Chemical Event encompasses chemical surety material accidents, incidents, and other circumstances as defined in AR 50–6.
- c. Chemical agent mishaps that meet the criteria for Class A or B Army accidents or involve off-post contamination (that is, the predicted or actual chemical agent No-Effects dosage distance extends beyond the post/installation boundary) will be investigated by a centralized accident investigation (CAI) limited use accident investigation board appointed by the DASAF. The board will consist of at least four members, two of whom are familiar with the effects of chemical agents. The board must also include members who are experienced in accident investigation techniques.

A. Heading	1.	For chemical accidents. Enter "This is a chemical accident report (RCS DD-FM&P (AR) 1020."
	2.	For chemical incidents. Enter "This is a chemical incident report (RCS CSOCS-311)."
B. Body	1.	Date and time of event.
	2.	Location.
	3.	Quantity and type of weapon(s) or container(s) and chemical agent(s
	4.	Description of property damage and personnel casualties.
	5.	Type of carrier (if one is involved).
	6.	Type of operation. For example, laboratory analysis, surveillance testing, logistical movement, storage inspection, alert, maintenance and renovation, or demilitarization.
	7.	Description of event.
A. Heading	1.	For chemical accidents. Enter "This is a chemical accident report (RCS DD-FM&P (AR) 1020."
	8.	Whether a weapon or container burned, detonated (to what degree), or was exposed to fire.
	9.	Details of any existing chemical weapon or container.
	10.	Condition of chemical weapon or container.
	11.	Whether news release was given to the media. If so, attach copies.
	12.	Measures taken to ensure safety and security.
	13.	Any other pertinent information, including cause factors if know, and any possible political implications.
	14.	Statement of corrective actions recommended, if appropriate.
	15.	Assistance required. For example, Augmentation Reserve Force, Explosive Ordnance Disposal.
C. Distribution	1.	DA WASH DC//DACS-SF/DAMO-NCC/DASG-PSP/DAIG-TI/DALO-ZD//.
	2.	CDRAMC ALEX VA//AMCSF-C/AMCCB//.
	3.	CDRUSANCA FT BELVOIR VA//MONA-SU/MONA-MS//.
	4.	CDR USACRC FT RUCKER AL//CSSC-I-D//.
	5.	DIRUSADACS SAVANNA IL//SMCAC-ES// (WHEN EXPLOSIVES ARE INVOLVED).

Table 5-1 Chemical Accide	Table 5–1 Chemical Accident and Incidents Report-Guidance and Distribution Format—Continued			
	6.	Other appropriate Army Headquarters.		

# 5-3. Explosives accidents

- a. Overview. Explosives are defined as all items of ammunition; propellants (solid and liquid); pyrotechnics; warheads; or explosive devices designed for use in demolitions or war. The term includes any device or assembly of devices that contain an explosive material. Examples are bombs, guided or unguided; water and land mines; depth charges; non-nuclear warheads; explosive-loaded projectiles; explosive components of aircrew escape systems; missile propellants; guided or unguided missiles; and pyrotechnic, illuminating, and signaling devices.
- (1) For reporting purposes, explosive accidents include- Unintentional damage or injury as a result of a planned or unplanned functioning of explosive devices or materials.
  - (a) Accidents occurring during the explosives or pyrotechnics manufacturing process.
  - (b) Off-range impacts of projectiles, bombs, missiles, or their fragments/components, during range operations.
- (c) Accidents involving dummy or inert materials, when used to simulate a real explosive item in training or testing situation.
  - (d) Accidents involving Engineer demolition explosives.
  - (e) Accidents involving EOD operations.
  - (f) The inadvertent actuation, jettisoning, release, or launching of explosive devices.
- (g) Explosives accidents include the accidental discharge of small arms weapons and hunting or recreational shooting accidents.
- (2) Commanders will report and investigate all explosive accidents. The USACRC will provide a CAI for selected Class A and Class B explosives accidents. Army Headquarters will form an installation accident investigation (IAI) board for all Class A and B explosive accidents not investigated by the USACRC.
- (3) Accidents involving Army explosives consigned to commercial carriers will be handled as outlined in AR 385-10 and AR 75-15.
  - b. Notification procedures (RCS DD-FM&P (AR) 1020).
- (1) Accidents will be reported per AR 385-10, chapter 3. The type of investigation planned (CAI, IAI, DA Investigation Team for Malfunctions (DAITM)), must also be provided for all explosives accidents.
- (2) In addition to normal accident reporting requirements, certain explosive accidents require an immediate telephonic report by the responsible Army Headquarters to the Army Operations Center (AOC) DSN 227–0218 or (COM (703) 697–0218) and the USACRC (DSN 558–2660/3410 or COM (334) 255–2660/3410). These accidents are—
- (a) Explosive accidents resulting in the loss of a major weapons system. These accidents may or may not be Class A or B accidents.
  - (b) An explosive accident resulting in a production loss of 72 hours or more.
  - (c) An explosive accident involving probable public interest or network media coverage.
- (3) Explosives accidents described in paragraph 5-3b, above will be reported on DA Form 285 or DA Form 285–AB. The DA Forms 285/285–AB will be submitted per AR 385-10, chapter 3. These forms should include all the basic data and the additional data described in paragraph 5-3d.
  - c. Explosives accident investigation.
- (1) Commanders are required to investigate all explosives accidents. When USACRC receives telephonic reports of Class A or B explosives accidents, they will notify U.S. Army Technical Center for Explosives Safety (USATCES) of the accident telephonically. If the USACRC Commander determines a CAI team will respond to the accident, USATCES will be notified of the requirement to provide technical assistance to the investigating team.
- (2) A decision by USACRC not to investigate an explosive accident does not eliminate the requirement to initiate a local or Army Headquarters level accident investigation. Technical support for Army Headquarters and local investigations may be requested from supporting Quality Assurance Specialist, Ammunition Surveillance (QASAS) personnel, or USATCES, DSN 956–8919 or COM (918) 420–8919. Technical expertise in explosives or explosives-related accident investigations is also available at U.S. Army Field Support Command, Safety/Rad Waste Directorate (DSN 793–2989/2971/2113) or COM (309) 782–2989/2971/2113).
- (3) Explosive accidents may involve ammunition malfunctions, which are investigated per AR 75–1. When an ammunition malfunction is suspected, the CAI/IAI will conduct the primary comprehensive investigation for DA/Army Headquarters and the DAITM will conduct its investigation as part of the CAI/IAI team.
- (a) Subject to the exercise of CID jurisdiction, the CAI/IAI board president shall exercise control over the coordination and investigative actions of all elements and/or technical teams supporting the board.
- (b) The CAI/IAI board president shall control access to the accident site and shall be responsible for releasing the site after all legitimate investigative actions are complete.
  - d. Explosives accident report. The supplementary technical data indicated below (as applicable) will be included in

the appropriate blocks of DA Form 285 or DA Form 285–AB, per the form's instructions. Required data that is not entered on the DA Form 285 or DA Form 285–AB will be included as attachments. If a malfunction investigation was conducted as part of the investigation, much of this information should be available in the ammunition malfunction reports, prepared by the DAITM or local QASAS. If an ammunition malfunction investigation was not conducted, questions and assistance concerning the collection of this data may be obtained from local QASAS personnel or by calling USATCES (request for technical support): DSN 956–8919, COM (918) 420–8919 or FAX DSN 956–8503, COM (918) 420–8503. All data must be addressed. If not applicable, so state—

- (1) Type of operation or transportation mode engaged in at the time of the accident (include reference to applicable SOP or regulatory document).
- (2) The following information, if not previously reported: quantity, type, lot number, configuration, and packaging of explosives involved in the accident.
  - (3) The following type of reaction or reactions:
  - (a) Single reaction such as detonation, deflagration, fire, release, or activation.
- (b) Multiple reactions such as detonation and fire. Ensure communications of reactions, such as detonations caused by fire, fire caused by detonation, detonation propagates to detonation, detonation to deflagration, and the time sequences between such events, is included.
  - (4) Possible or known causes.
- (5) Aerial and ground photographs, color whenever possible, of the accident be taken as soon as possible after the accident.
  - (6) Maps, charts, and overlays of the accident area showing or listing the following data:
  - (a) Location of personnel killed or injured with respect to the accident origin.
  - (b) Area containing property with complete destruction (more than 75 percent).
  - (c) Area containing property damage beyond economical repair (50 percent to 75 percent).
  - (d) Area containing repairable property (1 percent to 49 percent).
- (e) Radii of uniform or irregular glass breakage. When possible, include type and dimensions of glass broken at the farthest point.
  - (f) Locations and dimensions of craters.
- (g) Distances from the accident origin at which direct propagation occurred, and whether from blast, fragments, firebrands, or fire.
  - (h) Approximate number, size, and location of hazardous fragments and debris.
  - (7) Describe any influence of the following factors on the accident:
- (a) Environmental and meteorological, such as cloud cover, wind direction and velocity, temperatures, relative humidity, EMR, and electrostatic conditions.
  - (b) Topographical features such as hills, forests, lakes.
- (c) Structural features at the accident origin such as exterior and interior walls, substantial dividing walls, bulkheads, roofs, and overheads, doors and windows, cells or magazines, earth cover, barricades.
- (d) Safety features other than structural at the accident origin such as remote controls, sprinkler systems, deluge systems, detectors, alarms, blast traps, suppressive shielding, PPE.
- (e) Position, orientation, and type of construction of all structures, damaged or not, located within the maximum radius of damage. When the applicable intermagazine distance, intra-line distance, or inhabited building distances are greater than the radius of actual damage, show the location, orientation, and type construction of all structures situated within quantity distance (QD) radii.
- (f) Vessels, vehicles, and mobile equipment locations within maximum radius of damage. If QD requirements are greater than the actual area of damage, indicate the actual distance and damage sustained to all equipment located within all the QD arcs.
- (g) Personnel locations within maximum radius of damage. If QD requirements are greater than the actual area of injury, indicate the actual distance to all personnel located within all the QD arcs and extent of injuries received.
- (h) Explosives and chemical agent location, type of configuration, amounts, and protection provided within maximum radius of damage, or if QD requirements are greater, the location within the applicable magazine and intra-line arcs.
- (i) Identify buildings, exposures, and other locations that are under special consideration or waiver. The completed waiver package will be submitted as an appendix to the report. Describe interim safety measures that prevented injury or damage.
- (8) The report will include an analysis of the accident sequence, the conclusions reached from the investigation, and recommendations to prevent occurrence.

# 5-4. Ionizing and nonionizing radiation accidents

- a. Overview.
- (1) Command responsibilities. Commanders, Nuclear Regulatory Commission (NRC) Army license holders, Army

Radiation Authorization (ARA) holders, Radiation Safety Officers (RSOs), Laser Safety Officers (LSOs), and Radiofrequency Safety Officers (RFSOs), establish procedures to ensure notification, investigation, and reporting of ionizing and nonionizing radiation accidents are accomplished as per DODI 6055.08, DODI 6055.11, DODI 6055.15, AR 385–10, DA Pam 385–24, DA Pam 385–25, and this pamphlet. Army NRC licenses and ARAs may have specific reporting conditions in addition or in lieu of this guidance. These conditions and federal guidance must be completed to ensure the Army NRC licensee or ARA holder is in compliance. NRC license conditions may be more restrictive than federal regulations and should be followed. DA Pam 385–24 contains specific instructions and contact information for reporting accidents involving radioactive materials to the applicable licensee.

- (2) Classifying radiation accidents. Accidents will be classified in accordance with AR 385–10, chapter 3 for purposes of determination of DA requirements, to include criteria for entry into the DA accident data base.
  - b. Ionizing radiation accidents.
- (1) Basis of reporting requirements. Ionizing radiation accident reporting will be accomplished per NRC requirements as stated in Title 10 CFR, primarily in 10 CFR Part 20 (Standards for Protection Against Radiation), Part 30.50 (reporting requirements), Title 21 CFR (US Food and Drug Administration (FDA), primarily in 21 CFR Part 1002.20 (Reporting of accidental radiation occurrences), and per DA requirements as stated in DODI 6055.08, AR 385–10, DA Pam 385–24, and this pamphlet.
  - (2) Notification requirements.
- (a) Immediate notification requirements. The following situations, involving byproduct, source, or special nuclear material, require immediate notification by telephone to the NRC Operations Center (301) 816–5100 as per procedures in paragraph 5-4b(3), with a follow-up investigation as per 5-4b(4), and written notification within 30 days as per 5-4b(5), below.
  - 1. Loss or theft of NRC license material that exceed the limits of 10 CFR 20.2201(a)(1)(i).
- 2. Loss (other than normal operating loss), theft, attempted theft of one gram or more or accidental criticality of special nuclear material as per 10 CFR 70.52.
- 3. Discovery of an event that may have caused, or threatens to cause an individual to receive a dose equivalent or intake equal or greater to the conditions in 10 CFR 20.2202(a).
- 4. Receipt of a package which exceeds the levels of 10 CFR 20.1906. The final delivery carrier and the NRC Operations Center (301) 816–5100 must be notified by telephone when:
  - a. Removable radioactive surface contamination which exceeds the limits of 10 CFR 71.87(i) and 49 CFR 173.443.
  - b. Radiation levels exceed the limits in 10 CFR 71.47 and 49 CFR 173.443.
- 5. Event that prevents immediate protective actions necessary to avoid exposures to radiation or radioactive materials that could exceed regulatory limits or releases of licensed material that could exceed regulatory limits (events may include fires, explosions, toxic gas releases, etc.) as per 10 CFR 30.50(a), 10 CFR 40.60(a), and CFR 70.50(a).
- 6. Discovery that safety mechanisms on equipment fail or are defective creating the possibility the source could become unshielded and cause an exposure as per 10 CFR 21.21 and 10 CFR 31.5(c)(5).
- 7. Leak test results of a sealed source indicating total removable activity exceeding 0.005 microcuries (185 Becquerel (Bq)) as per 10 CFR 31.5(c)(5) and 10 CFR 34.27.
- 8. Accidents involving transportation including loading, unloading, and temporary storage in which fire, breakage, spillage, or suspected radioactive contamination occurs involving shipment of radioactive material as per 49 CFR 171. 15.
- 9. The release of radioactive material in concentrations which, if averaged over a period of 24 hours, would exceed 500 times the limits specified for such materials in 10 CFR 20.
- 10. When there is reason to believe there was a radiation accident/incident occurrence involving a manufactures electronic product as per 21 CFR 1002.20.
- (b) Twenty-four hour notification. The following situations, involving byproduct, source, or special nuclear material, require 24 hour notification by telephone to the NRC Operations Center (301) 816-5100 as per procedures in paragraph 5-4b(3), with an investigation as per 5-4b(4), and written notification as per 5-4b(5) below. Discovery of an event that may have caused, or threatens to cause, any of the following conditions, in a period of 24 hours as per 10 CFR 20.2202(b), 10 CFR 30.50b, 10 CFR 40.60(b), and 10 CFR 70.50(b).
- (c) Two day notification. The following situations, involving byproduct, source, or special nuclear material, requires a 2 day notification by telephone to the NRC Operations Center (301) 816–5100 as per procedures in paragraph 5-4b(4), with an investigation as per 5-4b(5), and written notification as per 5-4b(6) below. Discovery of defect in equipment that could create a substantial safety hazard as per 10 CFR 21.21(d)(3)(i).
  - (3) Initial Notification responsibilities and procedures.
- (a) The Commander or designated representative becoming aware of an ionizing radiation accident will telephonically report the accident within 3 hours of confirmation of the accident through command channels to-

*Note.* An exception to the 3-hour criteria is that each licensee must notify the NRC Operations Center within 1 hour after discovery of any case of accidental criticality or any loss, other than normal operation loss, of special nuclear material as per 10 CFR 70.52.

1. The appropriate Army NRC license holder, ARA holder or Army Radiation Permit (ARP) holder. The radiation

safety officer and installation safety manager are sources of information concerning contacting the Army NRC licensee holder, ARA holder, and the ARP holder. Notification phone numbers for Army Materiel Command (AMC) NRC commodity license RSOs are provided in DA Pam 385–24. Notification phone numbers are in respective TMs, TBs, technical reports, SOPs, and in the commodity matrix provided on the DA RSO website at https://cecomsafety.apg. army.mil/rso2/ accessible with a valid common access card (CAC).

- 2. When dealing with NRC generally licensed radioactive material not covered under an ARA or ARP contact the local command center, USACR/SC, and the Army Safety Office.
- a. Contact the USACR/SC at DSN 558–2660/3410, COM (334) 255–2660/3410, FAX DSN 558–3749, COM (334) 255–3749.
- *b.* Contact the Army Safety Office at DSN 227–1194/1321/1128, COM (703) 697–1194/1321/1128 or the AOC after duty hours, DSN 227–0218, COM (703) 697–0218.
  - (b) Upon notification of the accident or incident the Army NRC license holder, ARA holder, ARP holder will—
- 1. Notify the NRC and other applicable federal agencies, such as the Department of Transportation for transportation accidents.
- 2. Provide technical information and status of NRC reporting to the Army Safety Office at DSN 227-1194/1321/1128, COM (703) 697-1194/1321/1128.
  - 3. Provide technical assistance concerning the accident as requested by the unit experiencing the accident.
- (c) If the Commander experiencing the accident is unable to notify the Army NRC license holder, the USACR/SC, or the Army Safety Office in a timely manner, that Commander will notify the NRC directly and subsequently inform the Army NRC license holder, USACR/SC, and the Army Safety Office. The NRC Operations Center is at (301) 816–5100. Precise notification time requirements for various types of accidents or incidents are in 10 CFR 20, primarily 10 CFR 20.2202 and included in 5–4b(2) above. Maximizing the expertise of the Army NRC license holder in interacting with the NRC is the preferred process.
  - (d) Notifications will contain as much information as is currently available using the format at table 5-2.

# Table 5-2 Radiological Accident Report Date and time of event. Radiation producing device or source involved, including NSN, serial number, part number, radiation characteristics, and parameters of the event. Description of the event, including cause; names and SSNs of the people exposed, injured, or contaminated; estimated exposure; contamination levels; facilities affected; potential damages; impact on operations; and immediate-response actions taken. Actions taken to prevent reoccurrence. Recommendations to avoid similar instances at other installations possessing similar material or devices. 6. Name and telephone number of health physicist or radiation safety officer, field unit identification and the appropriate Army Command (ACOM), Army Service Component Command (ASCC) or Direct Reporting Unit (DRU) involved. Point of contact (name, address, and telephone number). 7. A statement of when the appropriate offices in DOL, NRC, and DOT were notified (if applicable) and by whom notification was NRC License number, Army Radiation Authorization number, or Army Radiation Permit number.

- (e) Notify the installation or activity public affairs officer at the onset of the accident or incident in order to activate public affairs contingency measures as per AR 360–1. Radiation accidents or incidents attract the attention of local and national media quickly. Early disclosure of accurate information is vital to maintaining the confidence of both internal and external public.
  - (4) Investigation responsibilities and procedures.
  - (a) The Commander experiencing the accident will—
  - 1. Ensure an accident investigation is conducted.
- 2. Cooperate with Army NRC license holder, or ARA holder, or ARP holder, and federal regulatory agencies in providing information requested to determine accident cause and determine corrective measures.
  - (b) The Army NRC license holder, or ARA holder, or ARP holder will—
  - 1. Provide technical assistance to the investigation, as appropriate.
  - 2. Interface with other federal agencies concerning investigation or other interaction as a result of an accident.
  - (5) Written reporting requirements and procedures.

- (a) Written reporting requirements. The following requirements for reporting exposures, radiation levels, and concentrations of radioactive material exceeding the limits will be met through the following procedures below.
- I. In addition to any initial notification required by paragraph 5–4b(3) above, or after learning of any of the following occurrences in 10 CFR 20.2201 to 10 CFR 20.2206, and as required to the Occupational Safety and Health Administration (OSHA) by 29 CFR 1910.1096(m), 29 CFR 1926.53(c), or FDA 21 CFR 1002.20, a written report is required. The Army NRC license holder shall submit a written report through command channels to the USACR/SC and the Army Safety Office within 10 days for review. The Army NRC license holder will provide the written report to the NRC within 30 days for NRC licensed materials.
- a. Any incident for which notification is required by 10 CFR 20.2202. This includes doses in excess of the occupational dose limits for adults (10 CFR 20.1201), the occupational dose limits for a minor (10 CFR 20.1207), the limits for an embryo/fetus of a declared pregnant woman (10 CFR 20.1208), the limits for an individual member of the public (10 CFR 20.1301), or any applicable limit in the license.
- b. Levels of radiation, or concentrations of radioactive material in a restricted area in excess of any applicable limit in the license, or an unrestricted area in excess of 10 times any applicable limit set forth in this part or in the license (whether or not involving exposure of any individual in excess of the limits in 10 CFR 20.1301).
- c. For licensees subject to the provisions of Environmental Protection Agency's applicable environmental radiation standards in 40 CFR 190, levels of radiation or releases of radioactive material in excess of those standards, or of license conditions related to those standards.
- d. Any accident/incident radiation occurrence resulting from a manufactures electronic product where reasonable grounds exist that an incident has occurred shall be reported to the Center for Devices and Radiological Health, FDA (21 CFR 1002).
  - 2. DA accident reporting criteria and requirements per AR 385-10, chapter 3 also apply.
  - (b) Reporting responsibilities and procedures.
- 1. The commander of the unit experiencing the accident will report the accident in accordance with AR 385–10, chapter 3.
  - 2. TheArmy NRC license holder will—
- a. Submit accident reports to the NRC to fulfill requirements of 10 CFR 20 (10 CFR 20.1007 Communications) and related CFR (10 CFR 30.6 Communications) see contact information provided in paragraph 5–4b(6)(b), below and to other federal agencies as required.
- b. Provide technical assistance to the commander of the unit experiencing the accident in developing the written Army accident report.
  - (6) Telephone numbers. Telephone numbers and addresses for reporting radiation accidents and incidents.
  - (a) To report ionizing radiation accidents and incidents to the NRC follow the guidance in 10 CFR 20.1007.
- (b) Unless otherwise specified, communications or reports concerning the regulations should be addressed to the Executive Director for Operations, and sent—
  - 1. Either by mail to the U.S. Nuclear Regulatory Commission, Washington, DC 20555-0001.
  - 2. By hand delivery to the NRC's offices at 11555 Rockville Pike, Rockville, Maryland.
- 3. Where practicable, by electronic submission, for example, via Electronic Information Exchange EIE@nrc.gov, or CD-ROM.
- 4. Electronic submissions must be made in a manner that enables the NRC to receive, read, authenticate, distribute, and archive the submission, and process and retrieve it a single page at a time.
  - (c) Detailed guidance on making electronic submissions can be obtained by—
  - 1. By calling (301) 415–6030.
- 2. By writing the Office of Information Services, U.S. Nuclear Regulatory Commission, Washington, DC 20555–0001.

Note. The guidance discusses, among other topics, the formats the NRC can accept, the use of electronic signatures, and the treatment of nonpublic information.

- (d) The NRC has delegated to the four Regional Administrators licensing authority for selected parts of its decentralized licensing program for nuclear materials as described in 10 CFR 30.6 paragraph (b)(1). Any communication, report, or application covered under this licensing program must be submitted to the appropriate Regional Administrator. The administrators' jurisdictions and mailing addresses are listed in 10 CFR 20 Appendix B.
- (e) Other involved federal agencies telephone numbers and addresses: U.S. Department of Transportation, Pipeline and Hazardous Materials Safety Administration, Office of Hazardous Materials Enforcement, contact information can be found at the following website http://www.phmsa.dot.gov/about/contact.
- (f) Information on reports dealing with electronic products is provided at the following webstie:http://www.fda.gov/Radiation-EmittingProducts/RadiationSafety/ReportaProblem/default.htm.
  - (g) USACR/SC at DSN 558-2660/3410, COM (334) 255-2660/3410, FAX DSN 558-3749, COM (334) 255-3749.
  - (h) HQDA (DACS-SF) The Army Safety Office at DSN 227-1194/1321/1128, COM (703) 697-1194/1321/1128

and (SGPS-PSP) DSN 289-0132/COM (703)-756-0132 (during non-duty hours, contact AOC, DSN 227-0218, COM (703) 697-0218, and indicate the offices to be notified).

- c. Nonionizing radiation accidents.
- (1) Definition. Nonionizing radiation accidents are of the following two types:
- (a) High-Intensity Optical Source. The primary types of these accidents involve lasers or arc sources, such as electric arc welding or arc lamp as used in a printing plant. Accidents occur when personnel exposure to nonionizing radiation exceeds levels established by DA, based on national standards (see AR 385–10, DA Pam 385–24, TB MED 524, ANSI Z136.1, or American Conference of Governmental Hygienists Threshold Limit Values (for laser, ultraviolet, or other optical sources), or when personnel injury/occupational illness results from exposure to nonionizing radiation during the use or maintenance of a nonionizing device. If nonionizing radiation levels are exceeded, immediately evacuate personnel suspected of experiencing potentially damaging eye exposure from laser radiation to the nearest medical facility for an eye examination. Laser eye injuries require immediate specialized ophthalmologic care to minimize long term visual acuity loss. Medical personnel should obtain medical guidance for such emergencies from the DOD Laser Incident Hotline at the Air Force ESOH Service Center: 1–800–473–3549, DSN 798–3764, or COMM 937–938–3764 email at esoh.service.center@wpafb.af.mil and information can be collected on the DOD Laser Injury Electronic Reporting Form https://hpws.afrl.af.mil/dhp/OE/ESOHSC/laserinjury/. Excluded from these accidents are cases of sunburn, which will be classified as "Personal Injury-Other" accidents.
- (b) Electromagnetic Radiation Sources. These accidents occur when a person is exposed to EMR sources, to include microwave and RF radiation, in excess of levels set in AR 385–10, DA Pam 385–24, DODI 6055.11, IEEE C95.1, and IEEE C95.3.
- (2) *Notification*. Accident notifications will be completed per AR 385–10. In addition, the Commander experiencing a nonionizing radiation accident will send an electrically transmitted message to the following addressees providing as many details of the accident as possible in the format in figure 5–2 within 24 hours of occurrence:
- (a) Commander, USACRC (CSSC-CG), Fort Rucker, AL, at DSN 558-2660/3410, COM (334) 255-2660/3410, FAX DSN 558-3749, COM (334) 255-3749.
- (b) HQDA (DACS-SF) The Army Safety Office at DSN 227-1194/1321/1128, COM (703) 697-1194/1321/1128 and (SGPS-PSP) DSN 289-0132/COM (703)-756-0132 (during non-duty hours, contact AOC, DSN 227-0218, COM (703) 697-0218, and indicate the offices to be notified).
- (c) Commander, U.S. Army Institute of Public Health (USAIPH), 5158 Blackhawk Road, Aberdeen Proving Ground, MD 21010–5403, (800) 222–9698 and the USAIPH Nonionzing Radiation P r o g r a m ( L O R P ) ( D S N 5 8 4 3 353 /3932 o r C O M ( 4 1 0 ) 4 3 6 3 353 /3932 o r ( 8 0 0 ) 2 2 2 9 6 9 8 ) ( e m a i l : usarmy.apg. medcom-phc.mbx.nonionizing@mail.mil).
- (d) Notify the installation or activity public affairs officer at the onset of the accident or incident in order to activate public affairs contingency measures as per AR 360–1. Radiation accidents or incidents attract the attention of local and national media quickly. Early disclosure of accurate information is vital to maintaining the confidence of both internal and external public.
  - (3) Investigation responsibilities and procedures.
  - (a) The Commander experiencing the accident will. —
  - 1. Ensure an accident investigation is conducted.
- 2. Cooperate with DA, DOD and federal agencies in providing information requested to determine accident cause and determine corrective measures.
  - (b) The RSO/LSO/RFSO will. —
  - 1. Provide technical assistance to the investigation, as appropriate.
- 2. Interface with DA, DOD, and other federal agencies concerning investigation or other interaction as a result of an accident.
- (c) Other investigations. HQDA (SGPS-PSP) may require a medical technical investigation to obtain exposure data. This investigation is separate from the accident investigation. The technical investigation report is maintained by the U.S. Army Institute of Public Health, 5158 Blackhawk Road, Aberdeen Proving Ground, MD 21010–5403, (800) 222–9698.
  - (4) Nonionizing radiation accidents.
- (a) Report a laser overexposure as per TB MED 524 appendix C (Medical Surveillance). For a laser overexposure once the optometrist or ophthalmologist suspects or confirms the incident, the occupational health clinic/Troop Medical Clinic or emergency responders will immediately notify—
  - 1. The division/installation/garrison LSO.
  - 2. The division/installation/garrison RSO.
- 3. The LSO or RSO will notify the DOD Laser Incident Hotline at the Air Force ESOH Service Center: 1–800–473–3549, DSN 798–3764, or COMM 937–938–3764 email at esoh.service.center@wpafb.af.mil and information can be collected on the DOD Laser Injury Electronic Reporting Form https://hpws.afrl.af.mil/dhp/OE/ESOHSC/

laserinjury/ and include information from the incident in the DOD Laser Injury Database https://hpws.afrl.af.mil/dhp/OE/laserinjury/.

- 4. The LSO or RSO will notify Commander, U.S. Army Institute of Public Health (USAIPH), 5158 Blackhawk Road, Aberdeen Proving Ground, MD 21010–5403, (800) 222–9698 and the AIPH Nonionzing Radiation P r o g r a m (DSN 584-3353/3932 o r COM (410) 436-3353/3932 o r (800) 222-9698) (e-mail:usarmy.apg.medcom-phc.mbx.nonionizing@mail.mil).
- 5. The LSO or RSO will notify USACHPPM Tri-service Vision Conservation and Readiness Program (TVCRP) Manager (DSN 584–2714 or COM (410) 436–2714) (e-mail: laserincient@ammed.army.mil). After normal duty hours, contact the USAIPH personnel via the staff duty officer (DSN 584–4375 or COM (410) 436–4375 or (800) 222–9698).
- (b) Report of an Electromagnetic Radiation Sources overexposure. Report EMR source overexposure as per AR 385–10, DA Pam 385–24, DODI 6055.11, and IEEE C95.7. For an EMR overexposure once the occupational health clinic/Troop Medical Clinic or emergency responders confirms the incident, they will immediately notify—
  - 1. The division/installation/garrison RFSO.
  - 2. The division/installation/garrison RSO.
- 3. The RFSO or RSO will notify the DOD EMF Injury Hotline, at the Air Force ESOH Service Center: 1–800–473–3549, DSN 798–3764, or COMM 937–938–3764 email at esoh.service.center@wpafb.af.mil and information can be collected on the EMF Injury Reporting Form https://hpws.afrl.af.mil/dhp/OE/ESOHSC/emfinjury/ and include information from the incident in the DOD EMF Injury Database https://hpws.afrl.af.mil/dhp/OE/emfInjury/.
- 4. The RFSO or RSO will notify Commander, U.S. Army Institute of Public Health (USAIPH), 5158 Blackhawk Road, Aberdeen Proving Ground, MD 21010–5403, (800) 222–9698 and the AIPH Nonionzing Radiation P r o g r a m D S N 5 8 4 3 353 /3932 o r C O M ( 4 1 0 ) 4 3 6 3 353 /3932 o r ( 8 0 0 ) 2 2 2 9 6 9 8 ) ( e m a i 1 : usarmy. apg.medcom-phc.mbx.nonionizing@mail.mil).

# 5-5. Nuclear weapon and reactor accidents

- a. General.
- (1) Command responsibilities. Commanders with reactor mission will establish procedures to ensure investigating and reporting of a nuclear accident is accomplished per guidance which follows.
- (2) Nuclear accident/incident response and assistance. This guidance is published in AR 50–5, chapter 5. Nuclear Accident/incident response and assistance is intended to minimize loss of life, personal injury, hazardous effects, and destruction of property.
  - b. Definition. Nuclear weapons and reactor accidents are defined in the glossary and AR 50-5.
  - c. Classifying nuclear weapon accidents. Accidents will be classified in accordance with AR 385-10, chapter 3.
- d. Notification. The commander of the reactor operation experiencing the nuclear accident will follow notification procedures in AR 50-5, appendix B (Required Reports).
  - e. Investigation.
- (1) The Director of Army Safety will convene the U.S. Army Nuclear Weapon/Reactor Accident Investigation Board to investigate nuclear weapon or reactor accidents.
- (2) The Director, U.S. Army Nuclear and Combating Weapons of Mass Destruction Agency, establishes procedures to ensure that a technical investigation and analysis is done for each significant incident (RCS DD-R&E(AR)1168(MIN)) or minor nuclear system incident (RCS CSOCS-310), AR 50-5.
  - f. Reporting.
- (1) The commander of the reactor operation experiencing the nuclear accident will follow the reporting procedures in AR 50-5 and AR 50-7.
- (2) Nuclear weapon and reactor accidents which also meet the criteria of Class A–D will be reported on DA Form 285 or DA Form 285–AB and DOL Forms CA–1 (Federal Notice of Traumatic Injury and Clain for Continuation of Pay/Compensation)/CA–2 (Notice of Occupation Disease and Claim for Compensation) as appropriate for injury, illness, and property damage.
- (3) Occupational illnesses to DA military or civilian personnel resulting from nuclear weapon or reactor accidents will be reported as prescribed in AR 40–400.

# 5-6. Biological mishaps

- a. Biological mishaps will be investigated and reported in accordance with DA Pam 385-69.
- b. Biological mishaps that also meet the criteria of Class A-D accidents will be investigated and reported in accordance with this pamphlet and AR 385-10.

# 5-7. Investigation of North Atlantic Treaty Organization nation aircraft or missile accidents and incidents

a. General. STANAG 3531, Investigation of Aircraft/Missile Accidents/Incidents, sets forth procedures for the investigation of these events within the North Atlantic Treaty Organization (NATO) Armed Forces.

- (1) In the provision—
- (a) Each nation may conduct its own accident safety investigation. The proceedings and conclusions will be privileged. When permitted, representatives of other involved nations will be invited to attend.
  - (b) Some NATO nations, either by law or by procedure may—
- 1. Permit reports of investigations into aircraft and missile accidents and incidents to be used in disciplinary or legal proceedings and for determining responsibility for claims.
  - 2. Determine reports of investigations are privileged and are to be used only for accident prevention and safety.
- 3. Conduct a separate investigation to determine civil responsibilities by the proper authorities of the country of occurrence. This is done according to the national laws of that country or other agreement between the governments concerned. When an investigation is required by disciplinary reasons, each nation concerned will be responsible for the conduct of the investigation.
- (2) The operating nation is responsible for accidents or incidents which occur in an airfield or launch site located in allied territory occupied by forces of another NATO nation.
- (3) Member nations should aid other member nations in investigating aircraft or missile accidents or incidents. When possible, they will release relevant information which does not compromise security or conflict with practices regarding privilege.
- (4) National authorities of the country of occurrence will respect any security restrictions imposed by the operating nation on the issue of statements to the press concerning accidents which occur in their territory. No statement will be issued without the consent of the operating nation.
- (5) When one nation carries out recovery of another nation's aircraft at that nation's request, payment of recovery costs will be as prescribed by STANAG 3113 ACS.
- b. Reporting requirements. In addition to the reports shown in this pamphlet and AR 385–10, if the aircraft or missile accident or incident involves toxic chemical material or nuclear weapons, the chemical accident/incident control provisions of AR 50–6 or AR 50–5 apply. Additional reporting requirements are under the reports control jurisdiction of the major overseas Army command according to AR 335–15.
  - c. Explanation of terms. See glossary.
- d. Functions. To initiate a good functional NATO nations accident and investigation reporting relationship, Army Headquarters commanders within separate NATO complexes should provide the following in their programs:
- (1) Procedures for notifying involved countries of the accident or incident and safeguarding wreckage in an undisturbed condition until the safety investigators of each nation involved have released the wreckage.
- (2) Measures to establish a safety zone around the location when there is reason to suspect the presence of explosives or other hazardous conditions in an accident or incident pending further guidance from the operating nation.
- (3) Procedures to notify other member nations of the names of the national agencies to be informed when equipment, facilities, or persons of that country are involved in an aircraft or missile accident or incident with the equipment, facilities, or persons of another country.
- (4) Procedures to designate an authority to be advised when a combined aircraft or missile accident investigation is needed.
  - (5) Joint planning and coordination procedures to investigate and report accidents and incidents.
- e. Related documents. STANAG 3318, Medical Aspects of Aircraft Accident Investigations, and STANAG 3113 ACS, Provisions of Support to Visiting Personnel, Aircraft, and Vehicles, are related documents. In addition, addressees of appropriate military safety centers for NATO countries are included in and made a part of STANAG 3101. (See AR 95–30/AFR 127–11/OPNAVINST 3750.16B/CG 307.)
- f. Investigation procedures. When an accident or incident occurs involving aircraft or missiles of one or more nations on another nation's territory or ship, the military authorities of the country of occurrence should perform the following:
  - (1) Assist injured crews and remove fatalities. In the event of fatal accidents—
  - (2) Provide an officer detailed to the country of occurrence to take legal steps required by the local civil authorities.
  - (3) Local military authorities will accord honors to fatalities as prescribed by their regulations.
  - (4) Fatalities will be treated according to the desires of the nations concerned.
  - (5) Provide a medical doctor, preferably with specialist aeromedical qualifications, to—
  - (a) Initiate any necessary medical investigation according to STANAG 3318.
  - (b) Assist the medical member or adviser to the aircraft or missile accident safety investigation committee.
- (c) Request national or local authorities to keep the scene of the accident guarded and untouched until the proper accident safety investigation committee assumes control. If the wreckage must be moved for technical or social reasons or to prevent further damage to the aircraft or missile, a reconstruction must be made by means of photographs, drawings, maps, and witnesses.
- (d) Report the accident according to current procedures of the country of occurrence. The country of occurrence will promptly notify the nearest representative of the allied authorities of the countries concerned, (for example, military

attaches, nearest air force, army, or naval base.) The nation operating the aircraft or missile will be invited to send an accident safety investigation committee.

- (e) Report to the operating nation's authorities the names (where known) of injured persons, giving their location and the seriousness of their injuries.
  - (f) No person may sit on the investigating committee or act as an observer who, in the line of duty:
  - 1. May be directly associated with the cause factor(s) of the accident or incident.
  - 2. May have personal interest in the outcome of the investigation.
  - g. National safety investigations.
- (1) The nation operating the aircraft or missile concerned is responsible for the accident safety investigation. However, when the operating nation does not wish to investigate an accident, the nation on whose territory the accident occurred will be responsible for the investigation. An officer (or officers) of the country of occurrence may, with the consent of both countries, be attached to the operating nation's investigating committee as an official assistant or observer. This officer will provide an interpreter if needed.
- (2) The operating nation's authorities will begin investigations after notifying the appropriate armed forces staff of the country of occurrence and the proper national headquarters.
  - (3) Medical aspects of aircraft accident investigations should be according to STANAG 3318.
- (4) An officer of the country of occurrence should be sent at once to the scene of the accident to perform the following:
  - (a) Collect in advance all possible written statements and other evidence for the investigating committee.
  - (b) Assist the investigating committee as needed.
- (c) Act as the liaison between the civil authorities of the country of occurrence and the accident safety investigation committee.
- (5) When a member nation does not wish to take part in a safety investigation, the president of the accident investigation committee may receive evidence, oral or written, that is relevant to the investigation. Such evidence may be accepted, whether or not it would be admissible in a civil court. Evidence of any type, sworn or unsworn, or expert opinion may be accepted by the committee and any reasonable inferences should be drawn.
  - h. Combined safety investigations.
- (1) General. All aircraft and missile accidents or incidents involving equipment, facilities, or persons of two or more member nations normally will be investigated by a combined aircraft or missile accident safety investigation committee. If equipment, facilities, or personnel of any other member nation were contributory causes to the accident, that nation will be notified and invited to take part in a combined investigation.
  - (2) Composition of the combined aircraft or missile accident safety investigation committee should—
- (a) Include investigators and technical advisers deemed necessary by each of the countries involved and be formed into one investigating committee. They should work under the unified direction of a coordinating group consisting of the senior member of each nation's investigating group. The most senior member of the group appointed by the operating nation will be president of the combined committee.
- (b) When notified of an aircraft or missile accident falling within the category in "a" above, the nations involved will advise the headquarters of the air force or missile arm of the country of occurrence of the names of the officers in their investigating group. The nations will also identify the officer who will serve as the senior member of their group.
- (c) When aircraft or missiles of two nations are involved in accidents over the territory of a third nation, the president of the combined committee will be determined by agreement among the nations involved.
- (d) When the committee is unable to present a unanimous conclusion as to the prime and contributory causes of the accident, each national point of view will be stated.
  - (3) Coordination of investigating efforts. The coordinating group will—
  - (a) Be responsible for overall direction of the investigation.
  - (b) Organize the investigating committee into specialized subcommittees, as needed.
  - (c) Conduct the investigation according to procedures normally used by the operating nation.
  - (4) Reporting.
  - (a) The investigation committee will report its combined findings. The report will include the following data:
  - 1. Factual circumstances.
  - 2. Investigation and analysis.
  - 3. Findings and conclusions.
  - 4. Recommendations.
- (b) Attach statements or exhibits to the report if they will make the findings more meaningful and comprehensive. The chief investigator of each nation involved will show his or her concurrence or nonconcurrence on the report. This

combined report may be separate from any other report required by regulations of the individual nations. Copies of the combined report will be sent to the nations taking part in the investigation.

(c) When one nation involved cannot take part in a combined investigation, that nation may request and receive copies of all original reports and conclusions of the investigation committee. When a combined investigation is not conducted because a nation involved declined to take part, copies of the investigation report will not be made available if privileged status precludes release of such reports.

# Appendix A References

#### Section I

# **Required Publications**

## AR 40-21

Medical Aspects of Army Aircraft Accident Investigation (Cited in paras 2-1c(4)(a), 2-4g(1), 3-12b.)

# AR 50-5

Nuclear Surety Program (Cited in paras 5-5a(2), 5-5b, 5-5d, 5-5e(2), 5-5f(1) and 5-7b.)

#### AR 50-6

Chemical Surety Program (Cited in para 5–2band 5–7b.)

### AR 385-10

The Army Safety Program (Cited in paras 1-1, 1-4a, 1-7, 1-8, 1-9b(2)(e), 1-9b(4), 1-9h(2), 1-9q(1)1-9q(2), 1-9r, 1-10a(1), 2-1a, 2-1c, 2-1c(1)(p), 2-1f(1), 2-1f(3)(c), 2-2b(1)(b), 2-2c(1)(a), 2-2e, 2-2e(2), 2-2e(3), 2-2f(3)(c), 2-3a(4)(a), 2-3a(4)(b), 2-4g(1), 2-9a(24), 3-1, fig. 3-6, 3-7b(2)(a), 3-17d(1), 3-17d(5), 3-20, 3-20a, 3-21a, 3-23b(1), 3-23b(9)(b), 3-30b(3)(h), 3-30b(8), 3-36b(2), 3-36b(16), 3-37b(23), 4-1a, 4-1b, 4-2a(1), 4-3a, table 4-2, fig. 4-3, 4-4b(2)(b), 4-5b(2)(b), 4-11a, 4-12b(2), 4-13b(10)(a), 4-16b(3), 4-16b(5), 5-1b, 5-3a(3), 5-3b(1), 5-3b(3), 5-4a(1), 5-4a(2), 5-4b(5)(a)2, 5-4b(5)(b)1, 5-4c(1)(a), 5-4c(1)(b), 5-4c(2), 5-4c(4)(b), 5-5c, 5-6b, 5-7b.

#### DA Pam 738-751

Functional Users Manual for the Army Maintenance Management System, Aviation (TAMMS) (Cited in paras 1-10b(11)(d), 2-5p(1)(a), 2-5p(3)(f), 3-29b(3)(g) and 3-37b(15)(b)2.)

#### DA Pam 750-8

The Army Maintenance Management System (TAMMS) Users Manual (Cited in para 2-5p(1)(a).)

#### Section II

## **Related Publications**

A related publication is a source of additional information. The user does not have to read it to understand the publication.

# AR 15-6

Procedures for Investigating Officers and Boards of Officers

## AR 27-20

Claims

## AR 27-40

Litigation

#### AR 40_3

Medical, Dental, and Veterinary Care

## AR 40-5

Preventive Medicine

#### AR 40-14

Control and Recording Procedures for Exposure to Ionizing Radiation and Radioactive Materials (DLAR 1000-28)

# AR 40-46

Control of Health Hazards from Lasers and Other High Intensity Optical Sources

## AR 40-400

Patient Administration

#### AR 40-66

Medical Record and Quality Assurance Administration

#### AR 50-5

Nuclear Surety

#### AR 50-6

Chemical Surety

#### AR 50-7

Army Reactor Program

#### AR 56-9

Watercraft

#### AR 75-1

Malfunctions Involving Ammunition and Explosives

# AR 75-15

Policy for Explosive Ordnance Disposal

#### AR 95-1

Flight Regulations

#### AR 95-23

Unmanned Aircraft System Flight Regulations

#### AR 95-30

Participation in a Military or Civil Aircraft Safety Investigation

## AR 190-45

Serious Incident Report

# AR 335-15

Management Information Control System

# AR 360-1

The Army Public Affairs Program

#### AR 380-86

Classification of Chemical Warfare and Chemical and Biological Defense Information

## AR 420-1

Fire Protection

#### AR 600-8-1

The Army Casualty and Memorial Affairs and Line of Duty Investigations

#### AR 600-55

The Army Driver and Operator Standardization Program (Selection, Training, Testing, and Licensing)

## AR 611-75

Personnel Selection, Qualification, and Classification of Army Divers

#### AR 735-8

Bailment Agreements for U.S. Army Aviation Major and Secondary Air Items

# AR 750-6

Ground Safety Notification System

#### DA Pam 385-24

The Army Radiation Safety Program

#### DA Pam 385-25

Occupational Dosimetry and Dose Recording for Exposure to Ionizing Radiation

#### DA Pam 385-40

Army Accident Investigations and Reporting

#### DA Pam 385-61

Toxic Chemical Agent Safety Standards

#### DA Pam 385-69

Safety Standards for Microbiological and Biomedical Laboratories

## ANSI Z136.1

Safe Use of Lasers (Available for purchase at http://www.ansi.org.)

## **DODI 5400.7**

DOD FOIA Program

#### **DODI 6055.06**

DOD Fire and Emergency Service (F&ES) Program

#### DODI 6055.07

Accident Investigation, Reporting, and Record Keeping

#### DODI 6055.08

Occupational Ionizing Radiation Protection Program

#### DODI 6055.11

Protecting Personnel from Electromagnetic Fields

## DODI 6055.15

DOD Laser Protection Program

#### **IEEE C95.1**

Safety Levels with Respect to Human Exposure to Radio Frequency Electromagnetic Fields, 3 kHz to 300 GHz (Available for free at http://standards.ieee.org/about/get/index.htm)

## **IEEE C95.3**

Recommended Practice for Measurements and Computations of Radio Frequency Electromagnetic Fields with Respect to Human Exposure to Such Fields. 100 kHz-300 GHz (Available for free at http://standards.ieee.org/about/get/index. html.)

#### **IEEE C95.7**

Recommended Practice for Radio Frequency Safety Programs, 3 kHz to 300 GHz (Available for free at http://standards.ieee.org/about/get/index.html.)

# NATO Standardization Agreement (STANAG) 3101

Exchange of Accident/Incident Information Concerning Aircraft and Missiles

# NATO Standardization Agreement (STANAG) 3113

Provision of Support to Visiting Personnel, Aircraft and Vehicles

## NATO Standardization Agreement (STANAG) 3318

Participation in a Military or Civil Aircraft Accident Safety Investigation

# NATO Standardization Agreement (STANAG) 3531

Safety Investigation and Reporting of Accidents/Incidents Involving

#### NAVSHIPS 250-538

U.S. Dive Manual, Volumes I, General Principles of Diving; Volume II, Surface Air and Self-Contained Diving (SCUBA)

#### OPNAVINST 3750.16C

Participation in a Military or Civil Aircraft Accident Safety Investigation.

#### OPNAVINST 5102-1D

Navy and Marine Corps Mishap and Safety Investigation, Reporting, and Record Keeping Manual

#### RCS CSOCS-309

Unmanned Aircraft System Accident Report (UASAR)

### SB 742-1

Inspection of Supplies and Equipment Ammunition Surveillance Procedures

#### TB 43-0002-3

Maintenance Expenditure Limits for Army Aircraft

# **TB MED 523**

Control of Hazards to Health from Microwave and Radio Frequency Radiation and Ultrasound

## **TB MED 524**

Control of Hazards to Health from Laser Radiation

# TC 21-305

Training Program for Wheeled Vehicle Accident Avoidance.

#### TM 55-1520-240-23-1P

Aviation Unit and Aviation Intermediate Maintenance Manual

# 10 CFR 19

Notices, Instructions and Reports to Workers: Inspection and Investigations

#### 10 CFR 20

Standards for Protection Against Radiation

# 10 CFR 21

Reporting Defects and Noncompliance

## 10 CFR 30

Rules of General Applicability to Domestics Licensing of Byproduct Material

#### 10 CFR 31

General Domestic Licenses for Byproduct Material

#### 10 CFR 34

Licenses for Industrial Radiography and Radiation Safety Requirements for Industrial Radiographic Operations.

# 10 CFR 40

Domestic Licensing for Source Material

# 10 CFR 70

Domestic Licensing of Special Nuclear Material

# 10 CFR 71

Packaging and Transport of Radioactive Material

## 21 CFR 1002.20

Reporting of Accidental Radiation Occurrences

#### 29 CFR 1904

OSHA Records Keeping and Reporting

#### 29 CFR 1910

Occupational Safety and Health Standards

#### 29 CFR 1910.1096

Ionizing Radiation

#### 29 CFR Part 1960

**OSHA** Standards

## **40 CFR**

Protection of Environment

#### **49 CFR**

Transportation

## 49 CFR 171.15

Immediate Notice of Certain Hazardous Materials Incidents

#### 49 CFR 173.443

Contamination Control

### Section III

# **Prescribed Forms**

Unless otherwise indicated, DA Forms are available on the APD Web site (www.apd.army.mil); DD Forms are available on the OSD Web site (www.dtic.mil/whs/directives/infomgt/formsprogram.htm); Standard Forms (SF) and Optional Forms (OF) are available on the GSA Web site (www.gsa.gov).

#### DA Form 285

Technical Report of U.S. Army Ground Accident (Prescribed in paras 1-4a, 1-6b, 1-9h(1), 1-9h(2), 2-9a(25), 3-2l, 4-1a, 4-1b(5), 4-2a, 4-2a(4), 4-4e(3)(d)2, 4-6b, 4-8e(2), 5-1a, 5-1b(3)(c), 5-1b(4), 5-1d, 5-3b(3), 5-3d, and 5-5f(2).)

#### DA Form 285-A

Technical Report of U.S. Army Ground Accident, Index A (Prescribed in paras 4-1b(1), 4-6c(1), 4-7, 4-8a, 4-9b, 4-8d, 4-14b(1), 4-14b(2) and 4-14b(3).)

# DA Form 285-B

Technical Report of U.S. Army Ground Accident, Index B (Prescribed in paras 4-1b(3), 4-6b, 4-6c(2), 4-7, 4-8b, 4-8e, 4-14b(1), 4-14b(2), 4-14b(3), and 4-14b(4).)

# DA Form 285-O

Technical Report of U.S. Army Ground Accident, Statement of Reviewing Officials (Prescribed in paras 4-1b(4), 4-8e(1), 4-9 and 4-12f(3).)

#### DA Form 285-W

Technical Report of U.S. Amy Ground Accident, Summary of Witness Interview (Prescribed in paras 4-1b(8), 4-5a, 4-5b(2)(c)4, 4-5b(2)(d), 4-8e(5), 4-13b and 4-13b(11)(c).)

#### DA Form 285-AB

U.S. Army Abbreviated Ground Accident Report (AGAR) (Prescribed in paras 1-4a, 2-9a(25), 3-2l, 5-1b(4), 5-1d, 5-3b(3), 5-3d and 5-5f(2).)

#### **DA Form 2397**

Technical Report of U.S. Army Aircraft Accident, Part I, Statement of Reviewing Officials (Prescribed in paras 1-4a, 1-9h(1)(c), 2-9a(25), 3-1, 3-2a, 3-2b, 3-2b(1), 3-3, 3-8a, 3-17a, 3-19, 3-19b, 3-19d, 3-20c, 3-21, 3-21c, 3-23b(25), 3-36a and 3-37b(5).)

#### DA Form 2397-1

Technical Report of U.S. Army Aircraft Accident, Part II, Summary (Prescribed in paras 3-2b(3), 3-4, 3-4a(1), 3-4a(2), 3-4a(3), 3-19b, 3-19e(5), 3-23, 3-23b(6), 3-23b(10)(b), 3-23b(19)(c), 3-23b26, 3-24b(3), 3-26b(12), 3-27c(2), 3-28b(5), 3-29b(7), 3-31b(13), 3-32b(14), 3-33b(15) and 3-34b(11).)

#### DA Form 2397-2

Technical Report of U.S. Army Aircraft Accident, Part III, Findings and Recommendations (Prescribed in paras 3-2b(1), 3-2b(3), 3-5a, 3-23b(16)(b), 3-23b(22), 3-24b(1)i(h), 3-33b(1) and 3-36b(24).)

#### DA Form 2397-3

Technical Report of U.S. Army Aircraft Accident, Part IV, Narrative (Prescribed in paras 2-1h, 3-2b(1), 3-6, 3-23b(9)(b), 3-23b(13), 3-23b(16)(c), 3-23b(16)(d), 3-23b(16)(f), 3-23b(22), 3-24b(1), 3-26b(11)(b), 3-26b(11)(d), 3-30b(1)(a), 3-30b(8), 3-30b(10), 3-33b(1) and 3-37b(12).)

## DA Form 2397-4

Technical Report of U.S. Army Aircraft Accident, Part V, Summary of Witness Interview (Prescribed in paras 3-2b(1), 3-7a, 3-7b(2)(a), 3-7b(5), 3-7b(6) and 3-26b(11)(c).)

#### DA Form 2397-5

Technical Report of U.S. Army Aircraft Accident, Part VI, Wreckage Distribution (Prescribed in paras 3-2b(2), 3-8a and 3-27a.)

### DA Form 2397-6

Technical Report of U.S. Army Aircraft Accident, Part VII, In-Flight or Terrain Impact and Crash Damage Data (Prescribed in paras 3–2*b*(3), 3–9*a*, 3–23*b*(16)(a), 3–28*b*(6), 3–36*b*(11)(f), 3–36*b*(22)(a), 3–37*b*(11)(j).)

# DA Form 2397-7

Technical Report of U.S. Army Aircraft Accident, Part VIII, Maintenance and Material Data (Prescribed in paras 3–10, 3–10*b*, 3–10*c*, 3–10*d*, 3–23*b*(22), 3–24*b*(1)i2(1) and 3–29*b*(1).)

#### DA Form 2397-8

Technical Report of U.S. Army Aircraft Accident, Part IX, Personal Data (Prescribed in paras 1-6b, 3-11, 3-23b(22), 3-24b(1)i2(h) and 3-30b(4).)

#### DA Form 2397-9

Technical Report of U.S. Army Aircraft Accident, Part X, Injury/Occupational Illness Data (Prescribed in paras 1-6b, 3-12a, 3-23b(10)(a), 3-23b(19)(b), 3-28b(7), 3-31b(5)(a), 3-31b(6), 3-31b(14), 3-32b(1), 3-34b(9)(c), 3-36b(10)(g) and 3-37b(10)(h).)

## DA Form 2397-10

Technical Report of U.S. Army Aircraft Accident, Part XI, Personnel Protective/Escape/Survival/Rescue Data (Prescribed in paras 3–13, 3–28*b*(7), 3–36*b*(22)(b) and 3–36*b*(22)(c).)

#### DA Form 2397-11

Technical Report of U.S. Army Aircraft Accident, Part XII, Weather/Environmental. (Prescribed in para 3–14 and 3–23*b*(22).)

## DA Form 2397-12

Technical Report of U.S. Army Aircraft Accident, Part XIII, Fire (Prescribed in paras 3-2b(3), 3-15 and 3-23b(13).)

#### DA Form 2397-13

Technical Report of U.S. Army Aircraft Accident, Index A (Prescribed in paras 3–16, 3–17a, 3–17b, 3–17d, 3–19d, 3–23b, 3–31b(13), 3–35b(1), 3–35b(2), 3–35b(3) and 3–35b(4).)

#### DA Form 2397-14

Technical Report of U.S. Army Aircraft Accident, Index B (Prescribed in paras 3-19d, 3-35b(1), 3-35b(2), 3-35b(3), 3-35b(4) and 3-35b(5).)

#### DA Form 2397-AB

Abbreviated Aviation Accident Report (Prescribed in paras 1-4a, 1-9h(1)(c), 2-9a(25), 3-1, 3-20, 3-20a, 3-20b, 3-20c, 3-21, 3-36b, 3-36b(5), 3-36b(22)(a), 3-36b(25) and 3-37b(5).)

#### DA Form 2397-U

Unmanned Aircraft System Accident Report (Prescribed in paras 1-4a, 3-1, 3-21, 3-21a, 3-37b and 3-37b(5).)

#### Section IV

#### Referenced Forms

#### DA Form 759

Individual Flight Record and Flight Certificate-Army

#### DA Form 759-1

Individual Flight Record and Flight Certificate-Army-Closeout Summary

#### **DA Form 2028**

Recommended Changes to Publications and Blank Forms

#### **DA Form 1352**

Army Aircraft Inventory, Status, and Flying Time

#### **DA Form 2173**

Statement of Medical Examination and Duty Status

#### DA Form 2404

Equipment Inspection and Maintenance Worksheet

#### **DA Form 2407**

Maintenance Request (Available through normal forms supply channels).

## DA Form 2408-series

Aircraft Operational and Maintenance Forms

# DA Form 2408-5

Equipment Modification Record

#### DA Form 2408-12

Army Aviator's Flight Record

## DA Form 2408-13

Aircraft Status Information Record

## DA Form 2408-14

Uncorrected Fault Record (Available through normal supply channels.)

#### DA Form 2408-15

Historical Record for Aircraft (Available through normal supply channels.)

## DA Form 2408-16

Aircraft Component Historical Record (Available through normal supply channels.)

# DA Form 2408-18

Equipment Inspection List (Available through normal supply channels.)

#### DA Form 2408-20

Oil Analysis Record

# DA Form 2410

Component Removal and Repair/Overhaul Record

#### **DA Form 3946**

Military Police Traffic Accident Report

#### **DD Form 175–1**

Flight Weather Briefing

#### DD Form 314

Preventive Maintenance Schedule and Record (Available through normal supply channels.)

#### DD Form 365

Weight and Balance Personnel, Record of

#### DD Form 365-4

Weight and Balance Clearance Form F-Transport/Tactical (Available through normal supply channels.)

#### DOL Form CA-1

Federal Notice of Traumatic Injury and Claim for Continuation of Pay/Compensation (Available at www.dol.gov/.)

#### DOL Form CA-2

Notice of Occupation Disease and Claim for Compensation (Available at www.dol.gov/.)

#### OF 346

U.S. Government Motor Vehicle Operator's Identification Card (Available through normal supply channels.)

#### OSHA Form 300

Log of Federal Occupational Injuries and Illnesses (Available from www.osha.gov/.)

#### OSHA Form 300A

Summary Log of Federal Occupational Injuries and Illnesses (Available from www.osha.gov/.)

#### OSHA Form 301

Injury and Illness Incident Report (Available from www.osha.gov/.)

#### SF 368

Product Quality Deficiency Report

#### SF 503

Medical Record - Autopsy Protocol

#### SF 543

Contributor's List of Pathological Material (Available through normal forms supply channels)

#### Appendix B

#### Explanations, Examples, and Keywords

#### B-1. Introduction

These explanations and examples are provided so all users will have the same understanding of what the factors mean. Where appropriate, a list of key words is given for each factor. These keywords, when appropriate, may be used instead of the factor term.

#### B-2. Tables

For ease of use, this appendix is organized as follows:

- a. Table B-1. Aviation-Specific Mistakes/Task Errors.
- b. Table B–2. Ground-Specific Mistakes/Task Errors. This table lists codes and explanations for ground specific task errors. Mistakes/errors are organized into three groups: general, vehicle specific and supervisory specific.
- c. Table B-3. Materiel Failures/Malfunctions. Use these definitions to assist in determining what materiel failure/malfunction occurred that caused/contributed to the accident.
- d. Table B-4. Environmental Conditions. Use these definitions to assist in determining what environmental conditions caused/contributed to the accident.

- e. Table B–5. System Inadequacies/Root Causes/Readiness Shortcomings. These explanations are provided so all users will have the same understanding of what the readiness shortcomings (root causes) for mistakes/errors, materiel failures, and environmental conditions mean.
  - f. Table B-6. Recommendations/Controls/Corrective Actions/Countermeasures.

*Note.* Prefix remedial codes as follows: "U" for unit level (company, troop, battalion); "H" for higher level (brigade, division, corps, Army Headquarters); and "A" for DA level (to include ACOM, ASCC, DRU, Army Headquarters with Army level proponency) to indicate the level of command where the action is directed.

Table B-1 Aviation specific	
Individual Task Errors	Errors made by personnel not in a supervisory capacity or a supervisor that makes an error not relat- ing to supervisory responsibilities. For example, it is an individual error if a supervisor is injured because he was not using the required equipment.
Code: P01	
Keyword/explanation:	Scan - Failure to properly direct visual attention inside or outside the aircraft, (for example, too much or too little time on one object/area/activity); scan pattern not thorough or systematic; channelizing/fixating attention, allowing attention to be drawn away from the scanning process so that visual information important to decisionmaking and/or aircraft control is missed and/or not acted upon.
Code: P02	
Keyword/explanation:	Maintain/recover orientation - Failure to properly execute procedures necessary to maintain or re- cover orientation in flight environments know to restrict visibility, (for example, fog, clouds, blowing snow/dust, and over black water or other spatial disorientation producing conditions). Loss of situa- tional awareness.
Code: P03	
Keyword/explanation:	In-flight planning - Failure to properly modify flight planning or procedure(s) in response to in-flight events, conditions, or circumstances. Improperly modifying the plan during execution.
Code: P04	
Keyword/explanation:	Preflight planning - Failure to choose appropriate flight options for known conditions and contingen- cies and develop these into a course of action to maximize probability of mission accomplishment.
Code: P05	
Keyword/explanation:	Improperly failed to estimate distance/closure/control input - Failure to accurately judge distance be- tween objects, rate of closure with objects, or the amount of control input required to properly maneuver aircraft (over/under control).
Code: P06	
Keyword/explanation:	Failed to detect hazards/obstacles - Failure to identify obstacles or recognize hazardous conditions; such as, obstacles in landing area, unsecured or improperly secured equipment/cargo/PAX, improper control/switch position, crewmember, or aircraft performance out of/going out of acceptable limits, ad- verse environmental conditions.
Code: P07	
Keyword/explanation:	Failed to diagnose/respond to emergency - Failure to properly identify and/or respond to actual, sim- ulated, or perceived emergency. "Properly" includes timeliness of identification and/or response as well as appropriateness of procedure(s) and/or control inputs.
Code: P08	
Keyword/explanation:	Coordination - Crew/work group coordination is the interaction between crewmembers/work group members (communication) and actions (sequence or timing) necessary for tasks to be performed efficiently, effectively, and safely.

Table B-1 Aviation specific—Continued	
	Direct/request assistance - Failure to properly direct or request assistance from non-flying crewmem- bers (for example, provide information on airspeed, altitude, engine; or assist with aircraft clearance and control; failure to request assistance from more experienced coworker in making complex repair for first time).
	Announcement decision/action - Failure to announce decision or action that affects other crewmem- bers'/work group members' duties.
	Positive communication - Lack of positive communication (transmission, acknowledgement, confirmation) using standard terminology with specific qualifiers.
	Assign responsibilities - Failure of ABC, AMC, AUC, FCO, IP and other supervisor to properly assign responsibilities.
	Offer assistance - Failure to offer assistance or information requested or needed by the flying pilot/ work group members.
	Action sequence - Improper sequencing or timing of actions. Crew-member/work group member initi- ated action before clearance to do so.
Code: P09	
Keyword/explanation:	Failed to use/follow list(s) to perform before/during/after operations/inspections of aircraft/equipment.
Code: P10	
Keyword/explanation:	Failed to follow maintenance manual (TM, SOP) instructions in servicing aircraft/equipment.
Code: P11	
Keyword/explanation:	Failed to follow proper instructions (TM, TB, MWO) while repairing/installing/adjusting equipment/component/part.
Code: P12	
Keyword/explanation:	Inspection - Inadequately/improperly inspected aircraft/equipment to determine its operational readi- ness, (for example, failed to search for/detect hazards). Inspection actions should include the follow- ing:
	Access panel latches not serviceable/fastened.
	Tools left in improper places, FOD.
	Bearings not lubricated.
	Damage to equipment.
Code: P13	
Keyword/explanation:	Failed to read/follow SOPs, notices, ARs, general rules/principles, to get needed information for job performance, or knowingly violates ARs, SOPs, and rules.
Code: P14	
Keyword/explanation:	Inadequate tool/equipment accountability. Failed to maintain strict equipment accountability, such as for tools and cleaning materials (for self or others).
Code: P15	
Keyword/explanation:	Failed to secure materiel/equipment/cargo subject to being blown or thrown about/damaged by wind/ rotorwash/turbulence/crash forces, (for example, ground equipment, pads, TA-50, ammunition, tool chests, and medical equipment).
Leader/supervisory task errors-	Errors made by personnel acting in a leader or supervisory capacity in which they failed to execute a task associated with supervisory responsibilities.
Code: P16	

Table B-1 Aviation specific—Continued	
Keyword/explanation:	Inadequately/improperly selected LZ/termination point; for example, size, obstacles/environmental hazards/aircrew experience.
Code: P17	
Keyword/explanation:	Improperly prepared LZ; for example, type/placement of landing markers/detection/removal of obsta- cles/hazards.
Code: P18	
Keyword/explanation:	Improper mix/match/number of personnel for job/mission (level of proficiency/fatigue).
Code: P19	
Keyword/explanation:	Inadequate time allowed for pre-mission preparation. Set mission launch time which did not allow ad- equate pre-mission preparation
Code: P20	
Keyword/Explanation:	Set/permitted inappropriate mission launch time for environment/ weather conditions.
Code: P21	
Keyword/explanation:	Permitted inappropriate selection of LZ/touchdown or termination point for aircrew experience/level of training intended.
Code: P22	
Keyword/explanation:	Failed to ensure repairs, services, modifications, installations, or maintenance such as lubrication/in- spections, were completed in accordance with TMs, SOPs.
Code: P23	
Keyword/explanation:	Failed to take appropriate/timely actions to prevent or stop violations of safe operations/procedures.
Code: P24	
Keyword/explanation:	Inadequate mission planning.
	Risk management, operational and logistical decisions.
	In-flight planning - Failure to properly modify flight planning or procedure(s) in response to in-flight events, conditions, or circumstances Improperly modifying the plan during execution.
	Preflight planning - Failure to choose appropriate flight options for known conditions and contingen- cies and develop these into a course of action to maximize probability of mission accomplishment
Code: P25	
Keyword/explanation:	Failed to brief/provide information adequate for mission accomplishment.
Code: P97	
Keyword/explanation:	Insufficient information to determine the mistake or task error.

Table B-2 Ground Specific	
Individual mistakes/task errors	Errors made by personnel not in a supervisory capacity or a supervisor that makes an error not related to supervisory responsibilities. For example, a supervisor was injured because he failed to wear his seatbelt.
Code: 01	
Keyword/explanation:	Inadequate planning - Failed to properly organize or coordinate. Improper modification of the plan during execution.
Code: 02	
Keyword/explanation:	Improperly/failed to lock/block/secure, (for example, load).

or TM to perform the inspection.  Code: 04  Keyword/explanation:  Improper application of safety equipment, device, guard, sign, signal, or PPE. Failed to adhere to posted warning signa/signals/guards. Failed to use required safety equipment, device, guard, sign, signa or PPE. Failed to use required safety equipment, device, guard, sign, signa or PPE.  Code: 05  Code: 06  Keyword/explanation: Operating while fatigued when not necessary/directed. Code: 06  Keyword/explanation: Improper use of equipment - Did not use equipment when required. Used right equipment improperty. Used wrong equipment. Code: 07  Keyword/explanation: Improper lifting - Used incorrect lifting technique. Failed to use appropriate assistance. Code: 08  Keyword/explanation: Failed to use appropriate precautions for adverse environmental conditions (rain, haze, fog, snow, ice, reduced visibility). Code: 09  Keyword/explanation: Improper body position - Hazardous position. Awkward position. Unprotected position (sleeping, eating). Code: 10  Keyword/explanation: Improperly walked, ran, or climbed. Code: 11  Keyword/explanation: Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations). Failed to pay attention. Improperly divided attention. Improperly divided attention. Improperly scanned. Fell asleep.	Table B-2 Ground Specific—Continued	
ing, after operations check). Failed to use the appropriate checklis or Thi to perform the inspection.  Code: 04  Keyword/explanation:  Improper application of safety equipment, device, guard, sign, signal, or PPE.  Failed to adhere to posted warning signs/signals/guards. Failed to adhere to posted warning signs/signals/guards. Failed to use required safety equipment, device, guard, sign, signal or PPE.  Code: 05  Code: 06  Keyword/explanation:  Operating while fatigued when not necessary/directed.  Operating while fatigued when not necessary/directed.  Used right equipment when required.  Used wrong equipment.  Code: 07  Used wrong equipment.  Code: 07  Used wrong equipment.  Code: 08  Keyword/explanation:  Improper litting - Used incorrect litting technique.  Failed to use appropriate assistance.  Code: 08  Keyword/explanation:  Failed to use appropriate precautions for adverse environmental conditions (rain, haze, fog. snow, ice, reduced visibility).  Code: 09  Keyword/explanation:  Improper body position -  Hazardous position.  Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation:  Improperly waiked, ran, or climbed.  Code: 11  Keyword/explanation:  Failed to stay slert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Improperly waiked attention.  Improperly waiked attention.  Improperly divided attention.  Improperly invided attention.  Improperly scanned.  Failed to pay attention.  Improperly monitored.  Improperly scanned.  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).	Code: 03	
Keyword/explanation:  Improper application of safety equipment, device, guard, sign, signal, or PPE. Falled to adhere to posted warning signs/signals/guards. Failed to use required safety equipment, device, guard, sign, signa or PPE. Code: 05  Keyword/explanation: Operating while fatigued when not necessary/directed. Code: 06  Keyword/explanation: Improper use of equipment - Did not use equipment improperly. Used wrong equipment.  Code: 07  Keyword/explanation: Improper lifting - Used incorrect lifting technique. Failed to use appropriate assistance.  Code: 08  Keyword/explanation: Failed to take appropriate precautions for adverse environmental conditions (rain, haze, fog, snow, ice, reduced visibility).  Code: 09  Keyword/explanation: Improper body position - Hazardous position. Alveward position.  Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation: Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operating).  Failed to pay attention.  Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation: Failed to pay attention.  Improperly walked attention.  Improperly individed attention.  Improperly indi	Keyword/explanation:	ing, after operations check). Failed to use the appropriate checklist
nal, or PPE. Failed to adhere to posted warning signs/signals/guards. Failed to use required safety equipment, device, guard, sign, signa or PPE.  Code: 05  Keyword/explanation: Operating while fatigued when not necessary/directed.  Code: 06  Keyword/explanation: Improper use of equipment - Did not use equipment when required. Used right equipment improperly. Used wrong equipment.  Code: 07  Lyed wrong equipment.  Code: 08  Keyword/explanation: Used incorrect lifting technique. Failed to use appropriate assistance.  Code: 08  Keyword/explanation: Failed to take appropriate precautions for adverse environmental conditions (rain, haze, fog, snow, ice, reduced visibility).  Code: 09  Keyword/explanation: Hrazardous position. Awkward position. Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation: Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation: Improperly divided attention. Improperly divided attention. Improperly divided attention. Improperly scanned. Failed to pay attention. Improperly scanned. Failed to pay attention. Improperly scanned. Failed to pay attention. Improperly scanned. Failed to pay attention. Improperly scanned. Failed to pay attention. Improperly scanned. Failed to pay attention. Improperly scanned. Failed to pay attention. Improperly scanned. Failed to ensure adequate clearance/space (enough room) for operation. Code: 12  Keyword/explanation: Failed to ensure adequate clearance/space (enough room) for operation. Failed to ensure adequate clearance/space (enough room) for operation. Failed to ensure adequate clearance/space (enough room) for operation. Code: 13  Keyword/explanation: Misjudged clearance (improperly estimated/evaluated).	Code: 04	
Failed to use required safety equipment, device, guard, sign, signa of PPE.  Code: 05  Keyword/explanation: Operating while fatigued when not necessary/directed.  Operating while fatigued when not necessary/directed.  Improper use of equipment - Did not use equipment when required. Used right equipment improperly. Used wrong equipment.  Code: 07  Code: 07  Light on tuse appropriate precautions for adverse environmental conditions (rain, haze, fog., snow, ice, reduced visibility).  Code: 08  Keyword/explanation:  Improper body position - Hazardous position.  Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation:  Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation:  Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation:  Improperly divided attention.  Improperly divided attention.  Improperly divided attention.  Improperly scanned.  Failed to pay attention.  Improperly scanned.  Failed to pay attention.  Improperly scanned.  Failed to eaure adequate clearance/space (enough room) for operation.  Code: 12  Keyword/explanation:  Failed to sure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Aligning deltastion (improperly estimated/evaluated).	Keyword/explanation:	
or PPE.  Code: 05  Keyword/explanation:  Code: 06  Keyword/explanation:  Did not use equipment - Did not use equipment improperly.  Used right equipment improperly.  Used right equipment.  Code: 07  Keyword/explanation:  Improper lifting - Used incorrect lifting technique.  Failed to take appropriate assistance.  Code: 08  Keyword/explanation:  Failed to take appropriate precautions for adverse environmental conditions (rain, haze, fog, snow, ice, reduced visibility).  Code: 09  Keyword/explanation:  Improper body position - Hazardous position.  Awkward position.  Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation:  Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation:  Improperly walked, ran, or climbed.  Code: 11  Failed to pay attention.  Improperly divided attention.  Improperly divided attention.  Improperly divided attention.  Improperly divided attention.  Improperly divided attention.  Improperly walked, ran, or climbed.  Code: 12  Keyword/explanation:  Failed to pay attention.  Improperly divided attention.  Improperly divided attention.  Improperly walked, ran, or climbed.  Code: 12  Keyword/explanation:  All passep.  Failed to pay attention.  Improperly divided attention.  Improperly divided attention.  Improperly walked, ran, or climbed.  Code: 12  Keyword/explanation:  All passep.  Code: 12  Keyword/explanation:  All passep.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).		Failed to adhere to posted warning signs/signals/guards.
Keyword/explanation:  Operating while fatigued when not necessary/directed.  Code: 06  Keyword/explanation:  Improper use of equipment -  Did not use equipment when required.  Used right equipment improperly.  Used wrong equipment.  Code: 07  Keyword/explanation:  Improper lifting -  Used incorrect lifting technique.  Failed to use appropriate assistance.  Code: 08  Keyword/explanation:  Failed to take appropriate precautions for adverse environmental conditions (rain, haze, fog, snow, ice, reduced visibility).  Code: 09  Keyword/explanation:  Improper body position -  Hazardous position.  Awkward position.  Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation:  Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation:  Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention.  Improperly divided attention.  Improperly divided attention.  Improperly monitored.  Improperly monitored.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Aliendrone defense.		Failed to use required safety equipment, device, guard, sign, signal or PPE.
Code: 06 Keyword/explanation:  Did not use equipment when required. Used right equipment myen required. Used wrong equipment.  Code: 07 Keyword/explanation:  Improper lifting - Used incorrect lifting technique. Failed to use appropriate assistance.  Code: 08 Keyword/explanation:  Failed to take appropriate assistance.  Code: 09  Keyword/explanation:  Improper body position - Hazardous position. Awkward position. Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation:  Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation: Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention. Improperly divided attention. Improperly divided attention. Improperly divided attention. Improperly monitored. Improperly scanned. Fell asleep.  Code: 12  Keyword/explanation: Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation: Misjudged clearance (improperly estimated/evaluated).	Code: 05	
Keyword/explanation:  Improper use of equipment - Did not use equipment when required.  Used right equipment improperly.  Used wrong equipment.  Code: 07  Keyword/explanation:  Improper lifting - Used incorrect lifting technique. Failed to use appropriate assistance.  Code: 08  Keyword/explanation:  Failed to take appropriate precautions for adverse environmental conditions (rain, haze, fog, snow, ice, reduced visibility).  Code: 09  Keyword/explanation:  Improper body position - Hazardous position.  Awkward position.  Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation:  Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation:  Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention.  Improperly divided attention.  Improperly divided attention.  Improperly monitored.  Improperly monitored.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).	Keyword/explanation:	Operating while fatigued when not necessary/directed.
Did not use equipment when required.  Used right equipment improperly.  Used wrong equipment.  Code: 07  Keyword/explanation:  Used incorrect lifting technique. Failed to use appropriate assistance.  Code: 08  Keyword/explanation:  Failed to take appropriate precautions for adverse environmental conditions (rain, haze, fog, snow, ice, reduced visibility).  Code: 09  Keyword/explanation:  Improper body position - Hazardous position. Awkward position. Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation:  Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation: Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention. Improperly divided attention. Improperly divided attention. Improperly monitored. Improperly monitored. Improperly scanned. Fell asteep.  Code: 12  Keyword/explanation: Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation: Misjudged clearance (improperly estimated/evaluated).	Code: 06	
Used right equipment improperly. Used wrong equipment.  Code: 07  Keyword/explanation:  Improper lifting -  Used incorrect lifting technique.  Failed to use appropriate assistance.  Code: 08  Keyword/explanation:  Failed to take appropriate precautions for adverse environmental conditions (rain, haze, fog, snow, ice, reduced visibility).  Code: 09  Keyword/explanation:  Improper body position -  Hazardous position.  Awkward position.  Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation:  Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation:  Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention.  Improperly divided attention.  Improperly divided attention.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).	Keyword/explanation:	Improper use of equipment -
Used wrong equipment.  Code: 07  Keyword/explanation: Improper lifting - Used incorrect lifting technique. Failed to use appropriate assistance.  Code: 08  Keyword/explanation: Failed to take appropriate precautions for adverse environmental conditions (rain, haze, fog, snow, ice, reduced visibility).  Code: 09  Keyword/explanation: Improper body position - Hazardous position. Awkward position. Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation: Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation: Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention. Improperly divided attention. Improperly divided attention. Improperly monitored. Improperly scanned. Fell asleep.  Code: 12  Keyword/explanation: Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation: Misjudged clearance (improperly estimated/evaluated).		Did not use equipment when required.
Code: 07  Keyword/explanation:  Improper lifting -  Used incorrect lifting technique.  Failed to use appropriate assistance.  Code: 08  Keyword/explanation:  Failed to take appropriate precautions for adverse environmental conditions (rain, haze, fog, snow, ice, reduced visibility).  Code: 09  Keyword/explanation:  Improper body position -  Hazardous position.  Awkward position.  Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation:  Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation:  Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention.  Improperly divided attention.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).		Used right equipment improperly.
Keyword/explanation:  Improper lifting -  Used incorrect lifting technique.  Failed to use appropriate assistance.  Code: 08  Keyword/explanation:  Failed to take appropriate precautions for adverse environmental conditions (rain, haze, fog, snow, ice, reduced visibility).  Code: 09  Keyword/explanation:  Improper body position -  Hazardous position.  Awkward position.  Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation:  Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation:  Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention.  Improperly divided attention.  Improperly monitored.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).		Used wrong equipment.
Used incorrect lifting technique. Failed to use appropriate assistance.  Code: 08  Keyword/explanation: Failed to take appropriate precautions for adverse environmental conditions (rain, haze, fog, snow, ice, reduced visibility).  Code: 09  Keyword/explanation: Improper body position - Hazardous position. Awkward position. Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation: Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation: Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention. Improperly divided attention. Improperly monitored. Improperly monitored. Improperly scanned. Fell asleep.  Code: 12  Keyword/explanation: Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation: Misjudged clearance (improperly estimated/evaluated).	Code: 07	
Failed to use appropriate assistance.  Code: 08  Keyword/explanation:  Failed to take appropriate precautions for adverse environmental conditions (rain, haze, fog, snow, ice, reduced visibility).  Code: 09  Keyword/explanation:  Improper body position -  Hazardous position.  Awkward position.  Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation:  Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation:  Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention.  Improperly divided attention.  Improperly monitored.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).	Keyword/explanation:	Improper lifting -
Code: 08  Keyword/explanation:  Failed to take appropriate precautions for adverse environmental conditions (rain, haze, fog, snow, ice, reduced visibility).  Code: 09  Keyword/explanation:  Improper body position -  Hazardous position.  Awkward position.  Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation:  Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation:  Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention.  Improperly divided attention.  Improperly monitored.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).		Used incorrect lifting technique.
Keyword/explanation:  Failed to take appropriate precautions for adverse environmental conditions (rain, haze, fog, snow, ice, reduced visibility).  Code: 09  Keyword/explanation:  Improper body position -  Hazardous position.  Awkward position.  Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation:  Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation:  Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention.  Improperly divided attention.  Improperly monitored.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).		Failed to use appropriate assistance.
conditions (rain, haze, fog, snow, ice, reduced visibility).  Code: 09  Keyword/explanation:  Improper body position -  Hazardous position.  Awkward position.  Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation:  Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation:  Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention.  Improperly divided attention.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).	Code: 08	
Keyword/explanation:  Improper body position - Hazardous position.  Awkward position.  Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation:  Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation:  Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention.  Improperly divided attention.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).	Keyword/explanation:	
Hazardous position.  Awkward position.  Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation:  Improperly walked, ran, or climbed.  Code: 11  Keyword/explanation:  Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention.  Improperly divided attention.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).	Code: 09	
Awkward position.  Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation:  Code: 11  Keyword/explanation:  Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention.  Improperly divided attention.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).	Keyword/explanation:	Improper body position -
Unprotected position (sleeping, eating).  Code: 10  Keyword/explanation:  Code: 11  Keyword/explanation:  Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention.  Improperly divided attention.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).		Hazardous position.
Code: 10  Keyword/explanation:  Code: 11  Keyword/explanation:  Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention.  Improperly divided attention.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).		Awkward position.
Keyword/explanation:  Code: 11  Keyword/explanation:  Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention.  Improperly divided attention.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).		Unprotected position (sleeping, eating).
Code: 11  Keyword/explanation:  Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention.  Improperly divided attention.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).	Code: 10	
Keyword/explanation:  Failed to stay alert, remain awake, or attentive to what was happening (situational awareness to environment, conditions, or operations).  Failed to pay attention.  Improperly divided attention.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).	Keyword/explanation:	Improperly walked, ran, or climbed.
ing (situational awareness to environment, conditions, or operations).  Failed to pay attention.  Improperly divided attention.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).	Code: 11	
Improperly divided attention.  Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).	Keyword/explanation:	
Improperly monitored.  Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).		Failed to pay attention.
Improperly scanned.  Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).		Improperly divided attention.
Fell asleep.  Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).		Improperly monitored.
Code: 12  Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).		Improperly scanned.
Keyword/explanation:  Failed to ensure adequate clearance/space (enough room) for operation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).		Fell asleep.
ation.  Code: 13  Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).	Code: 12	
Keyword/explanation:  Misjudged clearance (improperly estimated/evaluated).	Keyword/explanation:	Failed to ensure adequate clearance/space (enough room) for operation.
	Code: 13	
Code: 14	Keyword/explanation:	Misjudged clearance (improperly estimated/evaluated).
	Code: 14	

Table B-2 Ground Specific—Continued	
Keyword/explanation:	Improper weapons and ammunition handling -
	Improper sighting, aiming, firing, throwing.
	Unauthorized use or handling.
	Improper carrying, lifting, transporting.
	Improper clearing, disarming, unloading.
	Improper assembling, cleaning, disassembling.
	Improper disposal or turn-in.
Code: 16	
Keyword/explanation:	Improperly pulled or pushed equipment or material.
Code: 17	
Keyword/explanation:	Failed to firmly grip/hold equipment/material.
Code: 18	
Keyword/explanation:	Inadequate improvising/troubleshooting.
Code: 19	
Keyword/explanation:	Inadequate crew coordination/communication.
	Improper actions sequence - improper sequencing or timing of actions with other crewmembers; for example, driver initiated vehicle movement before receiving clearance from ground guide or senior occupant.
	Failure to offer assistance, information, or warning, (for example, driver failed to warn other crew- members of impending hazard (rollover)).
	Lack of positive communication, (for example, transmission, acknowledgement, or confirmation using standard terminology with specific qualifiers); (for example, tank commander failing to confirm crew- members were clear before traversing turret).
	Failure to announce decision/action that affects other crewmembers' duties, (for example, occupant failed to announce to the driver their decision to dismount the vehicle during a momentary halt).
	Failed to direct/request assistance from other crewmembers, (for example, although neither track command (TC) nor driver could see, the TC failed to direct a crewmember to dismount and act as a ground guide).
Code: 20	
Keyword/explanation:	Improper assembly.
Code: 21	
Keyword/explanation:	Under the influence of drugs or alcohol.
Codes 22–39 reserved for future use.	
	VEHICLE/EQUIPMENT SPECIFIC
Code: 40	
Keyword/explanation:	Excessive speed.
	Exceeding the posted speed limits.
	Excessive speed for conditions.
Code: 41	
Keyword/explanation:	Improper passing.
	Misjudged clearance while passing.
	Passing at an unsafe time or place.
	Failed to take precautions when passing pedestrians.

Table B-2 Ground Specific—Continued	
Code: 42	
Keyword/explanation:	Improper turning.
	Failed to yield the right-of-way while turning.
	Oversteering while turning.
	Improper U-Turn.
Code: 43	
Keyword/explanation:	Failed to yield the right-of-way other than when turning.
Code: 44	
Keyword/explanation:	Failed to stop at a controlled intersection.
Code: 45	
Keyword/explanation:	Improperly stopped or parked.
Code: 46	
Keyword/explanation:	Improper backing.
Code: 47	
Keyword/explanation:	Failed to use a ground guide when required.
Code: 48	
Keyword/explanation:	Ground guide used improper/incorrect position, signal, or procedure
Code: 49	
Keyword/explanation:	Following too close for environmental conditions or vehicle speed/design.
Code: 50	
Keyword/explanation:	Driving in the wrong lane.
Code: 51	
Keyword/explanation:	Improper lane change.
Code: 52	
Keyword/explanation:	Improper braking.
	Improper placement on the pedal.
	Too much or too little pressure.
	Applied too soon or too late.
Code: 53	
Keyword/explanation:	Improperly shifted/placed gear selector on vehicle or equipment.
Code: 54	
Keyword/explanation:	Abrupt control/steering response (except while turning).
Code: 55	
Keyword/explanation:	Improperly mounted or dismounted vehicle/equipment.
Code: 56	
Keyword/explanation:	Operating vehicle/equipment with known malfunction/unsafe mechanical conditions.
Codes: 57–74 reserved for future use.	
Leader/Supervisory Mistakes/Task Errors-Errors made execute a task associated with supervisory responsi	de by personnel acting in a leader or supervisory capacity in which they failed to ibilities.
Code: 75	

Table B-2 Ground Specific—Continued	
Keyword/explanation:	Improper personnel selection/assignment.
	Inexperienced.
	Untrained.
	Unlicensed.
	Impaired, (for example, fatigued).
Code: 76	
Keyword/explanation:	Knowingly allowed equipment operator to violate procedures.
Code: 77	
Keyword/explanation:	Failure to ensure proper positioning of personnel prior to vehicle/ equipment operation.
Code: 78	
Keyword/explanation:	Failure to brief or provide adequate information.
Code: 79	
Keyword/explanation:	Failure to assign responsibilities before or during the mission.
Code: 80	
Keyword/explanation:	Inadequately/improperly selected site location/termination point, (fo example, size, obstacles/envi- ronmental hazards/crew experience)
Code: 81	
Keyword/explanation:	Improperly prepared site location, (for example, type/placement of markers/detection/removal of ob- stacles/hazards).
Code: 82	
Keyword/explanation:	Failed to ensure adequate inspection/check of vehicle or equipmen (before, during, after operations check) was conducted. Failed to en sure the appropriate checklist or TM to perform the inspection was used.
Code: 83	
Keyword/explanation:	Failed to conduct adequate pre-mission inspection of personnel or equipment.
Code: 84	
Keyword/explanation:	Failed to ensure repairs, services, modifications, installations, or maintenance such as lubrication/in- spections, were completed in accordance with appropriate TMs and SOPs.
Code: 85	
Keyword/explanation:	Failed to take appropriate/timely actions to prevent or stop violations of safe operations/procedures; for example, make on the spot corrections.
Code: 86	
Keyword/explanation:	Failed to enforce use of personal protective equipment.
Code: 87	
Keyword/explanation:	Inadequate mission planning.
	Inadequate time allowed for pre-mission preparation. Set mission start time which did not allow ade- quate pre-mission preparation.
	Set/permitted inappropriate mission start time for environmental/ weather conditions.
	Mission execution - failure to properly modify the plan or procedure(s) in response to mission events, conditions, or circumstances Improperly modifying the plan during execution.

Table B-2 Ground Specific—Continued	
	Pre-mission planning - failure to choose appropriate options for known conditions and contingencies and develops this into a course of action to maximize probability of mission accomplishment. Risk management, operational, and logistical decisions.
Code: 97	
Keyword/explanation:	Insufficient information to determine the mistake or task error.

Materiel failures/malfunctions  Code: M01	
	1
Keyword/explanation:	Overheated/burned/melted. Key words: blister, boil, carbonize, char- flame, fuse, or glaze. Excessive heat caused materiel or equipment to fail or malfunction.
Code: M02	
Keyword/explanation:	Froze (temperature). Key words: congeal or solidify. Excessive cold caused materiel/equipment to fail/malfunction.
Code: M03	
Keyword/explanation:	Obstructed/pinched/clogged. Key words: block, crimp, or restrict. Function of materiel or equipment was hindered or completely cut off by an obstacle.
Code: M04	
Keyword/explanation:	Vibrated. Key words: oscillate or shake. Side-to-side or forward-and-backward movement of materiel or equipment caused it to fail or malfunction.
Code: M05	
Keyword/explanation:	Rubbed/worn/frayed. Key words: abrade, chafe, fret, groove, score or scrape. Friction-producing movement was applied to materiel or equipment to such and extent that it failed or malfunctioned.
Code: M06	
Keyword/explanation:	Corroded/rusted/pitted. Key words: erode or oxidize. Gradual wearing away (usually by chemical ac- tion) of materiel or equipment to such an extent that it failed or malfunctioned.
Code: M07	
Keyword/explanation:	Overpressured/burst. Key words: balloon, bulge, explode, rupture, or swell. Steady or abrupt force was applied over the surface of materiel or equipment to such an extent that it failed or malfunc- tioned.
Code: M08	
Keyword/explanation:	Pulled/stretched. Key word; elongate. Steady or abrupt force applied to materiel or equipment caused it to move toward the force, in whole or in part, to such an extent that it failed or malfunctioned.
Code: M09	
Keyword/explanation:	Twisted/torqued. Key word: turn. Steady or abrupt application of twisted forces caused materiel or equipment to fail or malfunction.
Code: M10	
Keyword/explanation:	Compressed/hit/punctured. Key words: chip, collapse, crush, dent, nick, pinch, press. Steady or abrupt application of force that presses/impacts materiel or equipment causing it to fail or malfunction.
Code: M11	
Keyword/explanation:	Bent/warped. Key words: bow or buckle. Changing materiel or equipment from an original straight, level, or even condition through the application of force to such an extent that it failed or malfunctioned.

Table B-3 Materiel failures/malfunctions—Continued	
Code: M12	
Keyword/explanation:	Sheared/cut. Key words: chop or sever. Failure or malfunction was caused by steady or abrupt force applied to materiel, resulting in a break with the two parts sliding parallel to each other in different directions.
Code: M13	
Keyword/explanation:	Decayed/decomposed. Key words: mildew, rot, or spoil. Chemical or biological action resulted in a gradual decline in materiel or equipment strength to such an extent that if failed or malfunctioned.
Code: M14	
Keyword/explanation:	Electric current action. Key words: short, arc, fusing, grounding, amperage, voltage, surge. Action of electric current caused materiel or equipment to fail or malfunction.
Code: M15	
Keyword/explanation:	No defect but does not meet the mission requirements.
Code: M97	
Keyword/explanation:	Insufficient information to determine type of failure.

Table B-4 Environmental conditions	
Code: E01	
Keyword/explanation:	Illumination. Key words: bright, dark, dim, glare, or light. Too much or too little light that was a nega- tive influence on vision.
Code: E02	
Keyword/explanation:	Precipitation. Key words: condensation, fog, frost, hail, ice, mist, rain, sleet, or snow. Climatic precipi- tation that has a negative influence on human or machine performance.
Code: E03	
Keyword/explanation:	Contaminants. Key words: carbon dioxide, carbon monoxide, chemicals, dust, foreign/debris, fumes, gases, impurities, mists, smog, smoke, toxic materials, or vapors. Natural or manmade elements that render material or the environment unsatisfactory for human or machine use and have a negative in- fluence on performance.
Code: E04	
Keyword/explanation:	Noise. Key words: bang, din, explosion, shout, or static. Unwanted sound that produces hearing loss, disturbs/distracts attention from task at hand, or interfered with communication.
Code: E05	
Keyword/explanation:	Temperature/humidity. Key words: blow, blast, gust, hurricane, storm, tornado, or turbulence. Natural or manmade air movement that has a negative influence on human or machine performance.
Code: E06	
Keyword/explanation:	Wind/turbulence. Key words: blow, blast, gust, hurricane, storm, tornado, or turbulence. Natural or manmade air movement that has a negative influence on human or machine performance.
Code: E07	
Keyword/explanation:	Vibration. Key words: bounce, buck, bump, jar, jolt, jump, oscillate, roll, shake, vibrate, shimmy, or sway. Repeated/periodic motions that have a negative influence on human or machine performance.
Code: E08	
Keyword/explanation:	Acceleration/deceleration. Forces experienced by personnel/materiel due to rate of change of veloci- ty.

Table B-4 Environmental conditions—Continued	
Code: E09	
Keyword/explanation:	Radiation. Key words: alpha radiation, beta radiation, gamma radiation, ionizing, laser, maser, neu- tron radiation, non-ionizing, radio waves, sunlight, ultraviolet, or X radiation. Radiant energy emitted in waves or particles that have a negative influence on human or machine performance.
Code: E10	
Keyword/explanation:	Work surface/space. Keywords: holes, inclines, rocky, rough, rutted, slippery, steep, or uneven wave action. Conditions (excluding precipitation) of natural or manmade work surfaces on which personnel and machines operate that have a negative influence on performance.
Code: E11	
Keyword/explanation:	Air pressure. Key words: altitude, bends, blast, boom, chokes, decompression, explosion, or hypoxia. Sudden or gradual changes in air pressure that have a negative influence on human or machine per- formance.
Code: E12	
Keyword/explanation:	Electricity. Key words: burn out, electrocute, discharge, ground, lighting, shock, short, or static. Natu- ral or manmade electrical current that has a negative influence on human or machine performance.
Code: E13	
Keyword/explanation:	Animals. Key words: bitten, burrowed, chewed, clawed, infects, infested, pecked, poisoned, scratched, stung, flew into. The actions or presence of animals that injures personnel, cause person- nel to make errors, damage equipment, or cause equipment to malfunction.
Code: E97	
Keyword/explanation:	Insufficient information to identify environmental conditions.
Code: E98	
Keyword/explanation:	Not applicable, not caused by Army. Army had no contributing role.
Code: E99	
Keyword/explanation:	Insufficient information reported to identify the cause.

# Table B-5 System inadequacies/readiness shortcomings/root causes ("Why" the error/failure/malfunction occurred) LEADER FAILURE occurs when leaders fail to monitor mission execution and planning, correct inappropriate behavior, take appropri- ate action, or emphasize correct procedures that allowed subordinates to commit task errors or results in a materiel failure.

Code: 01	
Keyword/explanation:	Inadequate/improper supervision by higher command.
Code: 02	
Keyword/explanation:	Inadequate/improper supervision by staff officer.
Code: 03	
Keyword/explanation:	Inadequate/improper supervision by unit command.
Code: 04	
Keyword/explanation:	Inadequate/improper supervision by direct supervisor/noncommissioned officer in charge/platoon leader/instructor. Note: Inadequate supervision becomes a root cause when it leads to accident-causing personnel mistakes or materiel failure/malfunctions. Inadequate supervision is more clearly identi- fiable at the immediate-supervisor level.
Code: 04A	

#### Table B-5

System inadequacies/readiness shortcomings/root causes ("Why" the error/failure/malfunction occurred) LEADER FAILURE occurs when leaders fail to monitor mission execution and planning, correct inappropriate behavior, take appropriate action, or emphasize correct procedures that allowed subordinates to commit task errors or results in a material failure—Continued

Keyword/explanation:	When a leader who is not in the individual chain of command fails to make an on-the-spot correction.				
TRAINING FAILURE occurs when training is incorrect, incomplete,	insufficient for performance to standard.				
Code: 05					
Keyword/explanation:	Inadequate school training. School training becomes a root cause when people make accident-caus- ing mistakes because the school training was inadequate in content or amount.				
Code: 06					
Keyword/explanation:	Inadequate unit/on-the-job training. Unit/on-the-job training becomes a root cause when people make accident-causing mistakes because the training provided was inadequate in content or amount.				
Code: 07					
Keyword/explanation:	Inadequate experience. Supervised on-the-job experience is the follow-up to school and unit training programs. Experience becomes a root cause when people make accident-causing mistakes because the experience provided was inadequate in content or amount.				
Code: 08					
Keyword/explanation:	Habit interference becomes a root cause when a person makes an accident-causing error because task performance was interfered with either the way he usually performs similar tasks, or the way he usually performs the same task under different conditions or with different equipment.				
STANDARDS FAILURE occurs when standards do not exist or the	y are unclear, impractical, or inadequate.				
Code: 09					
Keyword/explanation:	Inadequate written procedures for operation under normal or abnormal/emergency conditions. Inadequate written procedures (AR, TM, SOP, written directives) become the root causes when they lead to accident-causing mistakes or materiel failures/malfunctions.				
SUPPORT FAILURE occurs when the type, amount, capabilities, c Support includes: personnel, equipment, materiel, supplies, service	ondition of the support is sufficient to correctly perform the mission. s, or facilities.				
Code: 10					
Keyword/explanation:	Inadequate facilities/service. Inadequate facilities or services become root causes when the mainte- nance, space and/or support provided for personnel and materiel to accomplish their functions cause mistakes or failures/malfunctions that lead to accidents. (Examples of facilities or services are recreation areas, POL services, housing, medical clinics/hospitals, weather service, storage areas, mainte- nance facilities, and property disposal.)				
Code: 11					
	Inadequate/improper equipment design or equipment not provided.				
Keyword/explanation:	Improperly designed equipment and materiel or lack of equipment/ materiel become root causes when the design or lack of equipment leads to accident-causing personnel errors or materiel failures/mal- functions.				
Keyword/explanation:  Code: 12	materiel become root causes when the design or lack of equipment leads to accident-causing personnel errors or materiel failures/mal-				
	materiel become root causes when the design or lack of equipment leads to accident-causing personnel errors or materiel failures/mal-				

#### Table B-5

System inadequacies/readiness shortcomings/root causes ("Why" the error/failure/malfunction occurred) LEADER FAILURE occurs when leaders fail to monitor mission execution and planning, correct inappropriate behavior, take appropriate action, or emphasize correct procedures that allowed subordinates to commit task errors or results in a materiel failure.—Continued

Inadequate quality control, manufacture, packaging, or assembly. The inadequate manufacture, as- sembly, packaging, or quality control of materiel becomes a root cause when it leads to accident-causing personnel errors or materiel failures/malfunctions. Note: (Includes original manufacture and rebuild.)				
Inadequate maintenance. Inadequate maintenance. Inadequate maintenance (inspection, installation, troubleshooting, recordkeeping) becomes a root cause when it leads to accident-causing personnel errors or material failures/malfunctions.				
lard and is trained to standard but elected not to follow the standard.				
Fear/Excitement/Anger (inadequate composure). Each person is a part of the system. Therefore, his state of mind is a system element. Inadequate composure is a temporary state of mind that becomes a root cause when a person makes an accident-causing error because of fear, excitement, or some related emotional factor made clear, rational thought impossible.				
Overconfidence/complacency in abilities. Overconfidence is a temporary state of mine that becomes a root cause when an accident is caused by a person's unwarranted reliance on their own ability to perform a task, the ability of someone else to perform a task, the performance capabilities of equip- ment or other materiel.				
Lack of confidence. Lack of confidence is temporary of mind that becomes a root cause when acci- dent is caused by a person's unwarranted lack of reliance on his own ability to perform the task, the ability of someone else to perform the task, the performance capabilities of equipment or other mate- rial.				
Haste. A temporary state of mind that becomes a root cause when a person makes a mistake be- cause they are in a hurry and the error contributes to or causes an accident.				
Fatigue (self-induced). Fatigue is a temporary physical and/or mental state that becomes a root cause when a person makes an accident-causing error because of reduced physical or metal capabilities resulting from previous activity and/or lack of rest.				
Effects of alcohol, drugs, illness. The temporary effects of alcohol, drugs, or illness become a root cause when a person makes an accident-causing error because of reduced physical or mental capabilities resulting from one or more of these effects.				
Poor attitude/indiscipline. A temporary state of mind that becomes a root cause when a person's un- warranted or willful disregard for existing standards or know safe conduct results in an error that causes or contributes to an accident.				
Environment conditions. Unknown or unavoidable conditions, which result in materiel failure or induce human error.				
Insufficient information to determine system inadequacy/cause.				

Table B-6 Recommendations/controls/corrective acti	ons/countermeasures
Code: 01	
Keyword/explanation:	Improve school training. The improvement recommended should be directed toward the content or amount of school training needed to correct the accident-causing error. For example:
	Provide school training for the person who made the error due to not being school trained.
	Improve the content of a school training program to better cover the task in which the error was made.
	Expand the amount of school training given on the task in which the error was made.
Code: 02	
Keyword/explanation:	Improve unit training. The improvement recommended should be directed toward the content or amount of unit training needed to correct the accident-causing error. For example:
	Provide unit training for the person who made the error due to not being unit trained.
	Improve the content of unit training to better cover the task in which the error was made.
	Expand the amount of unit training given on the task in which the error was made.
Code: 03	
Keyword/explanation:	Revise procedures for operation under normal or abnormal/emergency conditions. The changes rec- ommended should be directed toward changing existing procedures or including new ones. If the change is to an AR, TM, FM, Soldier's Manual, or other Army publication, tell the date when DA Form 2028 was submitted.
Code: 04	
Keyword/explanation:	Ensure personnel are ready to perform. The purpose of this recommendation is to encourage super- visors to make sure that their people are capable of performing a job before making an assignment. They should consider training, experience, physical condition, and psycho-physiological state, (for ex- ample, fatigue, haste, excessive motivation, overconfidence, effects of alcohol/drugs.)
Code: 05	
Keyword/explanation:	Inform personnel of problems and remedies. This recommendation should be used when it is neces- sary to relay accident-related information to people at unit, installation, Army Command (ACOM), or DA levels.
Code: 06	
Keyword/explanation:	Positive command action. The purpose of this corrective action is to recommend that the supervisor take action to encourage proper performance and discourage improper performance by the person- nel.
Code: 07	
Keyword/explanation:	Provide personnel resources required for the job. This recommendation is intended to prevent an ac- cident caused by not enough qualified people being assigned to perform the job safely.
Code: 08	
Keyword/Explanation:	Redesign (or provide) equipment or materiel. This recommendation is made when equipment or ma- teriel caused or contributed to an accident because:  a. The required equipment or materiel was not available.  b. The equipment or materiel used was not properly designed.
Code: 09	

Table B–6 Recommendations/controls/corrective ac	tions/countermeasures—Continued
Keyword/explanation:	Improve (or provide) facilities or services. This recommendation is made when facilities or services lead to an accident because— a. The required facilities or services were not available. b. The facilities or services used were inadequate.
Code: 10	
Keyword/explanation:	Improve quality control. This recommendation is directed primarily toward t he improvement of train- ing, manufacturing, and maintenance operations where poor quality products (personnel or materiel) have led to accidents.
Code: 11	
Keyword/explanation:	Perform studies to get solutions to root cause. This recommendation should be made when corrective actions cannot be determined without special study. Such studies can range from informal efforts at unit level to highly technical research projects performed by DA-level agencies.

### Appendix C Crash Survival Charts and Figures

#### C-1. Instructions

This appendix contains charts and figures to assist in computing crash forces relative to the aircraft. its components. and occupants.

#### C-2. The following information is provided for crash survival:

a. A chart depicting the relationship of velocity of impact and declarative distance to force (see fig C-1).

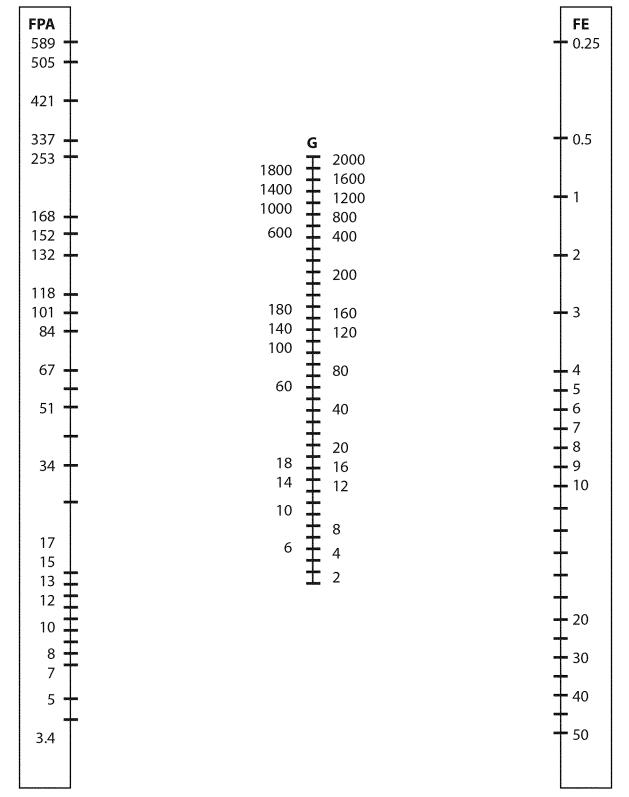


Figure C-1. Relationship of velocity of impact and declarative distance to force

b. A chart indicating the relationship of velocity of impact and declarative distance to force (see fig C-2).

	Transmission & Rotor		Engine		Seats			Landing Gear		
Aircraft	Nx	Ny	Nz	Nx	Ny	Nz	Nx	Ny	Nz	Sink Rate
AH1	<u>+</u> 8	<u>+</u> 8	<u>+</u> 8	<u>†</u> 15	<u>†</u> 5	<u>†</u> 15	± 15 - 5	<u>†</u> 15	<u>†</u> 15	8-10 fps
0H-58	<u>†</u> 16	+8	<u>+</u> 16	<u>+</u> 16	+ 8	<u>+</u> 16	<u>+</u> 20	<u>+</u> 10	<u>+</u> 20	10-15 fps
UH-1	<u>+</u> 8	<u>+</u> 8	+ 8	<del>+</del> 8	± 1.5	<del>+</del> 8	± 15** - 5	<u>+</u> 15**	± 15** - 7.5	8-10 fps
UH-60	<u>†</u> 20	<u>†</u> 18	+ 20 - 10	<u>+</u> 20	<u>†</u> 18	+ 20 - 10	† 20 - 12	<u>†</u> 10	+ 25 - 8	20 fps
AH-64	<u>+</u> 20	<u>†</u> 18	± 20 - 10	<u>†</u> 20	<u>†</u> 18	± 20 - 10	+ 20 - 12	<u>†</u> 10	± 25 - 8	30 fps
CH-47	<u>+</u> 8	<u>+</u> 8	<del>-</del> 8	<u>+</u> 8	<u>+</u> 8	<del>+</del> 8	<u>-</u> 8	<u>+</u> 8	<del>+</del> 8	A&B 8.2 fps C 6.0 fps
CH-54	<u>+</u> 10	± 5	<u>†</u> 10	<u>†</u> 10	<del>+</del> 5	<u>†</u> 10	<u>†</u> 10	<u>+</u> 5	<u>†</u> 10	9.8-12 fps
OH-6	<u>+</u> 17	± 15	<u>†</u> 17	<u>+</u> 20	<u>†</u> 6	<u>†</u> 12	<u>+</u> 20	<u>+</u> 10	<u>+</u> 20	15 fps

^{*} No failure occurs

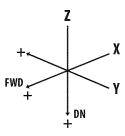


Figure C-2. Aircraft Design Load Factors and Landing Sink Rates

 $\it c.$  An illustration of human tolerable declarative force limits (see fig C-3).

^{**} Unarmored seats

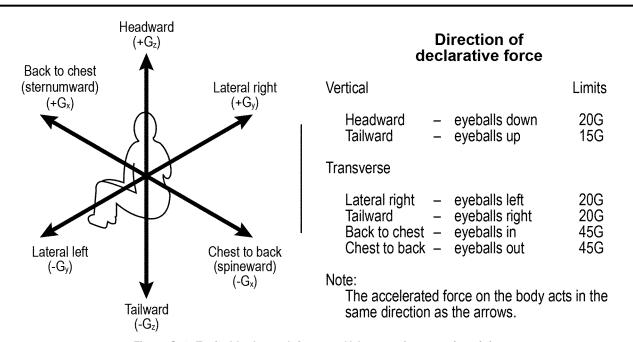


Figure C-3. Typical body crash impacts. Values are for no serious injury

d. Six illustrations of human extremity strike envelopes (see figs C-4 through C-9).

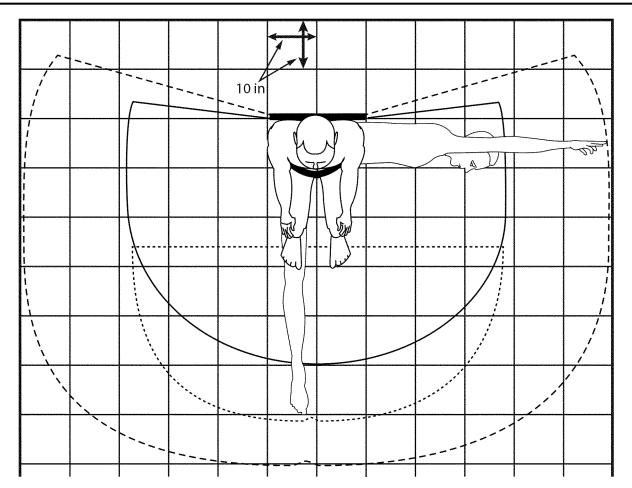


Figure C-4. Lap Belt-Only Extremity Strike Envelope-Top View

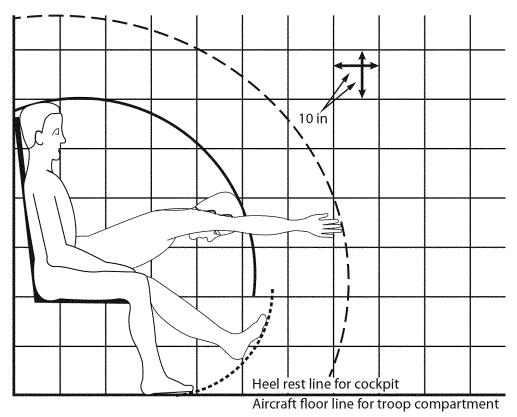


Figure C-5. Lap Belt-Only Extremity Strike Envelope-Side View

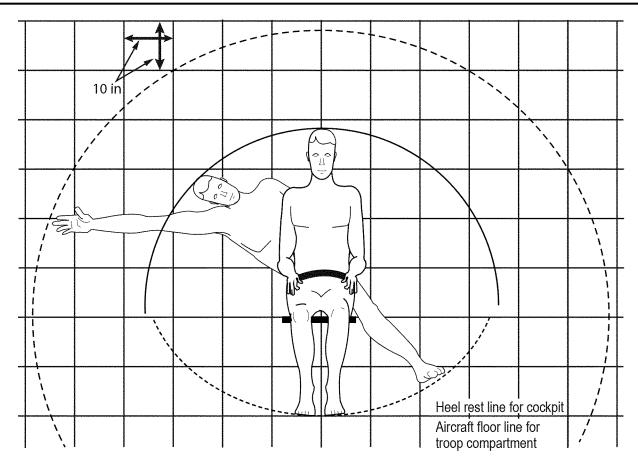


Figure C-6. Lap Belt-Only Extremity Strike Envelope-Front View

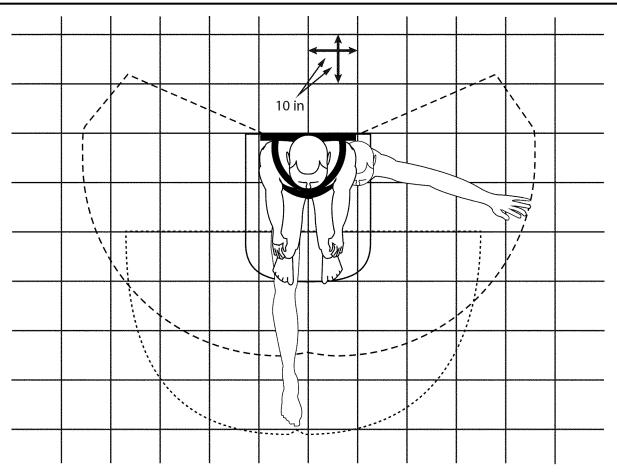


Figure C-7. Full-Restraint Extremity Strike Envelope-Top View

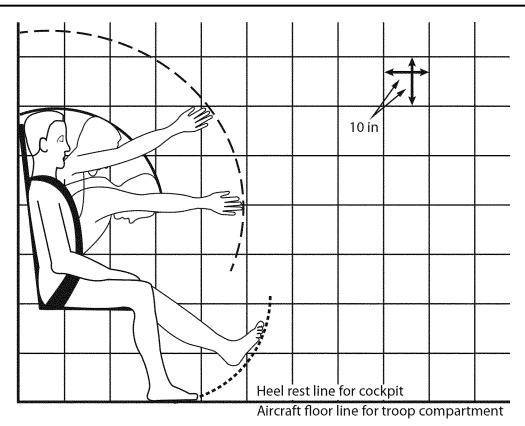


Figure C-8. Full-Restraint Extremity Strike Envelope-Side View

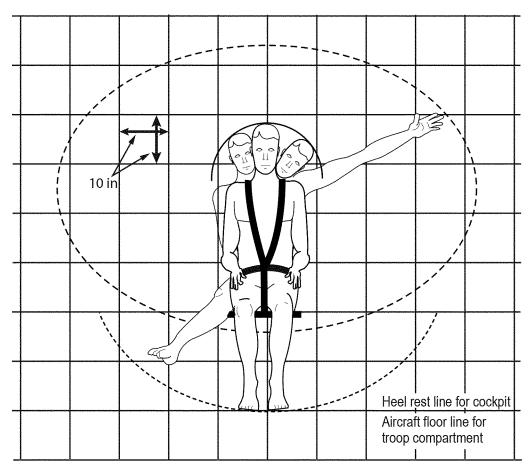


Figure C-9. Full-Restraint Extremity Strike Envelope-Front View

## Appendix D Basic Examples of Fractures and Damaging Stresses

#### D-1. Metal fatigue

- a. When metal is subjected to excessive, continuous stress, overload, or excessive vibration over a period of time, the ability of the metal to withstand established stress limitations progressively decreases. Such a condition is called metal fatigue and can result in metal fracture, shear, or warp.
- b. An example of metal fatigue failure is shown in figure D-1. The area of instantaneous failure will indicate the overstress placed on the fracture. If the area of instantaneous failure is larger in relation to the total area of failure, high overstress is indicated; if lower, a low overstress is indicated. Stop marks radiate outward from the origin of the failure. If the stop marks remain convex about the origin of the failure, low stress concentration is indicated; concave stop marks indicate a high stress concentration.


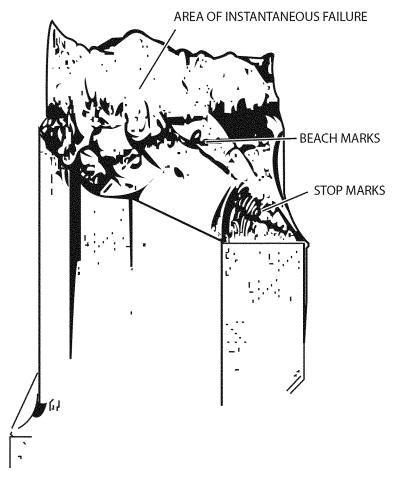


Figure D-1. Metal fatigue

#### D-2. Bending and/or rotation metal fatigue

- a. One-way bending (A, see fig D-2) with low overstress indicated by large area of beach marks and stop marks, and high stress concentration indicated by reversal of stop marks.
- b. One-way bending (B, see fig D-2) with high overstress indicated by small area of beach marks and stop marks, and high stress concentration indicated by reversal of stop marks.
- c. Two-way bending (C, see fig D-2) with low overstress indicated by large area of beach marks and stop marks, and high stress concentration indicated by reversal of stop marks.
- d. Two-way bending (D, see fig D-2) with high overstress indicated by small area of beach marks and stop marks, and high stress concentration indicated by reversal of stop marks.
- e. Reversed bending and rotation (E, see fig D-2) with low overstress indicated by large area of beach marks and stop marks, and high stress concentration indicated by reversal of stop marks.
- f. Reversed bending and rotation (F, see fig D-2) with high overstress indicated by large area of instantaneous failure.

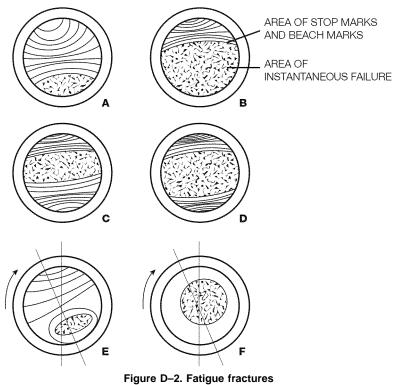

#### D-3. Propagation of fatigue crack and ductile-type failure

Propagation of fatigue at right angle to tension stress lines and ductile-type failure of instantaneous zone is shown in figure D-3.

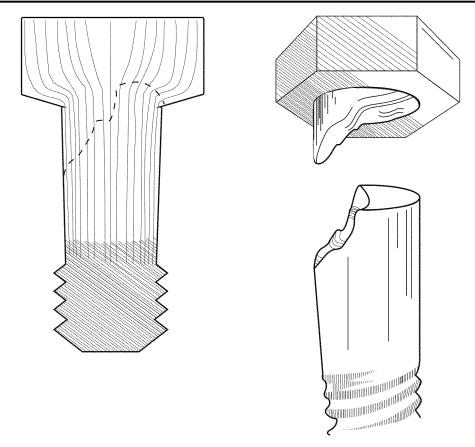


Figure D-3. Propagation of fatigue crack and ductile-type failure of instantaneous zone

#### D-4. Fatigue failure involving stress

Fatigue failure with no evidence of stress concentration and high stress concentration is shown in figures D-4 through D-13.

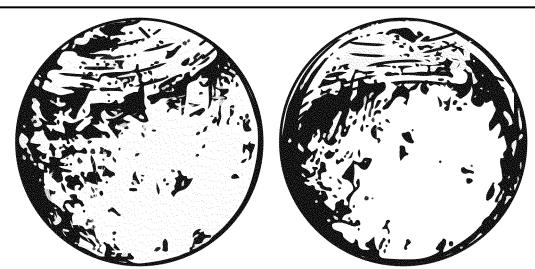


Figure D-4. Fatigue failure, no stress, and high stress concentration

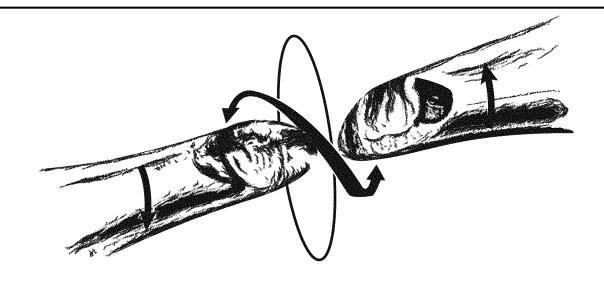


Figure D-5. Fatigue failure under torsion loading



Figure D-6. Torsion load failure


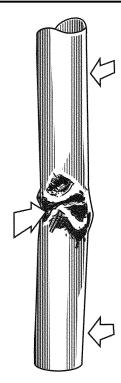


Figure D-7. Bending load failure

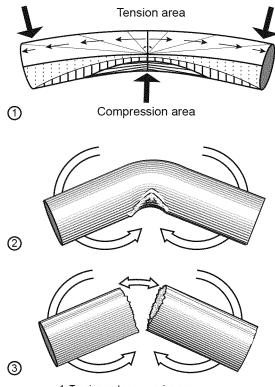

- Tension and compression areas.
   Permanent deformation (ductile metal).
- 3. Fracture (brittle metal).

Figure D-8. Deformation and fracture due to tension and compression

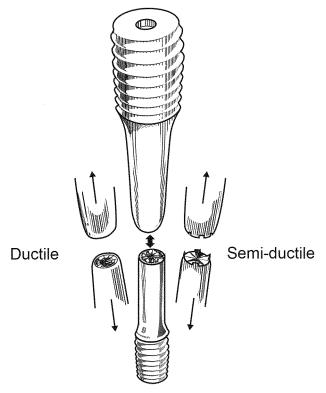


Figure D-9. Failure characteristics of ductile metal



Figure D-10. Failure characteristics of brittle metal due to tension load



Figure D-11. Static tension failure

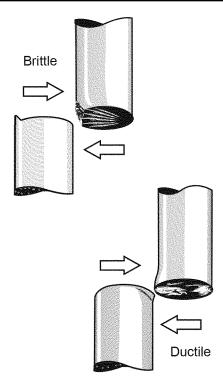


Figure D-12. Pure shear failure

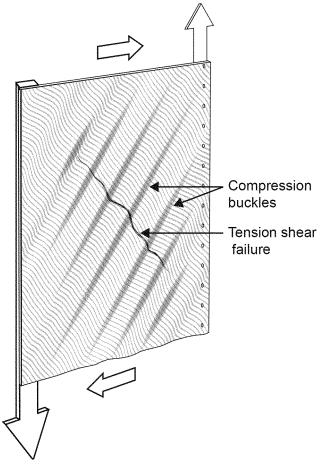


Figure D-13. Compression buckles and tension shear failure due to shear loads

## Appendix E Medical

#### E-1. Processing a gross autopsy

- a. Conduct of autopsy. The services of an experienced, forensically trained pathologist to perform the autopsy is prefered. When possible, autopsies should be performed by Armed Forces Medical Examiner System (AFMES). If AFMES personnel cannot perform the autopsy, it will be performed by personnel in the following order of precedence: first, DOD pathologist, secondly, by a civilian forensic pathologist. The Joint Committee on Aviation Pathology recommends the following six steps a pathologist should follow to perform an autopsy.
- (1) Become thoroughly familiar with the type of equipment, seating arrangements, escape mechanism, scene of the crash and objects personnel may have struck during the accident.
- (2) Become thoroughly familiar with all available information relative to the fatal accident, the nature of the accident, facts about weather, health of the deceased personnel involved, and their condition before and during the accident.
- (3) Carefully examine the helmet, clothing, and other protective clothing and equipment. Tissue particles attached to these objects may be identified by cytological examination and should also be examined under ultraviolet light.
- (4) Meticulously examine the exterior of the body and viscera with necessary close-up photographs and X-ray pictures of the skeleton, giving special attention to a detailed examination of all abrasions, lacerations, deep wounds, and fractures.
  - (5) Request an analysis of specimens by AFMES specimens should be dispatched within 72 hours to the Armed

Forces Medical Examiner System Division of Forensic Toxicology, Building 115 Purple Heart Drive, Dover AFB, DE 19902. DSN: 366–8648 COM (302)346–8648. Detailed shipping instructions are available at: www.afmes.mil.

- (6) Write a complete autopsy protocol. The protocol will include the findings transmitted from the AFMES and will be correlated with the findings obtained from autopsy. This may be done in narrative form.
- b. Preparation of gross autopsy report. Within 60 hours following completion of the autopsy, a preliminary autopsy report will be prepared, to include—
  - (1) A detailed description of gross pathologic changes will be attached.
- (2) Supplementary data. Supplementary data will include, if applicable, photographs of the body, individual organs, and other pertinent material, and copies of X-rays made at autopsy.
- (3) Results. The results of microbiological studies or the status of these studies and results of blood and urinalysis; for example, drug screen, lactic acid, carbon monoxide, and alcohol.
  - (4) Summary. Summary of the case and pathological diagnoses.
  - c. Distribution of gross autopsy report.
- (1) One copy of the autopsy report and photographs of each individual fatally injured in an aircraft accident will be submitted to Commander, USACRC (CSSC–SS), Fort Rucker, AL 36362–5363. The autopsy report and photographs of deceased personnel will not accompany the technical report of the accident through channels.
- (2) One copy of DA Form 2397–9 (aviation only), and one copy of the autopsy report for each individual fatally injured, along with accompanying photographs, will be sent directly to the Director, Armed Forces Medical Examiner System (Aerospace Pathology Division), Washington, DC 20306.
  - (3) One copy of the report will be retained by the laboratory of the medical facility conducting the investigation.

#### E-2. Collection and shipment of specimens

- a. Tissue and samples. The following tissue and fluid samples are recommended for fatalities and forensic studies:
- (1) BLOOD: 25-50 ml.
- (2) URINE: 100-500 ml.
- (3) STOMACH CONTENTS: 100-500 ml. BILE: All available.
- (4) LIVER: 500 Gm.
- (5) BRAIN: 100-299 Gm.
- (6) KIDNEY: 200-300 Gm.
- (7) LUNG: 200-300 Gm.
- (8) SKELETAL MUSCLE: 200-300 Gm. FAT: 200 Gm.
- b. Packaging and preservation. Each specimen should be individually packaged and heat sealed in sturdy polyethylene bags. Cellophane laminated plastic bags must not be used for frozen specimens as they will become brittle, crack, and come apart when placed in dry ice for 24 hours or longer. If fluids, they should be placed in tightly closed, preferably screw cap polyethylene containers. All of these primary containers are to be labeled with the name and service number of the individual, the type of specimen, date, name of the submitting facility, and the flight surgeon's or pathologist's name.
  - c. Shipment. All primary containers should be-
  - (1) Wrapped with sufficient absorbent material to contain any leakage and
  - (2) Then placed in a secondary container (a polyethylene plastic bag) and again heat sealed.
  - (3) A third, large polyethylene bag may now be used to keep all the specimens from one individual together.
- (4) The frozen tissue and body fluids must now be packed in an insulated shipping container large enough to hold the specimens plus a quantity of dry ice approximately 3 times the weight of the specimens.
- (5) The frozen specimens and dry ice should not be packed in containers which seal to the extent that gas is not permitted to escape.
  - (a) Gas pressure within a sealed container presents a potential hazard and could cause the container to burst.
  - (b) Dry ice must not be placed in a thermos bottle.
- (6) The shipment MUST be made via Air Express (overnight) or Air Freight. This is the only method rapid enough to deliver the specimens to AFMES quickly as necessary to preserve them in their frozen state.
  - (7) Never send specimens by military air (MEDEVAC or otherwise).
- (8) One cannot overemphasize the need to pack the specimens with the utmost care in sturdy containers, properly labeled, to include the proper paperwork.
  - d. Addressing the shipment. The following information should be placed on the outside wrapper of all shipments:
  - (1) Flight Surgeon or Pathologist's Address.
  - (2) The Director, Armed Forces Medical Examiner System, ATTN: AFIP-RRR, Washington, DC 20306-6000.
  - (3) "RUSH. FRAGILE."
  - (4) Aircraft Accident/Forensic Case (as appropriate).
  - (5) Specimen for Toxicological Examination.

- (6) Dry ice will last until (date).
- (7) If Chain of Custody is required: Annotate outside wrapper "Evidence Enclosed."
- e. AFIP notification.
- (1) Notifying AFMES that specimens are about to be shipped contributes immeasurably to expeditious handling of the shipment on arrival and may even make the difference as to whether the specimens reach AFMES in a good or bad condition.
- (2) Telephone numbers are as follows: Commercial Tox Div (202) 576–2982; Main Desk (202) 576–2800; DSN Tox Div 291–2910/2982; DSN Main Desk 291–2800.
  - (3) The message and/or telephone call should include the following information:
  - (a) Aircraft Accident/Forensic Case (as appropriate) Material.
  - (b) Patient(s)'s name, rank, service number.
  - (c) Method of shipment (Air Express/Air Freight).
  - (d) Name of Washington, DC, area airport to receive shipment.
  - (e) Name of airline.
  - (f) Flight number.
  - (g) GBL/Airbill number.
  - (h) Flight surgeons or pathologist's name and address.
  - (i) Departure time and date.
  - (j) Arrival time and date.
  - (k) Brief description of contents.
  - (1) Chain of custody, if required.
  - (m) Other information.

#### E-3. Incidents with survivors

- a. Collection. Only the following specimens need be collected:
- (1) SERUM: 15-20 ml (no preservatives) (unhemolyzed).
- (2) BLOOD: 15-20 ml (Sodium Fluoride or EDTA).
- (3) URINE: 50 ml is optimum (no preservatives).
- b. Armed Forces Medical Examiner System. The AFMES recommends that regardless of the type of container that these specimens are collected in, that they be placed in a primary container of polyethylene (one with a top that is a screw cap or that seals tightly for shipment.) This primary container must be labeled with the name and service number of the individual.
  - c. Packing and shipment. For packing and shipment, the primary containers should be-
  - (1) Wrapped with sufficient absorbent material to contain any leakage.
  - (2) placed in a secondary container (polyethylene plastic bag) and then heat sealed.
  - (3) A third, large, polyethylene bag may now be used to keep all the specimens from one individual together.
- (4) The blood and urine may now be packed, unfrozen, in a shipping container of sturdy cardboard, plastic or metal construction and mailed FIRST CLASS to AFMES.
- (5) Registered mail and/or "Return Receipt Requested" is not necessary or recommended and if the address is not present, could delay accessing and analysis.
- d. Outside markings. The following information should be placed on the outside wrapper of all shipments: Director, Armed Forces Medical Examiner System (AFMES–RRR), Washington, DC 20306–6000.

Note. If Chain of Custody is required: Annotate the above label "Evidence Enclosed."

#### E-4. Forms, documents, and paperwork

The following forms are necessary (original and 1 copy):

- a. Aircraft accident fatalities. SF Form 543, Contributor's List of Pathologic Material.
- b. Medical/legal (forensics).
- (1) SF Form 503-Medical Record-Autopsy Protocol.
- (2) SF Form 543.
- c. Form legibility. In order that these forms remain legible during packing, shipping, and unpacking. We request that they be placed into their own polyethylene bag. All available information on—
  - (1) The patient's or crew member's health history.
  - (2) The conditions prior to the crash or incident.
  - (3) A site description and the condition of the body(s) when recovered should be sent to AFMES.

(4) This historical data and array of pertinent facts can assist the toxicologist in selecting special procedures to supplement routine analysis.

#### Appendix F

#### Accident/Incident Event Codes Associated With Manned and Unmanned Aircraft Accidents

#### F-1. Categorizing accident/incident event codes

The following codes and explanations below are provided to categorize manned and unmanned aviation accidents by the type of event(s) involved as applicable (see tables F–1 and F–2). Additional UAS codes are included at the end of Table F–2.

Table F-1 Accident/incide	ent event codes
Code: 01	
Explanation:	Precautionary landing (PL). A landing resulting from unplanned events, occurring while the aircraft is in flight that makes further flight inadvisable. This event is to be used for PLs where no other event applies or in conjunction with other materiel failures events.
Code: 02	
Explanation:	Forced landing (FL). A landing caused by failure or malfunction of engines, systems, or components that makes continued flight impossible. This event is to be used in conjunction with other materiel failure/malfunction events.
Code: 03	
Explanation:	Aborted takeoff. An unplanned event that occurs before lift-off that interrupts a planned flight. This event is to be used for aborted takeoffs where no other events applies or in conjunction with other materiel failure events.
Code: 04	
Explanation:	Human factor event. A psychological, physiological, or pathological condition that occurs to personnel when intent for flight exists and results in interference with a crewmember's duties during aircraft operations or mission being delayed, diverted, or aborted.
Code: 05	
Explanation:	Cargo event. Injury or property damage resulting from cargo-related accident/incident, intentional or unintentional jettisoning of cargo hook load.
Code: 06	
Explanation:	Personnel handling event. Injury or property damage involving personnel handling errors or personnel handling.
Code: 07	
Explanation:	External stores event. Injury or property damage resulting from external stores handling errors or equipment failures.
Code: 08	
Explanation:	Multiple aircraft event. Injury or property damage resulting from the interactions of two or more aircraft. To qualify as a multiple aircraft event, two or more aircraft, with engines running, must be involved.
Code: 09	
Explanation:	Misappropriated aircraft. An aircraft accident that occurs during the operation of an Army aircraft that has been misappropriated, regardless of aircrew designation. Intent for flight must exist.
Code: 10	
Explanation:	Unmanned aircraft. Have a "Q" designator, and may be flown or operated by an air vehicle operator (AO) or external operator (EO).
Code: 11	
Explanation:	Contractor aircraft accident. An aircraft accident that occurs as a result of a government contractor's operation in which there is damage to Army property or injury to Army personnel. Included is non-delivered equipment for which the Army has assumed responsibility.
Code: 12	
Explanation:	Aircraft ground accident. Injury/occupational illness or property damage involving an Army aircraft in which no intent or flight exists and the engines are in operation.

Table F-1 Accident/incide	ent event codes—Continued
Code: 13	
Explanation:	Laser-induced/related. Property damage or personnel injury resulting from laser operations created. May be used in conjunction with other events.
Code: 14	
Explanation:	Fratricide. Persons killed, wounded, or equipment damage, in military action, mistakenly or accidentally, by friendly forces actively engaged with the enemy, who are directing fire at hostile force or what is thought to be hostile force.
Code: 15	
Explanation:	Single engine landing. An unplanned single engine landing of a multi-engine aircraft/UAS.
Code: 16	
Explanation:	Uncommanded control input. An uncommanded aircraft/UAS pitch, yaw, or roll motion (regardless of amount) that is not induced by the crew or adverse environmental conditions.
Code: 17	
Explanation:	Cockpit air bags. Activation/deployment of the cockpit airbags either intentional or unintentional.
Code: 18	
Explanation:	Icing. Accidents/incidents as a result of icing conditions other than structural icing captured in Event 69.
Code: 19	(Reserved for Future Use)
Code: 20	
Explanation:	Refueling accident. Damage incurred during refueling operations on the ground or in-flight.
Code: 21	
Explanation:	Midair collision. Those accidents in which more than one aircraft collide in flight. Hover is considered in flight. Damage does not have to be done to both aircraft (will be used in addition to "08 multiple aircraft event").
Code: 22	
Explanation:	Helocasting. Property damage or personnel injury occurring during helocasting operations.
Code: 23	
Explanation:	Hard landing. Damage incurred due to excess sink rate on landing touchdown. Includes autorotation landings when skids are damaged; main rotor blade flexing into tail boom; tire blowing on touchdown; landing gear driven into fuse-lage; fuselage, wing, and buckling.  Note. The landing area must be suitable for a probable successful landing.
Code: 24	
Explanation:	Wheels-up landing. Aircraft equipped with retractable landing gear in the wells. Includes intentional gear-up landings; crew forgetting to lower gear; gear does not extend when gear handle placed down.
Code: 25	
Explanation:	Landing gear collapse/retraction. During takeoff, landing, or taxi, the gear collapses for any reason or the crew in-advertently retracts or retracts too soon on takeoff (does not include gear shearing due to hard landing).
Code: 26	
Explanation:	Undershoot. When an approach is being made to a prepared area of field and the aircraft touches down short of the suitable landing surface. (Does not include striking wires, or trees on approach except an aircraft striking an airport boundary fence.)
Code: 27	
Explanation:	Overshoot or overrun. Landing in which the aircraft runs off the end of the runway because of touchdown speed, runway too short, touching down too long, or failure of brakes.
Code: 28	
Explanation:	Ditching. Landing in a controlled attitude in water. (Does not include creeks, streams, and so forth, or those landings to ships or barges in which the aircraft crashes in the water.)
Code: 29	
Explanation:	Ground loop/swerve. When aircraft damage is incurred because absolute directional control is not maintained (intentional or unintentional). Includes F/W ground loops; R/W auto-rotational landings; R/W running landings due to antitorque failures; aircraft running off side of runway.
Code: 30	

Table F-1 Accident/incide	ent event codes—Continued
Explanation:	Collision with ground/water. Those accidents in which the aircraft strikes the ground or water unintentionally. Includes crashing into a mountain under IFR, IMC, or night, inadvertent flying into the ground or water, such as making a gun run and failing to pull up; low-level flight resulting in striking ground or water.
Code: 31	
Explanation:	Aircraft collisions on the ground. Accidents in which two or more aircraft collide on the ground. None of the aircraft can be in flight. (used in addition to "08" multiple aircraft event).
Code: 32	
Explanation:	Other collisions. Accidents when an aircraft collides with something not accounted for by other type events listed.
Code: 33	
Explanation:	Rotor overspeed. Main rotor rpm exceeding the allowable limits for continued flight.
Code: 34	
Explanation:	Fire and/or explosion on the ground. Accidents that are initiated by a fire or explosion. The damage incurred must be prior to lift-off and/or after touchdown.
Code: 35	
Explanation:	Fire and/or explosion in the air. Same as on the ground except damage must be after lift-off and before touchdown.
Code: 36	
Explanation:	Equipment loss or dropped object. Accidents in which some part of the aircraft or attached equipment is lost in flight, other than cargo and external stores.
Code: 37	
Explanation:	In-flight breakup. Accidents in which aircraft begins to break up in flight. In these accidents, any type of landing is not expected. Includes loss of main rotor blades; loss of wing.
Code: 38	
Explanation:	Spin or stall. Fixed wing aircraft type accidents resulting in stalling and/or spinning due to loss of airspeed, or excessive angle of attack.
Code: 39	
Explanation:	Abandoned aircraft. Accidents in which all flight crew eject or parachute.
Code: 40	
Explanation:	Flight-related accident. Damage to property or injury/occupational illness to personnel without damage to aircraft.
Code: 41	
Explanation:	Instrument meteorological condition (IMC). Aircraft must be in IMC conditions when the accident/emergency occurs. This is a condition event and should not be used in the first position.
Code: 42	
Explanation:	Rappelling. Property damage or personnel injury occurring during rappelling operations.
Code: 43	
Explanation:	Fast rope. Property damage or personnel injury occurring during fast rope operations.
Code: 44	
Explanation:	Overstress. Stress damage to aircraft as a result of operating aircraft outside the design limitations.
Code: 45	
Explanation:	Turbine Engine FOD. Internal or external FOD damage confined to aircraft turbine engines only.
Code: 46	
Explanation:	Rotor/prop wash. Property damage or personnel injury resulting from rotor/prop wash (does not include damage incurred by Event 75).
Code: 47	
Explanation:	Engine overspeed/overtemp. Engine rpm or temperature exceeding the allowable limits for continued operations.
Code: 48	
Explanation:	Brownout. Loss of visual reference to the ground or horizon caused by rotor wash swirling dust around the aircraft. This is a condition event and should not be used in first position.

Table F-1 Accident/incident event codes—Continued		
Code: 49		
Explanation:	Bird strike. Accidents in which any part of the aircraft collides with a bird while in flight.	
Code: 50		
Explanation:	Tree strike. Accidents as a result of aircraft striking vegetation during any phase of flight.	
Code: 51		
Explanation:	Wire strike. Accidents as a result of the aircraft striking any kind of wires during any phase of flight.	
Code: 52		
Explanation:	In-flight breakup due to a mast bumping. Accidents in which the main rotor separates as a result of mast bumping.	
Code: 53		
Explanation:	Missing aircraft. Used when an aircraft does not return from a flight and is presumed to have crashed.	
Code: 54		
Explanation:	Foreign object damage (FOD). Accident in which FOD is the only damaged incurred, excludes turbine engine FOD.	
Code: 55		
Explanation:	Dynamic rollover. Accident in which the main rotor blades strike the terrain as a result of exceeding the lateral CG limits, while the aircraft structure is still intact.	
Code: 56		
Explanation:	Maintenance operational check (MOC). Accidents that occur during MOC while the engine(s) is/are in operation and/or rotors turning.	
Code: 57		
Explanation:	Weapons related. Accidents involving weapons that result in property damage or injury to personnel.	
Code: 58		
Explanation:	Lightning strike. Damage to aircraft/injury to occupant because of lightning strike(s).	
Code: 59		
Explanation:	Rescue operations. Property damage or personnel injury occurring during rescue operations.	
Code: 60		
Explanation:	Object strike. Aircraft/aircraft component struck objects other than ground, trees, or objects included in other events.	
Code: 61		
Explanation:	Air-to-ground collision. Aircraft in the air collides with or strikes aircraft on the ground.	
Code: 62		
Explanation:	Stump Strike. Aircraft contacts stump during routine landing.	
Code: 63		
Explanation:	Antenna Strike. Aircraft damage caused by contact with an antenna.	
Code: 64		
Explanation:	Engine MAST/XMSN overtorque/overload. Engines MAST/XMSN that have been subjected to torque loads beyond power limits specified, or engine loses rpm because of overload of aircraft for density altitude.	
Code: 65		
Explanation:	Whiteout. Loss of visual reference to the ground or horizon caused by rotor wash swirling snow around the aircraft. This is a condition event and should not be used in the first position.	
Code: 66		
Explanation:	Tie-down strike. Damage to the aircraft caused by main rotor tie-down device attached to main rotor during engine start.	
Code: 67		
Explanation:	Parachute deployment. Accidents involving paradrop operations inside or still attached to the aircraft.	
Code: 68		
Explanation:	Mast bumping. Damage resulting from contact between the main rotor and mast but not resulting in rotor separation.	

Table F-1 Accident/incident event codes—Continued		
Explanation:	Structural icing. The formation of ice on aircraft structures to include the rotor systems. Does not include carburetor, induction, or pitot static system icing.	
Code: 70		
Explanation:	Engine failure. Engine fails to develop sufficient power to maintain flight or internal failure of power plant. Excludes fuel starvation or fuel exhaustion and FOD.	
Code: 71		
Explanation:	Transmission Failure. Internal failure of a main transmission.	
Code: 72		
Explanation:	Vertical fin strike. Damage caused by the tail rotor blades coming in contact with the vertical fin on single rotor helicopters.	
Code: 73		
Explanation:	Spike knock. Damage occurred when the transmission spike contacts the striker plate with sufficient force to cause damage.	
Code: 74		
Explanation:	Seatbelt/restraint harness strike. Damage caused by unsecured seatbelts/restraint harnesses.	
Code: 75		
Explanation:	Blade flapping. Damage resulting from wind or rotor wash from other aircraft that causes the main rotor blades to flap to the extent that damage occurs.	
Code: 76		
Explanation:	Fuel exhaustion. Power loss resulting from using all usable fuel aboard an aircraft.	
Code: 77		
Explanation:	Fuel starvation. The result of fuel ceasing to flow to the power plant while fuel is still on board the aircraft. Example: The pilot fails to switch tanks when one runs dry or blockage of fuel lines occurs because of contamination.	
Code: 78		
Explanation:	Animal Strike. During takeoff, landing, an animal is struck by any part of the aircraft.	
Code: 79		
Explanation:	Battery fire/overheat. A fire in the battery compartment or over-heated battery, usually resulting in electrical failure.	
Code: 80		
Explanation:	Excessive yaw/spin. May occur on the ground or in the air (helicopter only). A maneuver where the aircraft yaws excessively or spins when power is added without adequate antitorque input, or a loss of antitorque control occurs.	
Code: 81		
Explanation:	Tail boom strike. Main rotor contacts tail boom on the ground due to wind conditions. Excludes hard landings and damage caused rotor wash.	
Note:	In addition to event codes 70 and 71 listed above the following events are used to categorize materiel factor related mishap events. The event applies regardless of the cause of the failure/malfunction (FWT, maintenance, design or manufacture).	

# F-2. Categorizing materiel factor events

Select the event(s) that best categorize the accident and enter the code(s) in block 2 of DA Form 2397-1.

Table F–2 Materiel factor	Table F–2 Materiel factor events	
Code: 82		
Explanation:	Airframe. Failure/malfunction of any airframe structure to include doors, windows, fairings, canopies, to include hardware.	
Code: 83		
Explanation:	Landing gear/arresting hook. Failure/malfunction of any landing gear part exclusive of the hydraulics.	
Code: 84		
Explanation:	Power train. Failure/malfunction of any part/component of the power train except when Events 47 or 70 apply.	
Code: 85		
Explanation:	Drive train. Failure/malfunction of any part/component of the drive train except when Events 71 and 86 apply.	
Code: 86		
Explanation:	Rotor/propellers. Failure/malfunction of rotor/prop assembly, hubs, blades. Exclude other drive train part failures, (for example, gearboxes, and mast).	
Code: 87		
Explanation:	Hydraulics System. Failure/malfunction of any hydraulic part. The failure of other systems resulting from hydraulic initiated failures will be coded as hydraulic.	
Code: 88		
Explanation:	Pneumatic system. Failure/malfunction of any pneumatic part. The failure of any other system resulting from pneumatic initiated failures will be coded as pneumatic.	
Code: 89		
Explanation:	Instruments. Failure/malfunction of any part of the instrument system that results in a faulty instruments indication.	
Code: 90		
Explanation:	Warning system. Failure/malfunction of any part of the warning system that results in a false indication of a failure/malfunction. Includes electrical components of the warning system.	
Code: 91		
Explanation:	Electrical system. Failure/malfunction of any part of the AC or DC electrical systems. Includes current producing, transforming, converting and amplifying parts, (for example, battery, generator, alternator, and relay.	
Code: 92		
Explanation:	Fuel system. Failure of any part of the fuel system. Does not include the fuel metering/fuel control unit which will be reported as part of the engine.	
Code: 93		
Explanation:	Flight control. Failure/malfunction of any part of the system. Excludes hydraulic part failures.	
Code: 94		
Explanation:	Utility/environmental control system. Failure/malfunction of any part of the system.	
Code: 95		
Explanation:	Avionics. Failure of any part of the radio navigation/communication equipment.	
Code: 96		
Explanation:	Cargo handling equipment. Failure of the cargo handling equipment attached to the aircraft only.	
Code: 97		
Explanation:	Armament. Failure of any part to include the aiming/firing system.	
Code: 98		
Explanation:	Night vision device. Any failure or malfunction of any part of the night vision device.	
Code: A1		
Explanation:	Launcher malfunction. Any failure or malfunction of the aircraft launcher.	
Code: A2		

Table F-2 Materiel factor events—Continued		
Explanation:	Tactical Automated Landing System (TALS) Landing/Recovery. TALS failure or malfunction during landing/recovery.	
Code: A3		
Explanation:	Arresting gear failure (drum, strap, pendant). Failure or malfunction of the arresting gear (drum, strap, pendant, net, and so forth.	
Code: A4		
Explanation:	Flight Termination System (FTS) Failure/Malfunction. Failure or malfunction of the FTS/parachute.	
Code: A5		
Explanation:	Automatic Take Off and Landing System (ATLS) Failure/Malfunction Landing. ATLS failure/Malfunction during the landing phase of flight.	
Code: A6		
Explanation:	Automatic Take Off and Landing System (ATLS) Failure/Malfunction Take-Off. ATLS failure/malfunction during the take-off phase of flight.	
Code: A7		
Explanation:	Battery Failure. Battery failed due to a loss of charge, received max number of recharges and so forth.	
Code: A8		
Explanation:	Flight Termination System (FTS) Deployment. Deployment of the FTS, either manually or automatically, to land the UA.	
Code: A9		
Explanation:	Test Flight. Accidents occurring while a test flight (experimental or maintenance) is being performed.	
Code: B1		
Explanation:	Ground Control System (GCS) Failure/Malfunction. A failure/malfunction of the Ground Control Station (including portable GCS) causing/resulting in the aviation accident.	
Code: B2		
Explanation:	Ground Data Terminal (GDT) Failure/Malfunction. A failure/malfunction of the Ground Data terminal causing/resulting in the aviation accident.	
Code: B3		
Explanation:	Ground Power Generation Equipment Failure/Malfunction. A failure/malfunction of the Ground Power Generation equipment causing/resulting in the aviation accident.	
Code: B4		
Explanation:	Loss of Downlink. Any loss of downlink regardless of cause (signal interference, material failure (hardware or software), and so forth.	
Code: B5		
Explanation:	Loss of Link. If the type of Loss of Link (downlink or uplink) is unknown, use this code.	
Code: B6		
Explanation:	Loss of Uplink. Any loss of uplink regardless of cause (signal interference, material failure (hardware or software), and so forth.	
Code: B7		
Explanation:	Other UAS Equipment Failure/Malfunction. A failure/malfunction of any other UAS equipment causing/resulting in the aviation accident.	
Code: C1		
Explanation:	Excessive High Winds during Aerostat Operation. Accident as a result of excessive winds during Aerostat flight or when moored.	
Code: C2		
Explanation:	Tether Strike. Accident as a result of a helicopter, fixed wind, or UAV colliding with the tether.	
Code: C3		

Table F-2 Materiel factor events—Continued		
Explanation:	Aerostat Blow Down. High vertical winds causing the Aerostat to severely reduce elevation whereby the tether either breaks during the elevation recover or snags on a ground object.	
Code: C4		
Explanation:	Mooring Station Failureaccident as a result of a Mooring Station failure. Malfunctioning equipment could cut the tether.	

# Appendix G

# Accident Investigation Information/Equipment Requirements

#### G-1. Aviation

The investigator(s) should ensure the following items are available for use or examination when conducting an aviation accident investigation, as required.

- a. Aviation-General.
- (1) Orders appointing investigation board (CAI and IAI only) signed.
- (2) Blood/urine samples/tissue samples.
- (3) Witness information: name, rank, telephone number (duty/work); summaries.
- (4) Secure work area with access to COM/DSN telephones.
- (5) CID/MP reports.
- (6) Individual flight records.
- (7) Individual medical records/autopsy results.
- (8) Individual personnel record(s) (field 201).
- (9) ECOD.
- (10) Computer.
- (11) Transportation: air and/or ground.
- (12) Name and location of flight surgeon, bodies, injured, AFMES personnel.
- (13) Weather statement (signed by forecaster).
- (14) Unit and parent organization SOPs to include:
- (a) Training.
- (b) Administrative.
- (c) Maintenance.
- (d) Shop standards.
- (e) Crew rest.
- (f) Safety.
- (g) Crew selection.
- (15) Directive/policy letters/supplements to regulations that pertain to:
- (a) That particular operation.
- (b) Assignment of tasks/missions.
- (c) AR 95-1, AR 95-2, and AR 95-23 (UAS).
- (d) Field manuals/training circulars.
- (16) Safety meeting minutes/council meeting minutes (if applicable).
- (17) Individual training folders (ATM).
- (18) 1:50,000 map which includes location of accident site.
- (19) Survey of mishap site/wreckage.
- (20) UICs/office symbols and chain of command addresses from unit through ACOM.
- (21) Name, grade, title of safety officer; address, and telephone number to send report.
- (22) Collateral officer's name, address, and telephone number.
- (23) Post wiring diagram (organization chart).
- (24) ATC tapes (from initial contact through -1 hours).
- (25) Unit pre-accident plan.
- (26) PAO/PIO name and telephone number.
- (27) Inbrief/outbrief information.
- (28) Aircraft recovery team.

- (29) Aircraft release letter.
- (30) Inventory of aircraft.
- b. Aviation Maintenance-Operations
- (1) Aircraft logbook.
- (a) DA Form 2408-5, Equipment Modification Record.
- (b) DA Form 2408-12, Army Aviator's Flight Record.
- (c) DA Forms 2408–13, Aircraft Inspection and Maintenance Record.
- (d) DA Form 2408-14, Uncorrected Fault Record.
- (e) DD Form 365-4, Weight and Balance Clearance Form F-Transport/Tactical.
- (2) Historical records.
- (a) Six-month file (DA Form 2408–13 series).
- (b) DA Forms 2408-15, 16, 17, 18.
- (c) Oil analysis records.
- (d) DA Forms 2407-Maintenance Work Orders.
- (3) Equipment Improvement Report.
- (a) Oil analysis records and samples sent.
- (b) Fuel analysis.
- (4) -10, Operator's Manual.
- (5) Any appropriate checklist.
- (6) ATM.
- (7) -10 Organizational Maintenance Manual.
- (8) Parts "P," Manual.
- (9) Monthly Maintenance Report.
- (10) Operations Information.
- (a) Performance Planning Card.
- (b) Briefing forms/data.
- (c) Flight plan.

### G-2. Ground

The investigator(s) should ensure the following items are available for use or examination when conducting a ground accident investigation, as required.

- a. Ground-General.
- (1) Orders appointing investigation board (CAI and IAI only) signed.
- (2) Blood/urine samples (Ask that the command test those involved in the accident.)
- (3) Witness information: name, rank, telephone number (duty/work), summaries.
- (4) Secure work area with access to DSN/COM telephones.
- (5) Serious Incident Report, MP, CID reports.
- (6) Individual personnel record(s) (field 201).
- (7) ECOD/ACOD.
- (8) Individual medical records/autopsy results.
- (9) Computer.
- (10) Photo lab support.
- (11) Location and name of doctor conducting autopsy. (Request a doctor on the board to be a part of the autopsy).
- (12) Weather statement (signed by forecaster).
- (13) Aircraft arrangements for overhead photos.
- (14) Unit and parent organization SOPs to include:
- (a) Training.
- (b) Administrative.
- (c) Maintenance.
- (d) Shop standards.
- (15) Directives that pertain to—
- (a) That particular operation.
- (b) Assigned tasks.
- (16) Training folders (individual, unit).
- (17) Individual counseling records.
- (18) Individual/OF 346.
- (19) 1:50,000 map which includes location of accident site.

- (20) UICs/office symbols and chain of command addresses from unit through ACOM.
- (21) Local report number.
- (22) Name, grade, title of safety manager; address and telephone number to send report.
- b. Ground Maintenance Records.
- (1) DA Form 2404, Equipment Inspection and Maintenance Worksheet.
- (2) DA Form 2404, Retained on file (quarterly/semi-annually).
- (3) DA Form 2404, Deferred Maintenance Worksheet.
- (4) DA Form 2407, Maintenance Work Orders.
- (5) DA Form 2408–20, Oil Analysis Record.
- (6) DD Form 314, Preventive Maintenance Record.
- (7) DA Form 2406, Materiel Condition Status Report.
- (8) Calibration Records.
- (9) Dispatch log.
- (10) Equipment logbook.
- (11) -10, Operator's Manual.
- (12) -20, Organizational Maintenance Manual.
- (13) Parts "P," Manual.

# Appendix H Notification Phone Numbers

# H-1. Notification phone numbers list

- a. AMC Operations Center: (703) 806–9200, DSN 656–9200, AMC Safety Office: DSN 656–8695, COM (703) 806–8695, FAX (703) 806–8863.
- b. Commander, AMC, DSN 284–9475, COM (703) 274–9475 (During non-duty hours, call duty officer DSN 284–9223, COM (703) 274–9223 or FAX DSN 284–9469, COM (703) 274–5481).
  - c. Armed Forces Medical Examiner System. DSN 366-8648 COM (302)346-8648. www.afmes.mil.
  - d. Army Operation Center (AOC) (DSN 227-0218, COM (703) 697-0218).
- e. Diving Safety Office, ATTN: ATSP-OCT-S, Fort Eustis, VA 23604-5407, DSN 927-1329, COM (804) 878-1329.
- f. DOT, Pipeline and Hazardous Materials Safety, 1200 New Jersey Avenue, S.E., East Building, 2nd Floor (PH), Washington, DC 20590, COM (202) 366–4433, FAX (202) 366–3666, Toll free:1–800–424–8802.

Note. The 800 number is to the National Response Center.

### H-2. The Office of Hazardous Materials Enforcement regional offices

- a. Eastern Region 820 Bear Tavern Road, Suite 306, West Trenton, NJ 08628, COM (609) 989–2256, FAX (609) 989–2277.
- b. Central Region- 2300 East Devon Avenue, Suite 478, Des Plaines, IL 60018-4696, COM (847) 294-8580, FAX (847) 294-8590.
- c. Southern Region U.S. Department of Transportation, Pipeline and Hazardous Materials Safety Administration, Office of Hazardous Materials Safety, 233 Peachtree Street NE, Suite 602, Atlanta, GA 30303, COM (404) 832–1140, FAX (404) 832–1168.
- d. Southwest Region U.S. Department of Transportation, Pipeline and Hazardous Materials Safety Administration, Office of Hazardous Materials Safety, 8701 S. Gessner Road, Suite 1110, Houston, TX 77074, COM (713) 272–2820, FAX (713) 272–2821.
- e. Western Region 3401 Centrelake Drive, Suite 550B, Ontario, CA 91761, COM (909) 937–3279, FAX (909) 390–5142.
  - f. National Response Center: Federal Hotline, for all oil or chemical spills (800) 424–8802, COM (202) 267–2675.
- g. Transportation Branch Marine Safety Office, ATTN: ATZF-CSS, Fort Eustis, VA 23604–5113, DSN 826–1327, COM (757) 878–1327.
  - h. USACRC SJA (DSN 558-2924, COM (334) 255-2924).
- i. USATCES (request for technical support): DSN 956-8919, COM (918) 420-8919 or FAX (918) 420-8503, DSN 956-8503.
  - j. USATCES, DSN 956-8919, COM (918) 420-8919.
- k. U.S. Army Field Support Command, Safety/Rad Waste Directorate (DSN 793-2989/2971/2113 or COM (309) 782-2989/2971/2113).

l. U.S. Naval Safety Center, Norfolk, VA, DSN 564-6389/6427, COM (804) 444-6389/6427.

# H-3. U.S. Nuclear Regulatory Commission

- a. Region I, U.S. NRC, 475 Allendale Road, King of Prussia, PA 19406–1415, COM (610) 337–5000, Toll free: 1–800–432–1156.
- b. Region II, U.S. NRC, Sam Nunn Atlanta Federal Center, 61 Forsyth Street, S.W., Suite 23T85, Atlanta, GA 30303–8931, COM (404) 562–4400, Toll free: 1–800–577–8510.
- c. Region III, U.S. NRC, 2443 Warrenville Road Suite 210, Lisle, IL 60532–4352, COM (603) 829–9500, Toll free: 1–800–522–3025.
- d. Region IV, U.S. NRC, Texas Health Resources Tower, 611 Ryan Plaza Drive, Suite 400, Arlington, TX 76011–4005, COM (817) 860–8100, Toll free: 1–800–952–9677.
- e. Also contact: HQDA (DACS–SF), DSN 329–2412/COM (703) 601–2412 and (SGPS–PSP) DSN 289–0132/COM (703) 756–0132 (During non-duty hours, contact AOC, DSN 227–0218/(703) 697–0218, and indicate the offices to be notified).

# Appendix I Military and Civilian OSHA Recordkeeping Requirements

#### I-1. General

The Occupational Safety and Health Administration's (OSHA) final rule amending the occupational injury and illness recording and reporting requirements applicable to Federal agencies IAW 29 CFR Part 1960, Subpart I, will make the Federal sector's recordkeeping and reporting requirements essentially identical to the private sector. However, this change will not diminish or modify Army's responsibility to report or record injuries and illnesses as required by the Office of Workers' Compensation Programs under the Federal Employees' Compensation Act (FECA). Except as modified by 29 CFR Part 1960, Subpart I, Army's injury and illness recording and reporting requirements will comply with the requirements under 29 CFR 1904, Subparts C, D, E, and G, except for the definition of "establishment" as contained in 29 CFR 1960.2(h).

# I-2. Recording criteria

29 CFR 1904, Subpart C is the most important section of the rule, as it defines which cases are required to be recorded. Determinations of recordable cases are based on the following:

- a. Work-relatedness. Work-relatedness is presumed for injuries and illnesses resulting from events or exposures occurring in the work environment. However, a case is presumed work-related only if an event or exposure in the work environment is a discernable cause of the injury or illness, or of a significant aggravation to a pre-existing condition.
  - b. New cases. A case is new if the employee:
- (1) Has not previously experienced a recordable injury or illness of the same type that affects the same part of the body; or
- (2) Previously experienced a recordable injury or illness of the same type that affects the same part of the body, but had recovered completely and an event or exposure in the work environment caused the signs and symptoms to reappear.
- c. General recording criteria. An injury or illness to an Army civilian or Army direct contractor is classified based on severity. Those that result in less than a day away from work beyond the date of the accident will be considered Class D injuries. Injuries and illnesses are considered recordable if they result in one or more of the following:
  - (1) Death
- (2) Days away from work. Record the case if it involves one or more days away from work, but do not include the day of injury or illness in the count. Count the number of calendar days (includes weekend days, holidays, vacation days, and so forth.) the employee was unable to work. The day count may be stopped if the employee leaves the job for a reason unrelated to the injury or illness or the count reaches the cap of 180 days.
- (3) Restricted work activity. A restricted work activity exists if the employee is unable to work the full workday they would otherwise have been scheduled to work or is unable to perform one or more routine job functions (regularly performed by the employee at least once per week). The day of injury/illness is not counted, and a restriction that is limited only to the day of injury or illness does not make a case recordable.
- (4) Transfer to another job. This is when an injured or ill employee is assigned to a job other than their regular job for part of the day. A case is recordable if the injured or ill employee performs their routine job duties for part of a day and assigned to another job for the rest of the day. If a permanent job transfer is made immediately, that is, on the day of injury or illness, at least one day of restricted work activity must be recorded.
- (5) Medical treatment beyond first aid. Medical treatment is the management and care of a patient to combat disease or disorder. Medical treatment does not include visits to a physician or licensed health care professional (PLHCP) soley

for observation and counseling, including follow-up visits. Medical treatment also does not include diagnostic procedures such as X-rays, blood tests, or magnetic resonance imaging (MRI). Use of prescription medications for diagnostic purposes is also not considered medical treatment. (For example, prescription eye drops used to dilate the pupils.) Finally, medical treatment does not include first-aid procedures.

- (6) Loss of consciousness. All work-related cases involving loss of consciousness must be recorded. The length of time the employee is unconscious is irrelevant.
- (7) Significant injury or illness diagnosed by a PLHCP. Such conditions as cancer, chronic irreversible disease, punctured eardrum, and fractured or cracked bones or teeth must be recorded at the time of diagnosis. There are some significant injuries, such as a punctured eardrum or a fractured toe or rib, for which neither medical treatment nor work restrictions may be recommended. In addition, there are some significant progressive diseases such as byssinosis, silicosis, and some types of cancer for which medical treatment or work restrictions may not be recommended at the time of diagnosis but are likely to be recommended as the disease progresses. OSHA believes that cancer, chronic irreversible diseases, fractured or cracked bones, and punctured eardrums are generally considered significant injuries and illnesses and must be recorded at the time of diagnosis, even if medical treatment or work restrictions are not recommended, or are postponed in a particular case. Significant injuries and occupational illnesses will be classified based on their severity. Those injuries resulting in less than a day away from work beyond the date of the accident will be classified as a Class D accident.
- (8) Needle sticks and sharps injuries. The rule requires recording of all work-related needle sticks and cuts from contaminated sharp objects. This has the greatest affect on the health care sector. Record all work-related needle sticks and cuts from sharps that are contaminated with another person's blood or other potentially infectious material (includes human bodily fluids, tissues, and organs; other materials infected with HIV or HBV such as laboratory cultures). Also record splashes or other exposures to blood or other potentially infectious material if it results in a diagnosis of a bloodborne disease or meets the general recording criteria.
- (9) *Medical removal*. If an employee is medically removed under the medical surveillance requirements of an OSHA standard, (for example, lead, cadmium, and benzene), the case must be recorded. The case will be recorded as either one involving days away from work or days of restricted work activity, depending on the circumstances of the removal. If an employee is voluntarily removed below the thresholds established in the standards, the case does not need to be recorded.
  - (10) Hearing loss. Employers must record work-related hearing loss cases where—
- (a) The employee has experienced a Standard Threshold Shift (STS) (see the OSHA noise standard 29 CFR 1910. 95(g)(10)(i)).
- (b) The employee's hearing level is 25 decibels (db) or more above audiometric zero (averaged at 2000, 3000, and 4000 hertz [Hz]) in the same ears at the STS. Employers must record work-related hearing loss cases when an employee's hearing test shows a marked decrease in overall hearing. If an event or exposure in the work environment caused or contributed to the hearing loss, or significantly aggravated a preexisting hearing loss, the case is work-related. If a PLHCP or other licensed health care determines that the hearing loss is not work-related or has not been significantly aggravated by occupational noise exposure, employers are not required to record the case.
- (11) *Tuberculosis*. If an employee is exposed to an active case of Tuberculosis (TB) at work and then has a positive TB skin test or becomes an active case, then it must be recorded. The case does not have to be recorded if there is evidence that the case did not arise from a workplace exposure.

#### I-3. First aid

If the most serious injury is first aid and there is no recordable property damage they are considered non-recordable. First aid is defined using a list of procedures that are all-inclusive. If a procedure is not on the list, it is not considered first aid for recordkeeping purposes. The following are the procedures contained in the list:

- a. Using nonprescription medications at nonprescription strength. However, if an employee is provided prescription medications or nonprescription medications at prescription strength, this is considered medical treatment.
  - b. Tetanus immunizations.
  - c. Cleaning, flushing, or soaking surface wounds.
- d. Wound coverings, butterfly bandages, Steri-Strips. However, use of wound closure methods such as sutures, medical glues, or staples is considered medical treatment.
  - e. Hot or cold therapy, regardless of how many times it is used.
  - f. Non-rigid means of support.
  - g. Temporary immobilization device used to transport accident victims.
  - h. Drilling of fingernail or toenail; draining fluid from blister.
  - i. Eye patches.
- j. Removing foreign bodies from eye using irrigation or cotton swab. However, use of other methods to remove materials from the eye is medical treatment.
- k. Removing splinters or foreign material from areas other than the eye by irrigation, tweezers, cotton swabs, or other simple means.

- l. Finger guards.
- m. Massages. Massage therapy is first aid, but physical therapy or chiropractic treatment is considered medical treatment.
- n. Drinking fluids for relief of heat stress. Drinking fluids for relief of heat stress is first aid, but administering an IV is medical treatment.

#### I-4. Forms

Employers must enter each recordable case on the appropriate OSHA forms within 7 calendar days of receiving information that a recordable case occurred. The rule requires employers to keep three forms:

- a. OSHA Form 300, Log of Work-Related Injuries and Illnesses. On the 300 Log, the employer checks one and only one of the outcome columns for each case, the one representing the most serious outcome of the case. If the status changes, then the entry must be changed. For example, if the injured employee is experiencing days away from work, then dies, the employer must remove (or line out) the day's away entry and the day count and check the box for a fatality. Only required for Army civilian occupational injuries and illnesses.
- b. OSHA Form 300A, Summary of Work-Related Injuries and Illnesses. This form must be posted at the end of each calendar year from 1 February to 30 April of the year following the year covered by the form.
- c. The OSHA Forms 300 and 300A or equivalent form will be maintained for all Army personnel, military, civilian, and contractors, as defined in this pamphlet. Maintain military occupational injuries/illnesses on a separate log from other personnel.
- d. The DA Form 285-series or DA Form 2397-series forms as appropriate will be used in lieu of the OSHA Form 301, Injury and Illness Incident Report. This form captures data on each injury and illness (the length of service, what time the injury occurred, what time the employee started work).

Note. Employers can keep their records on equivalent forms, on a computer, or at a central location, provided they can get information into the system within 7 calendar days after the injury or illness occurs and they can produce the data at the establishment when required. Records must be retained for 5 years.

# I-5. protection

For certain "privacy concern cases," employers must not enter the employee's name on the 300 form. Instead, they are to enter "Privacy Case." A separate confidential list of the employees' names and case numbers must be kept by the employer and provided to an OSHA inspector upon request. Privacy concern cases are defined very specifically as follows:

- a. An injury or illness to an intimate body part or the reproductive system.
- b. An injury or illness resulting from sexual assault.
- c. Mental illness.
- d. HIV infection, hepatitis, or TB.
- e. Needle sticks and cuts from contaminated sharps with another person's blood or other potentially infectious material.
- f. Illness cases where employees independently and voluntarily request that their names not be entered on the log. Note. For a privacy concern case, if the employee's identity can still be implied, the employer may use some discretion in describing the case. Enough information must be entered to identify the cause and general severity of the incident. For example, a sexual assault can be entered as "Assault" or an injury to a reproductive organ can be entered as a "Lower abdominal injury." The employer is not required to go into great deal in these types of cases. If the employer gives out the forms to the public, the names must be removed first. There are exceptions for employee access, OSHA access, auditor, insurance, or law enforcement personnel.

# I-6. Travel status

When employees are traveling, an injury or illness that occurs while the employee is engaged in work activities for the employer is considered work-related.

- a. Travel to and from customer contacts and entertaining or being entertained at the direction of the employer is work-related. For example, if an employee falls in the airport while on a business trip, the case is work-related.
- b. "Home away from home." When an employee checks into a hotel or motel, they establish a "home away from home." While in "home away from home" status, cases that occur are not work-related. For example, if an employee slips in the hotel shower and is injured, the case is not work-related.
- c. Detour for personal reasons. When an employee takes a side trip while on travel status for a vacation (For example, sight-seeing, shopping, and so forth.) and is injured, the case is not work-related.

# **Glossary**

# Section I

# **Abbreviations**

# **AAAR**

abbreviated aviation accident report

#### AC

aircraft commander

# **ACOD**

actual cost of damage

# **ACOM**

Army command

# **ACU**

Aircrew combat uniform

#### ACV

Army combat vehicle

# **ADSW**

active duty for special work

# **ADT**

active duty for training

# **AFME**

Armed Forces medical examiner

# **AFMES**

Armed Forces Medical Examiner System

# **AFTP**

Additional Flight Training Program

# **AGAR**

abbreviated ground accident report

# **AGL**

above ground level

# **AGR**

active guard reserve

# AID

analytical investigation division

#### AMC

Army Materiel Command

# **AMCOM**

Aviation and Missile Command

#### AMDE

Army master data file

# **AMV**

Army motor vehicle

# AOC

Army Operations Center

#### APU

auxiliary power unit

### AR

Army Regulation

### ARNG

Army National Guard

# ASA (IE&E)

Assistant Secretary of the Army (Installations, Energy, and Environment)

### ASA (ALT)

Assistant Secretary of the Army (Acquisition, Logistics, and Technology)

# **ASCC**

Army service component command

#### ASMIS

Army Safety Management Information System

# **ASO**

aviation safety officer

#### ASV

armored security vehicle

# AT

annual training

## ATC

air traffic control

# **ATLS**

Automated Take-off and Landing System

# ATM

Air-crew Training Manual

## BAC

blood alcohol content

#### **BMNT**

beginning of morning nautical twilight

#### CAl

centralized accident investigation

# **CFR**

Code of Federal Regulations

# $\mathbf{C}\mathbf{G}$

Center of Gravity

# CID

Criminal Investigation Division

# CPI

Consumer Price Index

### **CSA**

Chief of Staff, Army

### $\mathbf{C}\mathbf{Y}$

Calendar Year

# DA

Department of the Army

#### DAC

Department of Army Civilian

### **DAITM**

Department of the Army Investigation Team for Malfunctions

# DA PAM

Department of the Army Pamphlet

# DASA(ESOH)

Deputy Assistant Secretary of the Army (Environment, Safety and Occupational Health)

### DASAF

Director of Army Safety

#### DOD

Department of Defense

# **DODAC**

Department of Defense Activity Code

#### DODI

Department of Defense Instruction

# **DODIC**

Department of Defense Identification Code

#### DOI

Department of Labor

### DOT

Department of Transportation

### DR

deficiency report

# DRU

direct reporting unit

## DSC

digital source collector

# **DSN**

Defense Service Network

# **DTM**

data transfer module

# **E3**

Electromagnetic and environmental effects

### **ECOD**

estimated cost of damage

# **ECP**

entry control point

# **EENT**

end of evening nautical twilight

# **EMI**

electro-magnetic interference

#### FIR

equipment improvement report

# **ELT**

Emergency Locator Transmitter

#### EMR

electromagnetic radiation

# EO

external operator

#### **EOD**

explosive ordnance disposal

# **FAA**

Federal Aviation Administration

# **FAC**

flight activity category

# **FDA**

Food and Drug Administration

# FED LOG

Federal logistics record

# $\mathbf{FL}$

Forced Landing

### $\mathbf{FM}$

field manual

# **FMTV**

family of medium tactical vehicles

# **FOA**

field operating agency

# **FOD**

foreign object damage

# **FOIA**

Freedom of Information Act

# **FORSCOM**

Forces Command

### fpm

Feet per minute

# **FRAGO**

fragmentary order

# **FSW**

feet of sea water

# **FTS**

Flight Termination System

# FTX

field training exercise

# **FWT**

fair wear and tear

### **GCS**

ground control station

# **GDT**

Ground Data Terminal

#### GS

general schedule

# **GSA**

General Services Administration

# **HBV**

Hepatitis B Virus

# HE

high explosive

#### HIRTA

high-intensity radio transmission area

#### ніх

Human Immunodeficiency Virus

# **HMMWV**

high-mobility multi-purpose wheeled vehicle

#### **HPG**

Helicopter Procedures Guide

# **HQDA**

Headquarters, Department of the Army

# IAI

installation-level accident investigation

# **IATF**

individual aircrew training folder

# IDT

inactive duty training

### ΙE

Instrument Examiner

# **IFR**

instrument flight rules

### **IFRF**

individual flight record folder

#### ILS

Instrument Landing System

# **IMC**

instrument meteorological conditions

# **IMCOM**

Installation Management Command

#### Ю

instructor operator

# IP

instructor pilot

#### **JRT**(

Joint Readiness Training Center

# **KATUSA**

Korean Augmentation to the United States Army

#### KIAS

Knots indicated airspeed

# LOI

Level of Interoperability

# LOL

Loss of Link

# LSE

life support equipment

### LSO

laser safety officer

# LZ

landing zone

# **MEDCOM**

Medical Command

# **MEDDAC**

Medical Department Activity

# **MEDEVAC**

medical evacuation

# MOS

military occupational specialty

### MP

military police

# MOC

maintenance operational check

### **MRAP**

Mine resistant, ambush protected

### **MSF**

Motorcycle Safety Foundation

### **MSL**

mean sea level

### **MTDS**

mission, type, design, and series

#### MTF

medical treatment facility

# **MWO**

modification work order

### NAF

Non-appropriated fund

# **NAIRA**

nuclear accident and incident response and assistance

#### NATO

North Atlantic Treaty Organization

# NDB

non-directional beacon

#### **NFIRS**

National Fire Incident Reporting System

# **NEW**

net explosive weight

### NOE

nap of the earth

#### NRC

Nuclear Regulatory Commission

## **NSN**

national stock number

# NTC

National Training Center

# **NTSB**

National Transportation Safety Board

# **NVD**

night vision device

### **NVG**

night vision goggles

# NVS

night vision system

### **OCONUS**

outside the continental United States

# **OCSA**

Office of the Chief of Staff, Army

### OJT

on-the-job training

# **OPNAVINST**

Chief of Naval Operations Instruction

#### OSHA

Occupational Safety and Health Administration

### **PAO**

public affairs officer

#### PC

pilot -in-command

# **PPE**

personal protective equipment

#### PCS

permanent change of station

# **PEO**

program executive officer

# PΙ

pilot

## PII

personally identifiable information

#### PL

Precautionary Landing

# **PLHCP**

Physician or Licensed Health Care Professional

## PM

Program Manager or Product Manager

### PN

part number

# **POC**

point of contact

# POL

petroleum, oils, and lubricants

### POV/PMV

privately owned vehicle/private motor vehicle

#### **PODR**

product quality deficiency report

### PZ

Pick-up Zone

# **QASAS**

Quality Assurance Specialist, Ammunition Surveillance

#### RAW

risk assessment worksheet

### RDT&E

Research, Development, Test, and Evaluation

#### RFI

Radio Frequency Interference

# RL

readiness level

### RM

risk management

## **ROTC**

Reserve Officer Training Corps

# **RSO**

radiation safety officer

# SDZ

surface danger zone

#### SO

standardization instructor operator

# **SOP**

standard operating procedures

#### SSN

Social Security Number

# **STANAG**

Standardization Agreement (NATO)

## **STS**

Standard Threshold Shift

# **SUAS**

Small Unmanned Aircraft System

# **TALS**

Tactical Automated Landing System

# **TAMMS**

The Army Maintenance Management System

### **TASC**

Training and Audiovisual Support Center

#### TB

technical bulletin, Tuberculosis

### **TBO**

Time Before Overhaul

# TDY

temporary duty

#### TM

technical manual

# TOC

tactical operations center

#### TOF

table of organization and equipment

### **TRADOC**

U.S. Army Training and Doctrine Command

#### TTAL

temporary tour of active duty

### UA

unmanned aircraft

## **UASAR**

Unmanned Aircraft System Accident Report

# UAS

Unmanned Aircraft System

#### UIC

Unit Identification Code

## **USAARL**

U.S. Army Aeromedical Research Laboratory

#### **USACE**

United States Army Corps of Engineers

# **USAR**

United States Army Reserve

## **USACRC**

U.S. Army Combat Readiness Center

# **USAIPH**

U.S. Army Institute of Public Health

### **USAREUR**

United States Army Europe

### **USARPAC**

United States Army Pacific

#### **USATCES**

United States Army Technical Center for Explosives Safety

#### **USMA**

United States Military Academy

#### UT

unit trainer

### **VAR**

Variable

#### **VFR**

visual flight rule

#### VISTA

Volunteers in Service to America

#### **VMC**

visual meteorological condition

### **VOR**

Very High Frequency (VHF) Omni-directional Range

#### WSPS

Wire Strike Protection System

#### Section II

#### **Terms**

## **Aborted Takeoff**

An unplanned event that occurs before intent for flight exists, with engine(s) running that interrupts a planned flight (except for maintenance test flights and factory acceptance flights).

#### Accident

An unplanned event that causes personal injury or illness, or property damage.

## **Active Army Personnel**

Members of the Army on full-time duty in active military service, including cadets at the U.S. Military Academy.

### Aircraft

Balloons, gliders, airships, and flying machines, whether manned or unmanned, weight carrying structures for navigating of the air that is supported by its own buoyancy or the dynamic action of the air against its surfaces.

# Aircraft ground accident

Injury or property damage accidents involving Army aircraft in which no intent for flight exists and the engine(s) is in operation. (An installed aircraft Auxiliary Power Unit (APU) is not considered an aircraft engine.) In the case of an Aerostat balloon accident there must no intent for flight and the system must be operational. See the definition of operational Aerostat balloon.

### Aircraft, missile accident, or Incident

Any occurrence so classified by any of the nations involved and which involves projectiles. These projectiles can be of all types, whether guided or unguided and free-falling, rocket-propelled, or fired from a cannon.

# Aircraft or missile accident safety investigation

A systematic and thorough analysis, research, or careful examination to disclose all relevant facts, conditions, and circumstances associated with or surrounding each aircraft or missile accident. It is conducted for the sole purpose of

accident prevention. It is in addition to and separate from other investigations required by the laws of the nations involved.

# Aircraft or Missile Accident Safety Investigation Committee

A body comprised of such investigators and medical and technical advisers as needed by the country or each of the countries involved to carry out aircraft or missile accident safety investigations.

# Air Force

The Air Forces, Naval Air Forces, and Army Air Forces of the nations involved.

### Ammunition and explosives

Includes, but is not limited to, all items of ammunition; propellants, liquid and solid; high and low explosives; guided missiles; warheads; devices; pyrotechnics; chemical agents; components and substances associated therewith, presenting real or potential hazards to life and property.

### **Ammunition malfunction**

Failure of an ammunition item to function as expected when fired, launched, or when explosive items function under conditions that should not cause functioning. Malfunctions include hang-fires, duds, abnormal functioning, and premature functioning of explosive items under normal handling, maintenance, storage, transportation, and tactical deployment. Malfunctions do not include accidents or incidents that arise solely from negligence, all practice, or situations such as vehicle accidents or fires.

## Army accident

An Army accident is defined as an unplanned event, or series of events, which results in one or more of the following:

- a. Occupational illness to Army military or DA civilian personnel.
- b. Injury to on-duty Army civilian personnel.
- c. Injury to Army military personnel on or off duty.
- d. Damage to Army property.
- e. Damage to public or private property and/or injury or illness to non-Army personnel caused by Army operations (the Army had a causal or contributing role in the accident).

# Army civilian personnel

Types of Army civilian personnel—

- a. Senior Executive Service, General Management, General Schedule, and Federal Wage System, NSPS, employees.
- b. COE employees.
- c. ARNG and USAR technicians.
- d. NAF employees (excluding part-time military).
- e. Foreign nationals directly or indirectly employed by DA (paid by appropriated funds).
- f. Youth/Student Assistance and Temporary Program employees; VISTA volunteers; Job Corps, Neighborhood Youth Corps, and Youth Conservation Corps volunteers; Family Support Program volunteers.

## Army combat vehicle

Tanks, self-propelled weapons, tracked armored personnel carriers, amphibious vehicles ashore, and similar equipment.

### Army direct contractor

On-duty contractors supervised by Army personnel on a day-to-day basis.

# Army Leadership

Army Leadership refers to Army Officers, NCOs, SES officials, and GS employees designated, authorized, held responsible, and accountable by the Army to make decisions at various levels of the Army involving execution of the Army's mission. Designation must be documented in writing or contained in official orders.

# Army motor vehicle

Any vehicle that meets the following criteria:

- a. A vehicle that is owned, leased, or rented by DA and/or USAR components.
- b. A vehicle that is primarily designed for over-the-road operation.
- c. A vehicle whose general purpose is the transportation of cargo or personnel. Examples are passenger cars, station wagons, trucks, ambulances, buses, motorcycles, fire trucks, and refueling vehicles.

### Army National Guard (ARNG) Personnel

ARNG personnel who are on-

- a. Active duty for training.
- b. Inactive duty training.
- c. Annual training.
- d. ADSW.
- e. AGR.
- f. TTAD.
- g. Full-time manning.

### Army personnel

Active duty Army personnel, Army civilian personnel, Army Reserve personnel, Army National Guard personnel and ROTC personnel as defined in this regulation.

### Army property

Any item of Army property or property leased by the Army for which the Army has assumed risk of loss such as aircraft, vehicle, building, structure, system, and so forth.

## **Army RM Process**

A holistic approach to preserving readiness that applies 24/7 to Soldiers, Army civilian employees, and contract workers. The process has five phases that form a closed-loop system of risk assessment, mitigation, and evaluation.

# U.S. Army Reserve (USAR) Personnel

USAR members who are on—

- a. Active duty for training.
- b. Inactive duty training.
- c. Annual training.
- d. ADSW.
- e. AGR.
- f. TTAD.
- g. Full-time manning.

## **Bailed** aircraft

Any government-owned aircraft provided to a contractor under a Bailment Agreement for use in conjunction with a specific contractual requirement. Aircraft are usually bailed to a contractor to perform government contract work. Aircraft are usually leased to a contractor for the contractor's use. Bailment Agreements are legal contracts between the Government Program Office and the contractor.

### **Bailment Agreement**

An agreement for the delivery of personal property (as opposed to real property) in trust for a specific purpose, to be returned when the specific purpose is accomplished.

# Biological mishap

A biological mishap is an event in which the failure of laboratory facilities, equipment, or procedures appropriate to the level of potential pathogenicity or toxicity of a given etiologic agent (organism or toxin) may allow the unintentional, potential exposure of humans or the laboratory environment to that agent.

### Chemical agent mishap

A chemical agent mishap is an event in which the failure of facilities, equipment, or procedures may allow the possible unintentional exposure of personnel or the work environment to chemical agent, including Research, Development, Test and Evaluation solutions.

# Chemical event

A chemical event encompasses chemical surety material (see AR 50–6) accidents, incidents and other circumstances where there is a confirmed or likely release to the environment, exposure of personnel above the Short Term Exposure Limit (or maximum concentration limit for the Chemical Defense Training Facility at Fort Leonard Wood) for the chemical agent involved, threat to the security of chemical surety material, or event of concern to the local commander/director.

### **Combined Committee**

A body formed to investigate accidents involving equipment, facilities, or personnel of two or more member nations.

#### Commander

An individual that exercises authority and responsibility over subordinates by virtue of rank or position. The purpose of that authority and responsibility is to effectively use available resources and plan the employment of, organize, direct, coordinate and control the actions of an Army organization for the purpose of successful mission accomplishment. Examples of commanders are as follows:

- a. Commander of an Army Headquarters (ACOM, ASCC, DRU), CONUS and OCONUS.
- b. The Chief of Engineers (civil and military works).
- c. Commander, U.S. Army Space and Strategic Defense Command.
- d. The Chief, National Guard Bureau.
- e. Commander, U.S. Army Medical Research and Development Command.
- f. Commanders of Army installations with a full-time safety professional. This includes posts, camps, stations, and military communities.
  - g. State Adjutants General (ARNG).
  - h. Commanders of USAR organizations with a full-time safety professional.
  - i. Commanders of medical treatment facilities.
  - j. Commanders in direct support of general support maintenance units.
  - k. Director of Facilities Engineering.
  - l. Provost Marshal/Law Enforcement Commander.
  - m. Director of Industrial Operations.
  - n. U.S. Army Plant Representative Office.
  - o. Commander of TOE, MTOE, or TDA organization.

# **Command Responsibility**

Commanders down the entire chain of command are responsible for the safety of their personnel.

### **Competent authority**

An individual of the Armed Forces designated in command, responsible for the direction, coordination, and control of military forces. The commander alone is responsible for everything his unit does or fails to do. He cannot delegate his responsibility or any part of it, although he may delegate portions of his authority to competent individuals. An individual designated by the commander to address areas of primary interest within that individual's technical expertise.

# Competent medical authority

Any duly qualified physician (government or private), who is approved by the Office of Workman's Compensation to render treatment. "Competent medical authority" includes surgeons, podiatrists, dentists, clinical psychologists, optometrists, chiropractors, and osteopathic practitioners.

# Composite risk

Blends tactical, threat-based risks with accidental, hazard-based risks. (U.S. Army).

### **Contracting Agency**

The organization that has primary responsibility for monitoring, administering, and ensuring compliance with the contract, especially pertaining to the chemical agent program.

# Contracting officer

A designated officer who performs administrative functions listed in the Federal Acquisition Regulation.

# Contractor accident

An accident that occurs as a result of a government contractor's operations in which there is damage to U.S. Government or Army property or equipment, injury or occupational illness to Army personnel, or other reportable event. Occupational injury or illness to a contractor or subcontractor is reported only if contractually required and occurs while on duty and engaged in work at the Army work site. Also see Army direct contractor.

# Controlled Flight into Terrain

A mishap where an airworthy aircraft, under pilot control, inadvertently flies into terrain, water, or an object. This does not include incidents where there is intent to land, object/wire strikes, or the aircraft departs controlled flight.

#### DA contractor

A non-Federal employer engaged in performance of a DA contract, whether as prime contractor or subcontractor.

#### **DA** installation

A grouping of facilities located in the same vicinity that supports a particular DA function. Installations may include locations such as posts, camps, stations, or communities, land, and improvements permanently affixed thereto which are under the DA control and used by Army organizations. Where installations are located contiguously, the combined property is designated as one installation and the separate functions as activities of that installation. In addition to those used primarily by troops, the term "installation" applies to such real properties as depots, arsenals, ammunition plants (both contractor and government operated), hospitals, terminals, and other special mission installations.

# Days Away From Work

The actual or estimated number of days lost that the individual could not work excluding the day of the injury/ occupational illness. Count all calendar days including weekends and holidays. For military personnel, days away from work for on- and off-duty injuries and occupational illnesses include hospitalization, medical restrictions to quarters, convalescent leave, and commander directed removal from duties.

### **Deflagration**

A reaction characterized by a rapid burning action that generates vast amounts of heat and pressure if confined. However, the reaction is not as violent as a detonation. Burning propellants and pyrotechnics are typical deflagration type reactions.

# **Degraded Visual Environment**

An environment of reduced visibility of potentially varying degree, wherein situational awareness and aircraft control cannot be maintained as comprehensively as they are in normal Visual Meteorological Conditions (VMC) and can potentially be lost.

#### **Destroyed** aircraft

An aircraft is considered destroyed/total loss when the estimated cost to repair exceeds the current full-up replacement cost.

## **Detonation**

A violent reaction usually characterized by blast, high overpressure, and when located on or near the ground, a crater normally occurs. High-explosive (HE) munitions such as projectiles, grenades, and demolition material are typical detonation type munitions.

### Digital source collector

An aircraft/vehicle on-board device (static and/or mission equipment) that collects analog and digital data on systems, components, and mission equipment. Examples of DSC devices are Maintenance Data Recorder (MDR), Flight Data and Cockpit Voice Data Recorder (CVFDR), digital data collection PC media, analog tape and digital media video devices, Health and Usage Monitoring System (HUMS), Vibration Enhancement Management Program (VMEP), MILTOPE, GPS, and Mission Equipment Flash Cards and hard drives.

#### **Emergency**

An event for which an individual perceives that a response is essential to prevent or reduce injury or property damage.

#### Emplacing

The placing or setting of an explosives charge in a specific scenario for use as intended, but prior to the actual functioning of the item. Placing a shape charge against a door or a mine in the ground are examples of "emplacing munitions."

## **Environmental factors**

Environmental conditions which had or could have had an adverse effect on the individual's actions or the performance of equipment.

# **EOD**

The detection, identification, field evaluations, rendering safe, recovery, and final disposal of unexploded explosive ordnance or munitions chemical agents.

### **EOD** procedures

Those particular courses or modes of action for access to, recovery, render safe, and final disposal of explosive ordnance or any hazardous material associated with an EOD incident.

### **Establishment**

A single physical location where business is conducted or where services or operations are performed. Where distinctly separate activities are performed at a single physical location, each activity shall be treated as a separate establishment. Typically, an establishment refers to a field activity, regional office, area office, installation, or facility.

# **Explosion**

The chemical reaction of any chemical compound or mechanical mixture that when initiated, undergoes a very rapid combustion or decomposition, releasing large volumes of highly heated gases that exert pressure on the surrounding medium. Depending on the rate of energy release, an explosion can be categorized as a deflagration or a detonation.

#### Fair wear and tear (FWT)

Loss or impairment of appearance, effectiveness, worth, or utility of an item that has occurred solely because of normal and customary use of the item for its intended purpose.

#### I. First aid

First aid is defined as using a list of procedures that are all-inclusive and is not a recordable injury. If a procedure is not on the list, it is not considered first aid for recordkeeping purposes. The following are the procedures contained in the list:

- a. Using nonprescription medication at nonprescription strength. However, if an employee is provided prescription medications or nonprescription medications at prescription strength, this is considered medical treatment.
  - b. Tetanus immunizations.
  - c. Cleaning, flushing, or soaking surface wounds.
- d. Wound coverings, butterfly bandages, Steri-Strips. However, use of wound closure methods such as sutures, medical glues, or staples is considered medical treatment.
  - e. Hot or cold therapy regardless of how many times it is used.
  - f. Non-rigid means of support.
  - g. Temporary immobilization device used to transport accident victims.
  - h. Drilling of fingernail or toenail; draining fluid from blister.
  - i. Eye patches.
- *j.* Removing foreign bodies from eye using irrigation or cotton swab. However, use of other methods to remove materials from the eye is medical treatment.
- k. Removing splinters or foreign material from areas other than the eye by irrigation, tweezers, cotton swabs or other simple means.
  - l. Finger guards.
- m. Massages. Message therapy is first aid, but physical therapy or chiropractic treatment is considered medical treatment.
- n. Drinking fluids for relief of heat stress. (Drinking fluids for relief of heat stress is first aid, but administering an IV is medical treatment.)

# Flight accidents

Those accidents in which intent for flight exists (as defined in this glossary) and for which there is reportable damage to the aircraft itself. (Explosives, chemical agent, or missile events that cause damage to an Army aircraft with intent for flight are categorized as flight accidents to avoid dual reporting.)

# Flight crew

Personnel on flight pay who are involved in operation of the aircraft.

# Flight related accidents

Those aircraft accidents in which there is intent for flight and no reportable damage to the aircraft itself, but the accident involves a fatality, injury to aircrew, ground crew, passengers, other injury, and/or property damage.

### Forced landing

A landing caused by failure or malfunction of engines, systems, or components that makes continued flight impossible.

# Foreign object damage (FOD)

Damage to Army vehicle/equipment/property as a result of objects alien to the vehicle/equipment damaged. Excludes aircraft turbine engine(s) defined as a FOD incident.

# Fratricide/friendly fire (FF)

Circumstances in which members of a U.S. or friendly military force are mistakenly or accidentally killed or injured in action by U.S. or friendly forces actively engaged with an enemy or who are directing fire at a hostile force or what is thought to be a hostile force. Fratricide/FF incidents will be primarily investigated and reported under AR 385–10.

#### Ground accident

Any accident exclusive of aviation (flight/flight related/aircraft ground) (For example, AMV, ACV, POV, marine).

#### Hazard

A condition with the potential to cause injury, illness, or death of personnel; damage to or loss of equipment, property or mission degradation.

### Hazard analysis

A hazard analysis is a clear, systemic, concise, well-defined, orderly, consistent, closed-loop, quantitative or qualitative and objective methodology used to identify possible hazards within a mission, system, equipment, or process that can cause losses to the mission, equipment, process, personnel, or damage to the environment. Examples of hazard analyses are What-If, Preliminary Hazard Analysis, Sneak Circuit Analysis, Hazard and Operability Study, Fault Tree Analysis, Failure Mode and Effects Analysis, and Fault Hazard Analysis.

## Hazardous material

There are many definitions and descriptive names being used for the term hazardous material, each of which depends on the nature of the problem being addressed. Unfortunately, there is no one list or definition that covers everything. The United States agencies involved, as well as state and local governments, have different purposes for regulating hazardous materials that, under certain circumstances, pose a risk to the public or the environment.

# Hospitalization

Admission to a hospital as an inpatient for medical treatment.

#### **Human error**

Human performance that deviated from that required by the operational standards or situation. Human error in accidents can be attributed to a system inadequacy/root cause in training, standard, leader, individual, or support failure.

### **Human factors**

Human interactions (man, machine, and/or environment) in a sequence of events that were influenced by, or the lack of human activity, which resulted or could result in an Army accident.

### Impact area

The ground and associated airspace within the training complex used to contain fired or launched ammunition and explosives and the resulting fragments, debris, and components from various weapon systems. A weapon system impact area is the area within the surface danger zone (SDZ) used to contain fired or launched ammunition and explosives and the resulting fragments, debris, and components. Indirect fire weapon system impact areas include probable error for range and deflection. Direct fire weapon system impact areas encompass the total SDZ from the firing point or positions downrange to distance X:

- a. Temporary impact area. An impact area within the training complex used for a limited period of time to contain fired or launched ammunition and explosives and the resulting fragments, debris, and components. Temporary impact areas are normally used for non-dud-producing ammunition or explosives and should be able to be cleared and returned to other training support activities following termination of firing.
- b. Dedicated impact area. An impact area that is permanently designated within the training complex and used indefinitely to contain fired or launched ammunition and explosives and the resulting fragments, debris, and components. Dedicated impact areas are normally used for less sensitive ammunition and explosives than that employed in high hazard impact areas. However, any impact area containing fused HE or white phosphorous duds represent a high risk to personnel and access must be limited and strictly controlled.
- c. High hazard impact area. An impact area that is permanently designated within the training complex and used to contain sensitive HE ammunition and explosives and the resulting fragments, debris, and components. High hazard impact areas are normally established as part of dedicated impact areas where access is limited and strictly controlled

because of the extreme hazard of dud ordnance such as ICM, HEAT, 40-mm, and other highly sensitive ammunition and explosives.

### Individual failure

Soldier knows and is trained to standard but elects not to follow standard (self-discipline-mistake due to own personal factors).

# Initial denial authority

The official at HQDA level with the authority to deny release of a document, in whole or in part, under the FOIA.

### Injury

A traumatic wound or other condition of the body caused by external force, including stress or strain. The injury is identifiable as to time and place of occurrence and member or function of the body affected, and is caused by a specific event or incident or series of events or incidents within a single day or work shift.

# Installation

An aggregation of contiguous or near contiguous, common mission supporting real property holdings under the jurisdiction of the Department of Defense within and outside the continental United States. Examples include, but are not limited to, posts, camps, bases, and stations.

# Installation-level Safety Manager

Definition of Installation Safety Managers:

- a. The senior full-time safety professional responsible for providing safety support to Army installations, including camps, stations, military communities, and USAR organizations.
  - b. State Safety Manager or Specialist (ARNG).

# Intent for flight (UAS Manned Aircraft)

Intent for flight begins when power is applied or brakes released to move the aircraft under its own power, for the purpose of commencing authorized flight with an authorized crew. Intent for flight ends when the aircraft is at a full stop and power is completely reduced. Intent for Flight is the physical act of applying power to move the aircraft, not the thought process of the crew member as to what is going to occur in the future.

### Intent for flight (UAS)

Intent for flight begins when power is applied or brakes released (if so equipped), or UA is hand released by the operator, or the launcher is released, for the purpose of moving an aircraft under its own power to commence authorized flight (including ground taxi/hover) by an authorized crew. Intent for flight ends when the aircraft is at a full stop and power is completely reduced and/or stopped Intent for flight begins for Aerostat balloons when all of the mooring lines are removed for the purpose of deployment and ends when all of the mooring lines are attached.

### Investigation

A systematic study of an accident, incident, injury, or occupational illness circumstances.

#### Job transfer

When an employee/Soldier is assigned to a job other than his/her regular job for part of the day as a result of an injury or occupational illness.

#### Leader failure

Occurs when leaders fail to monitor mission execution and planning, correct inappropriate behavior, take appropriate actions, or emphasize correct procedures that allowed subordinates to commit task errors or results in a failure.

### Leased aircraft

Any government-owned aircraft provided to a contractor under a Lease Agreement for use in conjunction with a specific contractor need. Aircraft are usually leased to a contractor for the contractor's use. Aircraft are usually bailed to a contractor to perform government contract work. DODD 7230.8, further clarifies leased aircraft procedures and requirements. Lease agreements are legal contracts between the Government Program Office and the contractor.

# Maintenance/repair/servicing

Activities associated with the maintenance, repair, or servicing of equipment and other property. Excludes janitorial, housekeeping, or grounds-keeping activities. Examples: install/remove/modify equipment, tune/adjust/align/connect, hot

metal work, cold metal work, plastic working, soldering, repairing tires, inspecting tires/batteries, fueling/defueling, changing/inflating tires, charging batteries.

# Major component

A combination of subassemblies, assemblies, components, modules, and parts connected in such a manner as to be a self-contained unit which, although part of an end-item, is capable of operating independently of the end-item (for example, engine T–53).

# Malfunction

Failure of an ammunition item to function as expected when fired, launched, or when explosive items function under conditions that should not cause functioning. Malfunctions include hang-fires, misfires, duds, abnormal functioning and premature functioning of explosive items under normal handling, maintenance, storage, transportation, and tactical deployment. Malfunctions do not include accidents or incidents that arise solely from negligence, all practice, or situations such as vehicle accidents or fires.

### **Materiel factors**

When materiel elements become inadequate or counter-productive to the operation of the vehicle/equipment/system.

### **Medical treatment**

Any treatment (other than first aid) administered by a physician or licensed health care professional..

### Military personnel

All Soldiers (U.S. Army active duty personnel; USAR or ARNG personnel on active duty or full-time National Guard duty or in a paid drill status; Service Academy midshipmen/cadets; ROTC cadets when engaged in directed training activities; foreign national military personnel assigned to DA; and members of other U.S. uniformed services assigned to DA).

# Military-unique equipment, systems, and operations

The term "uniquely military equipment, systems, and operations" excludes from the scope of 29 CFR, Part 1960, Basic Program Elements for Federal Employee Occupational Safety and Health Programs and Related Matters, the design of DOD equipment and systems that are unique to the national defense mission, such as military aircraft, ships, submarines, missiles, and missile sites, early warning systems, military space systems, artillery, tanks, and tactical vehicles; and excludes operations that are uniquely military such as field maneuvers, naval operations, military flight operations, associated research test and development activities, and actions required under emergency conditions. The term includes, within the scope of the Order Department of Defense, workplaces and operations comparable to those of industry in the private sector such as vessel, aircraft, and vehicle repair, overhaul, and modification (except for equipment trials); construction; supply services; civil engineering or public works; medical services; and office work.

#### Missile

Air-to-air, surface-to-surface, air-to-surface, surface-to-air, and aerospace vehicles other than aircraft, whether guided or unguided.

### **National Committee**

A body formed by an operating nation to investigate accidents involving only equipment, facilities, or personnel of that nation.

# Nation involved

The nation-

- a. Owning the aircraft or missile.
- b. On whose territory (including territorial waters or ship) the accident occurs.
- c. To whom the crew belongs.

### NAF employees

Employees paid from non-appropriated funds, including summer and winter hires and special NAF program employees. Military personnel working part-time in NAF employment are excluded.

### Non-fatal case without lost workdays

Cases other than lost-workday cases where Army military or civilian personnel, because of an injury or occupational illness, experienced one or more of the following:

- a. Permanent transfer to another job or termination.
- b. Medical treatment greater than first aid.

- c. Loss of consciousness.
- d. Restricted work activity or profile.
- e. Diagnosis as having an occupational illness that did not result in a fatality or lost-workday case. This includes newly diagnosed occupational illnesses detected on routine physical examinations.

### Nuclear weapon

A device in which the explosion results from the energy released by reactions involving atomic nuclei, either fission, fusion, or both. For the purpose of this pamphlet, nuclear components of weapons are also included.

# Nuclear weapon accident

An unexpected event (Flagword: OPREP-3 PINNACLE BROKEN ARROW) involving nuclear weapons or nuclear components that results in any of the following:

- a. Non-nuclear detonation or burning of a nuclear weapon or radiological nuclear weapons component.
- b. Radioactive contamination.
- c. Seizure, theft, loss, or destruction of a nuclear weapon or radiological nuclear weapon component, including jettisoning.
  - d. Public hazard, actual or implied.

# Nuclear weapon minor incident

An unexpected event (Flagword DULL SWORD) involving nuclear weapons that is not reportable as a nuclear weapon accident or significant incident, but which results in any of the following:

- a. Damage to the warhead, or warhead section which Army organizations are authorized to repair, or malfunctions of associated equipment that could result in damage to the warhead, or warhead section. Associated equipment includes test, handling, launch, control, arming, and monitoring systems.)
- b. Damage, loss, or destruction of a nuclear-type training weapon, warhead, or warhead ection. Of particular concern are instances of damage or equipment failure when the same technical procedures and equipment prescribed for use with nuclear weapons were being used on a trainer.
- c. Unauthorized acts that degrade the safety of a nuclear weapon, unless they are reportable as accidents or significant incidents.
- d. A nuclear-capable missile system accident in flight that does not meet the definition of a NUCFLASH or while being transported or stored, even though no nuclear warhead or warhead joint flight test assembly is attached at the time. Missile system accidents will be reported and will contain the flagword "DULL SWORD."
- e. Any unexpected occurrence which results from Army developmental weapon testing, stockpile testing, or product improvement program testing of a nuclear weapon.
- f. Any other condition (for example, potentially adverse publicity, unauthorized release of contamination, or suspected contamination of the environment.) which is reportable in the judgment of the commander or custodian of a nuclear weapon.

### Nuclear weapon significant incident

An unexpected event (Flagword: OPREP-3 BENT SPEAR) involving nuclear weapons or nuclear components that does not fall into the nuclear weapon accident category but results in any of the following:

- a. Evident damage to a nuclear weapon(s) to the extent that major rework, complete replacement or examination, or recertification by the Department of Energy is required.
- b. The striking of a nuclear weapon by lightning or when a commander suspects that lightning has degraded the safety or reliability of a nuclear weapon system.
  - c. Known or suspected arming (partially or fully) of a nuclear weapon.
- d. Probable high interest by the public or news media that may result in adverse public reaction (national or international) or premature release of classified information.
- e. An attempted penetration, actual penetration, or other unexpected degradation of the security of nuclear weapons sites, activities, or logistical movements.
- f. A threat, actual or implied, of an attempt to seize a nuclear weapon. This includes a threat to attack or inflict damage to a nuclear weapons storage site, nuclear weapons, or nuclear weapons security forces.

### Nuclear weapon war risk accident

An event (Flagword: OPREP-3 PINNACLE NUCFLASH) that results in an accidental, unauthorized, or unexplained nuclear detonation; or an accidental or unauthorized launching, firing, or use by U.S. Forces or U.S.-supported Allied Forces of a nuclear-capable weapon system which could create the risk of an outbreak of war.

#### **Occupational illness**

Non-traumatic physiological harm or loss of capacity produced by systemic infection; continued or repeated stress or

strain (For example, exposure to toxins, poisons, fumes); or other continued and repeated exposures to conditions of the work environment over a long period of time. Includes any abnormal physical or psychological condition or disorder resulting from an injury, caused by long-or short-term exposure to chemical, biological, or physical agents associated with the occupational environment. For practical purposes, an occupational illness is any reported condition which does not meet the definition of an injury.

# Occupational injury

A wound or other condition of the body caused by external force, including stress or strain. The injury is identifiable as to time and place of the occurrence and a member or function of the body affected, and is caused by a specific event or incident or series of events or incidents within a single day or work shift.

## Off duty

Army personnel are off duty when they-

- a. Are not in an on-duty status, whether on or off Army installations.
- b. Have departed official duty station, temporary duty station, or ship at termination of normal work schedule.
- c. Are on leave and/or pass.
- d. Are traveling before and after official duties such as driving to and from work.
- e. Are participating in voluntary and/or installation team sports.
- f. Are on permissive temporary duty (no cost to Government other than pay).
- g. Are on lunch or other rest break engaged in activities unrelated to eating or resting.

# Off duty in a combat theater

In a combat theater, general considerations for making the duty status determination include the following:

- a. Soldier is off duty in a combat theater when on personal time in major built-up areas.
- b. Personal time DOES apply in areas where Soldiers are NOT authorized to have weapons loaded and are free to pursue personal activities without supervision such as:
  - (1) Personal hygiene.
  - (2) Personal trips to food exchanges and internet cafes (areas other than duty-associated mess hall).
  - (3) Participation in recreational sports.
  - (4) Personal time in Containerized Housing Units or sleeping areas.

### On duty

Army personnel are on duty when they are:

- a. Physically present at any location where they are to perform their officially assigned work. (This includes those activities incident to normal work activities that occur on Army installations such as lunch, coffee, or rest breaks, and all activities aboard vessels).
- b. Being transported by DoD or commercial conveyance for the purpose of performing officially assigned work. (This includes reimbursable travel in POVs for performing TDY, but not routine travel to and from work.)
  - c. Participants in compulsory physical training activities, including compulsory sports.
- d. Soldiers operating in and around outposts where combat operations are anticipated around the clock are considered to be on duty 24 hours a day.
- e. If an accidental discharge occurs while Soldiers are conducting weapons maintenance, even if the incident occurs during personal, unsupervised time, the mishap is on duty.

### **Operational Aerostat Balloon**

Aerostats are considered operational when the Aerostat system platform (or launch pad) is manned and power is applied to winches and other safety release devices as part of the launching process.

### **Operational** control

Operational control is the authority to perform those functions of command over subordinate forces involving organizing and employing command and forces, assigning tasks, designating objectives, and giving authoritative direction necessary to accomplish the mission. Operational control includes authoritative direction over all aspects of military operations and joint training necessary to accomplish missions assigned to the command. It does not, in and of itself, include authoritative direction for logistics or matters of administration, discipline, internal organization, or unit training.

### Operating nation

The nation which owns the aircraft or missile. In certain cases, this explanation will not apply. Therefore, the nations

concerned may agree that the operating nation is the nation under whose direct control the aircraft or missile was being flown or operated at the time of the accident or incident.

#### Over the road

Operation or driving on paved roads/highways.

### **Passenger**

Activities associated with being a passenger.

#### **Pedestrian**

A person who travels on foot (walking).

# Permanent total disability

Any nonfatal injury or occupational illness that, in the opinion of competent medical authority, permanently and totally incapacitates a person to the extent that he/she cannot follow any gainful employment. (The loss or loss of use of both hands, feet, eyes, or any combination thereof as a result of a single accident will be considered as permanent total disability.)

# Permanent partial disability

Any injury or occupational illness that does not result in death or permanent total disability but, in the opinion of competent medical authority, results in the loss or permanent impairment of any part of the body, with the following exceptions:

- a. Loss of teeth.
- b. Loss of fingernails or toenails.
- c. Loss of tip of fingers or tip of toe without bone involvement.
- d. Inguinal hernia, if it is repaired.
- e. Disfigurement.
- f. Sprains or strains that do not cause permanent limitation of motion.

### Physical training

Body conditioning or confidence building activities, excludes combat skills development. (For example confidence courses, combat football, combat basketball, push-ball, marches, calisthenics, pugil stick, running/jogging, physical training test.)

# Precautionary landing

A landing resulting from unplanned events that makes continued flight inadvisable.

# Preexisting physical condition

A medical condition that existed prior to the occurrence of the accident.

#### **Probability**

Probability is the qualitative or quantitative likelihood of a particular event or sequence of actions initiated by a hazard-related cause resulting in the Maximum Credible Loss. The probability can be expressed as the product of the Incident Rate and Mishap Set Likelihood.

### Recommendations

Those actions recommended to the command to correct system inadequacies which caused, contributed, or could cause or contribute to an Army accident. Also referred to in this pamphlet as corrective action, remedial measures, and/or countermeasures.

# Recordable accident

Reportable accident that meets the minimum criteria stated in the pamphlet for aviation Class A–E accidents and Class E and F incidents and ground Class A–D accidents.

### Reportable

All occurrences that cause injury, illness, or property damage of any kind must be reported to the Soldier's/employee's/unit's servicing/supporting safety office.

### Residual risk

The levels of risk remaining after controls have been identified and countermeasures selected for hazards that may

result in loss of combat power (personnel or equipment). Risks remaining after hazard mitigation measures have been applied.

# Residual significant risk

Residual significant risk is any risk remaining in a system after corrective actions have been executed.

# Restricted work activity

Individual's injury is such that they are unable to perform their normal duties. (For example, light-duty, profile.)

### Risk

Probability and severity of loss linked to hazards.

# Risk acceptability

Risk acceptability is that level of risk which has been determined as tolerable in order to fulfill mission requirements. It represents a level of risk where either the output of resources to rectify safety deficiencies does not result in a proportional increase in the level of safety be provided, or so restricts the performance that the assigned mission cannot be executed.

# Risk acceptance

Risk acceptance is a formal and documented process indicating Army Leadership understands the hazard, its associated cause, and the probable consequences to mission, personnel, equipment, public and/or the environment and that they have determined the total risk is acceptable because of mission execution. Risk acceptance is an Army Leadership prerogative.

# Risk acceptance level

Risk acceptance levels are used to denote the level of risk a particular level of Army Leadership and Management may accept. These levels are based on the magnitude of the risk involved and the duration of the risk acceptance.

### Risk assessment

The identification and assessment of hazards (the first two steps of the Composite Risk Management process).

#### Risk decision

The decision to accept or not accept the risk(s) associated with an action; made by the commander, leader, or individual responsible for performing that action.

# ROTC personnel

Types of ROTC personnel-

- a. Members of the ROTC during periods of basic or advanced training at premises owned or under the control of the Army whether on or off duty.
- b. Cadets performing professional enrichment training while under Army supervision and directed by competent orders, regardless of the location of the training site. Regular training on campus is excluded; that is, weekly drill and classroom instruction.
  - c. Cadets involved in rifle and pistol marksmanship training under Army supervision on any firing range.
  - d. Cadets undergoing ROTC flight instruction.

### Severity

The expected consequence of an event (hazardous incident)in terms of degree of injury, property damage, or other mission impairing factors (loss of combat power and so on) that could occur.

# Soldiering

Non-combat activities peculiar to military life, includes receiving instruction/training in such activities, excludes classroom training. (For example, marching, police call, formation, barracks detail, field sanitation.)

# **Sports**

Includes activities associated with sports, regardless of whether the participation is on duty or off duty, Army-supervised or unsupervised, excludes hobbies. (For example, racquetball/paddleball, handball, softball, tennis, soccer, baseball, basketball, football, volleyball, skiing, swimming, scuba diving, golf, boating, hunting, fishing, martial arts, canoeing.)

#### Standards failure

Standards/procedures not clear or practical, or do not exist.

# Support failure

Inadequate equipment/facilities/services in type, design, availability, or condition, or insufficient number/type of personnel, which influenced human error, resulting in an Army accident.

### System inadequacy

A tangible or intangible element that did not operate to standards, resulting in human error or materiel failure. Also referred to in this pamphlet as causes, readiness shortcomings and/or root causes.

### **Tactical training**

Training in a field environment that uses or develops combat, combat support, or combat service support skills.

### Training failure

Soldier/individual not trained to known standard (insufficient, incorrect or no training on task-insufficient in content or amount).

# Training-related death

A death associated with a non-combat military exercise or training activity that is designed to develop a military member's physical ability or to maintain or increase individual/collective combat and/or peacekeeping skills, and is due to either an accident or the result of natural causes occurring during or within one hour after any training activity where the exercise or activity could be a contributing factor. This does not apply to DA civilians participating in a Wellness Program.

### Unexploded ordnance (UXO)

Ammunition and explosives that have been primed, fused, armed, or otherwise prepared for action and that have been fired, dropped, launched, projected, or placed in such a manner as to constitute a hazard to operations, installations, personnel, or materiel, and remain unexploded by malfunction, by design, or for any other cause. UXO is synonymous for the dud.

## **Unmanned Aircraft (UA)**

An Army aircraft, to include Aerostat balloons, operated without the possibility of direct human intervention from within or on the aircraft. It is operated by personnel on the ground or in a manned aircraft. It is the major component of an unmanned aircraft system (UAS). A UA carries a variety of payloads to include day/night cameras, weapons, and so forth.

# **Unmanned Aircraft System (UAS)**

The system, whose components include the necessary equipment, data communications links, and personnel to control and employ unmanned aircraft, to include Aerostat balloons. The unmanned aircraft system is composed of six prmary components: the aircraft, payloads, data communications links, ground control stations, ground support equipment, and personnel to operate and maintain.

# Unmanned Aircraft System (UAS) Groups

Group 1 - Has a maximum gross takeoff weight of 1 - 20 pounds; operates normally at less than 1,200 feet above ground level (AGL) and at a speed of less than 100 KIAS.

Group 2 - Has a maximum gross takeoff weight of 21 - 55 pounds; operates normally at less than 3,500 feet AGL and at a speed of less than 250 KIAS.

Group 3 - Has a maximum takeoff weight less than 1,320 pounds; operates normally at less than 18,000 feet AGL and at a speed of less than 250 KIAS.

Group 4 - Typically weighs more than 1,320 pounds and normally operates below 18,000 feet mean seal level (MSL) at any speed.

Group 5 - Typically weighs more than 1,320 pounds and normally operates higher than 8,000 MSL at any speed.

# Workplace

A place (whether or not within or forming part of a building, structure, or vehicle) where any person is to work, is working, for the time being works, or customarily works, for gain or reward; and in relation to an employee, includes a place, or part of a place, under the control of the employer (not being domestic accommodation provided for the employee).

### Work-related injuries

Injuries or occupational illnesses incurred while performing duties in an on-duty status.

#### Section III

#### Special Abbreviations and Terms

This publication uses the following terms not contained in AR 310-50. These include terms used for activities and tasks applicable to Army accident investigating and reporting.

# **Bystanding/Spectating**

Includes activities associated with bystanding or spectating regardless of whether on or off duty.

#### **Combat Soldiering**

Using/developing skills peculiar to combat. Includes receiving instruction or training in such skills, excludes classroom training. (For example, hand-to-hand combat, slide for life, rope bridge, MOPP, NBC, bayonet training, military operations on urban terrain.)

### **Communications**

Activities related to installing, operating and recovering communications equipment. (For example, Erect/dismantle, lay/string/recover wire/cable, splice wire cables, install/operate/disconnect common equipment.)

# Counseling/advisory

Activities associated with nonsupervisory advice/assistance provided by subject-matter specialists on specific topics. (For example, alcohol/drug abuse, mental health, community services.)

#### **Educational**

Includes classroom training. Excludes field settings such as field training exercises and maneuvers. (For example, teach/instruct/brief/counsel student/audience activities.)

### Engineering or construction

Those activities associated with surveying, building, erecting, dissembling, or destroying things. (For example, lay/clear mine fields, bridging, quarrying, welding, brazing, roofing, installing electrical wiring, painting, land surveying, demolition, clearing, digging, concrete work, masonry work, dredging, trenching.)

#### **Fabricating**

Activities associated with the construction or manufacture of equipment and other products. (For example, making/modifying equipment/products.)

# **Firefighting**

Activities associated with developing or using firefighting skills. Excludes vehicle operation going to and from the scene. (For example, inspecting, rescuing, salvaging, firefighting.)

# Food/drink preparation

Activities associated with preparing, cooking, and serving food/drinks. (For example, preparing food, cleaning food preparation/serving equipment and facilities, cooking food, serving food.)

### Food and drug inspection

Activities associated with the certification of conditions, products, and facilities. (For example inspect livestock/poultry/and so forth, inspect storage facilities, inspect processing facilities, inspect transport and market facilities.)

### **Handling Animals**

Activities associated with handling animals.

### Handling/material/passengers

Activities associated with the transportation, distribution, and storage of material or passengers. (For example, distributing/issuing, loading/unloading, transporting/moving/delivering, packing/unpacking/preserving, inventorying/inspecting, weigh/measure, palletize/slingload/rig, retrieve, turn in/store.

# **Hobbies**

Includes activities associated with hobbies, regardless of whether the participation is on or off duty, Army-supervised or unsupervised. Excludes sports. (For example, camping, gardening, wood/metal working, ceramics.)

### Horseplay

Spontaneous physical activities not required by duty or mission and not condoned by the Army.

#### **Human movement**

Excludes human movement activities listed elsewhere such as sports, maintenance, physical training. (For example, walking, running, jumping, bending/leaning, climbing.)

#### Information and arts

Activities associated with the processing and dissemination of information. Includes writing, drawing, drafting, and photographing. (For example, taking pictures, printing activities, drafting/illustrating activities.)

# Janitorial/housekeeping/grounds keeping

Activities associated with the upkeep, tending, or cleaning of premises such as grounds, homes, offices, and other buildings; excludes maintenance, repair, or services activities. (For example, floor polishing, buffing, cleaning, vacuuming, sweeping, raking, shoveling, policing, planting, garbage disposal, incinerating.)

### Laundry/dry-cleaning services

Includes activities performed at personal residences, Laundromats, or on-post laundry/dry-cleaning plants. (For example, handling laundry, operating laundry/dry-cleaning equipment.)

#### Maintenance/repair/servicing

Activities associated with the maintenance, repair, or servicing of equipment and other property; excludes janitorial, housekeeping or grounds-keeping activities. (For example, install/remove/modify equipment, tune/adjust/align/connect, hot metal work, cold metal work, plastic working, soldering, repairing tires, inspecting tires/batteries, fueling/defueling, changing/inflating tires, charging batteries.)

### Office

Activities associated with the performance of clerical, typing, and administrative-type duties; excludes supervisory activities. (For example, typing/work processing, filing/posting, telephoning, operating office machines.)

### Operating Vehicle or Vessel

Activities associated with operating vehicles or vessels under power. (For example, driving, convoying/road marching, towing/pushing, mowing, hauling/transporting, driver testing, flying, vehicle road testing.)

### **Parachuting**

To descend by means of a parachute.

### Patient care (people/animals)

Activities associated with the medical treatment, detection, and prevention of disease/injury; excludes experiments, studies, and tests conducted with well people or animals for research purposes. (For example, injection/inoculation, cleaning wounds, medical equipment operations and handling, laboratory equipment operations and handling, changing dressings, lift/position/escort patients.)

### Personal hygiene/food/drink consumption/sleeping

Activities associated with taking care of personal requirements. (For example, personal cleaning, grooming, eating, drinking, sleeping/resting.)

# Pest/plant Control

Includes activities performed at personal residences and government facilities; excludes pest control tests and experiments. (For example, prepare/mix/dispense chemicals, inspect, setting traps, baits.)

# Physical training

Body conditioning or confidence building activities, excludes combat skills development. (For example, confidence course, combat football, combats basketball, push-ball, marches, calisthenics, pugil stick, running/jogging, physical training test.)

### Security/law enforcement

Activities associated with MP, CID, and other military or civilian personnel performing security or law enforcement rescue duties. (For example, traffic safety, investigating, apprehending suspects, guarding/patrolling, controlling disturbances, intelligence activities.)

# **Soldiering**

Noncombat activities peculiar to military life; includes receiving instruction/training in such activities; excludes classroom training. (For example, marching, police call, formation, barracks detail, field sanitation.)

#### **Sports**

Includes activities associated with sports, regardless of whether the participation is on duty or off duty, Army-supervised or unsupervised, excludes hobbies. (For example, racquetball/paddleball, handball, softball, tennis, soccer, baseball, basketball, football, volleyball, skiing, swimming, scuba diving, golf, boating, hunting, fishing, martial arts, canoeing.)

# **Supervisory**

Activities associated with the management of personnel. (For example, inspection tasks, directing workloads/work crews, monitoring work/crews, planning unit activities.)

### Test/study/experiments

Activities associated with the conduct of tests, studies, and experiments on natural or man-made materiel or on human beings or animals for research projects. (For example, preparing for test/study/experiment, performing test/study/experiment.)

# Weapons firing

Carrying, loading, sighting, firing, assembling. (For example, emplacing, loading/unloading, sight/aim/target acquisition, elevate/lowering, traversing, fire/discharge/wield/launch/throwing, assemble/disassemble/cleaning, bore sighting, misuse.)